



YELLOW HIRE



Atlas Industrial Holdings Pty Ltd
 Email: accounts@atlasholdings.com.au
 Phone: 1800 784 453
 ABN: 55 154 445 137
 Address: 14-28 Powell Street, East Bendigo

Service History

Date Generated: 18/03/2026 04:24 PM

Equipment Details

Equipment Number	YH049	Make:	Kubota
Equipment Description	Kubota KX80 - 8.0 Ton Excavator	Model:	KX80
Serial Number	27494		

Date	Type	Description	Last Meter Reading
14/05/2019 10:14 AM	Work Order - Repair	236 - Move bucket to safe location. Spray all teeth with crc. Knock out pins, remove collars, clean mounts with 5" buff wheel. Clean around area and fit new tiger teeth, check for fit ment all ok. Rotate jib lift left side to lift track. Check track clearance remove grease cover plate. Pump up tracks to spec. drop down and perform the same on right side.	653.00
21/08/2019 08:01 AM	Work Order - Repair	486 - Check horn wiring circuit. Remove lower cover to gain access. Check circuit and horn. Found circuit OK. Check horn on live power. No Good. Procure after market horn. Fit ,test and refit cover. All ok	836.00
17/03/2020 04:28 PM	Work Order - Repair	1088 - Replace blown fuse. Popped straight away. Turn of radio and uhf try again popped fuse. Remove fuse panel chase wiring look back to behind seat. Disconnect GPS still dead short. Remove cover to radio and radio strip winring to check for dead short. Follow wiring up to rotating light and disconnect, still dead short, remove tilt switch and check to ground. Follow tilt wiring back to harness, found pinch behind ash tray mount. Replace section of wiring and reassemble in reverse order.	
29/06/2020 01:25 PM	Work Order - Repair	1403 - Supply only door catch cover	1074.00
22/07/2020 08:11 AM	Work Order - Repair	1452 - Sublet to Sunrise ag replace windows and clean damaged area	1085.00
13/08/2020 09:41 AM	Work Order - Repair	1665 - Complaint: hydraulic hoses don't reach. 500mm short. Hydraulic quick couplers different. Correction: travel to site. Inspect machine. Checked length of hoses and fittings. Had new hose extensions made. Checked couplers, larger couplings on machine than on bucket. Swaped larger couplings to one side and other couplings to other side. Reassembled and tested for correct operation.	1087.00
28/09/2020 07:48 AM	Work Order - Repair	1895 - supply hoses as required	1170.00
30/09/2020 11:55 AM	Work Order - Repair	1935 - repair damaged hyd hose fitting.	1170.00
28/10/2020 03:54 PM	Work Order - Repair	2013 - Get ready for hire. Required extension hoses on jib and new brackets for bulk heads. Fit and test hammer, remove and replace failed am fm radio.	1221.00

Date	Type	Description	Last Meter Reading
25/02/2021 04:54 PM	Work Order - Repair	2604 - Pack bits and head to Red Cliffs in rays ute. Remove rear panel to gain access to leaking fitting in the rear of the excavator. Found loose dowdy washer clean and tighten. Test all ok. No mayor lose of fluid.	
30/03/2021 02:47 PM	Work Order - Repair	2812 - Check for risk assessments, fire extinguisher service dates, operations manual, prestart books	1313.00
26/07/2021 03:48 PM	Work Order - Repair	3458 - Belts slipping on machine. Sublet. Adjust belts and run and test operation alternator and air conditioner.	1488.00
30/08/2021 01:04 PM	Work Order - Repair	3627 - Mirror broken on Hire. Procure and fit new mirror	1529.00
06/09/2021 01:27 PM	Work Order - Repair	3779 - Bring machine up to workshop. Broom wash and polish out scuff marks on counterweight and panels.	1567.00
10/11/2021 04:01 PM	Work Order - Repair	4159 - supply risk assesment	1893.00
21/03/2022 12:13 PM	Work Order - Repair	BE4774 - Replaced Oil sender sender.	1763.00
27/04/2022 07:05 AM	Work Order - Repair	BE5157 - Travel to site locate unit inspect and found auger has 1/2 inch and excavator has 3/4 remove fittings travel back to supplier source adaptas and travel back to site and fit 1/2 fitting to excavator fit auger drive and auger test. adjust aux controls in dash and instruct operator how to use travel back to workshop	
29/04/2022 04:46 PM	Work Order - Repair	BE5178 - Inspect hydraulic shuddering/hammering dismantle valve block and found springs in lock valves lost tension source spacers fit and test test and adjust all pump pressures and relliefs	
01/12/2022 01:02 PM	Work Order - Repair	BE6386 - fit new mirrors	1969.00
09/03/2023 08:23 AM	Work Order - Repair	BE7024 - Locate spare track load on trailer, travel to site, unload track and reload broken track fit,second had track adjust tracks travel back to workshop	
20/03/2023 09:00 AM	Work Order - Repair	BE7104 - Travel to site inspect issue found aux settings not correct for hammer operation, reset and test instruct operator on how to operate hammer.	2069.00
22/03/2023 11:54 AM	Work Order - Repair	BE7060 - Replaced UHF hand piece. Test ok	2069.00
05/10/2023 02:48 PM	Work Order - Repair	BE7919 - replace damaged cover and mirror	2295.00
26/04/2024 02:13 PM	Work Order - 500 Hour Service	BE9205 - 500 Hour Service	
26/04/2024 02:14 PM	Work Order - Repair	BE9475 - incorrect flat faced fitted on auger drive - correct fittings installed. Went to site and discovered that the new fittings would not slide onto YH049 fittings on one side. Purchased and installed new fitting from Pirtek - problem solved.	
13/06/2024 07:55 AM	Work Order - Repair	BE9516 - Complaint: engine stalling. Correction,: inspected mnachine and found faulty connection at banjo fitting. Repaired. Reassembled and tested for correct operation.	

Date	Type	Description	Last Meter Reading
08/07/2024 03:25 PM	Work Order - Repair	BE9814 - Complaint: hard starting. Cause: battery failed. Correciton: removed and replaced battery. Clean fuel filters, remove fuel line and clean screens.	2576.00
02/08/2024 07:55 AM	Work Order - Repair	BE9935 - complaint: track loose. Cause: track adjuster not working. Correction: Removed track and dismantled. Unblocked track adjuster. Removed idler and cleaned out. Reassembled. Replaced track. Reassembled and tested for correct operation.	
09/08/2024 07:46 AM	Work Order - Repair	BE9996 - compaint: tidy up machine. Polish bonnet. Paint rear of macine and blade. Repair oil leak, repair work lights. Repair rabbit speed.	
13/08/2024 08:32 AM	Work Order - Repair	BE10161 - Compalint: Rear bonnet latch jammed. Correction: unjammed latch, removed repaired and reassembled. Tested for correct operation.	2611.00
23/08/2024 08:47 AM	Work Order - Repair	BE10160 - Complaint: track adjuster loosing pressure. Cause: seals in track adjuster failed. Correction: remove track adjsuter and inspect. Clean up and replace seals. Reassembled and testred for correct operation.	2611.00
11/04/2025 09:13 AM	Work Order - Repair	BE11488 - Replace worn track, remove failed track fit new and adjust	2955.00
08/05/2025 11:00 AM	Work Order - Repair	BE11518 - replace v-velts, remove failed belts, travel to supplier source new return fit and adjust	
17/07/2025 10:29 AM	Work Order - Repair	BE11914 - Client damage - Leaking and damaged boom hydraulics	2979.00
17/07/2025 01:14 PM	Work Order - 2000 Hour Service	BE12060 - 2000 Hour Service. Normal 500 hr service, plus hydraulic oil and filters.	2989.00
20/08/2025 03:24 PM	Work Order - Repair	BE12434 - Door could not be opened from the inside, radio was not working very well	3047.00
02/10/2025 09:18 AM	Work Order - Repair	BE12271 - major refurb - Track adjustor, pins and bushes	
06/01/2026 02:02 PM	Work Order - Repair	Replace lower track roller	
06/03/2026 05:22 PM	Work Order - Repair	Repair headlight wiring, replace uhf	