

ADAPT-A-LIFT GROUP PTY LTD

Service History Listing Active Units

For Equipment Code From: H15990 To: H15990
For Date Posted From: All To: All
Don't Show Cost

For Customer Code From: All To: All
For Branch Code From: All To: All

Date: 7/08/2026
Time: 10:09:18AM

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15990		Description: HYSTER H16.00XM _ moved to infra CB- until new site and new unit is located					
Make: HYSTER		Model: H16.00XM		Serial No.: G019E02124F			
1840345	oi leak	NMORAN	7/07/2026	Internal	5893.0	\$0.00	Carry out equipment condition assessment carry out cleaning pf pk site Travel to site, Labour deliver cleans supplies and empty water out of large battery boxes for scrap metal to take sort out truck at pk site Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, repair oil leaks for sale
1830308	Replace batteries	211 Planning A	1/06/2026	Internal	5890.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15990		Description: HYSTER H16.00XM _ moved to infra CB- until new site and new unit is located					
Make: HYSTER		Model: H16.00XM		Serial No.: G019E02124F			
1732787	replace battery	MCLARKE	14/07/2025	Internal	5890.0	\$0.00	Remove ancillary items and Remove Battery from unit and Inspect and report, Located batteries on unit. Removed batteries from unit. Will get a po tomorrow and go to bursons to get replacements. Labour Replace Battery, Travel to site, Travelled to bursons for batteries . Waited for one battery to be dropped off to bursons . Travelled to site. Refit Battery to unit, Refit ancillary items, Check/Inspect/Diagnose Fuel system, bleed Fuel system to remove air, Fitted batteries to unit and secured. Tried starting unit kicking over but not starting . Checked diesel low on diesel put 40L in unit. Bleed fuel system. Tested unit all ok. Return unit back to service. Prepare For Hire - Workshop
1635462	green tag inspection	NMORAN	26/06/2024	Internal	5869.0	\$0.00	
1615074	Conduct full inspection, unit arcing, report of wheel damage and low hydr oil	AMABBOTT	16/04/2024	Internal	5862.0	\$0.00	
1608893	CANCELLED dehiired for possible refurb at PK. 6000hr II 6000hr Service	BIG TRUCKS NSW	15/04/2024	Internal	5831.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15990		Description: HYSTER H16.00XM _ moved to infra CB- until new site and new unit is located					
Make: HYSTER		Model: H16.00XM		Serial No.: G019E02124F			
1613346	The left hand tynes is slow to move to the centre if used individully-Left hand tyne is higher then right hand tyne-Right and left hand handles are hard to open-Hydrualic fluid is low-ETKT-713461	BEGREEN	8/04/2024	Internal	5862.0	\$0.00	Repair Main Electrical Control Panel as necessary, Load software as required to calibrate the unit, travelled to site signed in and waited for escort. travelled to work area. located unit and attempted to start. unit didnt start and a eletrical arking noise ans smoke came frome right side of unit images attached. escort reported issie to supervisor and site was shut down for ohs inspection. authirisation was granted to continue work. carried out test and found isplator cuircit grown to be corroded and isolator. travelled to spares and obtained new isolator. travelled backo site and fitted cleaned all ground points and placed dialetric grease on exposed ground points. units hydraulic issues were a eletrical parremeter adjustment in the hydraulic controlller adjusted and tested ok. door lock strikers were adjusted and locks lubricated doors are working ok now. hydraul
1604273	sublet cost for 1578373	211 Planning F	28/02/2024	Internal	5831.0	\$0.00	
1578373	Affix plates and fit LED lights, inspect report of uneven tynes	DMCDONALD	12/12/2023	External	5831.0	\$1,129.00	Travel to site, wire in new LED lights and affix plates, inspected tynes, the left tyne appears to have been bent approx 3/4 way along the Tyne toward the tip with the bend tapering down closer to the tip which makes the lift Tyne sit approx 10mm higher. Customers crate has very tight tyne pockets creating difficulty with lifting due to bend. Quoted for replacement.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15990		Description: HYSTER H16.00XM _ moved to infra CB- until new site and new unit is located					
Make: HYSTER		Model: H16.00XM		Serial No.: G019E02124F			
1580155	INSTALL DIGITAL WEIGHT GAUGE	DMCDONALD	27/11/2023	Internal	5831.0	\$0.00	Travel to site, Replace Gauge/s Repair Gauge/s Labour Repair Visual display unit as necessary, Check/Inspect/Diagnose Hydraulic Tilt Valve Section and test operation, Remove ancillary items and Hydraulic Hose/s, inspect and report, Repair Hydraulic Hose/s as necessary, Fit weight scale - Travel to parts, travel to site, sign in.. locate unit and establish safe work area.. Prepare for weigh gauge installation, noticed unit already had scales fitted.. Requested known weigh to check fitted scales, found fitted scales not functioning. Fitted scale system, removed hydraulic balance line, and took to Hydraulink with the new transponder to purchase adaptors.. Hydraulink had no stock, travel to Enzed. Enzed supplied a selection of fittings and adapters to allow the transducer to adapt to the balance line t- piece. Travel to site, fit transducer, and adaptors.. Fit weigh scale, wire in system, run cables and mount display.. Test operation, observed leak from adaptor to transducer, removed and re tensioned using Teflon tape, no luck. Removed and re fitted using hydraulic thread sealant, again no luck.. removed transducer, re fitted previously fitted hose and scale transducer and returned unit to service. Cleaned up leak and thoroughly cleaned all residual oil from chassis. Strategize a different way of introducing the transducer to the lifting circuit with Tharala. Travel to site, removed entire balance lines and previously fitted transducer and travel to Hydraulink to have them assist in creating another way to adapting to this circuit.. Hydraulink had a different strategy to connect by using the transducer at the end of a hose using JIC adaptors. Travel to site, re fit balance circuit, re wired transducer to new location.. Test circuit to confirm no leaks, all ok at time of test. Calibrate scale system using known load.. all ok at time of calibration. Again assess system to confirm no leaks, all ok at time of

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001 Equip. Code: H15990 Description: HYSTER H16.00XM _ moved to infra CB- until new site and new unit is located Make: HYSTER Model: H16.00XM Serial No.: G019E02124F							
1572633	500hr Service (Due by time)	CMILLAR	31/10/2023	Internal	5831.0	\$0.00	test. Travel to site, Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. atten site, sign in and wait to be escorted to unit. set up safe work zone. remove engine oil, egien oil filter,air filters,and fuel filter. fill up engine oil. fit fuel filters,air filters,oil filter and acb filter. grease unit. grease chains. clean front winder. check lift chains. .03% warn. check all lights. all working at time of time of inspection. check operation of unit. all in good safe working order at time of inspection. clean up work zone.
1569477	Inspect tynes, report of different height between tynes?	211 Planning F	3/10/2023	Internal	5814.0	\$0.00	
1564319	Unit has a screw in the tyre. Etkk 523747	BEGREEN	13/09/2023	External	5814.0	\$341.00	Repair Drive Tyre/s as necessary, Travelled to site . Carried out site induction. Contacted site contact for security escort Travelled to machine Carried out inspection and found no foreign objects in tyre. Returned unit to customer.
1552374	Error Code and Brake Charge Issue	DMCDONALD	28/07/2023	Internal	5795.0	\$0.00	Escorted out and sighned out. Travel to site, Repair Starter Motor as required, Labour Carry out Inspection and Diagnosis of Brake System

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15990		Description: HYSTER H16.00XM _ moved to infra CB- until new site and new unit is located					
Make: HYSTER		Model: H16.00XM		Serial No.: G019E02124F			
1548626	Machine had difficulty starting when unloading off truck - WILLIAMTOWN NSW	APATRIMONIO	12/07/2023	Internal	5793.0	\$0.00	Travel to site, Repair Starter Motor as required, Travel to site, sign in, locate unit and establish safe work area. Supervisor states unit tnot starting when it arrived to site.. Confirmed no start, checked voltage at 22.5v.. Load tested and found batersy no drop to 17v.. Managed to start unit and observed charging system to be working great a t ttime of test.. Ran uni to charge batteries and tested starter operation.. Found starter function normal after unit charged.. found bateries to maintain 25v with engine off and sfter sittin.. continuously tested the starter of the unit and no fault was observed at time of inspection. If starter operation fails again i recommend starter replacement as batteries are now in optimum condition after good recharge. Unit operating fine at time of inspection. Labour Collect parts at Wetherill Park. Performed online site induction. Replace Starter Motor, Travel to site, sign in and locate unit. Set up work area and isolate unit. Disconnect battery connection. Disconnect startet motor wiring connections. Replaced starter motor assembly. Reconnnect wiring connections. Bleed fuel system. Connect battery cable and tested starting several times. Travel back to Sydney. Note: no machine image, taking photo inside the base is strictly prohibited.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15990		Description: HYSTER H16.00XM _ moved to infra CB- until new site and new unit is located					
Make: HYSTER		Model: H16.00XM		Serial No.: G019E02124F			
1546902	Inspection prep for hire, Need unit ready ASAP	ATEKLE	4/07/2023	Internal	5792.0	\$0.00	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Carry out equipment condition assessment Carry out Inspection and Diagnosis of Brake System Block up unit, Adjust brakes and handbrake, inspection and function test carried out unit has flat batteries green strobe light is faulty right hand side front outer tyre has some damage brakes are squeaky Replace Revolving/Flashing/Strobe light, Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Grease All Points on Unit, Prepare For Hire - Workshop brakes adjusted and drums cleaned (squeaking has lowerd but noy gone) batteries recharged and isolator replaced weight gauge rewired to stop battery voltage draw(conducted by Paul) green strobe light replaced brake pressure switch installed unit greased lubed cleaned and made ready for hire
1543949	STR Dehire Inspection	302WORKSHOP	23/06/2023	Internal	5785.0	\$0.00	Carry out equipment condition assessment
1542805	Green tag inspection	JSURAT	19/06/2023	Internal	5785.0	\$0.00	
1519053	5750 II 250hr Service Level B Service	311 Planning B	4/04/2023	Internal	5746.0	\$0.00	Check over unit. Unit is in good running condition.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15990		Description: HYSTER H16.00XM _ moved to infra CB- until new site and new unit is located					
Make: HYSTER		Model: H16.00XM		Serial No.: G019E02124F			
1524305	Repair unit as required	ATEKLE	29/03/2023	Internal	5781.0	\$0.00	Steam clean equipment as necessary. Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Remove ancillary items and Sideshift Cylinder, Strip, Inspect and report, Remove ancillary items and Hydraulic Hose/s, inspect and report, Repair Sideshift Cylinder as necessary, Reseal Sideshift Cylinder as necessary, Refit Sideshift Cylinder and ancillary items, Replace Battery, Replace Light/s Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Carry out Inspection and Diagnosis of Brake System Grease All Points on Unit, Install Stickers, Adjust Carriage to correct specification, Adjust Lift Chain to correct specification, Repair Hydraulic Hose/s as necessary, Repair Accumulator as necessary, Replace Attachment Cylinder, Prepare For Hire - Workshop armrest pad replaced brake accumulator relief valve replaced fan replaced stickers installed cab lift switch replaced tail light replaced

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001 Equip. Code: H15990 Description: HYSTER H16.00XM _ moved to infra CB- until new site and new unit is located Make: HYSTER Model: H16.00XM Serial No.: G019E02124F							
1521833	Scheduled Service Job. KM IC 4000hr SM - 4000hrs. 4000 Hour Service	ATEKLE	21/03/2023	Internal	5780.0	\$0.00	sump plug replaced fork positioner cylinder resealed fork positioner cylinder replaced 2 new batteries fitted operators manual fitted unit steam cleaned and wiped down unit greased lubed and made ready for hire 4000hr Service, 5000hr Service 4000 hrs service carried out Note Brake function and hydraulic oil leak to be examined and repaired
1521845	Inspection	ATEKLE	20/03/2023	Internal	5746.0	\$0.00	
1521693	rental return and dehire check	302WORKSHOP	17/03/2023	Internal	5746.0	\$0.00	
1509015	Hydraulic oil leaking from the front near the tynes + front wipers	JTINAO	25/01/2023	Internal	5746.0	\$0.00	Labour Travel to site, Check/Inspect/Diagnose Hydraulic Oil Leak and test operation, Repair Attachment Cylinder as necessary , Repair Horn Repair Revolving/Flashing/Strobe light as required, Repair Windscreen Wiper as necessary, Carry out Inspection and Diagnosis of Attachment Travelled to pick up parts,travelled to site,filled up t5,isolated Unit and pre work area,inspected unit oil leaking,found oil leaking on side shift cylinder,cleaned/inspect foundoil seal leaking on both side shift cylinder,lubricated side shift,inspected front wiper motor not working,found blewn fuse,replaced fuse ok,also found jet washer not working on top wiper an front wiper,need to replace motor,repared horn not working found corroded connector,repared beacon light found revolving motor not working,carried out appraisal ,Informed Customer unit good to go
1487582	Units starts but will not move	RLIGON	21/10/2022	Internal	5663.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15990		Description: HYSTER H16.00XM _ moved to infra CB- until new site and new unit is located					
Make: HYSTER		Model: H16.00XM		Serial No.: G019E02124F			
1483785	The unit has started but it's not moving. Tagged Out. URGENT. PTKT-225082	MOWENS	14/10/2022	Internal	5689.0	\$0.00	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Drive to site, make site safe, complete take 5, inspect unit, found unit was looseing air pressure, inspect over unit and found a vavle was leaking, went to a truck shop and got new valve, went back to site and fit new valve, test unit, unit was all ok, hand unit back to site Carry out Inspection and Diagnosis of Transmission Carry out Inspection and Diagnosis of Brake System Block up unit, Adjust brakes and handbrake, travel to site, check machine condition, machine is operational but they have to wait 5 minutes to full the air tank, quick relase valve is faulty that in every 5 to 10 seconds releasing air that result to low air pressure in the air tank, remove the cover and found out spring seat washer was damage and cannot hold the pressure, repair and put them together and runtest, machine back to operation
1472301	5500 II 500hr service Level B Service	311 Planning B	24/08/2022	Internal	5561.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Waited for parts confirmation,waited for parts,travelled to site,filled t5,carried out 500hrs. S.M as per agreed job scope,repared wiper,rectified trans oil leak,repared cabin tilt motor,diagnosed cylinder slow in operation,unit good to go Labour Travel to site, perform 500 hpirs service, diagnose oil leak on tines cylinder, diagnose tines left hand slow in, check electrical and hydraulic system, inspect machine structures

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15990		Description: HYSTER H16.00XM _ moved to infra CB- until new site and new unit is located					
Make: HYSTER		Model: H16.00XM		Serial No.: G019E02124F			
1467142	Compressor to be replaced	311 Planning G	25/07/2022	Internal	5561.0	\$0.00	Labour Travelled to drop point check for compressor found no compressor in Drop point Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Travel to Trug to chase the aircon compressor . Repair Air Conditioner as necessary, Travel to site. Check the aircon system. There's still a gas in the system. Need an aircon tech to recover the gas. Reported to Sharlaine already. Travel to site,
1455652	battery needs to be reaplced - PTCK 144132 - URGENT	GCAPUS	1/06/2022	Internal	5561.0	\$0.00	Remove ancillary items and Remove Battery from unit and Inspect and report, Labour Refit Battery to unit, Refit ancillary items, travel to site and performed dismantle the battery and grab the new battery from Rj batteries for replacement,test and run the unit. 1000hr Service Picked up parts,travelled to site,found Unit not on the site,Unit serial number D466R11127U (H3.5XT) is the Unit they have.
1448998	5000 II 1000hr service. Level B Service	311 Planning A	19/05/2022	Internal	5451.0	\$0.00	Labour perform 1000 hours service, check work lights, a/c function, wiper adjustment, replace wiper blade, travel to site, travel back to pacific national to dispose used oil, filter and rabish
1418937	Rplace steer tires as required	302WORKSHOP	6/12/2021	Internal	5451.0	\$0.00	Carry out equipment condition assessment Steam clean equipment as necessary. Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Prepare For Hire - Workshop
1417120	inspection prep for hire	RBLAIN	25/11/2021	Internal	5451.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15990		Description: HYSTER H16.00XM _ moved to infra CB- until new site and new unit is located					
Make: HYSTER		Model: H16.00XM		Serial No.: G019E02124F			
1402998	500hr	RBLAIN	20/09/2021	Internal	5189.0	\$0.00	Change Engine Oil as required, Replace Engine Oil Filter, Remove ancillary items and Fuel Filter and Replace, Refit Fuel Filter and ancillary items, Remove and Replace Air filter , Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Located machine, machine is operational, drained and replaced engine oil, replaced both air filters, replaced and bleed both fuel filters

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001 Equip. Code: H15990 Description: HYSTER H16.00XM _ moved to infra CB- until new site and new unit is located Make: HYSTER Model: H16.00XM Serial No.: G019E02124F							
1402585	Inspection	RBLAIN	17/09/2021	Internal	5439.0	\$0.00	Carry out equipment condition assessment NEEDS STEER TYRES RHS TILT CYLINDER LEAKING (SEAL BOTH) CHECK WHEN LAST WAS SERVICED REAR BONNET GAS STRUTS X2 BOTH S/S CYLINDERS LOOK LIKE THEIR WEEPING Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Fit Jump Start Plug to Equipment, Steam clean equipment as necessary. -Start engine. -Engine won't start. Flat battery. -Installed jumpstart battery. -Started engine. - Tested mast and attachment function. -Note: Left side fork positioner not working properly. Lift cylinder is drifting down.Need to reseal lift cylinder. Steam clean machine. Grease All Points on Unit, -Clean interior and exterior of machine cab. -Greased all point and lubricated chains. -Adjusted valve. -Tested and drive machine. Remove ancillary items and Lift Cylinder, Strip, Inspect and report, Repair Lift Cylinder as necessary, Refit Lift Cylinder and ancillary items, Refit Hydraulic Hose/s and ancillary items, Removed both lift cylinders, dismantled both cylinders, removed old seals and resealed with new seals, reassembled both cylinders, refitted cylinders back into the machine, refitted all hydraulic hoses, cable tied all cables and hoses, cleaned the cabin of the machine, Tested machine, all in operational order
1376623	Unit Inspection	312 Planning A	14/05/2021	Internal	5189.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15990		Description: HYSTER H16.00XM _ moved to infra CB- until new site and new unit is located					
Make: HYSTER		Model: H16.00XM		Serial No.: G019E02124F			
1337252	PREP UNIT FOR STR TO ACTION ALLIANCE	ASTANTE	2/11/2020	Internal	5179.0	\$0.00	Carry out Inspection and Diagnosis of Attachment truck only working in 2nd gear run diagnostic testing further testing required Carry out Inspection and Diagnosis of Transmission Labour Refuel Unit Carry out Inspection and Diagnosis of Brake System Carry out Inspection and Diagnosis of Electrical System Repair Light Circuit as required, Check/Inspect/Diagnose Hydraulic Oil Leak and test operation, Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15990		Description: HYSTER H16.00XM _ moved to infra CB- until new site and new unit is located					
Make: HYSTER		Model: H16.00XM		Serial No.: G019E02124F			
1292546	Carry out De-hire inspection	RROMERO	22/04/2020	Internal	5178.0	\$0.00	Carry out Inspection and Diagnosis of Attachment Carry out Inspection and Diagnosis of Telemetry System Carry out equipment condition assessment Repair Engine Air compressor as required, Replace Engine Air Compressor, Replace Switch/es Carry out Inspection and Diagnosis of Brake System Locate the machine. Test, run and check all the functions. Need to adjust brakes. Good hydraulic functions. Need to adjust the tilt cylinder due to uneven reach. All lights are working. Test the weight gauge. Carried out inspection and do the safety checks. The chains are good with .25% stretch. Tynes are on limit. Found some leaks on engine pressure switch and air compressor. Reported already to Mr. Paul. Repaired the air compressor, clean and replace the o-ring. Removed and replaced the engine pressure switch. Removed the back plate of the brakes and check the brakes. Need to blow out the dust and dirt. Replace Steering Wheel, Overhaul Brakes components as required, Remove, clean and refit Air filter, Repair Air Conditioner as necessary, Steam clean equipment as necessary. Removed and replaced the steering wheel spinner. Moved to the wash bay. Removed the back plate of the brakes. Blow out the too much dust inside left and right. Removed the air and cabin filter. Blow out all the dust and refitted. Steam clean the machine in and out. Replace Primary Diesel Filter as necessary, Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Grease All Points on Unit,

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001 Equip. Code: H15990 Description: HYSTER H16.00XM _ moved to infra CB- until new site and new unit is located Make: HYSTER Model: H16.00XM Serial No.: G019E02124F							
							Adjust Lift Chain to correct specification, Block up unit, Adjust brakes and handbrake, Error E0418 flashing on the dash and its the water separator sensor. Flush the diesel on filter. Blow out the wire socket. Drive around to dry the brakes. Greased all the greasing points and lubricated the chains. Adjusted the brakes. Need to adjust more but the parking brake wont release. Need to replace the brake chamber. Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Check/Inspect/Diagnose Hydraulic Tilt Valve Section and test operation, Repair Brake pipe/s as required. Replace Brake adjuster/s, Replace Brake Booster assembly, Released the brake. Removed the hoses and connectors. Removed the brake chamber. Measure the old shaft and cut the new shaft of the brake chamber with the same length. Replace Brake Pipe/s, Rotate the brake chamber to correct the position of the hose connector. Retighten the brake chamber. adjusted the brakes. Start the engine to build an air pressure. Check the brake chamber and it is working. Test and run the machine. Test the brakes. Need more adjustments. Adjust and test again. Braking is good now. Replace Brake Shoe/s, Repair Switch/es Refitted the back cover of the brakes. Wipe and clean inside the cabin. Repaired the cabin tilting switch due to malfunction. Wipe and clean the wind shield and top cover. Machine is in good condition.
1286480	Inspect unit and replace hoses	302WORKSHOP	25/03/2020	Internal	5905.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15990		Description: HYSTER H16.00XM _ moved to infra CB- until new site and new unit is located					
Make: HYSTER		Model: H16.00XM		Serial No.: G019E02124F			
1280713	Prep for Rental - Reseal Steer cylinder	ASTANTE	2/03/2020	Internal	5905.0	\$0.00	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, REMOVE STEER CYLINDER CYLINDER NEEDS TO BE RE-SEALED Grease All Points on Unit, Steam clean equipment as necessary. Prepare For Hire - Workshop RE SEAL STEER CYLINDER RE FIT STEER CYLINDER TO UNIT FIT HYDROLIC HOSES FIT STEER ARMS AND LINKS CHECK OVER ENTIRE UNIT STEAM CLEAN UNIT CLEAN ALL WINDOWS ADJUST DOOR LOCK BLOW OUT CAB AND DETAIL CAB TOP UP OIL FLUIDS ADJUST CHAIN GREASE UNIT LUBE CHAINS TEST DRIVE UNIT TORQUE WHEEL NUTS REPLACE WHEEL NUT INDICATORS TIGHTEN HOSE CLAMPS REPLACE 1 LIGHT GLOBE WIPE DOWN ENTIRE OUTER UNIT
1268366	Steering is not working, and hydraulic issue - urgent attendance tomorrow morning	BIG TRUCK VIC	9/01/2020	Internal	5905.0	\$0.00	Travel to site, Carry out Inspection and Diagnosis of Steering System check hydraulic oil level, steering cylinder and linkage, steering king pin and steering hoses are in good condition. machine is in good operating condition. Notes ; Hydraulic pump has a minimal oil leak in the middle of pump.
1263497	STR inspection	WDAVID SON	13/12/2019	Internal	1520.0	\$0.00	STR INSPECTION CHECK OVER TAKE PHOTOS WITH TABLET Carry out equipment condition assessment unit not on site

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15990		Description: HYSTER H16.00XM _ moved to infra CB- until new site and new unit is located					
Make: HYSTER		Model: H16.00XM		Serial No.: G019E02124F			
1262097	DE-HIRE INSPECTION AS REQ	ASTANTE	9/12/2019	Internal	1520.0	\$0.00	Carry out equipment condition assessment Steam clean equipment as necessary. Grease All Points on Unit, inspect unit steam clean inside and out clean windows inside and out detail cab grease unit test all hydrolic functions Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, grease unit repair x3 washer motors test drive unit adjust brake fit wheel indicators and torque wheels to spec replace lights lube chains repair all water lines to jets paint touch up adjust mirrors test all functions go over all hoses and fitting repair wiper arm wash unit grease unit detail cab paint touch up unit check oil leveld clean all windows Carry out equipment condition assessment Steam clean equipment as necessary. LOCATE UNIT STEAM CLEAN UNIT WIPE DOWN OUTSIDE UNIT DETAIL INSIDE CABIN PAINT WHEELS FINAL INSPECTION OVER ENTIRE UNIT TEST DRIVE UNIT TOP UP DIESEL
1259020	Pre Hire Inspection	ASTANTE	27/11/2019	Internal	1520.0	\$0.00	
1249927	DE-HIRE inspection on 1243636	301WORKSHOP	23/10/2019	Internal	1520.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15990		Description: HYSTER H16.00XM _ moved to infra CB- until new site and new unit is located					
Make: HYSTER		Model: H16.00XM		Serial No.: G019E02124F			
1243637	Carry out 500hr service as req	MOWENS	26/09/2019	Internal	1520.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1243636	De-hire inspection as req	302WORKSHOP	26/09/2019	Internal	5068.0	\$0.00	drain oil, remove fuel filter, remove engine filterreplave oil , replace air filter, greese unit, check over unit, check lights wash unit,

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15990		Description: HYSTER H16.00XM _ moved to infra CB- until new site and new unit is located					
Make: HYSTER		Model: H16.00XM		Serial No.: G019E02124F			
1234453	PREP UNIT FOR RENTAL TO PACIFIC NATIONAL - MELB WAGON MAINTENANCE SITE	JSURAT	21/08/2019	Internal	5068.0	\$0.00	Remove ancillary items and Hydraulic Hose/s, inspect and report, Remove ancillary items and Carriage, Strip, Inspect and report, Remove ancillary items and Mast, Strip, Inspect and report, Refit Mast and ancillary items, Need to swap mast of two trucks, but attachment and carriage remains. Firts is removed hydraulic hoses on mast on main machine. Then removed carriage. Then removed hoses on mast and removed mast assembly. Moved machine and put the other on work area for removal of mast again. Removed carriage of the other machine and then removed mast. Moved other main the put the main machine on work area to fit the mast. Fitmast assembly came from other machine then fit hoses. Repair Light Circuit as required, Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Refit Hydraulic Tilt Cylinder and ancillary items , Refit Hydraulic Hose/s and ancillary items, Refit Carriage and ancillary items, Remove ancillary items and Carriage Rollers, Strip, Inspect and report, Replace Lift Chain, Secure hoses and light wiring on mast. Repair oil leak on hoses. Prepare other mast to be fitted on the other machine. Fit mast and tilting cylinder. Fit hydraulic hoses on mast. Fit carriage and chain. Test machine. Machine is in working condition. Main machine need to replaced carriage rollers and lift chain prepare machine while still waiting for parts by removing carriage rollers and lift chain.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H15990		Description: HYSTER H16.00XM _ moved to infra CB- until new site and new unit is located					
Make: HYSTER		Model: H16.00XM		Serial No.: G019E02124F			
1232171	De-hire inspection and minor repairs repair air leak on brakes	MOWENS	13/08/2019	Internal	5068.0	\$0.00	Carry out equipment condition assessment Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Remove ancillary items and Transmission, Strip, Inspect and report, remove units out the way so i could access unit, drained trans oil and engine oil, removed all hoses on trans, removed bell house bolts and torque bolts removed trans and cleaned up area Replace Brake Booster assembly, remove brake terddle valve and fit new valve to unit, test unit, all ok Steam clean equipment as necessary. clean unit, greese unit, adjust brakes, clean windows, clean cab, move units around to find place to fit machine
1229960	Unit leaking water	312 Planning A	5/08/2019	Internal	5111.0	\$0.00	
1227302	Carry out inspection as req and prep for hire	MOWENS	25/07/2019	Internal	5111.0	\$0.00	Carry out equipment condition assessment Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, clean unit, greese unit, lube unit, fit new tail light to unit, cheak all oils and top up, paint unit number, pant whhels and tynes, clean wind screen
Equipment Total:						\$1,470.00	
Customer Total:						\$1,470.00	