

Taber, AB Ph: 403-223-3588 Fax 403-223-2273  
 Burdett, AB Ph: 403-833-3811 Fax: 403-833-2069  
 Lethbridge, AB Ph: 403-327-5512 Fax: 403-328-2599

12004 RR 64 P/O box 1413 • Medicine Hat, AB T1A 7N3

Ph: 403-526-4450 • Fax: 403-527-8569

Toll Free: 1-800-560-4450

www.westernt tractor.ca



**JOHN DEERE**

Ship To:



Invoice To:



Branch MEDICINE HAT, AB		
Date 08/29/23	Time 11:13:11 (O)	Page 01
Account No [REDACTED]	Phone No [REDACTED]	Inv No [REDACTED]
Ship Via	Purchase Order	
Tax ID No	Agrimart	
		Salesperson 665

**SERVICE INVOICE**

STK#/FLEET#	HRS	PIN/EIN	WARRANTY DATE	HRS
00053270 S680 STS COMBINE	X	1H0S680SLF0775595	08/15/16	
S680	831			1000

GST No. 103596318

Visit [www.westernt tractor.ca](http://www.westernt tractor.ca) to sign up for your secure access to WT Mobile.  
 Your information, at your convenience.

SEGMENT# 1 C 1288 NA 08/02/23 08/03/23  
 ecu 3480.01

CORRECTION:

-Checked the codes when I arrived, found they were stored and only 1 of each dosing pump coded (4 total). Checked starting operations and running of engine, it was fine. Cycled key 6 or 7 times and the codes came back but only for a moment and did not stay active. Couldn't get them to activate again for another dozen key cycles. Tried wiggle test on all the connectors, tap the pump and dosing unit with no issues. Plugged in pump and cycled the key dozens of times and let unit run for 30 min with no more issues.

ADDITIONAL DESCRIPTION:

-4 Codes related to ECU 3480.01 only single counts.

RE559865	Pump	1 N	1924.14	1924.14
3750	INBD FRT&HDL-AG	1	75.00	75.00
			PARTS	1999.14
			LABOR	576.00
10903000			SEGMENT TOTAL==>	2575.14



SEGMENT# 2 C 1288 SERV TRIP C 08/02/23 08/03/23

Customer Service Trip

CORRECTION:

shared trip

CONTINUED ON PAGE 02

**X**

Received By

I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full, an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto. It is understood that WESTERN TRACTOR Company Inc. assumes no responsibility for loss or damage by theft or fire to machines placed with them for storage, sale, repair or while field testing.

Taber, AB Ph: 403-223-3588 Fax 403-223-2273  
 Burdett, AB Ph: 403-833-3811 Fax: 403-833-2069  
 Lethbridge, AB Ph: 403-327-5512 Fax: 403-328-2599

12004 RR 64 P/O box 1413 • Medicine Hat, AB T1A 7N3

Ph: 403-526-4450 • Fax: 403-527-8569

 
Toll Free: 1-800-560-4450

www.westerntractor.ca




**JOHN DEERE**

Ship To:



Invoice To:

 

Branch MEDICINE HAT, AB		
Date 08/29/23	Time 11:13:11 (O)	Page 02
Account No [REDACTED]	Phone No [REDACTED]	Inv No [REDACTED]
Ship Via	Purchase Order	
Tax ID No	Agrimart	
		Salesperson 665

**SERVICE INVOICE**

STK#/FLEET#	HRS	PIN/EIN	WARRANTY DATE	HRS	
00053270	S680	STS COMBINE	X 1H0S680SLF0775595	08/15/16	
	S680		831	1000	
10903000				LABOR	336.00
				SEGMENT TOTAL==>	336.00

\*\*\*\*\* WORK ORDER TOTALS \*\*\*\*\*

PARTS	1999.14
LABOR	912.00
SERV SUPPLIES	72.96
SUB TOTAL==>	2984.10
GST No. 103596318	149.22
TOTAL MULTIUSE	3133.32

027085 8403738721

This purchase is subject to the terms outlined in the Special Terms Disclosure statement which I have agreed to and received.  
 This purchase is subject to the terms of the John Deere Financial Multi-Use Account Agreement. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

**POSTED**

X

Received By

I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full, an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto. It is understood that WESTERN TRACTOR Company Inc. assumes no responsibility for loss or damage by theft or fire to machines placed with them for storage, sale, repair or while field testing.

Taber, AB Ph: 403-223-3588 Fax 403-223-2273  
 Burdett, AB Ph: 403-833-3811 Fax: 403-833-2069  
 Lethbridge, AB Ph: 403-327-5512 Fax: 403-328-2599

12004 RR 64 P/O box 1413 • Medicine Hat, AB T1A 7N3

Ph: 403-526-4450 • Fax: 403-527-8569

 
Toll Free: 1-800-560-4450

www.westerntractor.ca



**JOHN DEERE**

Ship To:



Invoice To:



Branch MEDICINE HAT, AB		
Date 03/13/23	Time 16:03:48 (O)	Page 01
Account No [REDACTED]	Phone No [REDACTED]	Inv No [REDACTED]
Ship Via	Purchase Order 4830 PMI	
Tax ID No	Agrimart	
		Salesperson 988

**SERVICE PRELIMINARY**

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
001227	SPRAYER 4830		X N04830X008148	05/02/11	

SEGMENT# 1 S 1288 SPRAYANDWINT 01/20/23 01/20/23  
 AG PERFORMAX - SELF PROPEL SPRAYER INSPECTION & WINTERIZE  
 PERFORMAX - SELF PROPELLED SPRAYER INSPECTION AND WINTERIZE

\*\*\*\*\*

OPERATION CHECKS AND FLUID LEVELS  
 HYDRAULIC FLOW AND PRESSURE CHECK  
 AIR CONDITIONING AND CAB FUNCTIONS  
 STEERING, BRAKE AND CAB FUNCTIONS  
 ENGINE AND COOLING SYSTEM CHECKS  
 AXLE AND STEERING CHECKS  
 ELECTRICAL SYSTEMS CHECK  
 SAFETY SHIELDS  
 WET SYSTEM CHECK  
 NOZZLE FLOW RATE  
 PERFORMAX INCLUDES WASH

\*

ADD \$225.00 AS M-CODE FOR ANTIFREEZE

\*

\*NOTE\* THE LABOR DISCOUNT TO REDUCE THE PERFORMAX PRICE IS  
 APPLIED TO THE MISC TOTAL

\*\*\*\*\*

10100004	LABOR	2722.50
	SEGMENT TOTAL==>	2722.50

SEGMENT# 2 S 1288 HAULING 01/20/23  
 SEMI HAULING & MISC CHARGES (OFFICE USE ONLY)  
 110 k one way. Trucking charge \$1210.00 less \$605.00

SEGMENT# 3 S 1288 WASH 01/20/23

CONTINUED ON PAGE 02

**X**

Received By

Taber, AB Ph: 403-223-3588 Fax 403-223-2273  
 Burdett, AB Ph: 403-833-3811 Fax: 403-833-2069  
 Lethbridge, AB Ph: 403-327-5512 Fax: 403-328-2599

12004 RR 64 P/O box 1413 • Medicine Hat, AB T1A 7N3

Ph: 403-526-4450 • Fax: 403-527-8569

Toll Free: 1-800-560-4450

www.westernttractor.ca



**JOHN DEERE**

Ship To:



Invoice To:



Branch MEDICINE HAT, AB		
Date 03/13/23	Time 16:03:48 (O)	Page 02
Account No [REDACTED]	Phone No [REDACTED]	Inv No [REDACTED]
Ship Via	Purchase Order 4830 PMI	
Tax ID No	Agrimart	
		Salesperson 988

**SERVICE PRELIMINARY**

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
001227	SPRAYER 4830		X N04830X008148	05/02/11	
	WASH AND CLEAN UNIT				

SEGMENT# 4 S 1288 DECLINED 01/20/23  
 Repairs Declined By Customer

SEGMENT# 5 S 1288 48.3 02/08/23 02/08/23

Install Spraytest

CORRECTION:

- Installed spray test kit onto 4830.
- Ran harness and secured, checked operation of valves all working.

ADDITIONAL DESCRIPTION:

Follow manufacturer's instructions.

Test system

- Ordered kit through parts BUT under Tuchsherer Farms. So its not on the work order. Kit #ST8-4830

PM06535	6x20 flng bolt	1	1.54	1.54
PM06590	6m flange nut	1	1.36	1.36
ST8KIT	8 CHANNEL BOOM	1	1700.00	1700.00
3750	INBD FRT&HDL-AG	1	60.00	60.00
			PARTS	1762.90
			LABOR	247.50
10100004			SEGMENT TOTAL==>	2010.40

SEGMENT# 6 S 1288 21 02/08/23 02/08/23

ADJUST ENGINE VALVE LASH

CORRECTION:

- Removed air cooler line, oil line, and EGR exhaust from turbo/area
- Removed air intake line for compressor and multiple

CONTINUED ON PAGE 03

**X**

Received By

Taber, AB Ph: 403-223-3588 Fax 403-223-2273  
 Burdett, AB Ph: 403-833-3811 Fax: 403-833-2069  
 Lethbridge, AB Ph: 403-327-5512 Fax: 403-328-2599

12004 RR 64 P/O box 1413 • Medicine Hat, AB T1A 7N3

Ph: 403-526-4450 • Fax: 403-527-8569

Toll Free: 1-800-560-4450

[www.westerntractor.ca](http://www.westerntractor.ca)



**JOHN DEERE**

Ship To: [REDACTED]

Invoice To: [REDACTED]

Branch MEDICINE HAT, AB		
Date 03/13/23	Time 16:03:48 (O)	Page 03
Account No [REDACTED]	Phone No [REDACTED]	Inv No [REDACTED]
Ship Via	Purchase Order 4830 PMI	
Tax ID No	Agrimart	
		Salesperson 988

**SERVICE PRELIMINARY**

STK#/FLEET#	HRS	PIN/EIN	WARRANTY DATE	HRS
001227		X N04830X008148	05/02/11	

SPRAYER  
4830

- clamps, moving hoses out of the way.
- Removed engine lift mount and harness mount.
- blew off area and removed valve cover, it was stuck on and outside edge of cover ended up chipping off, when reinstalling used silicone to ensure seal.
- Removed cover, set valves as per manual. Assembled in reverse order torque bolts.
- Checked operation, good.

ADDITIONAL DESCRIPTION:

PUT HOOD INTO SERVICE POSITION  
 REMOVE AIR CLEANER AND ASSOCIATED PIPES  
 REMOVE COMPONENTS AS NECESSARY TO ACCESS TAPPET COVER.  
 SET VALVES AS PER CTM  
 REPLACE TAPPET COVER GASKET

R524497	GASKET	1	86.21	86.21
			PARTS	86.21
			LABOR	1287.00
10100004			SEGMENT TOTAL==>	1373.21

SEGMENT# 7 S 1288 DECLINED 02/08/23

Repairs Declined By Customer

-Some dirt buildup around corners of oil pan, very minor leak

-Engine oil change was very recent, if doing pan gasket potentially keep old oil

SEGMENT# 8 S 1288 DECLINED 02/08/23

Repairs Declined By Customer

-Battery bolts are starting to corrode. Replace all four bolts and nuts.

CONTINUED ON PAGE 04

**X**

Received By \_\_\_\_\_

Taber, AB Ph: 403-223-3588 Fax 403-223-2273  
 Burdett, AB Ph: 403-833-3811 Fax: 403-833-2069  
 Lethbridge, AB Ph: 403-327-5512 Fax: 403-328-2599

12004 RR 64 P/O box 1413 • Medicine Hat, AB T1A 7N3  
 Ph: 403-526-4450 • Fax: 403-527-8569  
 Toll Free: 1-800-560-4450  
 www.westernttractor.ca

 


**JOHN DEERE**

Ship To:



Invoice To:



Branch MEDICINE HAT, AB		
Date 03/13/23	Time 16:03:48 (O)	Page 04
Account No [REDACTED]	Phone No [REDACTED]	Inv No [REDACTED]
Ship Via	Purchase Order 4830 PMI	
Tax ID No	Agrimart	
		Salesperson 988

**SERVICE PRELIMINARY**

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
001227	SPRAYER		X N04830X008148	05/02/11	
	4830				

SEGMENT# 9 S 1288 DECLINED 02/08/23

Repairs Declined By Customer

-Customer has bracket in cab for left inner boom main pivot. Its the updated part and would like it installed.

AKK12671

-Check pads when off potentially replace.

SEGMENT#10 S 1288 66.1 02/08/23 02/10/23

Adjust Tread Adjust Shims (Per Corner)

CORRECTION:

-Jacked up each corner and extended axles out

-Both rear axles took extra time due to the slide supports being broken and stuck inside the axles (2 hrs extra)

ADDITIONAL DESCRIPTION:

-All four slides need to be adjusted, front right and rear left are bad and will price out new TOP pads for all 4.

Preferred method: jack up sprayer first

Loosen jam nuts and adjust to spec.

Operate tread adjust and check operation.

KK32893	Pad	8 N	62.88	503.04
N305164	SHIM	3 M	523.03	1569.09
R198608	PLUG	16 M	1.60	25.60
			PARTS	2097.73
			LABOR	825.00
10100004			SEGMENT TOTAL==>	2922.73

SEGMENT#11 S 1288 DECLINED 02/08/23

Repairs Declined By Customer

-Ladder mount is slotted out and ladder sometimes sticks

CONTINUED ON PAGE 05

**X**

Received By \_\_\_\_\_

 
Taber, AB Ph: 403-223-3588 Fax 403-223-2273  
 Burdett, AB Ph: 403-833-3811 Fax: 403-833-2069  
 Lethbridge, AB Ph: 403-327-5512 Fax: 403-328-2599

12004 RR 64 P/O box 1413 • Medicine Hat, AB T1A 7N3  
 Ph: 403-526-4450 • Fax: 403-527-8569  
 Toll Free: 1-800-560-4450  
 www.westerntractor.ca




**JOHN DEERE**

Ship To:



Invoice To:

 

Branch MEDICINE HAT, AB		
Date 03/13/23	Time 16:03:48 (O)	Page 05
Account No [REDACTED]	Phone No [REDACTED]	Inv No [REDACTED]
Ship Via	Purchase Order 4830 PMI	
Tax ID No	Agrimart	
		Salesperson 988

**SERVICE PRELIMINARY**

STK#/FLEET#	HRS	PIN/EIN	WARRANTY DATE	HRS
001227		X N04830X008148	05/02/11	

SPRAYER  
4830

when it's all the way down. Remove cylinder and asses mount, possibly weld up.

SEGMENT#12 S 1288 63 02/08/23 03/07/23

Adjust Toe-in

CORRECTION:

-Checked toe in within 1/8

ADDITIONAL DESCRIPTION:

-After tread adjust shims do Toe-in

Use tech manual to find spec

Adjust and recheck.

10100004

LABOR 99.00  
 SEGMENT TOTAL==> 99.00

SEGMENT#13 S 1288 NA 02/08/23 03/06/23

Left Boom Cracks

CORRECTION:

-Chipped away paint, found a couple small cracks cleaned and repaired.

ADDITIONAL DESCRIPTION:

-Clean and weld up marked boom cracks

10100004

LABOR 247.50  
 SEGMENT TOTAL==> 247.50

SEGMENT#14 S 1288 NA 02/08/23 02/08/23

Break Aways

CORRECTION:

-Removed nut and with help supported breakaways, replaced pins on both sides.

ADDITIONAL DESCRIPTION:

CONTINUED ON PAGE 06

**X**

Received By