





		Branch				
	IN STORE PICKUP	Outlook		*REPRI	NT*	
 Q		Date	Time			Page
Ship		04/21/25	22:	45:35 (B)	01
ळ		Account No.	Phone N	0.	Invo	oice No.
		Snip Via		Purchase	Order	
 ::						
Invoice						
<u>-</u>					Salespers	son
					LL4	:
		-				

STK#/FLEET# 024929 9430

9430 Tractor

HRS PIN/EIN

WARRANTY DATE

HRS

5196 1RW9430PLBP024929

09/30/13

2000

9430

Thank you for choosing Western Sales. For any future service needs contact our Outlook service department directly by text or phone at 306-518-7872.

SEGMENT# 1 C 4559 35.1

01/16/25 02/03/25

R&R FUEL INJECTOR CUPS & SLEEVES

COMPLAINT:

engine runs rough

Diagnostics:

bring machine in to get ready to replace fuel injectors. (runs rough) remove rocker cover and inspect. remove rocker shaft and found damage (see segment 3)

Repair:

remove injector cups, remove fuel injectors, install new cups, install new fuel injectors and new hardware, torque to spec. reinstall rocker shafts as needed and install new hardware, torque to spec. set valves as needed, set injectors as needed. install new

valve cover gasket and install cover. program new fuel injectors. run engine as needed to verify repair, engine runs good at this time

ADDITIONAL DESCRIPTION:

replace all fuel injectors

1 3				
CRDZ121294	Electronic Unit	6 -	146.00	876.00-
DZ112918	Filter Element	RETAIL	244.07	
		1	214.78	214.78
DZ120103	Gasket Kit	1	330.04	330.04
DZ121295	Electronic Unit	1	11588.83	11588.83
		CON	TINUED ON PAGE 02	

If you are not completely satisfied with your experience please let one of our managers know.

I HEREBY CERTIFY THAT I AM ENGAGED IN THE BUSINESS OF FARMING AND THAT THE GOODS SHOWN ON THIS INVOICE WILL BE USED EXCLUSIVELY IN THE CONDUCT OF THAT BUSINESS.









211.40

3.75 94.28

Ship to:	IN STORE PICKUP
Invoice to:	Lyndon Simonson Box 8 Macrorie SK SOL 2E0

Branch		
Outlook		
Date	Time	Page
04/21/25	22:45:35 (B	
Account No.	Phone No.	Invoice No.
Ship Via	Purchase Or	der
	S	alesperson
		LL4

STK#/FLEET# PIN/EIN WARRANTY DATE HRS HRS 024929 9430 Tractor 5196 1RW9430PLBP024929 09/30/13 2000 9430 DZ130550 Filter Element RETAIL 240.23 1 211.40 EHC-BIG 8"OR > \$1.25 @ 3 1.25

RE505499 KIT 1 N 157.91 157.91 RE572785 Oil Filter RETAIL 156.67 1 137.87 137.87

1

94.28

DESCRIPTION

R518352 Valve Bridge 1 N 121.73 121.73 R520798 RETAINER 2 M 1.28 2.56 PARTS 11987.15

LABOR 4810.00 10101 SEGMENT TOTAL==> 16797.15

SEGMENT# 2 C 4559 NA

01/16/25 02/28/25

Clamp

CHECK ALL CODES AND REPORT COMPLAINT:

customer wants codes checked

Diagnostics:

CLC 2366.05, 2370.05

ECU 1172.03, 3822.02, 1569.31

FDH 629.12

RE289839

PTP 190.01, 524267.16, 523438.12

SSU 522387.07

SV3 4084.18

SV4 4084.18

TEC 630.02

Repair:

After checking codes the only code that really matters is the air temp code on air tube. Found broken wires for

sensor. Repair wiring as needed and clear codes, no codes

CONTINUED ON PAGE 03

If you are not completely satisfied with your experience please let one of our managers know.

I HEREBY CERTIFY THAT I AM ENGAGED IN THE BUSINESS OF FARMING AND THAT THE GOODS SHOWN ON THIS INVOICE WILL BE USED EXCLUSIVELY IN THE CONDUCT OF THAT BUSINESS.







		Branch				
. 10	IN STORE PICKUP	Outlook Date	Time			Page
Ship		04/21/25 Account No.	Phone No	<u>45:35 (</u> o.	B) Inv	03 oice No.
		Snip Via		Purchase (Jrder	
Invoice to:						
<u>-</u>					Salesper LL4	
					LL4	

1RW9430PLBP024929

PIN/EIN

01/16/25 03/03/25

HRS

5196

STK#/FLEET#

024929

9430 Tractor

9430

came back at this time.

ADDITIONAL DESCRIPTION:

check codes

462.50 LABOR 10101

462.50 SEGMENT TOTAL ==>

HRS

2000

WARRANTY DATE

09/30/13

SEGMENT# 3 C 4559 N/A

R&R HEAD GASKET

COMPLAINT:

engine runs rough

>SUBLET NORTHSIDE AUTOMOTIVE PO# 012777BM

while working on injector segment, removed rocker arms and found 1 valve spring keeper looks broken, on closer inspection found #4 exhaust valve spring is crooked and what appears to be a shim sticking out at bottom, perform full diagnostics on this segment to see what has happened to valve. remove valve spring and inspect, found what looked like shim is actually valve seal thats broken. try to lower valve and found valve is bent above valve guide. (cylinder head needs to be removed for further diagnostics) after head removed try to remove valve, was unable to remove due to bend, sublet to machine shop for further inspection and repair.

Repair:

put hood in service mode, drain coolant and oil, remove rocker shaft (previously removed) remove turbo and exhaust manifold, remove intake manifold, remove cooling fan and front timing cover, remove cam gear, remove head bolts, remove fuel pump. lock cam into place, remove cylinder

CONTINUED ON PAGE 04

If you are not completely satisfied with your experience please let one of our managers know.

 
I HEREBY CERTIFY THAT I AM ENGAGED IN THE BUSINESS OF FARMING AND THAT THE GOODS SHOWN ON THIS INVOICE WILL BE USED EXCLUSIVELY IN THE CONDUCT OF THAT BUSINESS.



TERMS: PAYMENT DUE ON RECEIPT OF STATEMENT. SPECIAL ORDER GOODS ARE **NOT** RETURNABLE. ALL RETURNS MUST BE ACCOMPANIED BY THIS INVOICE. RETURNED GOODS SUBJECT TO RESTOCKING CHARGE. TITLE TO ALL ITEMS REMAINS WITH THE VENDOR UNTIL PURCHASE PRICE, AND OTHER CHARGES ARE FULLY PAID.

JOHN DEERE SIGNATURE







		Branch				
	IN STORE PICKUP	Outlook Date	Time			Page
sulb t		04/21/25 Account No.	22: Phone N	<u>45:35 (</u>	B)	04 voice No.
			1 110110 11			
 <u>.</u> .		Snip Via		Purchase (Order	
Invoice t						
=					Salespe	rson
l					$_{ m LL}$	4

1RW9430PLBP024929

STK#/FLEET#

024929

9430 Tractor

HRS PIN/EIN

5196

WARRANTY DATE

09/30/13

HRS 2000

9430

head, remove cam on bench, disassemble rest of cylinder head as needed.

inspect pistons for any possible damage (none) unsure why valve is bent. clean engine block of gasket material, clean all previously removed parts and install seals etc as needed. after getting head back from machine shop reinstall cam as needed. install new head gasket, reinstall cylinder head install new head bolts, torque to spec. reinstall all previously removed parts as needed. install new fuel pump to camshaft drive link as well. change engine

new fuel pump to camshaft drive link as well. change engine oil and filter. continue on segment 1

ADDITIONAL DESCRIPTION:

Remove:

- -Hood
- -Exhaust and intake pipes
- leak-off lines
- -Fan support
- -Rocker arm cover and assembly

Remove cylinder head, check head and block flatness.

Install new gasket and install head to specification.

Replace injector cups .


A4730R	O-RING	2	4.02	8.04
EHC-ANTI	Enviro Charge	50	.14	7.00
EHC-ANTICON	\$0.10/L Contain	50	.10	5.00
EHC-OIL	6¢ PER LITRE	41	.06	2.46
MMHD	1/10 LBS METRIC	2	2.25	4.50
RE523985	Seal	24 M	42.79	1026.96
RE527611	THERMOSTAT	1	82.94	82.94
RE527612	THERMOSTAT	2	74.96	149.92
RE530816	Gasket Kit	1 M	1152.28	1152.28
		CONTINU	JED ON PAGE 05	

If you are not completely satisfied with your experience please let one of our managers know.

 I HEREBY CERTIFY THAT I AM ENGAGED IN THE BUSINESS OF FARMING AND THAT THE GOODS SHOWN ON THIS INVOICE WILL BE USED EXCLUSIVELY IN THE CONDUCT OF THAT BUSINESS.









		Bianch				
Г	IN STORE PICKUP	Outlook				
<u>:</u>		Date	Time		P	age
		04/21/25	22:45:3	35 (B)	0)5
;		Account No.	Phone No.		Invoice	
_		Ship Via	Purci	nase Orde	er	_
; [
•				Sal	esperson	
L					LL4	

STK#/FLEET# HRS PIN/EIN WARRANTY DATE HRS 024929 9430 Tractor 9430 RE530817 Bolt Kit 1 N 621.54 R136507 M10x70 SCREW 12 9.13 R241746 V-BELT 1 64.58 R518328 VALVE 2 N 172.71	
9430 RE530817 Bolt Kit 1 N 621.54 R136507 M10x70 SCREW 12 9.13 R241746 V-BELT 1 64.58 R518328 VALVE 2 N 172.71	
RE530817 Bolt Kit 1 N 621.54 R136507 M10x70 SCREW 12 9.13 R241746 V-BELT 1 64.58 R518328 VALVE 2 N 172.71	
R136507 M10x70 SCREW 12 9.13 R241746 V-BELT 1 64.58 R518328 VALVE 2 N 172.71	621.54
R241746 V-BELT 1 64.58 R518328 VALVE 2 N 172.71	109.56
	64.58
	345.42
R519643 Gasket 2 18.90	37.80
R519732 Clip 1 N 12.40	12.40
R520798 RETAINER 48 N 1.28	61.44
R523533 RING 3 M 35.18	105.54
R532008 Bushing 4 N 93.41	373.64
R56461 O-RING 1 M 4.46	4.46
R63185 O-RING 3 6.41	19.23
SUBLET50 Northside 40027 1 2017.09	2017.09
TY26576 COOL-GARD TM RETAIL 63.76	
5 57.38	286.90
TY26660 15W40 Bulk 1L 41 6.67	273.47
19M7913 SCREW 2 5.61	11.22
51M7095 O-RING 2 2.72	5.44
PARTS	4771.74
LABOR	4625.00
SUBLET	
10101 SEGMENT TOTAL==> 1	2017.09

***** WORK ORDER TOTALS ******

PARTS 16758.89

LABOR 9897.50

SUBLET 2017.09

SHOP SUPPLIES 300.00

SUB TOTAL==> 28973.48

CONTINUED ON PAGE 06

If you are not completely satisfied with your experience please let one of our managers know.

I HEREBY CERTIFY THAT I AM ENGAGED IN THE BUSINESS OF FARMING AND THAT THE GOODS SHOWN ON THIS INVOICE WILL BE USED EXCLUSIVELY IN THE CONDUCT OF THAT BUSINESS.









		Dianch				
	IN STORE PICKUP	Outlook				
 Q		Date	Time			Page
Ship		04/21/25	22:45	5:35 (E	;)	06
ळ		Account No.	Phone No.		Invo	ice No.
		Snip Via	1	urchase O	rder	
.: •						
Invoice						
<u>-</u>					Salespers	on
					LL4	

1RW9430PLBP024929

STK#/FLEET#

024929

9430 Tractor

9430

HRS PIN/EIN

5196

WARRANTY DATE

HRS

09/30/13 2000

> 1448.66 30422.14

If you are not completely satisfied with your experience please let one of our managers know.

I HEREBY CERTIFY THAT I AM ENGAGED IN THE BUSINESS OF FARMING AND THAT THE GOODS SHOWN ON THIS INVOICE WILL BE USED EXCLUSIVELY IN THE CONDUCT OF THAT BUSINESS.

