

Operational Asset	Number	Description	Work Plan	Work Done	Completed
DZR00015	WO-GTP-178-013	CLEAN OUT COOLER PACK	CLEAN OUT COOLER PACK	LOOSEN INTERCOOLERS AND PULLED BACK TO GAIN ACCESS TO COOLERS ,USING COMPRESSED AIR TO CLEAN OUT COOLERS ,	07/24/2025
DZR00015	WO-GTP-177-624	LADDER LOCK FAULT	LADDER LOCK FAULT	HRS 10384 RE ADJUSTED BOTTOM PLATE AND SPRAYED GRAPHITE LUBE IN LOCK PIN TO HELP FREE UP DURING OPERATION. TESTED AND OPERATING CORRECTLY.	07/16/2025
DZR00015	WO-GTP-177-532	RESAMPLE AND CHECK FINAL DRIVES	RESAMPLE AND CHECK FINAL DRIVES	10'354 HR RESAMPLE BOTH FINAL DRIVES AND CHECK MAG PLUGS, MAG PLUGS OK - NORMAL AMOUNT OF VERY FINE METAL ON BOTH SIDES, R/H FINAL OIL VERY LOW - LEVEL WITH BOTTOM OF DUO SEAL , PULL COVER PLATE TO INSPECT AND TAKE SAMPLE, VISUALLY LOOKS OK, REFIT COVER PLATE AND TOP UP OIL 40-50L, NEED TO CHECK OIL LEVEL DAILY AS DUO IS LEAKING BADLY	07/15/2025
DZR00015	WO-GTP-177-070	LOOSE / MISSING BOLTS ON R/H SPROCKET	LOOSE / MISSING BOLTS ON R/H SPROCKET	10'287 HR END BOLTS LOOSE ON EVERY SEGMENT ON R/H SIDE, 2 BOLTS MISSING, CHECK ALL BOLTS, TIGHTEN LOOSE BOLTS WITH RATTLE GUN, REPLACE 2X MISSING BOLTS WITH OLD BOLTS, MONITOR RETORQUED ALL BOLTS TO MANUFACTUREERS SPEC	07/12/2025
DZR00015	WO-GTP-176-934	Smoke Bomb Cab	Smoke bomb cab and reseal if required.		
DZR00015	WO-GTP-176-722	R/H LIFT CYLINDER LIGHT MOUNT SNAPPED	R/H LIFT CYLINDER LIGHT MOUNT SNAPPED	REMOVED RUBBER MOUNTS AND REPLACED WITH NEW MOUNTS AND TENSIONED	06/29/2025
DZR00015	WO-GTP-176-407	FUEL FILTER BLOCKED CODES	FUEL FILTER BLOCKED CODES	10'187 HR REPLACE FUEL FILTERS X3 + PRIME	06/23/2025
DZR00015	WO-GTP-175-774	Fire Suppression Service	Service Fire Suppression System - MITCHELL AND BROWN TO COMPLETE	FIRE SUPPRESSION CARRIED OUT BY MITCHELL AND BROWN - REPORT ATTACHED	06/20/2025
DZR00015	WO-GTP-174-766	D Service - Dozer	Service as per attached Service Sheet	COMPLETED AS PER MANUFACTURER SPECS , RIGHT HAND FINAL DRIVE FOUND TO BE LOW ON OIL DUE TO LEAKING DUO SEAL , COMPLETED AT 10,079	06/12/2025
DZR00015	WO-GTP-174-743	ADJUST TRACKS	ADJUST TRACKS	9864HR ADJUST TRACK TENSION TO SPEC COMPLETED BY MITCHELL AND BROWN REFER TO INVOICE 121199	05/22/2025
DZR00015	WO-GTP-174-684	Fire Equipment Service - Site	Inspect, test and tag fire equipment - Midwest Fire		06/30/2025
DZR00015	WO-GTP-173-862	A Service - Dozer	Service as per attached Service Sheet		
DZR00015	WO-GTP-173-241	ALL BELLY PLATES LOOSE AND HARDWARE MISSING	ALL BELLY PLATES LOOSE AND HARDWARE MISSING	REPLACED HARDWARE AND TIGHTENED	06/29/2025
DZR00015	WO-GTP-172-893	CLEAN OUT COOLERS	CLEAN OUT COOLERS	DROPPED INTER COOLERS BACK AND BLEW OUT COOLERS RE FITTED INTER COOLERS AND CHECKED SYSTEM.	04/22/2025
DZR00015	WO-GTP-172-747	REMOVE AND REPLACE DRAFT ARMS, TILT CYLINDERS.	REMOVE AND REPLACE DRAFT ARMS, TILT CYLINDERS.	HRS 9615 REMOVE KEEPER PLATES, PINS. REMOVE TILT CYLINDERS /DRAFT ARMS. ASSEMBLE DRAFT ARMS ONTO NEW BLADE, INSTALL CYLINDERS AND HOSES ON ARMS.	05/05/2025
DZR00015	WO-GTP-172-450	Dozer 3rd Party Assessment of Track and Undercarriage	3rd Party Assessment of Track and Undercarriage	REFER TO WORK ORDER WO-GTP-172-449 COMPLETED 10/04/2025 BY WESTRAC - REPORT ATTACHED	01/25/2025
DZR00015	WO-GTP-172-449	Dozer 3rd Party Assessment of Track and Undercarriage	3rd Party Assessment of Track and Undercarriage	TRACK INSPECTION COMPLETED BY WESTRAC - REPORT ATTACHED	04/10/2025
DZR00015	WO-GTP-172-174	WORN TRANSMISSION HOSES	REPLACE TRANSMISSION HOSES	COMPLETED ON WO-GTP-171-660	04/07/2025
DZR00015	WO-GTP-172-022	WELD WEAR STRIPS ONTO NEW BLADE	MARK OUT/ PREP AREA, TACK WEAR STRIPS IN PLACE AND FULLY WELD.		
DZR00015	WO-GTP-171-661	PLUGGED FUEL FILTERS	PLUGGED FUEL FILTERS	REMOVED OLD FILTERS AND REPLACED WITH NEW FILTERS AND BLED UP FUEL SYSTEM AN RAN UP MACHINE AND CHECK HIGH LOW OPERATION.	03/26/2025
DZR00015	WO-GTP-171-660	TRANSMISSION NOISE	TRANSMISSION NOISE	HRS 9589 26/3/25 INSPECT TRANSMISSION NOISE, MAKING RUMBLING/GROWLING NOISE WHEN IN GEAR. PULL FILTER TO FIND FULL OF METAL. TAG MACHINE OUT. 27/3/25 CHECK FOR LOGGED CODES/EVENTS RELATING TO TRANSMISSION - NOTHING. DRAIN TRANSMISSION OIL AND SCREEN TO FIND FILLED WITH METAL. WHAT LOOKS TO BE A FAILED BEARING. USE BORE SCOPE TO TRY SEE INTERNALS OF TRANSMISSION. SUSPECT TRANSSION/DIFF HAS FAILED A BEARING. START REMOVING COUNTER WEIGHT SLABS. 28/3/25 SUPPORT COUNTERWEIGHT WITH FORKLIFT, TRY REMOVE TOP PINS, R/H SIZED. ENDED UP LANCING PIN BUT PIN IS STILL GETTING STUCK IN FRAME. DECISION WAS MADE TO BRING IN 3RD MACHINE. 29/3/25 PUT DZR15 BACK TOGETHER TO MOVE MACHINE OFF SITE FOR REPAIR. REFILL TRANSMISSION OIL, MOVE MACHINE FROM WASH PAD, MOVE EQUIPMENT IN YARD TO ALLOW TRUCK/FLOAT TO DRIVE IN. 1/4/25 REMOVE DRAFT ARM AND BLADE ASSEMBLY FOR MACHINE TO BE FLOATED. HAD BEEN TOLD THAT MACHINE WILL NOT BE FLOATED NOW. SET MACHINE UP AGAIN TO REMOVE COUNTERWEIGHT. OXY CUT REMAINDER OF SIZED PIN OUT OF COUNTERWEIGHT ARM. LOWER COUNTERWEIGHT READY FOR TRANSMISSION GUARD REMOVAL. 2/4 - REMOVE AND CLEAN LOWER GUARD, PRESSURE CLEAN AROUND TRANS AREA. REMOVE FLOOR AND PRESSURE CLEAN HELL HOLE. SETUP GUIDE STUDS AND LIFT EQUIPMENT. 4/4 - SETUP C BRACKET, CARRY OUT KARARA FRANNA PASS OUTS AND VOC. RIG EQUIPMENT. REMOVE AXLES, REMOVE HOSES AND HARNESS FOR REMOVAL. REMOVE TRANS AND DIFF ASSEMBLY. CLEAN METAL OUT OF AXLE HOUSING. WAIT FOR MANAGEMENT TO DECIDE REPAIR EXTENT. INSPECT FAILURE. BRING ASSEMBLY BACK TO CONTAINER YARD TO DISASSEMBLE. CONSTRUCT PARTS LISTS. 5/4 - GET NEW PARTS FROM FREIGHT, TRANSPORT TO CONTAINER YARD, NO FORKLIFT TO UNLOAD, RIG UP BOXES AND MOVE INTO WORKSHOP. USE TRUCK HIAB TO DISASSEMBLE OLD ASSEMBLY AND ASSEMBLE NEW PARTS. SWAP OVER FITTINGS / BRACKETS. PUT OLD PARTS INTO PARTS EXCHANGE BOXES. PREP NEW ASSEMBLY FOR INSTALL. INSTALL TRANSMISSION, INSTALL AXLES, INSTALL NEW TRANS PUMP, REPLACE FILTERS AND SCREEN. FIT MULTIPLE NEW HOSES AND HARNESSES. FILL WITH OIL AND RUN UP - STARTER MOTOR STARTED LEAKING. REMOVE STARTER MOTOR AND REPLACE GASKET. BLEED TORQUE CONVERTER SCAVENGER PUMP AND RUN UP AGAIN. CONDUCT MULTIPLE PRESSURE CHECKS - ALL WITHIN SPEC. MOVE DOZER INTO DRAFT ARMS AND INSTALL CAPS. INSTALL STABILISER BAR, SHIM CAPS, SHIM TRUNNION CAPS, FIT ALL HOSES AND LIFT CYLINDERS. MOVE MACHINE TO WASH PAD, RUN UP MACHINE AND CHECK OIL LEVELS. PUT MACHINE TO WORK, RE CHECK AFTER MACHINE HAS WORKED. FOUND DRAIN PLUG LEAKING, REMOVE PLUG TO FIND WRONG ORING IN PLACE. FIT NEW ORING. EVERYTHING LOOKS OK. PUT MACHINE TO WORK.	05/05/2025
DZR00015	WO-GTP-171-474	A/C INTERMITTENT CUT OUT	A/C INTERMITTENT CUT OUT	A/C INTERMITTENT CUT OUT FAULT AS OPERATOR WAS WORKING MACHINE , CUT CABLE TIES AROUND A/C SWITCH HARNESS LOOKING FOR RUB THROUGHS AND BREAKS, CHECKING FOR CONNECTORS FOUND A LOOSE CONNECTOR PIN ON A/C SWITCH CONNECTOR TIGHTEN PIN HOLDER AND RE TESTED A/C WAS OPERATING CORRECTLY. REPLACED LOW AND HIGH SIDE SWITCHS.	03/26/2025
DZR00015	WO-GTP-171-144	B Service - Dozer	Service as per attached Service Sheet	HRS 9589 9615HRS COMPLETED B SERVICE	04/20/2025
DZR00015	WO-GTP-171-143	A Service - Dozer	Service as per attached Service Sheet	9615HRS COMPLETED B SERVICE	04/20/2025
DZR00015	WO-GTP-171-018	NEW BLADE ASSEMBLY	NEW BLADE ASSEMBLY	ADVISED THAT WORK ORDER NOT REQUIRED AS THE BLADE ASSEMBLY WILL BE REMOVABLE.	03/14/2025
DZR00015	WO-GTP-170-907	Dozer Track Assembly Replacement	Track Assembly Replacement	7586HRS REPLACE UNDERCARRIAGE AND TRACK ASSEMBLIES. HDXL CHAINS. WESTRAC PROVIDED LABOUR TO RUN DOUBLE SHIFTS TO UNDERTAKE WORKS. completed on WO-GTP-159-064	09/06/2024

DZR00015	WO-GTP-170-717	CLEAN COOLER PACKS	CLEAN COOLER PACKS	USING AIR WAND CLEANED ALL BUILD UP FROM COOLER PACKS, DROPPED HEAT EXCHANGER BACK TO ALLOW BETTER ACCESS TO CORES AND REMOVED BUILD UP ONCE COMPLETE SOAKED IN DEGREASER AND WASHED OUT CORES. USING E T MADE SURE FAN SPEEDS WERE TO SPEC AND OPERATING CORRECTLY.	03/08/2025
DZR00015	WO-GTP-170-498	TRANS FILTER HOSES U/S	TRANS FILTER HOSES U/S	HRS 9413 6/3 - REMOVE HOSES TO TRANS FILTER HOUSING AND REPLACE, INSTALL NEW SEALS. USE CABLE TIE SWIVEL MOUNTS TO ROUTE HOSES WITHOUT ANY RUB POINTS. RUN UP TEST - OK	03/06/2025
DZR00015	WO-GTP-170-453	WEAR STRIP COMING OFF	BLADE WEAR STRIP COMING OFF	9,372HR	03/03/2025
DZR00015	WO-GTP-170-307	REPLACE LIFT CYLINDER TO BLADE JOINTS	REPLACE LIFT CYLINDER TO BLADE JOINTS	ATTEND BREAKDOWN, CUT 2 SECTIONS OF WEAR STRIP OF FRONT OF BLADE REPLACE LIFT CYLINDER TO BLADE JOINTS	03/12/2025
DZR00015	WO-GTP-169-699	OIL LEAK FROM REAR BELLY PLATE	OIL LEAK FROM REAR BELLY PLATE	9187 HRS PULL OUT FLOOR, FOUND ADJUSTER ON FAN PUMP CONTROLLER LEAKING, REMOVE ADJUSTER - O-RING ON SPOOL U/S, FIND O-RING TO FIT, REFIT, TOP UP HYDRAULIC OIL, CLEAN DOWN AND TEST RUN, NO LEAKS, PUT FLOOR BACK IN AND SEND DOZER BACK TO WORK	02/17/2025
DZR00015	WO-GTP-169-602	HYD PIPE	FABRICATE NEW HYD PIPE	CUT OFF BOTH ENDS OF HYD PIPE BEND AND SILVER NEW PIPE ON	02/15/2025
DZR00015	WO-GTP-169-519	CLEAN OUT COOLER PACKS	CLEAN OUT COOLER PACKS	9145HR CLEAN OUT COOLER PACKS WITH COMPRESSED AIR 11/2 - INSPECT HYDRAULICS PRESSURES, PILOT SPEC 600 +- 70 PSI, ACTUAL 530 PSI. ET LICENSE EXPIRED SO COULDN'T COMPLETE ALL TESTS. CHECK MAX SPEED PRESSURE, WHEN HYD TEMP GETS TO 90 DEG, FAN PRESSURE IS 3750 PSI. SPEC IS 3200PSI. FAN PRESSURE WAY TOO HIGH, COULDN'T ADJUST DOWN WITH MAX PRESSURE ADJUSTMENT, STRIP AND INSPECT COMPENSATOR, ALL LOOKS OK, NEEDS SEAL REPLACING FOR MAX PRESSURE ADJUSTMENT SPOOL.	02/12/2025
DZR00015	WO-GTP-169-426	HYDRAULICS OVERHEATING	HYDRAULICS OVERHEATING	12/2/25 MATCH UP ORING TO SUIT AND INSTALL TO MAX PRESSURE ADJUSTMENT SPOOL, RUN UP AND CHECK FOR LEAKS. CHECK PRESSURES, PUMP PRESSURE IS 3750PSI (SPEC 3200PSI) PRESSURE NOT COMING DOWN WHEN ADJUSTED. READ THROUGH SCHEMATICS. SUSPECT FAULT IS WITH FAN PUMP ACTUATOR. 18/2/25 - REPLACE FAN PUMP COMPENSATOR, ADJUST PILOT PRESSURE TO SPEC (610PSI). CAP OF LINES TO SEQUENCE VALVE, ONCE MACHINE HOT PRESSURE MAXED OUT AGAIN, COULDN'T ADJUST SEQUENCE VALVE DUE TO PRESSURES WAY TOO HIGH, COULDN'T EVEN START CALIBRATING. REMOVE SEQUENCE VALVE AND INSPECT, ALL OK. REMOVE PLUGS FROM BACK OF PUMP TO CHECK FOR ANY OBVIOUS INTERNAL DAMAGE. CONSULT SCHEMATICS. SUSPECT INTERNAL PUMP FAILURE HOLDING PUMP AND MAX STROKE. CONFIRM ECM IS VARYING AMPERAGE TO SOLENOID. TURN ON/OFF BYPASS VALVE IN CONFIG TO CHECK IF IT HAS ANY AFFECT, NONE NOTED. PUT OLD COMPENSATOR VALVE BACK ON, SUSPECT ISSUE WITH PUMP INTERNALS. 4/3/25 - REPLACE FAN PUMP, RESEAL HOSES AND ASSOCIATED COMPONENTS, PRIME PUMP, CRANK WITHOUT INJECTION TO BUILD OIL PRESSURE, RUN UP TEST, ADJUST SEQUENCE VALVE TO 625 PSI AS PER PROC. ADJUST PILOT TO 600 PSI. WARM UP MACHINE, SET MAXIMUM PUMP PRESSURE 3250 PSI (SPEC 3234 +- 73PSI) SET MINIMUM PUMP PRESSURE 577 PSI (SPEC 580+-30PSI). PERFORM FAN SPEED CALIBRATIONS, MAX 1200 RPM, MIN 540 RPM AND NOMINAL/CLIP 900 RPM.	03/11/2025
DZR00015	WO-GTP-169-263	SPROCKET & HARDWARE	SPROCKET & HARDWARE SUPPLIED BY WESTRAC	SPROCKET & HARDWARE SUPPLIED BY WESTRAC	02/07/2025
DZR00015	WO-GTP-169-241	C Service - Dozer	Service as per attached Service Sheet	9147HRS COMPLETED AS PER CAT SPEC, SAMPLES TAKEN OILS CHANGED, FILTERS CHANGED, INSPECTION COMPLETED OPERATIONAL CHECKS COMPLETED	02/10/2025
DZR00015	WO-GTP-169-110	REPLACE HYDRAULIC HOSES FROM FRONT GRILL TO BACK OF BLADE	REPLACE HYDRAULIC HOSES FROM FRONT GRILL TO BACK OF BLADE	REPLACE HOSES FROM GRILL TO BLADE	05/05/2025
DZR00015	WO-GTP-169-026	DPF OVER PRESSURE LIGHT INTERMITTENT	DPF OVER PRESSURE LIGHT INTERMITTENT	9055HR CLEAN OUT WATER TRAPS, REMOVE DPF CENTRES AND WASH OUT. REFIT TO MACHINE AND RUN UP.	02/02/2025
DZR00015	WO-GTP-168-954	R/H TILT CYLINDER PIPE RUSTED THROUGH	R/H TILT CYLINDER PIPE RUSTED THROUGH	9048 HR REMOVE LEAKING PIPE, FIT NEW PIPE FROM CONTAINER WITH NEW O-RINGS, RUN UP, ALL OK	01/31/2025
DZR00015	WO-GTP-168-947	LIFT HOSES WORN ON STEEL CLAMPS	REPLACE LIFT HOSES IN FRONT OF COOLER PACK	HOSES DIDN'T REQUIRE CHANGING NEW HOSES STILL IN CONTAINER	07/24/2025
DZR00015	WO-GTP-168-714	NEW SUPPRESSION CYLINDER AND INSTALL	NEW SUPPRESSION CYLINDER AND INSTALL	NEW SUPPRESSION CYLINDER AND INSTALL WORK TO BE DONE BY MITCHELL AND BROWN	01/28/2025
DZR00015	WO-GTP-168-590	LADDER FAULT	LADDER FAULT	8927 HRS - LADDER DOWN FAULT INTERMITTENT WHILE OPERATING. FIND WEAR PADS AND PIN ALIGNMENT OUT OF ADJUSTMENT. ROTATE WEAR PADS. ALSO ADJUST SENSOR ALIGNMENT, TEST OPERATION, ALL OK.	01/23/2025
DZR00015	WO-GTP-168-497	RHS LIFT CYLINDER ROD FAILURE	RHS LIFT CYLINDER ROD FAILURE	21/1 - RHS LIFT CYLINDER ROD FALLEN OUT WHILE ON STOCKPILE. NUT HAS UNWOUND THEN PULLED LAST 3-4 THREADS. CAP LINES, SECURE ROD TO BLADE, TOP UP HYDRAULIC OIL, USE LHS CYLINDER TO LIFT BLADE, MOVE DOZER TO WASHPAD. 22/1 - 8927 HRS - POSITION DOZER ON WASHPAD, REMOVE RHS LIFT CYLINDER AND ROD. CLEAN UP MOUNT SURFACES. INSTALL NEW CYLINDER, CHANGE ALL O-RINGS IN HOSES / PIPES. CLEAN AND INSTALL CAPS, TORQUE CAP BOLTS TO 900NM. INSTALL LIGHT BRACKETS AND HARNESS. INSTALL ROD TO BLADE. BLEED THROUGH CYLINDER, TOP UP HYDRAULIC OIL, TEST OPERATION, PACK/CLEAN UP. STRIP AND INSPECT DAMAGED CYLINDER, DROP TO GERALDTON HYDRAULICS FOR REPAIR / RESEAL, PICK UP CYLINDER AND BOX UP AS SPARE	02/25/2025
DZR00015	WO-GTP-168-453	OIL LEAKING IN FRONT GRILL	OIL LEAKING IN FRONT GRILL	8919HR FOUND OIL LEAKING IN FRONT GRILL. DEGREASE AND WASH DOWN TO FIND SOLENOID HAD COME LOOSE AND BLOWN THE ORING. REPLACE ORING AND TEST - OK. DEGREASE AND PUT BACK TO WORK.	01/20/2025
DZR00015	WO-GTP-168-315	REPLACE CUTTING EDGE	REPLACE CUTTING EDGE	5/3/25 - REMOVE OLD CUTTING EDGES, BUFF BLADE SURFACES, REMOVE PAINT FROM NEW EDGES, INSTALL NEW EDGES WITH NEW HARDWARE, TORQUE 1700 FT LB.	03/06/2025
DZR00015	WO-GTP-168-206	REPLACE L/H REAR WORK LIGHT	REPLACE LEFT HAND REAR WORK LIGHT	8,869HR REPAE FAILED WORKLIGHT ON L/H REAR NEXT TO COUNTERWEIGHT	01/14/2025
DZR00015	WO-GTP-168-190	REVERSE ALARM NOT WORKING	REVERSE ALARM NOT WORKING	8868 HRS 14/1 - INSPECT WORK ALARM, CHECK 24V SUPPLY, REMOVE ALARM, TEST ON BENCH, ALARM U/S NEEDS REPLACING. 26/01 REPLACED ALARM WITH NEW TESTED AND OPERATING CORRECTLY.	01/26/2025
DZR00015	WO-GTP-167-912	A Service - Dozer	Service as per attached Service Sheet	8868hrs CARRY OUT A SERVICE	01/14/2025
DZR00015	WO-GTP-167-911	FUEL FILTERS BLOCKED	FUEL FILTERS BLOCKED	8,797HR PICK UP FILTERS FROM WESTRAC, REPLACE FUEL FILTERS AND RUN UP	01/06/2025
DZR00015	WO-GTP-167-883	PLUGGED FUEL FILTER CODES	REPLACE FUEL FILTERS	FILTERS REPLACED AS PER WO-GTP-167-911 RECHARGE AFFF SYSTEM WITH NITROGEN TO KEEP MACHINE OPERATIONAL UNTILL NEW BOTTLE ARRIVES.	01/14/2025
DZR00015	WO-GTP-167-800	R/H SIDE AFFF BOTTLE LEAKING	R/H SIDE AFFF BOTTLE LEAKING	7/1 - ASSISTED JON IN REPLACING RHS AFF BOTTLE. TEST OK	01/02/2025
DZR00015	WO-GTP-167-586	BROKEN GROMMET FOR LIFT CYLINDER HOSES	BROKEN GROMMET FOR LIFT CYLINDER HOSES IN FRONT COOLER PACK BEHIND GRILL	REMOVED OLD GROMET AND REPLACED WITH NEW GROMET .	07/24/2025
DZR00015	WO-GTP-167-585	BLOWN O-RING ON FAN VALVE BLOCK	BLOWN O-RING ON FAN VALVE BLOCK	OIL LEAK IN FRONT OF COOLER PACK, FIND BLOWN O RING AND LOOSE SOLENOID VALVE IN FAN CONTROL VALVE BLOCK. REMOVE 2 X SOLENOID + VALVE, REPLACE O RINGS. SOLENOID VALVES WERE LOOSE. RE-INSTALL, THROUGHY DEGREASE AND WASH OUT COOLER PACK, RUN UP TEST, ALL OK. 8729 HRS	12/30/2024

DZR00015	WO-GTP-167-331	FIRE SUPPRESSION ALARM - LOW PRESSURE	FIRE SUPPRESSION ALARM - LOW PRESSURE	8664HR ATTEND BREAKDOWN, FIRE SUPPRESSION ALARM FOR LOW PRESSURE. TANK PRESSURE IS OK. BRIDGE OUT PRESSURE SWITCH SO ALARM WILL GO OUT AND OPERATOR CAN KEEP USING DOZER.	12/23/2024
DZR00015	WO-GTP-167-236	HYDRAULICS RUNNING HOT	HYDRAULICS RUNNING HOT	8615HR COOLER PACKS BLOCKED , CLEAN COOLER PACKS, CHECK FAN SOLENOID OPERATION WITH E.T. CHECK FAN RAMP UP/DOWN. PUT MACHINE BACK TO WORK	12/20/2024
DZR00015	WO-GTP-166-916	HYDRAULICS OVERHEATING	HYDRAULICS OVERHEATING	27 OCC OF HIGH HYDRAULIC TEMP ON NIGHTSHIFT. INSPECT DOZER, FIND BLOCKED COOLER PACK. UNBOLT AFTER COOLERS AND THOROUGHLY CLEAN BEHIND. DEGREASE AND WASH OUT. RUN UP DOZER, CHECK FAN SPEEDS, MAX FAN SPEED 1375 RPM (SPEC 1050RPM). TRY CALIBRATE MAX FAN SPEED DOWN, CALIBRATING HAD NO EFFECT ON FAN SPEED. SUSPECT ISSUE WITH COMPENSATOR OR PUMP SETTINGS AGAIN. NEED TO CONTINUE DIAGNOSIS. 8502 HRS	01/27/2025
DZR00015	WO-GTP-166-811	8 VOLT SENSOR SUPPLY CODE - NO STEERING	8 VOLT SENSOR SUPPLY CODE - NO STEERING	INSPECT DOZER, FIND ACTIVE CODE FOR 8 VOLT SENSOR SUPPLY FOR TRANSMISSION ECM VOLTAGE BELOW NORMAL. FIND SHORTED HARNESS UNDER LHS ARMREST, REPOSITION AND REPAIR HARNESS TO ENSURE NO RUBBING. CHECK OPERATION, ALL OK	12/11/2024
DZR00015	WO-GTP-166-601	SNAPPED CARRIER ROLLER MOUNTS	SNAPPED CARRIER ROLLER MOUNTS	31/12 - TAKE WEIGHT OF ROLLER WITH PORTA POWER AND RAM, REMOVED OUTER RHS MOUNT, CLEAN UP SURFACES, MAKE UP GUIDE STUDS FROM OLD BOLTS, POSITION NEW MOUNT, INSTALL NEW HARDWARE AND MOUNT. COULDN'T GET ROLLER TO SIT FLUSH WITH NEW MOUNT, WILL NEED TO ALIGN WHEN INNER IS DONE. FINE TO RUN - JY 14/1/25 SUPPORT L/H CARRIER ROLLER WITH JACK. REMOVE SNAPPED MOUNTS. CLEAN FACES AND FIT NEW MOUNT. LOOSEN INSIDE MOUNT TO ALLOW MOVEMENT LINE UP CORRECTLY. FIT AND TORQUE ALL BOLTS	01/14/2025
DZR00015	WO-GTP-166-449	B Service - Dozer	Service as per attached Service Sheet	8501HRS CARRY OUT B SERVICE AS PER MANUFACTURES SPECS ADJUST TRACK TENSION	12/08/2024
DZR00015	WO-GTP-166-342	AFFF LOW PRESSURE ALARM	AFFF LOW PRESSURE FAULT	BEHIND L/H AFFF BOTTLE IS THE LOW PRESSURE SWITCH, BRIDGED AND ALARM WENT OUT , ORDERED NEW SWITCH .	01/07/2025
DZR00015	WO-GTP-166-076	Fire Suppression Service	Service Fire Suppression System - Contractor to Complete	MITCHELL AND BROWN FIRE REPLACE SWITCH WORK COMPLETED BY MITCHELL AND BROWN	12/31/2024
DZR00015	WO-GTP-165-992	ALTERNATOR NOT CHARGING	ALTERNATOR NOT CHARGING	8347HR ATTEND BREAKDOWN, ALTERNATOR U/S. COLLECT FROM WESTRAC AFTER HOURS. REPLACE ALTERNATOR AND TEST - ALL GOOD.	11/23/2024
DZR00015	WO-GTP-165-774	A Service - Dozer	Service as per attached Service Sheet	B SERVICE COMPLETED ON WO-GTP-166-449	12/08/2024
DZR00015	WO-GTP-165-720	Fire Equipment Service - Site	Inspect, test and tag fire equipment - Midwest Fire	WORKS COMPLETED BY MITCHELL AND BROWN	12/31/2024
DZR00015	WO-GTP-164-965	RUBBED HYDRAULIC HOSE FROM RIPPER CONTROL VALVE	RUBBED HYDRAULIC HOSE FROM RIPPER CONTROL VALVE	HYDRAULIC HOSE REPLACED	04/18/2025
DZR00015	WO-GTP-164-855	REMOVE INTERCOOLERS AND CLEAN COOLER PACKS	REMOVE INTERCOOLERS AND CLEAN COOLER PACKS	8180.5HR REMOVE INTERCOOLERS AND HYDRAULIC COOLERS, USE COMPRESSED AIR TO CLEAN EXCESSIVE DIRT/BUILD UP FROM RADIATOR THAT WAS BLOCKING AIR PATH OF COOLERS. REFIT INTERCOOLERS AND HYDRAULIC COOLERS. RUN UP AND CHECK OVER.	11/05/2024
DZR00015	WO-GTP-164-829	HYDRAULICS OVERHEATING	HYDRAULICS OVERHEATING	8174 HR ALARM / CODE FOR OVERHEATING HYDRAULIC OIL, HYD OIL 94 DEG, COOLANT AND TRANNY TEMPS OK, COOLERS LOOK CLEAN AND GOOD AIRFLOW, PULL OUT FLOOR AND CHECK ALL HYDRAULIC COMPONENTS WITH TEMP GUN, ALL CYLINDERS, VALVES, FAN MOTOR AND MAIN PUMPS AROUND 75-80 DEG, FAN PUMP AROUND 90 DEG, VERY LITTLE TEMP DROP ACROSS COOLER, MONITOR HYDRAULIC TEMPS AFTER RECTIFYING FAN SPEED FAULT	11/06/2024
DZR00015	WO-GTP-164-698	RADIATOR FAN NOT CHANGING SPEED	DIAGNOSE FAN FAULT	8180HR REPLACED FAN CONTROL VALVE AND SOLENOID GROUP. RESEALED LEAKING FAN RELIEF VALVE. RUN UP MACHINE TO OPERATING TEMP, FAN STARTS TO RAMP AT 80 DEG C HYDRAULIC TEMP, AT FULL SPEED AT 90 DEG C HYDRAULIC TEMP. ATTEMPT TO CARRY OUT FAN SPEED CALIBRATION, SPEEDS NOT RESPONDING TO CALIBRATION SPEC, CAN ADJUST SPEEDS SLIGHTLY BUT THEY'RE ALL TOO FAST FOR WHAT CALIBRATION SPECIFYS. ENSURE MAX FAN SPEED IS SLIGHTLY ABOVE SPEC. COMPARE PROCEDURE WITH DZR16 AND ITS THE SAME. MAX FAN SPEED SEEMS TOO HIGH ON DZR15 POSSIBLY CREATING TOO MUCH SYSTEM LOAD / HEAT. ADJUST AMPERAGE FOR MAXIMUM FAN SPEED FOM 0.02A TO 0.35 (DZR16 IS 0.35A) AND RETEST. FAN IS RAMPING UP AND DOWN ACCORDING TO HYDRAULIC TEMP AS PER NORMAL SPECIFICATION. PUT MACHINE BACK TO WORK.	11/06/2024
DZR00015	WO-GTP-164-431	R/H HAND PIVOT SHAFT SEAL LEAKING	R/H HAND PIVOT SHAFT SEAL LEAKING	8054HRS REMOVE SEAL GUARD, HOSE DOWN SIDE OF MACHINE AND SEAL AREA. SEAL TORN BADLY AT TOP OF SEAL. BRAKE CLEAN DOWN, INJECT GREASE INTO PIVOT SHAFT, BUILD UP LAYERS OF SIKAFLEX AROUND DAMAGED PART OF SEAL. FILL COMPARTMENT WITH MOREYS. REFIT GUARD AND REPLACE CORRODED BOLTS.	10/25/2024
DZR00015	WO-GTP-164-430	ADJUST TRACKS	ADJUST TRACKS	8054HRS ADJUST TRACK TENSION TO SPEC	10/25/2024
DZR00015	WO-GTP-164-393	MOVE MINE RADIO ANTENNA TO A DIFFERENT POSITION	MOVE MINE RADIO ANTENNA TO A DIFFERENT POSITION	8051HRS MOVE ANTENNA BASE AND RE RUN ARIEL INSIDE CAB.	10/24/2024
DZR00015	WO-GTP-164-375	DE SHIM DRAFT ARMS	DE SHIM DRAFT ARMS	8051HRS COMPLETED JHA , PLACED JACK STAND UNDER R/H DRAFT ARM AND USING HI TORQUE WE REMOVED DRAFT ARM NUTS AND BOLTS , LIFTING CAP WITH FORK LIFT WE REMOVED DRAFT ARM CAP AND CLEANED ALL SURFACE'S AND BOLTS ,APPLYING ANTI SIZIE. REMOVING SHIM PACK AND REPLACING CAP WITH FORK LIFT RE TENSIONING BOLTS WITH RATTLE THEN HI TORQUE TO SPEC 4800 PSI THEN REPEAT ON L/H DRAFT ARM.	10/24/2024
DZR00015	WO-GTP-164-328	OIL LEAK DURING SHIP LOADING	OIL LEAK DURING SHIP LOADING	8047HR ATTEND BREAKDOWN, OIL LEAKING IN GRILL. FOUND FAN REVERSE SOLENOID HAD FAILED AN ORING. REMOVE AND REPLACE ORING. CLEAN DOWN AND RUN UP - ALL GOOD. PUT MACHINE BACK TO WORK.	10/23/2024
DZR00015	WO-GTP-163-919	INLET AIR TEMP VOLTAGE ABOVE NORMAL	INLET AIR TEMP VOLTAGE ABOVE NORMAL	ACTIVE CODE FOR INLET AIR TEMP SENSOR VOLTAGE ABOVE NORMAL. FIND INTERNAL WIRE BREAK IN HARNESS RUNNING FROM ECM UP TO AIR FILTER BOX SENSORS. CUT OUT BROKEN HARNESS AND REPAIR. HEAT SHRINK UP AND TIDY HARNESS WITH FABRIC TAPE. ORDER REPLACEMENT HARNESS SECTION. 19/10 - REPLACE HARNESS, CABLE TIE AND POSITION SECURELY, TEST OP - ALL OK	10/20/2024
DZR00015	WO-GTP-163-856	REPLACE BLOWN GREASE LINES TO EQUALIZER BAR	REPLACE BLOWN GREASE LINES TO EQUALIZER BAR	7997HRS REMOVE BELLY GUARD, REMOVE PANELS FROM SIDE OF CAB, REMOVE CAB FLOOR, REPLACE BLOWN GREASE LINES AND CLAMPS WITH NEW, PURGE LINES AND EQ BAR END PINS, ALL OK, REASSEMBLE.	10/20/2024
DZR00015	WO-GTP-163-855	REPLACE LEAKING TRANSMISSION HOSES	REPLACE LEAKING TRANSMISSION HOSES	7997 HRS WASH, REMOVE BELLY GAURDS, REMOVE LEAKING TC - TRANS - COOLER HOSES X 2. REPLACE WITH NEW HIGH TEMP HOSES AND SEALS, ORIENTATE SO NO RUBBING. TEST OPERATION FOR LEAKS, ALL OK.	10/20/2024
DZR00015	WO-GTP-163-850	REPLACE RADIATOR CAP	REPLACE RADIATOR CAP DUE TO CRACKED SEAL AND POOE CONDITION	7667 HRS REPLACED RADIATOR CAP WITH NEW DUE TO PERISHED SEALS.	10/20/2024

DZR00015	WO-GTP-163-668	HYDRAULICS OVERHEATING	HYDRAULICS OVER HEATING	7910HRS CHECK OVER MACHINE, HYDRAULICS RUNNING HOTTER THAN NORMAL. FOUND COOLER PACKS EXTERNALLY BLOCKED. BLOWOUT COOLER PACKS WITH COMPRESSED AIR. PUT MACHINE BACK TO WORK.	10/11/2024
DZR00015	WO-GTP-163-342	D Service - Dozer	Service as per attached Service Sheet	7997HRS CARRY OUT 2000HR SERVICE	10/20/2024
DZR00015	WO-GTP-163-241	REPLACE WORN BLADE STABILIZER BAR TRUNNION BALL	REPLACE WORN BLADE STABILIZER BAR TRUNNION BALL	1/12 - CHAIN UP STABILISER BAR TO BLADE AS IT LOOKS LIKE ITS ABOUT TO FALL OFF - JY 31/12 - WASH DOZER, REMOVE STABILISER BAR, BOILERMAKERS CUT OFF AND WELDED ON NEW BALL. INSTALL BAR WITH NEW CAP, SHIM ACCORDINGLY, INSTALL NEW BOLTS AND NUTS, TORQUE TO 780 FT LB. 8729 HRS	12/31/2024
DZR00015	WO-GTP-162-886	L/H FRONT WORKLIGHT MOUNTS U/S	L/H FRONT WORKLIGHT MOUNT U/S	REPLACE 2X SNAPPED MOUNTS ON L/H FRONT WORK LIGHT	09/25/2024
DZR00015	WO-GTP-162-727	A Service - Dozer	Service as per attached Service Sheet	7746HR COMPLETE A SERVICE 7655HRS	09/24/2024
DZR00015	WO-GTP-162-311	REPLACE BLOWN HOSES IN HELL HOLE	REPLACE BLOWN HOSES IN HELL HOLE	ATTEND BREAK DOWN, MACHINE LEAKING OIL FROM ABOVE BELLY PLATES. REMOVE HELL HOLE COVER, 2X IMPLEMENT CONTROL HOSES HAVE BLOWN. WILL NEED TO REMOVE BELLY PLATES. ORGANISE JHA AND APPROVAL TO REMOVE BELLY PLATES. REMOVE BELLY PLATE, REMOVE HOSES. SOURCE NEW HOSES FROM WESTRAC AND REFIT. RUN UP AND CHECK FOR LEAKS - ALL GOOD. REFIT BELLY PLATE AND HELL HOLE COVER. REFILL HYDRAULIC OIL. PACK UP AREA AND TOOLING.	09/13/2024
DZR00015	WO-GTP-161-459	AIR CON NOT COLD	AIR CON NOT COLD	7499HRS CHECK REPORT OF AIR CON NOT COLD, COULD NOT GET SYSTEM TO FAULT. CHECKED HIGH AND LOW PRESSURE SWITCHES, ALL SEEMED OK AT CURRENT TIME 10/9/24 A/C NOT COLD- COMPRESSOR NOT ENGAGING, CHECK FUSES AND PRESSURE SWITCHES- ALL OK, SWAP RELAYS, CHECK WIRING DIAGRAM- COMPRESSOR CLUTCH SWITCHED DIRECTLY FROM IMPLEMENT ECM, NEED LAPTOP TO DIAGNOSE FURTHER, CHECK TEMP. VALUES ETC, THROUGH DASH- ALL SEEM OK BUT NOT ACTIVATING OUTPUT FOR COMPRESSOR CLUTCH, NEED LAPTOP TO DIAGNOSE FURTHER 14/9/2024 CHECK MONITORING SYSTEM - OK, CHECK HIGH/LOW PRESSURE SWITCHES - OK. CHECK COMPRESSOR CIRCUIT - OK. CHECK PRESSURES - OK. SYSTEMS STARTED WORKING AGAIN AND COULDNT FAULT AGAIN.	10/13/2024
DZR00015	WO-GTP-161-403	TOP RHS WORKLIGHT BRACKET BROKEN	TOP RHS WORKLIGHT BRACKET BROKEN	REPLACE BROKEN WORKLIGHT BRACKET WITH SPARE HEAVY DUTY BRACKET, CONVERT HARDWARE OVER, CABLE TIE HARNESS SECURE, TEST OP - OK	08/26/2024
DZR00015	WO-GTP-161-315	RHS TILT CYLINDER BEARING FAILED	RHS TILT CYLINDER BEARING FAILED	7478 HRS COMPLETED BY WESTRAC DURING UNDERCARRIAGE REPAIRS	09/18/2024
DZR00015	WO-GTP-161-239	REPLACE GOANNAS	REPLACE GOANNAS	6/3 - OLD GOANNA BAR PINS SEIZED, STEVE CUT OFF. CLEAN UP SURFACES, INSTALL NEW GOANNAS WITH NEW HARDWARE.	03/06/2025
DZR00015	WO-GTP-161-053	REPAIR COOLANT LEAK	REPAIR COOLANT LEAK	7412HR FOUND COOLANT LEAKING FROM TOP HOSE. TIGHTEN HOSE CLAMP AND CHECK - ALL GOOD.	08/19/2024
DZR00015	WO-GTP-161-051	ADJUST TRACKS	ADJUST TRACK TENSION	7412HRS ADJUST TRACK TENSION AS PER SPEC	08/19/2024
DZR00015	WO-GTP-160-890	L/H TILT CYLINDER REAR BEARING U/S	L/H TILT CYLINDER REAR BEARING U/S	7,410HRS 16/8/24 FOUND L/H REAR TILT CYLINDER BEARING HAS COLLAPSED. BRING MACHINE OUT OF SHED, REMOVED PIN AND CHECK CONDITION OF CYLINDER, PIN/BUSH U/S. SITE SUPERVISOR HAS DECIDED TO RUN MACHINE TO FINISH SHIFT. 17/8/24 PICK UP PARTS FROM WESTRAC, WRITE UP JHA AND HOT WORKS PERMIT. REMOVE PIN, OXY CUT REMAINDER OF BUSH OUT OF CYLINDER. CLEAN UP DAMAGE TO CYLINDER AS BEST AS POSSIBLE TO INSTALL NEW BEARING. CIRCLIP GROOVES BADLY DAMAGED. REFIT CYLINDER TO MACHINE AND GREASE. PACK UP AREA. TIME DELAYS DUE TO BAD WEATHER.	08/17/2024
DZR00015	WO-GTP-160-467	B Service - Dozer	Service as per attached Service Sheet	7478HRS CARRY OUT B-SERVICE - SAMPLE ALL COMPARTMENTS CHANGE ENG, HYD, CAB, FUEL AND AIR FILTERS CHANGE ENG AND FINAL DRIVE OILS CLEAN AND REPLACE FUEL, TRANS, AND PIVOT SHAFT BEATHERS.	08/24/2024
DZR00015	WO-GTP-160-454	RADIO INTERFERENCE	RADIO INTERFERENCE	REPLACE UHF AERIAL, CLEAN UP MOUNTS FOR GROUNDING. RUN INTO CAB. TEST OPERATION, STILL INTERFERENCE. RUN SEPERATE POWER SOURCE, STILL FAULTING. DISCONNECT REMOTE SPEAKERS, STILL FAULTING. SWAP MINE RADIO FROM DZR16 INTO DZR15, STILL FAULTING. INSTALL NEW GME TS4500 - NO MOUNT BRACKET SUPPLIED, MODIFIED DIN BRACKET TO FIT FOR NOW. WAITING ON OPERATOR FEEDBACK	08/26/2024
DZR00015	WO-GTP-160-384	FIRE SUPPRESSION BOTTLE MOUNT CRACKED	FIRE SUPPRESSION BOTTLE MOUNT CRACKED	26/8 - FIT CORRECT UHF BRACKET. NO ISSUES WITH RADIO SO FAR, CLOSING OUT WORKORDER. REMOVED AFFF BOTTLE P CLAMPS AND BOTTLE STRAP, LIFTED BOTTLE OUT AND PLACED ON TO COUNTER WEIGHT, REMOVED FRAME AND CLEANED UP AROUND CRACKS AND CHASE CRACKS ,GRIND OUT AND WELD AND FILL. CLEAN UP FACE AND PLACED NEW MOUNTING FRAME AND DRILL OUT NEW MOUNTING HOLES . PRIMED AND TOP COATED AND TENSIONED TO FRAME , LIFTED AND FITTED AFFF FRAME TENSION TO NEW FRAME . LIFTED BOTTLE ONTO FRAME AND TENSIONED CLAMP AND P CLAMPS .	10/24/2024
DZR00015	WO-GTP-160-226	OIL LEAK IN FRONT GRILL	OIL LEAK IN FRONT GRILL	7289HRS ATTEND BREAKDOWN, REMOVE FRONT GRILL. CHECK OIL LEAK. FOUND LOOSE HOSE ON FAN MOTOR. REPLACE BLOWN ORING. REFIT HOSE. CHECK ALL OTHER HOSES FOR TENSION. REFIT GRILL.	08/04/2024
DZR00015	WO-GTP-160-101	CLEAN COOLER PACK	CLEAN COOLER PACK	CLEANED COOLER PACK WITH HIGH PRESSURE AIR	08/01/2024
DZR00015	WO-GTP-159-735	A Service - Dozer	Service as per attached Service Sheet	HRS 7343 A SERVICE COMPLETED, ENGNIE SAMPLE COMPLETED GREASED INSPECTION COMPLETED	07/27/2024
DZR00015	WO-GTP-159-457	REPLACE BOLTS ON TRACK CANNON COVER PLATE	REPLACE BOLTS ON TRACK CANNON COVER PLATE	HRS 7242 7171HRS REPLACE RUSTED 6X BOLTS ON TRACK CANNON COVER PLATE.	07/21/2024
DZR00015	WO-GTP-159-409	ADJUST TRACKS	ADJUST TRACKS	7171HRS ADJUST TRACK TENSION TO MANUFACTURS SPEC REMOVE GRILL, CHECK HOSES FOR CONDITION . REPLACED LIFT HOSE,S AND FAN HOSE,S.	07/19/2024
DZR00015	WO-GTP-159-383	HYDRAULIC HOSES DELAMINATING IN FRONT GRILL	REPLACE FRONT GRILL HYDRAULIC HOSES	HRS 7242	07/27/2024

DZR00015	WO-GTP-159-064	REPLACE UNDERCARRIAGE TRACK ROLLERS,IDLERS AND TRACKS	REPLACE UNDERCARRIAGE TRACK ROLLERS,IDLERS AND TRACKS	7586HRS REPLACE UNDERCARRIAGE AND TRACK ASSEMBLIES. HDXL CHAINS. WESTRAC PROVIDED LABOUR TO RUN DOUBLE SHIFTS TO UNDERTAKE WORKS. REMOVE AND REPAIR BROKEN / MISSING HARDWARE ON 9KG FIRE EXTINGUISHER BRACKET. ENSURE CLOSING FIRMLY AND SECURE.	09/06/2024
DZR00015	WO-GTP-159-053	FIRE EXTINGUISHER BRACKET BROKEN	FIRE EXTINGUISHER BRACKET BROKEN	WORKS HAVE BEEN DONE - ASSUMED COMPLETED - PLEASE COMPLETE WORK DONE SECTION WITH INFORMATION	07/14/2024
DZR00015	WO-GTP-158-982	HYDRAULIC LEAK IN FRONT BELLY PLATE	HYDRAULIC LEAK IN FRONT BELLY PLATE- BLOWN FAN MOTOR HOSE	7085HR LOW PRESSURE ALARM GOING OFF ON FIRE SUPPRESSION SYSTEM. CHECK SYSTEM, ALL GUAGES ARE READING OK. SUSPECT SLIGHT DROP IN PRESSURE SINCE SYSTEM RECHARGE. MACHINE OK TO USE, ISSUE WILL BE CORRECTED ON MONDAY.	07/11/2024
DZR00015	WO-GTP-158-699	FIRE SUPPRESSION ALARM GOING OFF	FIRE UPPRESSION ALARM GOING OFF	7075HRS REMOVE ROOF LINING. FOUND BAD CONNECTION IN STEREO WIRING. HAD SCOTCH LOCKS FITTED INTO WIRING. CUT OUT SCOTCH LOCKS AND REPLACE DEUTSCH PLUG. REFIT ROOF LINING.	07/06/2024
DZR00015	WO-GTP-158-600	STEREO CUTTING OUT WHEN MACHINE HITS A BUMP	STEREO CUTTING OUT WHEN MACHINE HITS A BUMP	WORK DONE BY MITCHELL AND BROWN C.W REMOVE CAB FLOOR MATT AND FLOOR PANELS FOR CONTRACTOR TO COMPLETE FIRE SUPPRESSION SERVICE.	07/04/2024
DZR00015	WO-GTP-158-571	Fire Suppression Service	Service Fire Suppression System - Contractor to Complete	7013 HRS REMOVE GROUSERS, PRESS OUT 2 LINKS, PRESS PINS OUT OF BOX SECTION FROM USED TRACK, CLEAN UP ALL LINKS, PRESS BOX SECTION INTO TRACK, VAC AND OIL 3X PINS, BUFF AND REFIT GROUSERS, TORQUE GROUSERS, CLEAN UP HYTORQUE + TRACK PRESS ETC. AND DROP BACK TO JMH	06/25/2024
DZR00015	WO-GTP-158-265	FAILED LINK IN L/H TRACK	FAILED LINK IN L/H TRACK- BUSH CRACKED AND PIN WORN INTO LINK	7075HRS CLEANED OUT COOLER PACK , REMOVED INTERCOOLER MOUNTING BOLTS MOVED BACK AND FORWARDED AND CLEANED OUT WITH HIGH PRESSURE AIR. REMOVED ALL THE BUILD UP PRODUCT AND RE FITTED MOUNTING BOLTS .	06/27/2024
DZR00015	WO-GTP-157-863	C Service - Dozer	Service as per attached Service Sheet	HRS 6900 805.4HRS COMPLETED BY WESTRAC	07/05/2024
DZR00015	WO-GTP-157-590	CLEAN OUT COOLER PACK	CLEAN OUT COOLER PACK	DUE TO SUPPLIER ISSUES THESE WERE UNABLE TO BE COMPLETED - SMOKE MACHINE AQIRED OCTOBER 2024 - GOING FOWARD THESE WILL BE COMPLETED	06/13/2024
DZR00015	WO-GTP-157-565	Dozer 3rd Party Assessment of Track and Undercarriage	3rd Party Assessment of Track and Undercarriage	BEND GRAB RAIL BASE FLAT, CUT AND WELD 1 1/2" ROD TO BASE. PAINT GRAB RAIL.	10/25/2024
DZR00015	WO-GTP-157-564	Smoke Bomb Cab	Smoke bomb cab and reseal if required.	6,845HRS FOLLOWED CAT REMOVAL AND INSTALL PROCEDURE. CLEANED FACES BEFORE INSTALL AND APPLIED ANTI SIEZE TO FACES AND THREADS . TENSIONED USING HI TORQUE TO 1100 FTLBS DE MOB KEY YARD AND BROUGHT ALL METAL BACK TO CONTAINER PARK , METAL BIN WORK COMPLETED BY MITCHELL AND BROWN	10/13/2024
DZR00015	WO-GTP-157-389	REPAIR L/H ACCESS HAND RAIL	REPAIR L/H ACCESS HAND RAIL	INTERFERENCE THROUGH RHS CB RADIO SPEAKER WHEN TRANSMITTING ON MINE RADIO. CLEAN AERIAL EARTHS, CHECK TO ENSURE NO CONTINUITY BETWEEN COAX AND EARTH. INSTALL EARTH STRAP FROM ROPS TO CAB FRAME. CHECK POWERS AND EARTHS. COULDN'T GET TO FAULT CONSISTENTLY, SWAP CB MODULE FROM DZR15 TO DZR16 TO SEE IF FAULT MOVES.	06/11/2024
DZR00015	WO-GTP-157-236	CHANGE OUT SPROCKET SEGMENTS	CHANGE OUT SPROCKET SEGMENTS	27/6 CHECKED WITH OPERATORS THROUGHOUT CREWS, NO COMPLAINTS. 6787HRS CLEAN OUT COOLER PACKS WITH COMPRESSED AIR	06/06/2024
DZR00015	WO-GTP-156-940	Fire Equipment Service - Site	Inspect, test and tag fire equipment - Midwest Fire	6787HRS CARR OUT 'A' SERVICE AS PER MANUFACTGURES SPEC	06/30/2024
DZR00015	WO-GTP-156-648	RADIO INTERFERENCE THROUGH CB SPEAKER	RADIO INTERFERENCE THROUGH CB SPEAKER	6,667HRS ADJUST TRACKS TO MANUFACTURES SPECS REMOVE DAMAGED ACCESS HANDLE FROM R/H SIDE OF DOZER.	06/27/2024
DZR00015	WO-GTP-156-498	BLOW OUT COOLER PACKS	BLOW OUT COOLER PACKS	STRAIGHTEN MOUNTING PLATE. CUT GRAB HANDLE OUT OF 1 1/4 SOLID ROD AND WELD ON. PAINT AND FIT TO MACHINE WHEN DRY. CLEAN AND PREPED RIGHT HAND SIDE OFF DOZER BLADE TO WELD ON CHOCKY BAR TO SLOW DOWN KNUCKLE AND PIN WASH FROM PRODUCT. WELDED TWO CHOCKY BARS TO BLADE AND CLEANED OFF SLAGG AND CHECKED WELD AS PROGRESSED AROUND BAR.	05/27/2024
DZR00015	WO-GTP-156-476	A Service - Dozer	Service as per attached Service Sheet	HRS 6550 6544 HR COMPLETE SERVICE AS PER MANUFACTURERS SCHEDULE	05/27/2024
DZR00015	WO-GTP-155-778	ADJUST TRACKS	ADJUST TRACKS	6530 HR REMOVE FLOOR, REMOVE GUARDS, TAKE BACK TO CONTAINER YARD AND REPAIR, REFIT GUARDS, REFIT FLOOR	05/13/2024
DZR00015	WO-GTP-155-503	REPAIR ACCESS HANDLE TO R/H SIDE OF MACHINE	REPAIR ACCESS HANDLE TO R/H SIDE OF MACHINE	6500HRS CHECK ALL COMMUNICATION POINTS, REPLACE END ON ARIEL, CLEAN UP ALL EARTH POINTS AND TEST- ALL GOOD. REMOVED OLD CLAMPS AND HOSE AND REPLACED WITH NEW HOSE AND CLAMPS START DZR15 AND CHECKED FOR LEAK ,NONE FOUND	05/09/2024
DZR00015	WO-GTP-155-202	WELD CHOCKY BARS TO RHS BLADE	WELD CHOCKY BARS TO RHS BLADE	HRS 6550 6544 HR COMPLETE SERVICE AS PER MANUFACTURERS SCHEDULE	05/02/2024
DZR00015	WO-GTP-155-018	B Service - Dozer	Service as per attached Service Sheet	6530 HR REMOVE FLOOR, REMOVE GUARDS, TAKE BACK TO CONTAINER YARD AND REPAIR, REFIT GUARDS, REFIT FLOOR	05/01/2024
DZR00015	WO-GTP-155-000	REPAIR AUX DRIVE SHAFT GUARD	REPAIR AUX DRIVE SHAFT GUARD	6500HRS CHECK ALL COMMUNICATION POINTS, REPLACE END ON ARIEL, CLEAN UP ALL EARTH POINTS AND TEST- ALL GOOD. REMOVED OLD CLAMPS AND HOSE AND REPLACED WITH NEW HOSE AND CLAMPS START DZR15 AND CHECKED FOR LEAK ,NONE FOUND	04/29/2024
DZR00015	WO-GTP-154-854	BAD INTERFERENCE OVER 2 WAY RADIO	RECTIFY BAD INTERFERENCE OVER 2 WAY RADIO	HRS 6550 6544 HR COMPLETE SERVICE AS PER MANUFACTURERS SCHEDULE	04/28/2024
DZR00015	WO-GTP-154-613	RUBBED BOOST HOSE	RUBBED RHS BOOST HOSE AFTERCOOLER TO INTAKE MANIFOLD L PIECE	6500HRS REMOVE AFTERCOOLERS AND RE-POSITION HYDRAULIC COOLER TO GAIN ACCESS TO RADIATOR. CLEAN OUT HEAVY DIRT BUILDUP FROM CORES.	05/02/2024
DZR00015	WO-GTP-154-593	RHS HANDRAIL BENT CONTACTING TRACK	RHS HANDRAIL BENT CONTACTING TRACK	6760HRS ORGANISE JHA AND TOOLING FOR JOB, REMOVE GROUSERS, PRESS OUT TRACK PINS AND REMOVE 2 FAILED LINKS. PRESS NEW LINKS TOGETHER AND FIT TO TRACK ASSEMBLY. OIL PINS, INSTALL GROUSERS AND TENSION TRACKS. PACK UP TOOLING AND CLEAN UP SITE.	04/22/2024
DZR00015	WO-GTP-154-323	CLEAN OUT COOLER PACKS	CLEAN OUT COOLER PACKS	24/5/24 CHECK OVER MACHINE AND RE ADJUST TRACKS, LOAD TOOLING ONTO TRUCK AND DELIVER TO JMH.	04/16/2024
DZR00015	WO-GTP-153-935	FAILED RHS TRACK LINK	FAILED RHS TRACK LINK	6397.5HRS DRAIN COOLANT, REMOVE ENGINE BAY DOORS. REMOVE INTERCOOLERS. REMOVE THERMOSTAT HOUSING, CLEAN AND REPLACE THERMOSTATS. REFIT THERMOSTAT HOUSING TO MACHINE. REFILL COOLANT.	05/20/2024
DZR00015	WO-GTP-153-902	REPLACE THERMOSTATS	REPLACE THERMOSTATS	16/4 FIT INTERCOOLERS AND PIPING. RUN UP TEST, ALL OK.	04/16/2024

DZR00015	WO-GTP-153-845	AIRCON BLOWING WARM - BELT BROKEN	AIRCON BLOWING WARM - BELT BROKEN	A/C BLOWING WARM, LOW SIDE PIPE WARM, NO CODES. FIND AC / ALT BELT BROKEN. REMOVE CAB FLOOR, REMOVE FIRE WALL, REMOVE AUX SHAFT GUARDS. BROKEN BELT WEDGED INTO AUX DRIVE GEAR, REMOVE BROKEN PIECES OF BELT. CHECK ALT, A/C AND TENSIONER PULLEYS TO ENSURE NO DAMAGE OR FAILURES LEADING TO BELT BREAK. FIND SLIGHT OIL AROUND AND BELOW A/C COMP, COULDN'T FIND SOURCE OR REPLICATE. INSTALL SPARE BELT, RUN UP TO TEST ALIGNMENT, ALL OK. INSTALL GUARDS, FIREWALL, FLOOR AND PANELS. NOTE: AUX SHAFT LOWER GUARD SECTION IS BROKEN AROUND WELDS WHERE IT MOUNTS TO FLYWHEEL HOUSING, NEEDS TO BE REMOVED AND WELDED UP WHEN ALTERNATOR C/O COMPLETED.	04/04/2024
DZR00015	WO-GTP-153-205	A Service - Dozer	Service as per attached Service Sheet	6352 HRS 6242HRS SERVICE AS PER WORKSHEET	03/23/2024
DZR00015	WO-GTP-152-984	RIGHT HAND TRACK LINK BUSH CRACKED	REPLACE TRACK LINKS	21/3 ASSIST WESTRAC REPLACING TRACK LINK BOX SECTION ON RHS TRACK. INSTALL NEW LINKS, BUSHES, PINS, BEARINGS AND SEALS. OIL NEW PINS. CONDITION OF REST OF CHAIN IS POOR, CORRSION WEAR ON SEAL FACES OF BUSHES AND EXCESS MOVEMENT IN OTHER LINKS. NEED TO MONITOR. INSTALL GROUSERS TORQUE 1100FT LB + 120 DEG. TENSION TRACKS. CHECK TRACK TENSION AND ADJUST R/H SIDE TO SPEC.	03/21/2024
DZR00015	WO-GTP-152-930	TENSION TRACKS	TENSION TRACKS	6187HRS REPLACE BROKEN WORK LIGHT MOUNT ON R/H TOP WORK LIGHT.	03/16/2024
DZR00015	WO-GTP-152-929	REPLACE WORK LIGHT MOUNT	REPLACE WORK LIGHT MOUNT	6187HRS 6397HRS	03/16/2024
DZR00015	WO-GTP-152-835	Alternator Replacement	Replace alternator, belt and belt tensioner.	REMOVE CAB FLOOR, FIREWALL AND ENGINE COVERS FROM L/H SIDE. REPLACE ALTERNATOR, BELT AND TENSIONER. CABLE TIE SPARE BELT TO AUX SHAFT GUARD. REFIT FLOOR, FIREWALL AND ENGINE COVERS. RUN UP AND CHARGE RATE - 27.6V	04/14/2024
DZR00015	WO-GTP-152-678	RUBBED SECONDARY TRANS FILTER HOSES	RUBBED SECONDARY TRANS FILTER HOSES	REMOVE FLOOR, REMOVE OLD HOSES, INSTALL NEW HOSES, O-RINGS, ENSURE SECURE AND NO RUB POINTS WITH NEW P CLAMPS AND CABLE TIES. TEST OP ALL OK	03/23/2024
DZR00015	WO-GTP-152-585	TRANS SUCTION SCREEN REMOVED INSPECTION AND CLEAN	TRANS SUCTION SCREEN REMOVED INSPECTION AND CLEAN	REMOVED FLOOR MAT ,BOARDS AND REMOVED TRANS SCREEN AND SEAL INSPECTED CLEANED AND REFITTED SCREEN SEAL AND PLATE.	03/10/2024
DZR00015	WO-GTP-152-546	HELL HOLE CLEAN AND HOSE INSPECTION	HELL HOLE CLEAN AND HOSE INSPECTION	REMOVE FLOOR, WASH OUT HELL HOLE, INSPECT HOSE AND HARNESS CONDITION.	03/11/2024
DZR00015	WO-GTP-152-545	Hydraulic Oil Replacement	Drain hydraulic oil and refill with new oil.	DRAIN AND REFILL HYDRAULIC OIL WITH CASTROL TRANSMAX 30	03/09/2024
DZR00015	WO-GTP-152-489	BOTH KNUCKLE JOINTS FROM BLADE TO DRAFT ARM WORN , NEEDING RE BUSHING AND PINS	BOTH KNUCKLE JOINTS FROM BLADE TO DRAFT ARM WORN , NEEDING RE BUSHING AND PINS	REMOVE KNUCKLES, CUT OUT OLD BEARINGS, CLEAN UP BORES. FREEZE AND INSTALL NEW BEARINGS. RE-ASSEMBLE WITH NEW PINS AND HARDWARE. SHIM ACCORDINGLY. TEST OPERATION, ALL OK	04/19/2024
DZR00015	WO-GTP-152-074	Dozer 3rd Party Assessment of Track and Undercarriage	3rd Party Assessment of Track and Undercarriage	WORK COMPLETED BY WESTRAC 12.03.2024	03/12/2024
DZR00015	WO-GTP-151-768	CLEAN COOLER PACK	CLEAN COOLER PACK	BLOW OUT COOLER PACKS, VERY BLOCK IN BOTTOM 1/3. REMOVE UPPER BOLTS FROM AFTERCOOLERS AND LEAN BACK TO ACCESS BEHIND THEM. BLOW OUT AND CHIP OFF EXCESS PRODUCT FROM RAD CORE. FLUSH OUT WITH WATER TO FINISH. RE ASSEMBLE.	02/23/2024
DZR00015	WO-GTP-151-767	RE SHIM STABILIZER BAR	RE SHIM STABILIZER BAR	RE MOVED RIGHT HAND END CAP AND FOLLOWED CAT PROCEDURE TO RE SHIM RIGHT HAND SIDE. ALL SHIMS WERE REMOVED BAR ONE FOR NEXT ADJUSTMENT THE BALL JOINT WILL HAVE TO BE REPLACED. LEFT HAND SIDE WAS STILL IN SPEC AND NO SHIMS WERE REMOVED. ALL BOLTS AND NUTS TENSIONED TO SPECIFICATION 780 FTLBS	02/23/2024
DZR00015	WO-GTP-151-532	D Service - Dozer	Service as per attached Service Sheet	HRS 6027 6019HRS CARRY OUT D.SERVICE AS PER OMM - RESHIM STABILIZER BAR - CLEAN COOLER PACKS - TENSION TRACKS	02/23/2024
DZR00015	WO-GTP-151-444	RECTIFY EXHAUST MUFFLERS LOOSE	RECTIFY EXHAUST MUFFLERS LOOSE	FOUND EXHAUST R/H MUFFLER SECTIONS LOOSE AND RATTLING AROUND. V-BAND CLAMP IS NOT SEATED CORRECTLY. FIT CORRECTLY, CHECK L/H/S AND ADJUST ASWELL.	02/17/2024
DZR00015	WO-GTP-151-105	OIL LEAK RHS TILT CYLINDER	OIL LEAK RHS TILT CYLINDER	5,976HRS REPLACE RHS TILT CYLINDER PIPE DUE TO CORROSION. INSTALL SPARE WHILE BOILYS MANUFACTURED REPLACEMENT PIPE.	02/20/2024
DZR00015	WO-GTP-150-973	REPLACE CENTRAL CUTTING EDGES AND TENSION TO SPECIFICATION	REPLACE CENTRAL CUTTING EDGES AND TENSION TO SPECIFICATION	INSTALL PIPE ONCE MADE, CHECK OVER, ALL OK. SET UP ON STANDS WASHED AND REMOVED BULK DIRT AND PRODUCT THEN NEEDLE GUN AROUND NUTS. USED HYTORQUE AND LOOSENED NUTS AND REMOVED HARDWARE . REMOVED OLD CUTTING EDGES WITH FORK LIFT AND CLEANED UP BLADE. REMOVED PAINT FROM NEW CUTTING EDGES AND LIFTED INTO POSITION WITH FORK LIFT AND COPPER COATED HARDWARE , TIGHTENED WASHERS AND NUTS BY HAND. MOVED FORKLIFT AND HYTORQUED TENSIONED NUTS TO SPEC AND DE MOB EQUIPMENT , AREA	02/08/2024
DZR00015	WO-GTP-150-311	CAMERA BRACKET BROKEN	CAMERA BRACKET BROKEN - REAR RHS CAB ROOF	HRS 5887 26/1 - REMOVE BROKEN PIECE OF BRACKET. DRILL NEW HOLE AND REMOUNT	01/26/2024
DZR00015	WO-GTP-150-249	BEACON NOT WORKING	BEACON NOT WORKING	FIND BROKEN PIN IN DEUTSCH PLUG TO BEACON. REPLACE PLUG MALE AND FEMALE END. TEST OPERATION ALL OK.	01/24/2024
DZR00015	WO-GTP-149-774	REPLACE ACCESS LADDER WEAR PADS	REPLACE ACCESS LADDER WEAR PADS AND ADJUST LOCKING PINS TO SUIT	REPLACE ACCESS LADDER WEAR PADS AND ADJUST LOCKING PINS TO SUIT LOCATION OF LADDER WHEN RAISED.	01/18/2024
DZR00015	WO-GTP-149-436	LOW POWER COMPLAINT	INSPECT FOR COMPLAINT OF LOW POWER	5745.1HRS INSPECT DOZER, VISUAL CHECK OVER, NO CODES OR EVENTS, NO OVERHEATS. CHECK PERFORMANCE PARAMETERS DURING STALL TEST, FUEL PRESSURE, BOOST, OK. NO ENGINE DERATE. AIR FILTER RESTRICTION GOOD. STALL SPEED OK. TEMPS RECOVERING QUICKLY AFTER STALL. END UP FINDING HALFWAY THROUGH PUSH EXHAUST BACKPRESSURE LIGHTS COMING ON. NEED TO ORGANISE REPLACEMENT / OR SERVICE DPF.	01/10/2024
DZR00015	WO-GTP-149-165	REPAIR R/H TURBO WASTEGATE HOSE	REPAIR TURBO WASTEGATE HOSE	FOUND WASTEGATE HOSE HAS PERISHED AND COME AWAY FROM ACTUATOR. REPAIR HOSE AND REFIT TO ACTUATOR.	01/05/2024
DZR00015	WO-GTP-148-760	OVER HEATING ENGINE, HYDRAULICS	OVER HEATING ENGINE, HYDRAULICS	5,679HRS INSPECTED DZR15 FOUND THAT THE HYDRAULIC FAN WASNT OPERATING CORRECTLY AND NOT RAMPING UP WHEN SYSTEM WAS HOT .CHECKED FUSE PANEL FOUND A BLOWN FUSE REPLACED AND CHECKED SYSTEM STILL NOT OPERATING CORRECTLY . FOLLOWED CAT PROCEDURE AND USING ET , GAUGES AND TACHO GUN CHECKED FAN PUMP PRESSURE AND FAN RPM AT HI AND LOW IDLE SET FAN AMP SETTING BACK TO SPECIFICATION AS PER PROCEDURE TESTED SYSTEM BUT FUALT KEPT OCCURING . REMOVED AND INSPECTED FAN BLOCK VALVES CHECKING SPRING TENSION , SEALS AND PASSAGES. REMOVED AND INSPECTED BOTH SOLENOIDS CHECKING SEALS , PASSGES AND SPRING TENSION . REPLACED RETURN BYPASS SOLENOID AND TESTED SYSTEM FAULT STILL OCCURED . REMOVED AND INSPECTED BOTH SPOOLS AND FOUND BLOWN BACKING RINGS AND ORING ON THE END OF DIRECTION SPOOL . TEMPORARILY FIXED FOR VESSEL LOADING SENT BACK TO WORK REVERSE AND OEM PARTS ORDERED WAITING FOR DELIVERY. OEM PARTS INSTALLED AND TESTED DOZER SENT BACK TO WORK RESEALED DIRECTIONAL SPOOL AND BYPASS SPOOL RE FITTED AND TESTED SENT BACK TO WORK CLEAN OUT COOLER PACK CORES WITH COMPRESSED AIR EXTERNALLY.	12/31/2023
DZR00015	WO-GTP-148-495	BLOW OUT COOLER PACKS	BLOW OUT COOLER PACKS	5,587HRS	12/24/2023
DZR00015	WO-GTP-147-813	CALIBRATE ENGINE FAN	CALIBRATE ENGINE FAN	5747 HRS - ATTEMPT TO CARRY OUT FAN CALIBRATIONS, PHOTOTACH NOT READING FAN CORRECTLY AND ET CALIBRATIONS NOT WORKING CORRECTLY. SOURCE CORRECT PHOTOTACH AND TRY FAN SPEED CALIBRATIONS, CALIBRATION FAILED BUT FAN SPEED IN SPEC. WHEN CHANGING AMPERAGE IN CALIBRATION FAN SPEED IS NOT SLOWING DOWN CORRECTLY. FAN IS RAMPING UP WITH MACHINE TEMPERATURE BUT IT DOESNT RAMP DOWN CORRECTLY. CHECK PUMP PRESSURES AND AMPERAGE AT PUMP DEMAND SOLENOID, FOUND AMPERAGE SUPPLY IS CORRECT. WHEN SOLENOID UNPLUGGED FAN RUNS 100% (FAIL SAFE) READ THROUGH DIAGNOSTICS AND SCHEMATICS, SUSPECT ISSUE IS WITH PROPORTIONAL VALVE THAT CONTROLS FAN PUMP, NOT ALLOWING PUMP TO DESTROKE WHEN ASKED.	01/18/2024

DZR00015	WO-GTP-147-787	Fire Suppression Service	Service Fire Suppression System - Contractor to Complete	WORK COMPELED BY MITCHELL AND BROWN	11/30/2023
DZR00015	WO-GTP-147-765	INSPECT NO START FAULT	INSPECT NO START FAULT	CHECK NO START FAULT - FOUND BATTERIES HAVE FAILED. SOURCE BATTERIES AND REPLACE. START AND CHECK VOLTAGE - 27.80V	12/11/2023
DZR00015	WO-GTP-147-654	B Service - Dozer	Service as per attached Service Sheet	5463.3HRS COMPLETED SERVICE AS PER MANUFACTURER SPECS @ 5,464 HRS	12/12/2023
DZR00015	WO-GTP-147-424	LADDER LOCK PINS NOT LOCKING	LADDER LOCK PINS NOT LOCKING	5463HRS - REPLACE LADDER RELAY, TEST OP, ALL OK. REMOVE BRACKETS TO ACCESS AND SECURELY MOUNT RELAY AND HARNESS'S. CLEAN UP AND LUBE PINS. ADJUSTED PIN LOCTAOR PLATE AND CLEANED AND BORED PIN HOLES TESTED AND LADDER LOCKS AND UNLOCKS . REPLACE JOYSTICK AND TEST OPERATION - WORKING AS PER NORMAL.	01/15/2024
DZR00015	WO-GTP-147-324	JOYS STICK IN CAB FAULTED	DIAGNOSE JOYSTICK AS FAULTY REPLACE JOYS STICK TO RECTIFY	5451HRS CLEANED AND REMOVED GET USING HIGH TORQUE CLEAN BOARD AND NEW GET , INSTALLED WITH NEW HARDWARE AND GET AND HIGH TORQUE TO SPECIFICATION 5000PSI	12/09/2023
DZR00015	WO-GTP-147-317	REPLACE CUTTING EDGE	REPLACE CUTTING EDGE	CLEANED L/H SIDE OF BLADE AND WELDED ON CHOCKY BAR TO IDENTIFIED AREAS TO SLOW DOWN WEAR OF TILT CYLINDER AND EQUALIZER NUCKLE	01/15/2024
DZR00015	WO-GTP-147-305	WELD CHOCKY BAR TO SIDE OF BLADE	CLEAN L/H SIDE OF BLADE AND WELD ON CHOCKY BAR TO SLOW DOWN WEAR OF TILT CYLINDER AND EQUALIZER NUCKLE		11/30/2023
DZR00015	WO-GTP-147-202	Fire Equipment Service - Site	Inspect, test and tag fire equipment - Midwest Fire	Fire equipment serviced by Mitchell and Brown CARRY OUT SMOKE BOMB TEST ON OPERATORS CAB	12/22/2023
DZR00015	WO-GTP-146-611	Smoke Bomb Cab	Smoke bomb cab and reseal if required.	5,323HRS REMOVE AFTERCOOLERS, CLEAN OUT COOLERPACKS WITH COMPRESSED AIR AND HIGH PRESSURE WATER. REFIT AFTER COOLERS AND RUN UP MACHINE.	11/23/2023
DZR00015	WO-GTP-146-483	REMOVE AFTERCOOLERS AND WASH OUT COOLER PACKS	REMOVE AFTERCOOLERS AND WASH OUT COOLERPACKS	5302HRS 18/11 - INSPECT DOZER, CHECK LEVELS, NO OBSTRUCTION TO HYD COOLER, FAN NOT SPINNING FAST IN FORWARD DIRECTION WHILE MACHINE HOT, HISSING SOUND FROM FAN CONTROL VALVE, POSSIBLE BYPASS. REVERSED FAN - ALL OK. SHUT DOWN, ISOLATED WHILE TESTED DZR16 TO COMPARE. CAME BACK FAN WORKING OK. USE ET TO BYPASS FAN AND CHECK THROUGHOUT REV RANGES, SEEM TO BE WORKING FINE. DID NOT OVERHEAT ON N/S. NEED TO MONITOR THIS. - NO ISSUES SINCE COOLER PACKS HAVE BEEN CLEANED	11/21/2023
DZR00015	WO-GTP-146-269	HYDRAULICS OVERHEATING	HYDRAULICS OVERHEATING	5,323HR REPLACE COOLANT HOSES BETWEEN TURBO'S AND HEADER TANK, TOP UP COOLANT AND RUN UP MACHINE. CHECK OVER FOR LEAKS.	11/23/2023
DZR00015	WO-GTP-146-235	COOLANT HOSES TO TURBO U/S	REPLACE COOLANT HOSES	5302HRS 5305HRS COMPLETED BY WESTRAC.	11/21/2023
DZR00015	WO-GTP-146-166	Dozer 3rd Party Assessment of Track and Undercarriage	3rd Party Assessment of Track and Undercarriage	5323HRS CARRY OUT 250HR SERVICE AS PER SERVICE SHEET.	11/21/2023
DZR00015	WO-GTP-146-165	A Service - Dozer	Service as per attached Service Sheet	NOTICED MISSING RHS TRACK GROUSER BOLT, CLEAN UP MOUNTING FACE, INSTALL NEW BOLT. MARK GROUSER WITH RED PAINT TO KEEP AN EYE ON IT	11/23/2023
DZR00015	WO-GTP-146-109	REPLACE MISSING RHS TRACK GROUSER BOLT	REPLACE MISSING RHS TRACK GROUSER BOLT	CLEAN OUT COOLER PACKS WITH COMPRESSED AIR.	11/14/2023
DZR00015	WO-GTP-145-843	CLEAN OUT COOLER PACK	CLEAN OUT COOLER PACK	5213.7HRS INSPECT OIL LEAK, FOUND BLANKING PLUG ON FAN MOTOR CONTROL VALVE HAS BLOWN AN O'RING. REPLACED O'RING, AND RAN UP. DEGREASED EXCESS OIL FROM COOLER PACK AREA AND GRILL. WASH DOWN TRACK BAY WHEN DONE.	11/10/2023
DZR00015	WO-GTP-145-781	RECTIFY OIL LEAK AROUND FAN MOTOR AREA	RECTIFY OIL LEAK AROUND FAN MOTOR AREA	5205.8HRS INVESTIGATE MULTIPLE JOYSTICK CODES - MODE AND MANUAL SELECTION SWITCHES. FIND INTERNALLY BROKEN WIRES IN HARNESS TO UPPER HANDLE SECTION. RE-SOLDER 7 BROKEN WIRES. WILL NEED TO REPLACE JOYSTICK AS WITH REPAIRED HARNESS IT DOESN'T SIT OR MOVE WELL WHEN JOYSTICK IS MOVED. TEST OPERATION, CLEAR LOGGED CODES. JOY STICK REPLACED UNDER WO-GTP-147-324	11/08/2023
DZR00015	WO-GTP-144-637	MULTIPLE ACTIVE JOYSTICK CODES	DIAGNOSE AND REPAIR ACTIVE FAULTS	4872Hrs CALIBRATE LEVERS AND BLADE SOLENOIDS	12/28/2023
DZR00015	WO-GTP-144-537	BLADE DROPPING QUICKLY	CALIBRATE BLADE SOLENOIDS	ASSIST WESTRAC IN REPLACING BROKEN / CRACKED TRACK BUSH. 2 X BOX SECTIONS AND 3 PINS AND SEALS REPLACED UNDER WARRANTY. COMPLETED AT 5017HRS	10/17/2023
DZR00015	WO-GTP-144-536	BROKEN RHS TRACK BUSH	REPAIR BROKEN RHS TRACK BUSH	CARRY OUT SERVICE AS PER MANUFACTERS SPECIFICATIONS.	10/17/2023
DZR00015	WO-GTP-144-052	C Service - Dozer	Service as per attached Service Sheet	4980HRS REMOVE, STRAIGHTEN AND RE-WELD DAMAGED HANDRAILS OFF DRAFT ARMS	10/13/2023
DZR00015	WO-GTP-143-969	REPAIR DAMAGED HANDRAIL	REPAIR DAMAGED HANDRAIL	SOURCE PARTS FROM WESTRAC, REPLACE WORN RUBBER MOUNTS ON R/H TOP HEADLIGHT.	10/06/2023
DZR00015	WO-GTP-143-758	R/H RUBBER MOUNTS ON TOP RAM LIGHTS U/S	REPLACE RUBBER MOUNTS ON LIGHTS	4889HRS FIND CRACK ON LHS BOTTLE WHERE TANK IS WELDED TO LOWER MOUNT COLLAR. CONTACT MITCHELL AND BROWN FIRE FOR REPLACEMENT BOTTLE. ASSIST JON WITH REPLACEMENT, RECHARGING AND TESTING OF SYSTEM.	10/03/2023
DZR00015	WO-GTP-143-419	FIRE SUPPRESSION LOW PRESSURE ALARM	FIRE SUPPRESSION LOW PRESSURE ALARM	21/9 - TOP UP SYSTEM AFTER SETTLED AND IN COOL WEATHER.	09/20/2023
DZR00015	WO-GTP-143-245	A Service - Dozer	Service as per attached Service Sheet	4872Hrs Carry out service as per service sheet. Blow out cooler packs, adjust track tension & replace air filters.	09/28/2023
DZR00015	WO-GTP-143-127	CLEAN OUT COOLER PACK	CLEAN OUT COOLER PACK	4755Hrs Clean cooler packs out externally.	09/14/2023
DZR00015	WO-GTP-142-952	BLOWN TRANS HOSE	REPAIR BLOWN TRANS HOSE	4745Hrs Replace blown transmission hose, refit holding clamps and secure with cable ties. Re-fill oil & run up.	09/15/2023
DZR00015	WO-GTP-142-567	Dozer 3rd Party Assessment of Track and Undercarriage	3rd Party Assessment of Track and Undercarriage	4696HRS COMPLETED BY WESTRAC	09/06/2023
DZR00015	WO-GTP-142-425	L/H/F WORK LIGHT U/S	L/H/F WORK LIGHT OUT	4660HRS REPAIR BROKEN WIRE AND TEST - ALL GOOD.	08/30/2023
DZR00015	WO-GTP-142-349	Liebherr Dozer Track Assembly Replacement	Track Assembly Replacement	3898HRS COMPLETED ON WO-GTP-138-541	06/16/2023
DZR00015	WO-GTP-141-742	CLEAN COOLER PACK	CLEAN OUT RADIATOR AND COOLER PACK	4483Hrs Clean out cooler pack.	08/14/2023
DZR00015	WO-GTP-141-687	REPLACE BROKEN ROOF LIGHT MOUNTS	REPLACE BROKEN ROOF LIGHT MOUNTS	NEW ISOLATION RUBBER MOUNTS PURCHASED FROM HOPPPY. REMOVE LIGHTING BRACKET AND FIT NEW MOUNTS.	08/13/2023
DZR00015	WO-GTP-141-658	REPLACE FAST FILL CAP	REPLACE MISSING DIESEL FAST FILL CAP	4492Hrs Replace fast fill cap & lanyard.	08/16/2023
DZR00015	WO-GTP-141-657	FLUSH AND ADD COOLING SYSTEM ADDITIVE	FLUSH AND ADD COOLING SYSTEM ADDITIVE	Flush cooling system and add CCAC additive fun up and re check coolant level. replace fuel filters, bleed, test run no faults	08/22/2023
DZR00015	WO-GTP-141-506	PLUGGED FUEL FILTER CODE	PLUGGED FUEL FILTER CODE	hrs-4432 Carry out B service.	08/07/2023
DZR00015	WO-GTP-141-494	B Service - Dozer	Service as per attached Service Sheet	hrs 4479 INSPECT REVERSE CAMERA, NO CAMERA SHOWING. REMOVE, CLEAN AND APPLY DIELECTRIC GREASE TO ALL CONNECTIONS. CYCLE POWER. ALL OK.	08/13/2023
DZR00015	WO-GTP-141-206	CAT REVERSE CAMERA NOT SHOWING	CAT REVERSE CAMERA NOT SHOWING	4364Hrs Mark camera & bracket position. Remove camera. Fabricate new bracket out of ally. Re-fit bracket and camera.	07/31/2023
DZR00015	WO-GTP-141-205	TOP LEFT MT DATA CAMERA BRACKET SNAPPED	TOP LEFT MT DATA TOP LEFT CAMERA BRACKET SNAPPED	REPLACE BLOWN LOWER HUMP HOSE. REPLACE OIL COOLER WATER HOSES X 4. REPLACE INCH TRANSFER HOSE FROM HEADER TANK. FLUSH COOLING SYSTEM.	07/31/2023
DZR00015	WO-GTP-141-057	COOLANT LEAK	REPAIR COOLANT LEAK	Complete A service as per check list.	08/01/2023
DZR00015	WO-GTP-140-693	A Service - Dozer	Service as per attached Service Sheet	hrs 4479	08/12/2023

DZR00015	WO-GTP-140-600	Dozer 3rd Party Assessment of Track and Undercarriage	3rd Party Assessment of Track and Undercarriage	COMPLETED BY WESTRAC	07/05/2023
DZR00015	WO-GTP-140-486	OIL IN COOLANT	OIL IN COOLANT. GREY SLUDGE. SUSPECT ENGINE OIL COOLER FAILURE.	4209Hrs OPERATOR REPORTED SLUDGE OVERFLOW FROM HEADER TANK AND LOW ENGINE OIL LEVEL. NO ALARMS OR LOGGED CODES FOR LOW OIL PRESSURE. DRAIN COOLING SYSTEM OF CONTAMINATED OIL/COOLANT MIX. REMOVE OIL COOLER. FIND SWOLLEN / DISLODGED INTERNAL RUBBER IN COOLER. REPLACE OIL COOLER WITH REMAN UNIT. REPLACE ENGINE OIL AND FILTERS. THOROUGHLY FLUSH COOLING SYSTEM OF HEAVY SLUDGE AND OIL BUILD UP WITH COOLING SYSTEM FLUSH ADDITIVES. BOTTOM FILL TO FLOAT UP CONTAMINANTS AND EVAC FROM HEADER TANK. CHECK OVER ENGINE, OIL PRESSURE GOOD. CONTINUE FLUSHING OVER THE WEEK UNTIL SYSTEM IS CLEAN THEN FILL WITH CAT ELC.	07/20/2023
DZR00015	WO-GTP-140-308	CLEAN OUT COOLER PACK	CLEAN OUT COOLER PACK	CLEANED OUT COOLER PACK. RAN MACHINE AT HIGH IDLE, WITH FAN IN BOTH FORWARD AND REVERSE DIRECTIONS TO MOVE OUT ANY LOOSE DIRT AFTER COOLER PACK CLEAN.	07/11/2023
DZR00015	WO-GTP-140-307	Alternator Replacement	Replace alternator, belt and belt tensioner.	REPLACED ALTERNATOR, BELT AND TENSIONER. ENSURE REPLACEMENT BELT LEFT TIED SECURELY INCASE OF FAILURE.	07/11/2023
DZR00015	WO-GTP-140-287	RELOCATE REVERSE CAMERA TO ROOF FOR BETTER FIELD OF VIEW	RELOCATE REVERSE CAMERA TO ROOF FOR BETTER FIELD OF VIEW	4191Hrs Fabricate new bracket out of ally - fit to roof. Fit camera extension lead and re-route cables. Fit camera to new bracket. Adjust/rotate camera to right angle.	07/13/2023
DZR00015	WO-GTP-140-278	DRIVE SHAFT COUPLING U/S	REPLACE DRIVE SHAFT COUPLING	REMOVE OLD DRIVE COUPLINGS, INSTALL NEW COUPLINGS AND HARDWARE. TEST OP, ALL OK.	09/05/2023
DZR00015	WO-GTP-140-012F.1	COMPLETE VALVE SET	COMPLETE VALVE SET	WASH AND BLOW DOWN ENGINE BEFORE COVER / PIPE REMOVAL. REMOVE INTAKE / EXHAUST / COVERS. TIME ENGINE WITH CAT TOOL. CHECK / ADJUST VALVES AND INJECTORS AS REQUIRED. ALL INJECTORS REQUIRED APPROX 1/8 TURN IN. NORMAL EXPECTED TIGHTNESS STILL WITHIN SPEC ON MOST VALVES. EXHAUST VALVES #4 AND #8 AROUND 0.050" (SPEC 0.030"). INSPCT CAM / ROCKER ARMS / SPRINGS AND ROTATOR, ALL LOOKED FINE. ADJUSTED AND ROTATED ENGINE 360 AGAIN, RE-CHECKED #4 AND #8 EXHAUST, ALL OK. REINSTALL COVERS, PIPING, PANELS ETC. TEST RUN, ALL OK.	09/05/2023
DZR00015	WO-GTP-140-012	D Service - Dozer	Service as per attached Service Sheet	4118Hrs Completed service. Replaced belt & tensioner.	07/06/2023
DZR00015	WO-GTP-139-450	DOZER CONTACTED ROOF WITH LHS AND REAR HAND RAILS	INSPECT MACHINE FOR REPORTED DAMAGE, REMOVE AND REPAIR DAMAGED HANDRAILS AFTER DOZER CONTACTED ROOF	Jig made to replicate the mounting points on the dozer. New handrail fabricated and painted to the drawing supplied. Old mounts and knuckles cut off old handrails and reused. PICK UP HANDRAILS FROM TRANSPORT YARD	07/04/2023
DZR00015	WO-GTP-139-117	SHIM DRAFT ARM CAPS	SHIM DRAFT ARM CAPS	3898Hrs Re-shim draft arm caps and blade stabilizer link caps as per procedure. Torque all bolts to spec.	06/15/2023
DZR00015	WO-GTP-138-854	CHANGE OUT LHS SPROKET SEGMENTS	CHANGE OUT LHS SPROKET SEGMENTS	3885Hrs MOVE MACHINE OUT OF SHED AND SET UP, UNBOLT AND REMOVE SPROKET SEGMENTS, CLEAN MATING SURFACES INSTALL NEW SEGMENTS AND BOLTS AND TORQUE TO SPEC, PACK UP WORK AREA	06/09/2023
DZR00015	WO-GTP-138-789	Smoke Bomb Cab	Smoke bomb cab and reseal if required.	3898Hr Smoke bomb cab, seal up any leaks as required around cab with sika flex. Fit new cab pressure filters.	06/16/2023
DZR00015	WO-GTP-138-541	UNDER CARRIAGE REBUILD AND TRACK REPLACEMENT	REPLACE ALL BOGIE ROLLERS AND IDLER ROLLERS. FIT NEW TRACKS TO MACHINE	3898Hrs Remove old tracks, rollers and idlers. Clean all parts. Fit 8x new rollers per side, 2x new idlers per side and both tracks. Replace all bolts and torque to spec. Mob/Demob all gear to K.E.T. Clean washpad, shift oil bunds/pods.	06/16/2023
DZR00015	WO-GTP-138-368	EXHAUST OVER PRESSURE FAULT	EXHAUST OVER PRESSURE FAULT	3807Hrs EXHAUST OVER PRESSURE LIGHT GOING RED. CHECK SENSORS/LINES. EMPTY WATER TRAP AND BLOW MOISTURE OUT OF LINES. TEST WITH LAPTOP. GET OPERATORS TO LOAD UP TO BURN OFF DPF - STILL FAULTING. CHECK SENSOR READINGS AGAINST HAND PUMP/GAUGE. REMOVE BOTH DPF MUFFLERS, BLOW OUT UNTIL CLEAN. ALL OK.	05/30/2023
DZR00015	WO-GTP-137-615	Fire Suppression Service	Service Fire Suppression System - Contractor to Complete	COMPLETED BY MITCHELL & BROWN FIRE	07/05/2023
DZR00015	WO-GTP-137-614	Fire Equipment Service	Inspect, test and tag fire equipment - Midwest Fire	Completed by Mitchell & Brown Fire.	07/17/2023
DZR00015	WO-GTP-137-477	REPAIR FAST FILL CENTRE DOOR HINGE	REPAIR FAST FILL CENTRE DOOR HINGE	DRILL OUT BROKEN RIVETS. INSTALL BOLTS FOR INCREASED RIGIDITY AND SERVICE LIFE. TEST OPERATION, ALL OK.	05/19/2023
DZR00015	WO-GTP-137-434	A Service - Dozer	Service as per attached Service Sheet	3795Hrs Complete machine check over, Grease up and replace air filters.	05/29/2023
DZR00015	WO-GTP-137-412	REPAIR LOOSE RHS ARM REST	REPAIR LOOSE RHS ARM REST	REPLACE MISSING BOLTS, ADJUST AND TIGHTEN ARMREST	05/18/2023
DZR00015	WO-GTP-136-967	REPLACE SPROCKET SEGMENTS	REPLACE SPROCKET SEGMENTS	3593HRS REPLACE RHS SPROCKET SEGMENTS. CLEAN MATING SURFACES AND TORQUE TO SPEC.	05/09/2023
DZR00015	WO-GTP-136-725	REPLACE FAILED RHS TRACK LINK	REPLACE FAILED RHS TRACK LINK	3536HRS ASSIST WESTRAC REPLACING FAILED PIN/BUSH ON RHS TRACK. REPLACE BOX SECTION OF TRACK CHAIN. CLEAN UP GROUSERS, INSTALL AND TORQUE. TENSION TRACK.	05/03/2023
DZR00015	WO-GTP-136-705	Dozer 3rd Party Assessment of Track and Undercarriage	3rd Party Assessment of Track and Undercarriage	3536HRS COMPLETED BY WESTRAC.	05/03/2023
DZR00015	WO-GTP-136-692	REPLACE MISSING LIFT HOSE GROMMET	REPLACE MISSING LIFT HOSE GROMMET	3562HRS REMOVE RADIATOR GUARDS, INSTALL MISSING LIFT HOSE GROMMET. RE-INSTALL GUARDS.	05/05/2023
DZR00015	WO-GTP-136-290	B Service - Dozer	Service as per attached Service Sheet	3482HRS CONDUCT 500HR SERVICE AS PER CAT SERVICE SHEET. TAKE ALL FLUID SAMPLES, CHANGE ENGINE OIL & FILTER, FUEL FILTERS & HYDRAULIC OIL FILTERS, AIR FILTERS, BLOW/CLEAN OUT COOLER PACK & CHANGE FINAL DRIVE OIL.	04/26/2023
DZR00015	WO-GTP-136-190	TIGHTEN RHS TRACK	TIGHTEN RHS TRACK	3431HRS TIGHTEN RHS TRACK TO SPEC	04/19/2023
DZR00015	WO-GTP-136-189	RH SIDE TURBO BOOST ACTUATOR LINE U/S	REPLACE BOOST ACTUATOR LINE	3431HRS FIT NEW HOSE, CLAMPS & HEAT SHIELD.	04/25/2023
DZR00015	WO-GTP-135-336	AIR CON BLOWING WARM	AIR CON BLOWING WARM	3266HRS WARM AIR FLOW, NOT COLD. RUN HEATER FOR 5 MINS. COLD AIR STARTED AGAIN, VENT TEMP DOWN TO 8 DEG C. SUSPECT EVAP FREEZING. OPERATOR HAD TEMP SET TO MIN, SET TO MIDWAY TO PREVENT FREEZING. FIND EVAP CORE TEMP READING 91 DEG C. ORDER REPLACEMENT TEMP PROBE. REPLACE THERMISTOR, TEST OPERATION, ALL OK.	04/05/2023
DZR00015	WO-GTP-135-080	RHS DRAFT ARM HANDRAIL BENT	REMOVE RHS DRAFT ARM HANDRAIL STRAIGHTEN AND RE INSTALL	3217HRS REMOVE RHS DRAFT ARM HANDRAIL AND BRACKET, STRAIGHTEN BRACKET IN PRESS AND STRAIGHTEN HANDRAIL RE INSTALL	03/29/2023
DZR00015	WO-GTP-135-025	A Service - Dozer	Service as per attached Service Sheet	3217HRS CONDUCT SERVICE AS PER SERVICE SHEET.	03/29/2023
DZR00015	WO-GTP-134-907	HYDRAULIC OIL LEAKING FROM RIGHT HAND TILT CYLINDER	REMOVE GUARD TO INSPECT LEAK AND REPAIR	3217HRS INSPECT FOR REPORTED OIL LEAK FROM RHS TILT CYLINDER. REMOVE GUARD & FOUND STEEL PIPE CORRODED THROUGH & LEAKING. REMOVED PIPE & TAKE TO YARD. MADE UP JIG, CUT OUT PIPE AND WELD IN NEW PIPE. COLLECT PIPE FROM YARD & RE-INSTALL INTO MACHINE. RUN UP & TEST, ALL OK. RE-INSTALL GUARD.	03/29/2023
DZR00015	WO-GTP-134-867	LHS TRACK ROLLER NOISE	LHS TRACK ROLLER NOISE	3193HRS INSPECT FOR TRACK ROLLER NOISE REPORTED BY OPERATORS. CHECK UNDERCARRIAGE FOR LEAKS, MISSING HARDWARE OR MISALIGNMENT. ALL OK, MODERATE TO HEAVY WEAR ON UNDERCARRIAGE. LISTEN TO MACHINE WHILE MOVING, FAINT SQUEAL HEARD INTERMITTENTLY. CANNOT PIN POINT, CONTINUE TO MONITOR.	03/27/2023
DZR00015	WO-GTP-134-784	RHS WASTEGATE HOSE SPLIT	RHS WASTEGATE HOSE SPLIT	3166HRS NOTICE WHISTLING SOUND WHEN COMPLETING MACHINE PRESTART. FIND RHS BANK WASTEGATE HOSE HEAT DAMAGED AND SPLIT ON THE END. CUT BACK TUBE 1 INCH AND RE CONNTECT, ENSURE HEAT SHIELDING COVERING HOSE. TEST OK	03/24/2023
DZR00015	WO-GTP-133-897	INSPECT COUNTERWEIGHT AFTER CONTACT WITH WALL	INSPECT COUNTERWEIGHT AFTER CONTACT WITH WALL	INSPECT COUNTERWEIGHT AFTER OPERATOR REVERSING INTO WALL. MINOR DAMAGE TO BOTTOM LIP. ENSURE ALL PIN RETAINERS SECURE, REMOVE COUNTERWEIGHT SAFETY CAPS AND ENSURE MOUNT RODS SECURE, ALL OK.	03/10/2023
DZR00015	WO-GTP-133-847	FRONT IDLER SCRAPERS WORN	FRONT IDLER SCRAPERS WORN	3900Hrs Clean dirt away, remove scraper - rubber worn and folded over due to idler wear. Steel backing on rubber u/s, clean up and re-fit scraper - needs replacement. Replacement scrapers fitted at undercarriage change out.	06/16/2023
DZR00015	WO-GTP-133-820	REPLACE ISOLATION SWITCH WITH HIGH AMPERAGE CONTACT UNIT TO PREVENT FUTURE FAILURES	REPLACE ISOLATION SWITCH WITH HIGH AMPERAGE CONTACT UNIT TO PREVENT FUTURE FAILURES. DUE TO INCORRECT AMPERAGE ISOLATION SWITCH BEING FITTED FROM FIT OUT	3035HRS REMOVE ISOLATOR, DRILL OUT CABLE LUGS & CLEAN UP. FIT NEW ISOLATOR, CHECK OPERATION, ALL OK.	03/09/2023
DZR00015	WO-GTP-133-732	TIGHTEN RHS TRACK	TIGHTEN RHS TRACK	3036HRS TIGHTENED RHS TRACK TO SPEC, RHS CANNON EXTENSION 6 1/8". LHS CANNON EXTENSION 5 1/4"	03/08/2023
DZR00015	WO-GTP-133-626	WELD ON WEAR PLATE TO BLADE	WELD ON WEAR PLATE TO BLADE	3035HRS WELD ON CHOCY BAR WEAR PLATE TO BLADE SIDES	03/08/2023
DZR00015	WO-GTP-133-137	Dozer 3rd Party Assessment of Track and Undercarriage	3rd Party Assessment of Track and Undercarriage	3035HRS COMPLETED BY WESTRAC	03/08/2023
DZR00015	WO-GTP-133-104	C Service - Dozer	Service as per attached Service Sheet	3035HRS COMPLETE SERVICE AS PER CAT SERVICE SCHEDULE.	03/08/2023

DZR00015	WO-GTP-133-035	REPAIR AM/FM RADIO FALLEN OUT OF ROOF	REPAIR AM/FM RADIO FALLEN OUT OF ROOF	2995HRS REMOVE RADIO FASCIA, REMOVE RADIO, RE-INSTALL METAL MOUNT BRACKET AND TIGHTEN RETAINING CLIPS. REINSTALL RADIO.	02/27/2023
DZR00015	WO-GTP-132-975	REPLACE FAILED WORKLIGHTS - BLACKTIPS WARRANTY	REPLACE FAILED WORKLIGHTS - BLACKTIPS WARRANTY	2955HRS REPLACE LHS ROOF LIGHT AND INNER LHS LIFT CYLINDER LIGHTS WITH NEW LIGHTS REPLACED ON WARRANTY BY BLACKTIP DUE TO FAILED WIRING IN BACK OF LIGHT.	02/28/2023
DZR00015	WO-GTP-132-930	TIGHTEN LHS AND RHS TRACKS	TIGHTEN LHS AND RHS TRACKS	2965HRS TIGHTEN LHS AND RHS TRACKS	02/23/2023
DZR00015	WO-GTP-132-894	CLEAN OUT COOLER PACKAGE	CLEAN OUT COOLER PACKAGE	2965HRS USED COMPRESSED AIR TO CLEAN OUT PRODUCT BUILD UP FROM RADIATOR CORES.	02/23/2023
DZR00015	WO-GTP-132-669	BATTERY ISOLATOR U/S	INSPECT FOR REPORTED BATTERY ISOLATOR U/S	2952HRS INSPECT FOR REPORTED BATTERY ISOLATOR U/S, TEST ISOLATOR, FOUND ISOLATOR HAS CONSTANT CONTINUITY AND DOES NOT DISCONNECTING THE BATTERY, DISCONNECT AND REMOVE ISOLATOR, TRAVEL TO TRANSPORT YARD AND COLLECT NEW ISOLATOR, RETURN TO KARARA AND INSTALL NEW ISOLATOR, TEST AFTER REPAIR, ALL OKAY	02/21/2023
DZR00015	WO-GTP-132-631	FIRE SURPRESSION ALARM GOING OFF AND MACHINE SHUT DOWN	INSPECT MAHINE FOR REPORTED FIRE SURPRESSION ALARM GOING OFF AND MACHINE SHUT DOWN ON STOCK PILE	2939HRS INSPECTED MAHINE FOR REPORTED FIRE SURPRESSION ALARM GOING OFF AND MACHINE SHUT DOWN ON STOCK PILE, FOUND LHS REAR SURPRESSION BOTTLE BELLY STAP HAD BROKEN AT ONE END AND HAD ALLOWED THE BOTTLE TO MOVE AROUND AND BROKEN A PRESSURE SWITCH WIRE, US AE RATCHET STRAP TO TEMPORARILY SECURE BOTTLE, REPAIR BROKEN WIRE AT DEUTCHE PLUG, REPAIR BELLY STRAP AND RE INSTALL ONTO MACHINE	02/19/2023
DZR00015	WO-GTP-132-291	CHANGE OUT PIVOT SHAFT OIL	DRAIN PIVOT SHAFT OIL COMPARTMENT, AND RE FILL WITH TRANSMAX OFFROAD 50W, BLEED AIR OUT OF SYSTEM AND TOP UP OIL	2877HRS DRAIN PIVOT SHAFT OIL COMPARTMENT, AND RE FILL WITH TRANSMAX OFFROAD 50W , BLEED AIR OUT OF SYSTEM AND TOP UP OIL	02/14/2023
DZR00015	WO-GTP-132-289	BAD COOLANT SAMPLE REPORT	DRAIN COOLANT, RE FILL COOLING SYSTEM WITH NEW CAT ELC COOLANT, RUN UP MACHINE AND GET TO OPERATING TEMPERATURE AND TOP UP COOLANT	2877HRS DRAIN COOLANT, RE FILL COOLING SYSTEM WITH NEW CAT ELC COOLANT, RUN UP MACHINE AND GET TO OPERATING TEMPERATURE AND TOP UP COOLANT, PACK UP WORK AREA	02/14/2023
DZR00015	WO-GTP-132-134	CHANGE OUT LEFT HAND MASTER LINK	REMOVE 3 GROUSER PLATES FROM MASTER LINK. USE TRACK PRESS TO REMOVE MASTER LINK PINS. FIT STANDARD LINK IN PLACE OF MASTER LINK. PRESS IN NEW PINS. OXY CUT NEW HOLES IN MASTER LINK GROUSER PLATE TO SUIT NEW LINK. VAC AND OIL PINS	2877HRS PICK UP TRACK PRESS & HI-TORQUE FROM JMH. REMOVE GROUSER PLATES, SPLIT TRACK, PRESS MASTER LINK PINS OUT. TRACK PRESS DIES BURRED/WONT FIT. CLEAN UP/POLISH GRIND DOWN PIN TO MAKE DUMMY PIN. CLEAN UP LINKS, PRESS IN NEW PINS. GRIND DOWN BEARING TO PRESS LOCK RINGS. OXY/DIE GRIND HOLES IN GROUSER PLATE. VAC & OIL PINS. BOLT GROUSERS ON.	02/14/2023
DZR00015	WO-GTP-131-466	A Service - Dozer	Service as per attached Service Sheet	2901HRS COMPLETED SERVICE AS PER ATTACHED SERVICE SHEET.	02/16/2023
DZR00015	WO-GTP-131-425	REPAIR RHS MASTERLINK SNAPPED	REPAIR RHS MASTERLINK SNAPPED	2707HRS USE 200T TRACK PRESS TO PRESS OLD PINS OUT OF LINK, REMOVE MASTERLINK, POLISH ALL SURFACES. FIT NEW SEALS & BEARINGS. PRESS NEW PINS IN. REFIT GROUSER PLATES, OXY CUT MASTERLINK GROUSER PLATE HOLES BIGGER TO SUIT VAC & OIL TRACK PINS. NEW BOLTS FITTED TO GROUSERS.	01/31/2023
DZR00015	WO-GTP-131-371	REPLACE 2 BROKEN BOLTS RHS TRACK MASTERLINK	REPLACE 2 BROKEN BOLTS RHS TRACK MASTERLINK	2737HRS REMOVE 2 BROKEN BOLTS FROM RHS TRACK (BOTH SHORT BOLTS) , CLEAN UP MASTERLINK AND FACES. SOURCED REPLACEMENT BOLTS FROM BOLTS R US. INSTALL REPLACEMENT BOLTS, TORQUE 1100 FT LBS + 90 DEG.	01/28/2023
DZR00015	WO-GTP-131-282	ROTATE CUTTING EDGES	ROTATE CUTTING EDGES	2707HRS REMOVED AND ROTATED CENTRE CUTTING EDGES (CORNER TIPS PREVIOUSLY REPLACED). BUFFED ALL HARDWARE AND SURFACES. TORQUE HARDWARE 1700FT LBS.	01/25/2023
DZR00015	WO-GTP-131-259	FIT REMOTE BREATHER FOR PIVOT SHAFT RESERVOIR	FIT REMOTE BREATHER FOR PIVOT SHAFT RESERVOIR	2590HRS FABRICATE BRACKET, RE-LOCATE BREATHER ASSY.	02/14/2023
DZR00015	WO-GTP-130-922	DIAGNOSE BLADE TILT FAULT	DIAGNOSE AND REPAIR BLADE TILT FAULT	2661HRS INSPECT MACHINE FOR REPORTED TILT THUMB CONTROL FAULT, BLADE WONT TILT BACK. INSPECT/TEST HARNESS & CONTROL. FOUND THUMB CONTROL UNIT U/S. REMOVE JOYSTCK AND HANDPIECE. COLLECT NEW HANDPIECE FROM WESTRAC & INSTALL. RE-INSTALL JOYSTICK AND TEST OPERATION, ALL OK.	01/20/2023
DZR00015	WO-GTP-130-695	AIR CONDITIONER BLOWING WARM	AIR CONDITIONER BLOWING WARM	2590HRS INSPECT SYSTEM, FIND FREEZING OVER DUE TO RUNNING IN MIN TEMP. ADJUST RUNNING TEMP TO 23 DEGREES INSTEAD OF 18 DEGREES. RAN A/C AFTER DEFROSTED - VENT TEMP 6 DEGREES. LET OPERATOR KNOW IDEAL RANGE IN HOT/HUMID CONDITIONS.	01/16/2023
DZR00015	WO-GTP-130-618	INVESTIGATE LOW POWER COMPLAINT	INVESTIGATE LOW POWER COMPLAINT	2553hrs INVESTIGATE LOW POWER COMPLAINT. CHECK LEVELS AND FOR OBSTRUCTION OF COOLERS, ALL OK. CHECK FOR ANY LOGGED CODES OR EVENTS, NOTHING LOGGED. GET MACHINE TO OPERATING TEMPERATURE, CARRY OUT VARIOUS STALL TEMPS AT FULL HEAT SOAK, LH AND RH BANK BOOST 146 - 148KPA (SPEC 142KPA). FUEL PRESSURE GOOD. INLET AIR RESTRICTION GOOD. EXHAUST TEMPS GOOD. ENGINE STALL SPEED 1482RPM @ 120 DEG TCO TEMP. (SPEC 1485RPM). NO ENGINE DERATE WHEN TESTING.	01/13/2023
DZR00015	WO-GTP-130-230	CORNER TIP REPLACEMENT	CARRY OUT CORNER TIP REPLACEMENT	2553hrs NO FAULT FOUND, RETURN TO WORK.	01/13/2023
DZR00015	WO-GTP-130-226	B Service - Dozer	Service as per attached Service Sheet	2553hrs CARRY OUT CORNER TIPS & TORQUE TO SPEC. CLEANED MOUNTING SURFACES BEFORE MOUNTING.	01/05/2023
DZR00015	WO-GTP-130-199	Dozer 3rd Party Assessment of Track and Undercarriage	3rd Party Assessment of Track and Undercarriage	2522HRS DOUBLE UP - SERVICE COMPLETED ON WO-GTP-129-860.	01/10/2023
DZR00015	WO-GTP-129-860	B Service - Dozer	Service as per attached Service Sheet	2475HRS WESTRAC COMPLETED UNDERCARRIAGE & TRACK ASSESSMENT.	01/05/2023
DZR00015	WO-GTP-129-793	TENSION RHS TRACK	TENSION RHS TRACK	2435HRS CONDUCT 500HR SERVICE AS PER CHECKLIST. TAKE ALL FLUID SAMPLES & CHECK ALL LEVELS. GREASE ALL POINTS, ADJUST LHS TRACK. BLOW OUT RADIATOR.	12/30/2022
DZR00015	WO-GTP-129-745	TENSION RHS TRACK	TENSION RHS TRACK	2297HRS TENSION RHS TRACK. CHECK TORQUE ON FILL & BLEED SCREWS TO ENSURE NO LEAK OFF.	12/15/2022
DZR00015	WO-GTP-129-214	REPAIR MISSING BOLTS ON 9KG FIRE EXTINGUISHER BRACKET	REPAIR MISSING BOLTS ON 9KG FIRE EXTINGUISHER BRACKET	2290HRS TIGHTEN LOOSE RHS TRACK.	12/14/2022
DZR00015	WO-GTP-129-092	A Service - Dozer	Service as per attached Service Sheet	2290HRS REPLACED MISSING BOLTS ON 9KG FIRE EXTINGUISHER BRACKET. ADJUST ACCORDINGLY.	12/14/2022
DZR00015	WO-GTP-128-931	Smoke Bomb Cab	Smoke bomb cab and reseal if required.	2274HRS CARRY OUT A SERVICE.	12/12/2022
DZR00015	WO-GTP-128-142	MACHINE RUNNING HOT RADIATOR PARTIALLY BLOCKED	WASH OUT RADIATORS AND AFTER COOLERS	2099HRS SMOKE BOMB CAB & SEAL ANY LEAKS WITH SIKAFLEX. CAB PRESSURISER FILTER REQUIRES REPLACING.	11/25/2022
DZR00015	WO-GTP-128-139	RHS EXHAUST OVER TEMP FAULT	DIAGNOSE AND REPAIR REPORTED RHS EXHAUST OVER TEMP FAULT	2113HRS CONDUCTED JHA, OPEN UP RADIATOR GRILLS SCRAPE OUT PRODUCT FROM INFRONT OF RADIATOR, USE AIR TO BLOW OUT RADIATORS AND AFTER COOLERS, CLOSE UP GRILL MACHINE RUNNING HOT RADIATOR PARTIALLY BLOCKED	12/03/2022
DZR00015	WO-GTP-127-430	Fire Suppression Service	Service Fire Suppression System - Contractor to Complete	2003HRS INSPECT MACHINE FOR REPORTED EXHAUST OVER TEMP FAULT ON RHS. CONNECT LAPTOP AND CONFIRM FAULT. WALK THRU DIAGNOSTIC PROCEDURE. FOUND RHS WASTEGATE SILICONE SIGNAL HOSE ON RHS TURBO BROKEN OFF. (HEAT DAMAGE) CUT HOSE SHORTER & PUT BACK ONTO TURBO. TESTED BOOST PRESSURES - RHS STILL TIGHT AS MUCH AS LHS.	12/31/2022
DZR00015	WO-GTP-127-421	Fire Equipment Service	Inspect, test and tag fire equipment - Midwest Fire	2003HRS 2/12 - REPLACED RHS WASTEGATE ACTUATOR (OLD ACTUATOR FAILED). TIGHTENED LOOSE TURBO TO EXHAUST V-CLAMP. FOUND BOOST PRESSURE SENSORS WIRED TO ECM INCORRECTLY, LHS SHOWING RHS & VICE VERSA. CORRECTED WIRING. CARRY OUT WASTEGATE CALIBRATION, ALL OK.	12/31/2022
DZR00015	WO-GTP-126-648	Dozer 3rd Party Assessment of Track and Undercarriage	3rd Party Assessment of Track and Undercarriage	2078HRS WESTRAC COMPLETED TRACK AND UNDERCARRIAGE ASSESSMENT	11/15/2022
DZR00015	WO-GTP-126-647	Alternator Replacement	Replace alternator, belt and belt tensioner.	1927HRS REMOVE CAB FLOOR, REMOVE AUX DRIVE SHAFT GUARD, CHANGE OUT BELT TENSIONER & BELT. REMOVE ENGINE SIDE GUARD, DISCONNECT AND REMOVE ALTERNATOR. SWAP OVER PULLEY TO NEW ALTERNATOR, INSTALL NEW ALTERNATOR AND CONNECT UP. INSTALL GUARDS AND CAB FLOOR. RUN UP AND TEST, ALL OK.	11/22/2022
DZR00015	WO-GTP-126-644	D Service - Dozer	Service as per attached Service Sheet	1927HRS CARRY OUT 2000HR SERVICE	11/22/2022
DZR00015	WO-GTP-126-293	2 WAY NOT RECIEVING	INSPECT AND RECTIFY 2 WAY FAULT	1927HRS INSPECT 2 WAY FINDING TRANSMITTING FINE BUT NOT RECEIVING, UNPLUG EXTENSION SPEAK RESOLVING FAULT. REPLACE EXTENSION SPEAK WITH NEW PART RESOLVING FAULT	11/27/2022

DZRO0015	WO-GTP-126-044	BAD SAMPLE RETURN FOR COOLANT	FIT 5L OF CAT COOLANT EXTENDER TO MACHINE	1.814HRS ADD 5 L OF COOLANT EXTENDER TO COOLANT	10/27/2022
DZRO0015	WO-GTP-125-792	RADIATOR PARTIALLY BLOCKED	SET UP MACHINE AND WASH OUT RADIATOR	CONDUCT JHA SET UP MACHINE AND WASH OUT RADIATOR 1.686hrs	10/14/2022
DZRO0015	WO-GTP-125-076	DIESEL FUEL FILTER BLOCKED CODE THROWING UP DURING OPERATION	DIESEL FUEL FILTER BLOCKED CODE THROWING UP DURING OPERATION	1516 HRS CHANGE ALL FUEL FILTERS AND WATER SEPARATOR	09/29/2022
DZRO0015	WO-GTP-124-300	B Service - Dozer	Service as per attached Service Sheet	1591HRS COMPLETE 500HR SERVICE AS PER SERVICE SHEET	10/04/2022
DZRO0015	WO-GTP-123-630	TENSION LOOSE TRACKS	MEASURE AND TENSION LOOSE TRACKS TO SPEC	1278 HRS SET UP MACHINE ON PAD, MEASURE TRACKS AND TENSION TO CAT SPEC	09/05/2022
DZRO0015	WO-GTP-123-527	BLADE DROPPING/CREEPING	DIAGNOSE AND REPAIR BLADE DROPPING/CREEPING	INSPECT/TEST MACHINE FOR REPORTED BLADE DROPPING, CONDUCT CONTROL LEVER AND BLADE POSITION SENSOR CALIBRATIONS. RETURN MACHINE TO WORK, BLADE FLOAT FOUND TO BE SWITCHED ON	09/13/2022
DZRO0015	WO-GTP-123-526	FM RADIO POOR RECEPTION/STATIC	DIAGNOSE AND REPAIR FM RADIO POOR RECEPTION	1285 HRS TEST/INSPECT ANTENNA AND CABLE TO HEAD UNIT. REMOVE AND REPLACE ANTENNA BASE/CABLE AND TEST - ALL OK	09/06/2022
DZRO0015	WO-GTP-122-926	A Service - Dozer	Service as per attached Service Sheet	1285 HES CARRY OUT A SERVICE	09/06/2022
DZRO0015	WO-GTP-122-829	BAD COOLANT SAMPLE	FILL RADIATOR WITH 2% CAT ELC COOLANT EXTENDER (5 LITRES)	1208 HRS ADD 5 LITRES OF COOLANT EXTENDER TO RADIATOR HEADER TANK	08/30/2022
DZRO0015	WO-GTP-122-802	MACHINE RUNNING HOT	INSPECT MACHINE FOR FAULT	1142 HRS INSPECT MACHINE FINDING RADIATOR BLOCKED WASH OUT RADIATOR RESOLVING ISSUE	08/22/2022
DZRO0015	WO-GTP-122-608	Smoke Bomb Cab	Smoke bomb cab and reseal if required.	1220 HRS SMOKE BOMB CAB AND SEAL ANY LEAKS WITH SIKAFLEX	08/31/2022
DZRO0015	WO-GTP-122-542	ACCESS LADDER BENT/DAMAGED	INSPECT DAMAGED ACCESS LADDER AND REPAIR AS REQUIRED	1097 HRS INSPECTED DAMAGED ACCESS LADDER, STRAP UP LADDER AND REMOVE LADDER UP SWITCH AND STRAP TO SENSOR TO ALLOW MACHINE TO WORK, REMOVE AND REINSTALL DSS RECORDER HARD DRIVE. REMOVE LADDER ASSEMBLY AFTER DOING JHA. DISASSEMBLE LADDER, HEAT UP, STRAIGHTEN BOTH SIDE HAND RAILS. COLLECT NEW LADDER PLATE AND ASSEMBLE. PAINT HAND RAILS, INSTALL LADDER ASSEMBLY ONTO MACHINE AND ADJUST LATCH. TEST OPERATION - ALL OK	08/18/2022
DZRO0015	WO-GTP-121-567	Dozer 3rd Party Assessment of Track and Undercarriage	3rd Party Assessment of Track and Undercarriage	1361.9 HRS WESTRAC COMPLETED 3rd Party Assessment of Track and Undercarriage	09/14/2022
DZRO0015	WO-GTP-121-270	TRACKS REQUIRE ADJUSTING	ADJUST TRACKS TO CAT SPECIFICATION	1364 HRS ESCORT WESTRAC, CONDUCT JHA, ASSIST TO CONDUCT TRACK INSPECTIONS. WASH MACHINES BEFORE INSPECTIONS	07/24/2022
DZRO0015	WO-GTP-121-244	CAB PRESSURISER ALARMING	INSPECT FOR REPORTED CAB PRESSURISER ALARM GOING OFF	963 HRS SET UP STRING LINE, CLEAN OFF AND REMOVE COVER AND MEASURE. TRACKS FOUND TO BE AT A MEASUREMENT OF 100MM AT POINT A AND B (25MM OVER SPEC AT EACH SPOT), ADJUSTED TRACK TO WITHIN SPEC AT 75MM AT EACH SPOT, REINSTALLED COVER	07/23/2022
DZRO0015	WO-GTP-121-120	MACHINE THROWING FAULTS THINKING LADDER IS DOWN	INSPECT AND DIAGNOSE LADDER FAULT	961 HRS INSPECT FOR REPORTED CAB PRESSURISER ALARM GOING OFF, TEST SYSTEM AND COMPARE TO DZR16 FOUND SYSTEM BELOW PRESSURE SPEC FILTER FOUND TO BE BLOCKED, REMOVE AND REPLACE FILTER AND RE TEST, ALL OKAY	07/21/2022
DZRO0015	WO-GTP-121-090	C Service - Dozer	Service as per attached Service Sheet	932 HRS INSPECT LADDER SYSTEM FOR REPORTED LADDER DOWN FAULT OCCURRING. CHECK WIRING AND SWITCHES, ADJUST LADDER UP/DOWN SWITCH. FOUND PRODUCT BUILT UP ON SWITCH MAGNET STOPPING SWITCH	07/21/2022
DZRO0015	WO-GTP-121-089	NDT DRAFT ARM WEAR PLATES FOR CRACKS AND RE WELD AS NECESSARY	CLEAN DOWN, NDT ALL WELDS FOR CRACKS, REPAIR AS NECESSARY	963 HRS CONDUCT JHA, TAKE ALL OIL SAMPLES. CONDUCT C SERVICE AS PER SERVICE SHEET	07/24/2022
DZRO0015	WO-GTP-120-580	LADDER LATCH ACTUATOR US	ASSIST WESTRAC TO REPLACE LADDER LATCH ACTUATOR	957 HRS DIG OF TRACKS AND DRAFT ARMS AND PRESSURE CLEAN ARMS. SET UP BLADE ON STANDS FOR NDT TESTING. NDT COMPLETED - NO CRACKS FOUND	07/22/2022
DZRO0015	WO-GTP-120-408	FUEL TANK CAP BREATHER LEAKING	FUEL TANK CAP BREATHER LEAKING	795 HRS ASSIST WESTRAC TO REPLACE LADDER LATCH ACTUATOR	07/06/2022
DZRO0015	WO-GTP-120-093	A Service - Dozer	Service as per attached Service Sheet	921 HRS INSPECT FOR FUEL LEAKING OUT OF FUEL CAP, FOUND PART OF BREATHER BROKEN. ORDER NEW PART. NEW BREATHER FITTED	07/20/2022
DZRO0015	WO-GTP-119-926	TRACKS REQUIRE ADJUSTING	ADJUST TRACKS AS PER SPECIFICATION	CONDUCT JHA, CONDUCT A SERVICE AS PER SERVICE SHEET	07/24/2022
DZRO0015	WO-GTP-119-863	REAR TOW PIN SEIZED IN	REMOVE SEIZED IN REAR TOW PIN CLEAN UP AND RE INSTALL	743 HRS MOVE MACHINE OUT TO WASH PAD, MEASURE AND ADJUST TRACKS AS PER SPECIFICATION	06/27/2022
DZRO0015	WO-GTP-119-696	LADDER LOCK ACTUATOR NOT WORKING	INSPECT FOR REPORTED LADDER LOCK ACTUATOR NOT WORKING AND REPAIR AS REQUIRED	731 HRS REMOVED SEIZED REAR TOW PIN FROM TOW POINT CLEAN UP SURFACES WITH WIRE WHEEL AND REINSTALL PIN WITH ANTI SEIZE	06/26/2022
DZRO0015	WO-GTP-118-932	OIL LEAKING FROM CYLINDER 12/10 ROCKER COVER	REMOVE AND REPLACE ROCKER COVER GASKET	728 HRS TEST LADDER, TEST/INSPECT WIRING, HOT WIRE ACTUATOR, ALL OK. FOUND ACTUATOR CONTROL TO BE FAULTY, REMOVE ACTUATOR ASSEMBLY. INSTALL NEW CONTROLLER AND RETEST WIRING ALL OK REMOUNT ASSEMBLY	06/30/2022
DZRO0015	WO-GTP-118-585	LEFT HAND STEP WORK LIGHT SNAPPED OFF	LEFT HAND STEP WORK LIGHT SNAPPED OFF	624 HRS INSPECT FOR REPORTED OIL LEAK FROM #10/12 ROCKER COVER. REMOVE BRACKET AND HOSE. REMOVED ROCKER COVER AND FOUND SEAL HAD BEEN PINCHED. CLEAN UP COVER AND ROCKER BASE, INSTALL NEW SEAL. REINSTALL ROCKER COVER AND BRACKETS/HOSES, RUN AND TEST - ALL OK	06/09/2022
DZRO0015	WO-GTP-118-584	TRACKS LOOK LOOSE	CHECK AND ADJUST TRACK AS PER MAN SPECS	570 HRS REMOVE LIGHT AND OLD BRACKET, DRILL HOLE IN PLATFORM TO BOLT WORK LIGHTS THROUGH	05/31/2022
DZRO0015	WO-GTP-118-521	Fire Suppression Service	Service Fire Suppression System - Contractor to Complete	570 HRS CHECK AND ADJUST TRACKS	05/31/2022
DZRO0015	WO-GTP-118-518	Fire Equipment Service	Inspect, test and tag fire equipment - Midwest Fire	COMPLETED BY MIDWEST FIRE	06/30/2022
DZRO0015	WO-GTP-117-759	B Service - Dozer	Service as per attached Service Sheet	COMPLETED BY MIDWEST FIRE	06/30/2022
DZRO0015	WO-GTP-117-700	QUICK FILL SHUTTING OFF BEFORE TANK FULL	DIAGNOSE QUICK FILL FAULT	498 HRS COMPLETE 500 HR SERVICE. CHANGE ALL FILTERS. DRAIN/CHANGE DRIVE OILS. COMPLETE VALVE SET	05/25/2022
DZRO0015	WO-GTP-117-346	LEFT HAND REAR VISION MIRROR FALLEN OFF	LEFT HAND REAR VISION MIRROR FALLEN OFF	465 HRS CHECK FILL GUN PRESSURISING AND SHUTTING OFF. REMOVE PRESSURE INCREASING VALVE. TEST OK	05/18/2022
DZRO0015	WO-GTP-117-339	Dozer 3rd Party Assessment of Track and Undercarriage	3rd Party Assessment of Track and Undercarriage	400 HRS REFIT MIRROR, LOCKTITE BOLTS. CHECK OTHER SIDE IS TIGHT	05/10/2022
DZRO0015	WO-GTP-117-293	OPERATORS REPORT SMOKE COMING FROM LADDER	OPERATORS REPORT SMOKE COMING FROM LADDER	593HRS WESTRAC COMPLETED TRACK AND UNDERCARRIAGE ASSESSMENT	06/04/2022
DZRO0015	WO-GTP-117-200	OPERATORS REPORT LOOSE WORK LIGHTS	OPERATORS REPORT LOOSE WORK LIGHTS	410 HRS PINS NOT OPERATING, STRAP LADDER UP SO DOZER CAN GO TO WORK. WESTRAC REPLACED CONTROL MODULE (SOLENOID) UNDER WARRANTY	05/13/2022
DZRO0015	WO-GTP-117-047	REINFORCE 2 WAY MOUNTING BRACKET	REINFORCE 2 WAY MOUNTING BRACKET	400 HRS TIGHTEN UP LIGHTS, CHECK ALL OTHER LIGHTS	05/06/2022
DZRO0015	WO-GTP-117-046	WORK LIGHT SNAPPED OFF RIGHT HAND PLATFORM	REMOUNT LIGHT TO RIGHT HAND PLATFORM	400 HRS REMOVE MOUNTING BRACKET AND MEASURE. MAKE TEMPLATE FOR FABRICATION OF NEW REINFORCED BRACKET. FAVORITATE AND PAINT NEW BRACKET. REMOVE OLD BRACKET, FIT NEW BRACKET TO DOZER	05/12/2022
DZRO0015	WO-GTP-116-983	OPERATOR REPORTED HEAVY GEAR CHANGES WHEN SHIFTING FROM FORWARD TO REVERSE	INSPECT MACHINE FOR REPORTED HEAVY GEAR CHANGES WHEN SHIFTING FROM FORWARD TO REVERSE	359 HRS REMOVE BRACKET FROM LIGHT. DRILLED HOLE/TAPPED AND MOUNTED LIGHT TO DOZER. RHS PLATFORM AND ADJUST	05/06/2022
DZRO0015	WO-GTP-116-982	INSPECT TRANSMISSION COOLER TO IDENTIFY LEAK	INSPECT TRANSMISSION COOLER TO IDENTIFY LEAK	334 HRS INSPECT FOR REPORTED HARSH SHIFTING, INSPECT BRAKE AND DECELERATOR. TRY TO CONNECT LAPTOP BUT WOULDN'T CONNECT, DRIVE TO WESTRAC. SORT OUT LAPTOP/COMMS ADAPTOR, RETURN TO KET. CONNECT LAPTOP. TAKE MACHINE DOWN LOAD AND COULD NOT CALIBRATE BRAKE/DECELERATOR	05/03/2022
DZRO0015	WO-GTP-116-928	WET COMMISSIONING CHECKS	WET COMMISSIONING CHECKS	498 HRS REMOVE FRONT BELLY PLATE, REMOVE TRANSMISSION OIL COOLER CRACKED COOLER. REPLACE ALL GASKETS AND O-RINGS - REFIT TO MACHINE. REFILL COOLANT AND TOP UP TRANSMISSION. JOB COVERED UNDER WARRANTY	05/26/2022
DZRO0015	WO-GTP-116-886	TRANSMISSION OVER FULL	DRAIN SOME TRANSMISSION OIL TO CORRECT LEVEL	COMPLETED COMMISSIONING CHECKS	04/18/2022
DZRO0015	WO-GTP-116-867	MACHINE WON'T TAKE BULK FUEL	INSPECT FOR REPORTED MACHINE WON'T TAKE BULK FUEL	310 HRS ATTEMPTED TO DRAIN SOME TRANSMISSION OIL TO CORRECT LEVEL, SERVICE TRUCK WOULD NOT SUCK OIL OUT, TAKE FLOOR OUT OF CAB AND FOLLOW BULK OIL HOSE. FOUND HOSE NOT CONNECTED TO TRANS, HOSE WAS HANGING WITH PLUG IN END. REMOVED CAP AND PLUG AND CONNECTED HOSE TO TRANS, REINSTALLED FLOOR, USED SERVICE TRUCK TO SUCK OIL OUT TO CORRECT LEVEL	05/01/2022
DZRO0015	WO-GTP-116-656	A Service - Dozer	Service as per attached Service Sheet	306 HRS INSPECT FOR REPORTED MACHINE WON'T TAKE BULK FUEL, FOUND FUEL TANK BREATHER SENSE LINE HOLDING PRESSURE AND STOPPING BULK FUEL COUPLER ACCEPTING FUEL, REMOVE BREATHER AND RELEASE PRESSURE FROM SENSE LINE AND REINSTALL BREATHER AND RE FUEL MACHINE ALL OKAY	04/30/2022
DZRO0015	WO-GTP-116-558	ENGINE COOLANT OVERHEATING	INSPECT FOR REPORTED ENGINE COOLANT OVERHEATING AND REPAIR AS REQUIRED	300 HRS CONDUCT 250 HRS SERVICE AS PER SERVICE CHECKLIST, REMOVE CAB FLOOR AND INSPECT COMPONENTS IN MAN HOLE	04/29/2022
DZRO0015	WO-GTP-116-557	FIRE SUPPRESSION SYSTEM LOW PRESSURE ALARM GOING OFF	INSPECT FOR REPORTED FIRE SUPPRESSION SYSTEM LOW PRESSURE ALARM GOING OFF	266 HRS INSPECT COOLING SYSTEM, TEST FAN CONTROL SYSTEM AND REVERSE FAN SWITCH. FAN CAN GET STUCK IN REVERSE IF SWITCHED MANUALLY. OPERATOR HAS SWITCH TO FIT FAN	04/26/2022
DZRO0015	WO-GTP-116-524	FIT EXTENSION SPEAKERS TO UHF RADIO	FIT EXTENSION SPEAKERS TO UHF RADIO	266 HRS CONDUCT JHA, INSPECT FOR REPORTED FIRE SUPPRESSION SYSTEM LOW PRESSURE ALARM GOING OFF, TEST PRESSURE SWITCHES, SIGN IN FIRE TECHNICIAN, AND ASSIST TO TEST AND RE PRESSURISE SUPPRESSION SYSTEM TANKS, TEST OPERATION, ALL OKAY	04/26/2022
DZRO0015	WO-GTP-115-345	PRE OPERATION FIT OUT	FIT CORNER TIPS AND GOANNA BARS TO BLADES, FIT WORK LIGHTS AND MINE 2 WAY ADJUST INCHING PEDALS AND DECELERATOR	265 HRS FIT TWO WAY EXTENSION SPEAKERS TO UHF RADIO, MOUNT TO SIDE OF RADIO BRACKET	04/26/2022
DZRO0015	WO-GTP-115-345	PRE OPERATION FIT OUT	PRE OPERATION FIT OUT	151 HRS Fabricate cover plate for dozer as per drawings	04/16/2022