

Operational Asset	Number	Description	Work Plan	Work Done	Completed
DZR00016	WO-GTP-178-014	CLEAN OUT COOLERS	CLEAN OUT COOLERS	LOOSEN INTER COOLER AND PULLBACK TO GAIN ACCESS TO COOLERS , USE COMPRESSED AIR TO CLEAN OUT COOLERS .	07/24/2025
DZR00016	WO-GTP-177-623	TRACK SLACK REQUIRES ADJUSTMENT	TRACK SLACK REQUIRES ADJUSTMENT	REMOVED PRODUCT AND OPENED TRACK ADJUSTMENT PLATE, PLACED TRACK LEVEL STRING LINE AND PUMPED GRASE INTO TRACK ADJUSTER. PUMPED UP TO SPEC AND CLOSED UP PLATE AND REPEATED ON OPERSITE SIDE.	07/16/2025
DZR00016	WO-GTP-176-933	Smoke Bomb Cab	Smoke bomb cab and reseal if required.		
DZR00016	WO-GTP-176-580	R/H TRACK WON'T DRIVE - FINAL DRIVE FAILURE	R/H TRACK WON'T DRIVE - FINAL DRIVE FAILURE - INNER SUN GEAR STRIPPED AND INNER PLANETARY U/S	PUSHED TRACK PIN AND DROPPED TRACK .REMOVED OLD FINAL , CLEANED UP FACES AND TAP HOLES AND REPLACED ALL SEALS AND INSTALLED INTO DZR16 TENSIONED ALL MOUNTING BOLTS , TENSION SEGMENTS. REATTACHED TRACKS FILLED FINAL DRIVE OIL AND CHECKED OPERATION.	06/25/2025
DZR00016	WO-GTP-176-482	COOLANT LEAK	DIAGNOSE AND REPAIR	REPLACED BLOWN COOLANT HOSE AND REFILLED COOLENT TO CORRECT LEVEL RUN UP AND TESTED MACHINE ALL OK HOURS 10491	06/24/2025
DZR00016	WO-GTP-175-893	OPERATORS REPORT MACHINE OVERHEATING	OPERATORS REPORT MACHINE OVERHEATING	UNBOLT INTERCOOLERS AND HYD COOLER AND BLOW OUT RADIATOR - RAD WAS VERY BLOCKED BETWEEN COOLERS, SEND BACK TO WORK	06/13/2025
DZR00016	WO-GTP-175-775	Fire Suppression Service	Service Fire Suppression System - MITCHELL AND BROWN TO COMPLETE	FIRE SUPPRESSION SERVICE COMPLETED BY MITCHELL AND BROWN - REPORT ATTACHED	06/20/2025
DZR00016	WO-GTP-175-647	BLADE SKIN	BLADE SKIN BRUCE ROCK ENGINEERING	BLADE SKIN BRUCE ROCK ENGINEERING	06/10/2025
DZR00016	WO-GTP-174-854	MACHINE OVER HEATING	MACHINE OVER HEATING	10,230HR CHECK MACHINE OVERHEATING, SUSPECT MACHINE IS NOT ACTUALLY OVERHEATING. FOUND GREEN DEATH IN ECU PLUG. CLEAN OUT PLUG AND TERMINALS, RE ASSEMBLE ECU. CLEAN OUT COOLER PACK AND PUT MACHINEN TO WORK. MACHINE ENGINE TEMP OVERHEATING AFTER HALF A SHIFT CHECKED FOR LEAKS AND ALL FLUID LEVELS CLEANED OUT COOLERS AND REPLACED DIRTY AIRFILTERS STALLED OUT MACHINE TO OPERATING TEMP TO CHECK OPERATION OF THERMOSTATS SEEM TO BE WORKING AT 92 DEGREES SENT MACHINE TO WORK FOR TESTING 10256 HOURS	05/28/2025
DZR00016	WO-GTP-174-685	Fire Equipment Service - Site	Inspect, test and tag fire equipment - Midwest Fire	COMPLETED BY MITCHELL AND BROWN REFER TO INVOICE 121199	06/30/2025
DZR00016	WO-GTP-174-409	ACCESS LADDER WONT RELEASE	ACCESS LADDER WONT RELEASE	10,196HR REMOVE COVERS,FOUND SNAPPED PIVOT STUD FOR LINKAGE. REMOVE PINS, DRILL AND TAP HOLE INTO PIVOT ARM, INSTALL NEW STUD AND CUT TO LENGTH. REFIT TO MACHINE, LUBRICATE PINS AND TEST - OK. REFIT COVERS	05/21/2025

DZR00016	WO-GTP-174-217	MACHGINE LOW ON POWER	REPLACE FUEL FILTERS	10,182HR CHECK ENGINE PARAMETERS ON ET, COMPARE TO DZR15. CARRY OUT STALL TESTS, CHECK TRANSMISSION AND TORQUE CONVERTER PRESSURES - OK. ADJUST STEERING CLUTCH PRESSURES TO SPEC. ORDER REPLACEMENT FUEL FILTERS 21/5/25 PICK UP FILTERS FROM WESTRAC, FIT TO MACHINE. 22/5/25 REMOVE DPF FILTERS FROM MACHINE AND WASH OUT, BLOW OUT WITH COMPRESSED AIR AND REFIT TO DOZER. RUN UP. COOLER PACKS FOUND TO BE BLOCKED , REMOVED INTERCOOLERS TO BLOW OUT COOLERS ,REFIT EVERYTHING RESOLVING FAULT	06/09/2025
DZR00016	WO-GTP-174-072	R/H INNER CARRIER BOLTS SNAPPED	R/H INNER CARRIER BOLTS SNAPPED	CLEAN DOWN TRACK FRAME, USE HI TORQUE TO REMOVE R/H INNER CARRIER ROLLER MOUNT . REMOVE 2X SNAPPED BOLTS IN TRACK FRAME. INSTALL CARRIER ROLLER MOUNT AND TORQUE BOLTS. HRS 10160	05/16/2025
DZR00016	WO-GTP-173-240	MISSING BOLT FROM R/H SPROCKET	MISSING BOLT FROM R/H SPROCKET	10,196HR DRIVE SEGMENTS AND BOLTS REPLACED AS PER WO-GTP-169-264	05/22/2025
DZR00016	WO-GTP-173-052	L/H INNER CARRIER ROLLER MOUNT U/S	L/H INNER CARRIER ROLLER MOUNT U/S	9985HR CLEAN DOWN TRACK FRAME, USE HI TORQUE TO REMOVE L/H INNER CARRIER ROLLER MOUNT THAT WAS SNAPPED IN 2. REMOVE 3X SNAPPED BOLTS IN TRACK FRAME. INSTALL NEW CARRIER ROLLER MOUNT AND TORQUE BOLTS.	04/27/2025
DZR00016	WO-GTP-172-881F.1	CARRY OUT VALVE SET D Service - Dozer	CARRY OUT VALVE SET FROM WO-GTP-172-881 D Service - Dozer	10,126HR FILL OUT JHA, REMOVE ENGINE BAY COVERS, CARRY OUT INJECTOR AND VALVE ADJUSTMENT AS PER CAT SPECS. REFIT COVERS AND RUN UP - CHECK FOR LEAKS - ALL GOOD.	05/13/2025
DZR00016	WO-GTP-172-881	D Service - Dozer	Service as per attached Service Sheet	CARRY OUT D SERVICE AS PER MANUFACTURES SPECS AS AT 02.05.25 VALVE SET NOT COMPLETED - Follow up work order created for valve set	04/26/2025
DZR00016	WO-GTP-172-819	RUB THROUGH FAN CONTROL HOSE	RUB THROUGH FAN CONTROL HOSE	DROPPED BELLY GUARDS AND CAB FLOOR REMOVED HOSE CLAMPS AND ENDS OF HOSE PULLED CLEAR. REPLACED AND RAN BACK THROUGH HOSE CLAMPS AND SEALED AND TENSION ENDS. STARTED AND CHECKED FOR LEAKS. LIFTED BELLY GUARDS AND TENSIONED NUTS AND BOLTS RE FIT CAB FLOOR AND SENT BACK TO WORK. HRS 9945	04/21/2025

DZR00016	WO-GTP-172-647	OVERHEATING - COOLER PACK BLOCKED	OVERHEATING - COOLER PACK BLOCKED	OPERATORS REPORT OVERHEATING AND LOW POWER - CHECK OVER - COOLER PACK BLOCKED AND NEEDS BLOWING OUT BLEW OUT AND CLEANED COOLER PACKS	04/17/2025
DZR00016	WO-GTP-172-381	Dozer 3rd Party Assessment of Track and Undercarriage	3rd Party Assessment of Track and Undercarriage	TRACK INSPECTION CONDUCTED BY WESTRAC	04/10/2025
DZR00016	WO-GTP-172-298	FUEL COVER LID BROKEN	FUEL COVER LID BROKEN	RE MOVED OLD HINGE AND REPLACED WITH NEW HINGE AND BOLTS MOUNTED TO FUEL MOUNT AND TESTED LID AND LATCH WAS WORKING CORRECTLY . HRS 9779	04/08/2025
DZR00016	WO-GTP-171-833	COOLANT LEAK	COOLANT LEAK	FOUND COOLANT LOW ON PRE START, LOOK OVER MACHINE, FOUND BOTTOM RADIATOR HOSE BETWEEN THE 2 COOLERS IS LEAKING. ORDERED PARTS ON 31/3/25	
DZR00016	WO-GTP-171-443	CARRIER ROLLER BRACKETS BROKEN	CARRIER ROLLER BRACKETS BROKEN	RHS CARRIER ROLLER MOUNTS BROKEN, CARRIER ROLLER BROKEN OFF AND SITTING ON TRACK FRAME. LOOSEN TRACK, SUPPORT TRACK WITH FORKLIGHT AND REMOVE CARRIER ROLLER. NEED TOOLING TO REMOVE CARRIER ROLLER FROM BROKEN BRACKETS. SETUP TRACK AS NON CARRIER ARRANGEMENT FOR TIME BEING. LHS OUTER BRACKET BROKEN, REMOVE PLATE, 2 X BROKEN BOLTS VERY STUBBORN, REMOVE AND REPLACE BOLTS. NEED TO TAP 1 THREAD. REPAIR THREADS AND REPLACE BRACKETS	03/28/2025
DZR00016	WO-GTP-171-185	REPLACE LEFT HEADLIGHT MOUNTS	REPLACE LEFT HEADLIGHT MOUNTS	9514HR REPLACED 4X MOUNT RUBBERS FOR L/H HEADLIGHT	03/18/2025
DZR00016	WO-GTP-171-146	B Service - Dozer	Service as per attached Service Sheet	10573hrs COMPLETED AS PER CAT PROCEDURE SAMPLED OIL AND FILTERS CHANGED CAT SERVICE KIT	07/12/2025
DZR00016	WO-GTP-171-145	A Service - Dozer	Service as per attached Service Sheet	DZR00016WO-GTP-172-881D Service - Dozer12.00CARRY OUT D SERVICE AS PER MANUFACTURES SPECS AS AT 02.05.25 VALVE SET NOT COMPLETED - Follow up work order created for valve set26/04/2025 DZR00016WO-GTP-172-881F.1CARRY OUT VALVE SET D Service - Dozer12.0010,126HR FILL OUT JHA, REMOVE ENGINE BAY COVERS, CARRY OUT INJECTOR AND VALVE ADJUSTMENT AS PER CAT SPECS. REFIT COVERS AND RUN UP - CHECK FOR LEAKS - ALL GOOD.13/05/2025	03/02/2025
DZR00016	WO-GTP-170-873	NO FORWARD 2ND GEAR	NO FORWARD 2ND GEAR	USING E T FOUND THAT FORWARD 2ND GEAR WAS LOCKED OUT CHECKING ALL STATUS'S WERE GOOD AND NO FAULT CODES WERE ACTIVE , CHANGED FROM 1 FORWARD AND 2 REVERSE ONLY TO 2 FORWARD AND 2 REVERSE AND TESTED SYSTEM HRS 9429	03/11/2025

DZR00016	WO-GTP-170-872	CLEAN OUT COOLER PACKS	CLEAN OUT COOLER PACKS	REMOVED HEAT EXCHANGER MOUNTING BOLTS AND PULL BACK TO ACCESS COOLER PACKS , USING AIR WANDS CLEAN OUT DEBRIS FROM CORES AND DEGREASE AND WASH OUT ONCE FINISHED. RE INSTALLED MOUNTING BOLT AND DOORS, RAN UP DZR16 AND CYCLED FAN THROUGH. OPERATED CORRECTLY SENT BACK TO WORK. HRS 9429 9,348HR	03/11/2025
DZR00016	WO-GTP-170-407	CLEAN OUT COOLER PACKS	CLEAN OUT COOLER PACKS	CLEAN OUT COOLER PACKS WITH COMPRESSED AIR	03/02/2025
DZR00016	WO-GTP-170-136	Dozer Track Assembly Replacement	Track Assembly Replacement	DZR00016WO-GTP-164-486REPLACE TRACKS AND UNDERCARRIAGE90.009,090HRS WESTRAC TECHNICIANS ASSISTING WITH WORKS 6/1 - JACK MACHINE, CUT TRACKS, REMOVE OLD ROLLERS, IDLERS, CARRIER ROLLER, TRACK GUIDES. INSTALL NEW ROLLERS, IDLERS, GUIDES, HARDWARE, TORQUE ...25/02/2025	11/22/2024
DZR00016	WO-GTP-169-623	COMP PLATE REPAIRS	REPAIR COMP PLATES	REMOVE RUST GOUGE OUT CRACKS ON 2 PLATES FULL DOUBLE V PREP ON 2 PLATES PRE HEAT AND WELD GRIND FLAT REDRILL HOLES	02/16/2025
DZR00016	WO-GTP-169-436	CLEAN COOLER PACKS	CLEAN COOLER PACKS	CLEANED AFTER COOLERS THEN REMOVED MOUNTING BOLTS AND CLEANED COOLER PACKS WITH COMPRESSED AIR, LOOSNING AND CHIPPING AWAY AT BUILT UP PRODUCT. HRS 9126 10,196HR	02/11/2025
DZR00016	WO-GTP-169-264	SPROCKET & HARDWARE	SPROCKET & HARDWARE SUPPLIED BY WESTRAC	REPLACE ALL DRIVE SEGMENTS, NUTS AND BOLTS. ADJUST TRACK TENSION TO SPEC.	05/22/2025
DZR00016	WO-GTP-169-242	C Service - Dozer	Service as per attached Service Sheet	9090HRS COMPLETED SERVICE AS PER CAT SPEC SAMPLES AND OILS CHANGED FILTERS CHANGED SEAL CHANGED INSPECTION COMPLETED OPERATIONAL CHECKS COMPLETED	02/07/2025
DZR00016	WO-GTP-169-111	REPLACE HYDRAULIC HOSES FROM FRONT GRILL TO BACK OF BLADE	REPLACE HYDRAULIC HOSES FROM FRONT GRILL TO BACK OF BLADE		
DZR00016	WO-GTP-168-920	BLOWN COOLANT HOSE	BLOWN COOLANT HOSE	9032HR DOZER HAS BLOWN TOP COOLANT HOSE ON RADIATOR. WRITE UP JHA, DRAIN COOLANT, REPLACE BLOWN HOSE WITH SPARE. REFILL COOLANT AND RUN UP. CHECK FOR LEAKS - RETURN TO MACHINE TO WORK. PACK UP TOOLING	01/30/2025
DZR00016	WO-GTP-168-918	TENSION R/H TRACK	TENSION R/H TRACK	9032HR R/H TRACK SKIPPING UNDER LOAD, TENSION TRACK	01/30/2025
DZR00016	WO-GTP-168-917	GROUSER PLATE ABOUT TO FALL OFF	GROUSER PLATE ABOUT TO FALL OFF	9032HR OXY CUT BROKEN BOLTS FROM TRACK, REPLACE BOLTS WITH BOLTS FROM NEW TRACKS.	01/30/2025
DZR00016	WO-GTP-168-715	NEW SUPPRESSION CYLINDER AND INSTALL	NEW SUPPRESSION CYLINDER AND INSTALL	WORK TO BE DONE BY MITCHELL AND BROWN	01/28/2025

DZR00016	WO-GTP-168-507	BLOWN LHS UPPER LIFT CYLINDER HOSE	BLOWN LHS UPPER LIFT CYLINDER HOSE	21/1 - 8920 HRS - UPPER LHS LIFT CYLINDER HOSE BLOWN. REMOVE LIGHT ENCLOSURES, REMOVE OLD HOSES, REPLACE ALL 4 UPPER LIFT CYLINDER HOSES FOR LHS AND RHS CYLINDERS AS OTHERS HAD SOME RUB AND WEAR MARKS. REPLACE ALL SEALS, REINSTALL HOSES, COVERS AND WORKLIGHT BRACKETS. TEST OPERATION, WASH MACHINE.	01/21/2025
DZR00016	WO-GTP-168-409	FAB HYDRAULIC PIPE	REPLACE RUSTED OUT STEEL HYD PIPE	FABRICATED NEW PIPE	01/19/2025
DZR00016	WO-GTP-168-316	REPLACE CUTTING EDGE	REPLACE CUTTING EDGE	9418 HRS - REMOVE OLD CUTTING EDGES, CLEAN UP MATING SURFACES, INSTALL NEW CUTTING EDGES AND CORNER TEETH WITH NEW HARDWARE, TORQUE TO 1700 FT LB.	03/09/2025
DZR00016	WO-GTP-168-312	REPLACE L/H AFFB BOTTLE	REPLACE L/H AFFB BOTTLE	8872HRS COMPLETE JHA, ASSIST M&B FIRE WITH BOTTLE CHANGE OUT AND RE CHARGING SYSTEM. PUT MACHINE BACK TO WORK.	01/15/2025
DZR00016	WO-GTP-168-173	FUEL FILTER RESTRICTION CODES	FUEL FILTER RESTRICTION CODES	REPLACE PRIMARY AND SECONDARY FUEL FILTERS DUE TO FUEL FILTER RESTRICTION CODES.	01/13/2025
DZR00016	WO-GTP-168-155	WORK LIGHTS U/S	REPLACE WORK LIGHTS	REPAIR VARIOUS BROKEN WIRING AND REPLACE U/S WORKLIGHTS WITH MINE SPEC BLACKTIPS. TEST OP - ALL OK	01/14/2025
DZR00016	WO-GTP-168-080	LOW FIRE SUPPRESSION ALARM	LOW FIRE SUPPRESSION ALARM	TOPPED UP WITH NITROGEN AND CHECKED FOR LEAKS NONE FOUND SENT DZR16 BACK TO WORK.	01/09/2025
DZR00016	WO-GTP-167-931	SEAT BELT ALARM GOING OFF	SEAT BELT ALARM GOING OFF	INSPECT SEAT BELT HARNESS. SLIGHT PINCH, NO DAMAGE TO INTERNAL WIRING. REMOVE PLUG AND CLEAN OUT, SEAL AND LOCK CLIP MISSING, REINSTALL. TEST SEAT BELT LATCH, CHECK STATUS IN ADVISOR SCREEN AND TRY TO GET TO FAULT. MOVE HARNESS AND WIGGLE SEAT BELT CLIP REPEATEDLY, CANT FAULT. 13/1 - FIND INTERNAL BREAK IN HARNESS AT REAR OF CAB, RUN JUMPER WIRE TO SEAT PLUG. CHECK OPERATION, ALL OK	01/13/2025
DZR00016	WO-GTP-167-910	R/H SIDE GROUSERS LOOSE	R/H SIDE GROUSERS LOOSE	8,799HR MULTIPLE GROUSERS LOOSE, TIGHTEN WHAT BOLTS WERE LEFT. TRACKS WILL NEED REPLACING SOON.	01/06/2025
DZR00016	WO-GTP-167-874	L/H FRONT WORK LIGHT U/S	L/H FRONT WORK LIGHT U/S	8,787HR REPLACE BROKEN MOUNT ON L/H FRONT RAM LIGHT	01/05/2025
DZR00016	WO-GTP-167-869	GROUSER PLATES LOOSE	GROUSER PLATES LOOSE	8,787HR CUT OUT BROKEN BOLTS FROM LOOSE GROUSERS, TIGHTEN WITH 1/2 INCH RATTLE GUN	01/05/2025
DZR00016	WO-GTP-167-213	R/H TILT CYLINDER PIPE U/S	R/H TILT CYLINDER PIPE U/S	8630HRS INSPECT OIL LEAK, FOUND R/H TILT CYLINDER PIPE HAS RUSTED OUT. REPLACE PIPE AND TEST - ALL GOOD.	12/19/2024
DZR00016	WO-GTP-166-979	LIFT CYLINDER LINKAGE/PINS EXTREMELY WORN	REPLACE LINKS AND PINS	REMOVE OLD KNUCKLES AND PINS. CLEAN UP BORES, WEAR IN BLADE BOSS BORES. BUSHES IN LIFT CYLINDERS WORN NEED REPLACING - HAVE BEEN ORDERED. FIT NEW KNUCKLES, PINS AND LOCK PLATES.	

DZR00016	WO-GTP-166-450	B Service - Dozer	Service as per attached Service Sheet	8562HRS CARR OUT B SERVICE AS PER MANUFACTURES SPCS ADJUST TRACK TENSION	12/08/2024
DZR00016	WO-GTP-166-158	REPLACE 2X SNAPPED GROUSER BOLTS ON R/H SIDE TRACK	REPLACE 2X SNAPPED GROUSER BOLTS ON R/H SIDE TRACK	8,404HRS CUT OUT AND REPLACE 2 X SNAPPED GROUSER PLATE BOLTS ON R/H SIDE TRACK	11/26/2024
DZR00016	WO-GTP-166-113	ADJUST TRACK TENSION	ADJUST TRACK TENSION	8,404HR ADJUST TRACK TENSION TO SPEC	11/25/2024
DZR00016	WO-GTP-166-075	Fire Suppression Service	Service Fire Suppression System - Contractor to Complete	WORK COMPELTED BY MITCHELL AND BROWN	12/31/2024
DZR00016	WO-GTP-165-775	A Service - Dozer	Service as per attached Service Sheet	8865HRS CARRY OUT A SERVICE	01/13/2025
DZR00016	WO-GTP-165-721	Fire Equipment Service - Site	Inspect, test and tag fire equipment - Midwest Fire	WORKS COMPLETED BY MITCHELL AND BROWN	12/31/2024
DZR00016	WO-GTP-165-024	REPLACED FAILED WORKLIGHT	REPLACE FAILED WORKLIGHT	8249HRS REPLACED R/H INSIDE WORKLIGHT ON FRONT RAM WITH SPARE FROM WORKSHOP	11/08/2024
DZR00016	WO-GTP-165-023	ADJUST TRACKS	ADJUST TRACKS	8249HR ADJUST TRACK TENSION TO MANUFACTURES SPEC	11/08/2024
DZR00016	WO-GTP-165-022	CLEAN OUT COOLER PACK	CLEAN OUT COOLER PACK	8249HRS REMOVE INTERCOOLERS AND HYDRAULIC COOLER FROM MACHINE, USE COMPRESSED AIR TO CLEAN DIRT BUILD UP FROM COOLER PACK, REFIT INTERCOOLERS AND HYDRAULIC COOLER. RUN UP AND CHECK - ALL GOOD	11/08/2024
DZR00016	WO-GTP-164-964	TIGHTEN LOOSE GROUSER BOLTS AND REPLACED SNAPPED BOLTS	TIGHTEN LOOSE GROUSER BOLTS AND REPLACED SNAPPED BOLTS	8220HR COLLECT HI TORQUE FROM JMH. TIGHTEN 9 LOOSE GROUSER BOLTS, REPLACE ONE SNAPPED BOLT. RETURN HI TORQUE TO JMH	11/06/2024
DZR00016	WO-GTP-164-846	WORKLIGHT BROKEN OFF	WORKLIGHT BROKEN OFF	WORKLIGHT BROKEN MOUNT AND RIPPED HARNESS OUT OF BACK OF LIGHT. REPLACE LIGHT WITH SPARE FROM YARD AND UPGRADE TO HEAVY DUTY MOUNT.	11/05/2024
DZR00016	WO-GTP-164-751	BROKEN LHS GROUSER BOLTS	BROKEN LHS GROUSER BOLTS	8220 HRS BROKEN GROUSER BOLTS IDENTIFIED BY OPERATORS. DO JHA AND HOT WORK PERMIT, CUT OUT BROKEN BOLTS, INSTALL REPLACEMENT BOLTS. TIGHTEN WITH INCH RATTLE GUN.	11/02/2024
DZR00016	WO-GTP-164-618	FAILED LHS REAR IDLER ROLLER	FAILED LHS REAR IDLER ROLLER	8179 HR LHS REAR IDLER ROLLER FAILED BEARING, CHECKED MACHINE AFTER 1 HOUR SITTING AND IDLER STILL 300 DEG C. HIRE TOOLING FROM JMH. SPLIT TRACK, REPLACE IDLER WITH USED SPARE. RE-CONNECT TRACK, INSTALL GROUSERS. PACK / CLEAN UP AREA AND TOOLING.	11/01/2024
DZR00016	WO-GTP-164-515	REPAIR R/H DRAFT ARM GRAB RAIL	REPAIR R/H DRAFT ARM GRAB RAIL	8130HR REMOVE REMAINS OF HAND RAIL FROM DRAFT ARM, PRESS STRAIGHT AND WELD 1 1/2 INCH ROD TO BASE PLATE, PAINT IN CAT YELLOW. REFIT TO MACHINE.	11/06/2024

DZR00016	WO-GTP-164-494	add ELC coolant at 2%	add ELC coolant at 2%	8220HR ADD ELC AS PER SPEC	11/06/2024
DZR00016	WO-GTP-164-486	REPLACE TRACKS AND UNDERCARRIAGE	REPLACE TRACKS AND UNDERCARRIAGE	9,090HRS WESTRAC TECHNICIANS ASSISTING WITH WORKS 6/1 - JACK MACHINE, CUT TRACKS, REMOVE OLD ROLLERS, IDLERS, CARRIER ROLLER, TRACK GUIDES. INSTALL NEW ROLLERS, IDLERS, GUIDES, HARDWARE, TORQUE TO SPEC. INSTALL NEW TRACKS, CONNECT WITH NEW PINS/SEALS. LOWER DOZER, SET TRACK TENSION, TEST OP - ALL OK NOTE: TRACK CANNONS LEAKING FROM SEAL, MOVEMENT IN SOME MAJOR BOGIE PINS, FINAL DRIVE DUOS LEAKING SLIGHTLY. SPROCKETS NEED REPLACING PARTS ORDERED ON ANOTHER JOB. FIT NEW INNER RHS IDLER CAP DUE TO CORROSION ON OLD CAP. TORQUE 2220 FT LB	02/25/2025
DZR00016	WO-GTP-164-432	L/H PIVOT SHAFT OIL LEAK	L/H PIVOT SHAFT OIL LEAK	8114HRS REMOVE SEAL GUARD, HOSE DOWN SIDE OF MACHINE AND SEAL AREA. SEAL TORN BADLY AT TOP OF SEAL. BRAKE CLEAN DOWN, INJECT GREASE INTO PIVOT SHAFT, BUILD UP LAYERS OF SIKAFLEX AROUND DAMAGED PART OF SEAL. FILL COMPARTMENT WITH MOREYS. REFIT GUARD AND REPLACE CORRODED BOLTS. - SYSTEM STILL LEAKING. SUSPECT PIVOT SHAFT WORN	11/08/2024
DZR00016	WO-GTP-164-374	DE SHIM DRAFT ARMS	DE SHIM DRAFT ARMS	COMPLETED JHA , PLACED JACK STAND UNDER R/H DRAFT ARM AND USING HI TORQUE WE REMOVED DRAFT ARM NUTS AND BOLTS , LIFTING CAP WITH FORK LIFT WE REMOVED DRAFT ARM CAP AND CLEANED ALL SURFACE'S AND BOLTS , APPLYING ANTI SIZIE. REMOVING SHIM PACK AND REPLACING CAP WITH FORK LIFT RE TENSIONING BOLTS WITH RATTLE THEN HI TORQUE TO SPEC 4800 PSI THEN REPEAT ON L/H DRAFT ARM. HRS 8114	10/24/2024
DZR00016	WO-GTP-164-365	REPLACE MULTIPLE RUBBED AND HARD HOSES	REPLACE MULTIPLE RUBBED AND HARD HOSES	21/1 - REPLACE LIFT AND FAN HOSES IN FRONT RADIATOR COMPARTMENT. REPLACE DAMAGED GROMMETS AND RE-ORIENTATE HOSES TO PREVENT RUBBING. 8920 HRS	01/21/2025
DZR00016	WO-GTP-164-327	LOOSE GROUSER BOLTS	LOOSE GROUSER BOLTS	REMOVED KET AND NEEDLE GUN AROUND BOLT HEAD USE HIGH TORQUED BOLTS TO TENSION TO SPEC AND START MACHINE AND ROTATE TRACK TO NEXT LOOSE BOLTS POSITIOIN AND REPEAT . HRS 8119	10/23/2024

DZR00016	WO-GTP-164-325	TRANSMISSION HOSE REPLACEMENT	TRANSMISSION HOSE REPLACEMENT	CONDUCT JHA .REMOVED SIDE PANELS AND HOSE CLAMPS , REMOVE CAB FLOOR PANELS AND BOLTS , REMOVE CHARGE AIR PIPE FOR ACCESS . REMOVE OLD HOSE AND CHANGED OUT WITH NEW HOSE RESEAL WITH HIGH TEMP O RINGS AND CLAMP AND ROTATE INTO POSTION. TENSION AND RE INSTALL CLAMPS AND AND LINES. START MACHINE AND RE FILL TRANS OIL AND CHECK FOR LEAKS NONE FOUND SO WASHED OUT ENGINE BAY RE FIT SIDE PANELS AND DOORS ,FLOOR PANELS AND MAT . HRS 8119	10/23/2024
DZR00016	WO-GTP-164-323	REMOVE BELLY GUARD	REMOVE BELLY GUARD	CONDUCT JHA ,REMOVED AND LOWERED BELLY GUARD READY FOR WORK . HOSE OUT BUILT UP PRODUCT FROM UNDER ENGINE AND CHASSIS RAILS. RASIE AND SECURE BELLY GUARD AFTER JOBS COMPLETE. HRS 8114	10/23/2024
DZR00016	WO-GTP-163-848	REPLACE RADIATOR CAP	REPLACE RADIATOR CAP DUE TO CRACKED RUBBER SEAL	REPLACED WITH NEW	10/18/2024
DZR00016	WO-GTP-163-846	BROKEN AND LOOSE GROUSER BOLTS	BROKEN AND LOOSE GROUSER BOLTS	RENT HI TORQUE FROM JMH. INSPECT AND MARK LOOSE / BROKEN BOLTS ON TRACKS. 2 BROKEN BOLTS 1 LHS 1 RHS. DO JHA AND HOT WORK. CUT OUT BROKEN BOLTS. CLEAN UP GROUSER AND INSTALL SPARES. INSPECT LOOSE BOLTS, 4 LHS 3 RHS TRACKS. TIGHTEN AS PER SPEC. 8022 HRS	10/15/2024
DZR00016	WO-GTP-163-702	ADJUST TRACK TENSION	ADJUST TRACK TENSION	8000HR ADJUST TRACK TENSION TO SPEC	10/12/2024
DZR00016	WO-GTP-163-701	BLOW OUT COOLER PACK	BLOW OUT COOLER PACK	8000HRS BLOW OUT COOLER PACKS WITH COMPRESSED AIR	10/12/2024
DZR00016	WO-GTP-163-343	D Service - Dozer	Service as per attached Service Sheet	8021HRS CARRY OUT 2000HR SERICE AS PER MANUFACTURES SPEC	10/15/2024
DZR00016	WO-GTP-163-258	TRANSMISSION OIL LEAK	TRANSMISSION OIL LEAK FROM HELL HOLE AREA	TRANS PUMP TO FILTER HOUSING HOSE BLISTERED AND WEEPING OIL. FITTED REPLACEMENT MADE BY HOSE X AS WESTRAC EX PERTH. CONVERTER OUTLET TO TRANS COOLERS LEAKING FROM CRIMP, ORDERED BOTH EX PERTH, ONLY RECEIVED LEAKING HOSE, OTHER HOSE PUT INTO SPARE RACK. REMOVE LHS ENGINE GUARDS AND PANELS, RELOCATE HEATER HOSES, REMOVE BOOST PIPE, REMOVE HELL HOLE, FIRE WALL. REMOVE LEAKING HOSE, VERY HARD AND BRITTLE. FIT NEW HIGH TEMP HOSE. REASSEMBLE, RUN UP TEST OP - ALL OK 7956 HRS	10/06/2024

DZR00016	WO-GTP-163-242	REPLACE WORN BLADE STABILIZER BAR TRUNNION BALL	REPLACE WORN BLADE STABILIZER BAR TRUNNION BALL	REMOVED STABILIZER BAR END AND LOWER TO THE GROUND. BOILER MAKER REMOVED OLD TRUNNION BALL CLEANED UP FACE AND ATTACHED NEW TRUNNION BALL , RAN MULTIPLE RUNS AROUND BALL TO SECURE. USING JIB WE LIFTED AND FITTED STABILIZER BAR AND SHIMMED END CAP TO NEW TRUNNION BALL TENSIONED BOLTS AND TESTED BLADE MOVEMENT.	01/01/2025
DZR00016	WO-GTP-163-155	RE-TORQUE LOOSE LHS GROUSER BOLTS	RE-TORQUE LOOSE LHS GROUSER BOLTS	PICKUP HI-TORQUE, RE-TORQUE LOOSE GROUSER BOLTS LHS TRACK, ALOT OF BOLTS LOOSE, ENDED UP RE-TORQUING 80% OF TRACK AS KEPT FINDING LOOSE BOLTS. BOLT HEADS WORN DOWN, HI-TORQUE NOT MOUNTING SQUARE, WILL NEED TO ORDER MORE REPLACEMENTS FOR FUTURE.	10/01/2024
DZR00016	WO-GTP-163-129	REPLACE SNAPPED GROUSER BOLTS RHS TRACK	LOOSE GROUSERS/ SNAPPED BOLTS	SETUP JSA AND HOT WORK PERMIT. CUT OUT BROKEN BOLTS AND REPLACE WITH SPARES. TORQUE 1100FT LB + 120 DEG.	10/02/2024
DZR00016	WO-GTP-163-080	REPLACE SNAPPED GROUSER BOLTS ON R/H SIDE TRACK	REPLACE SNAPPED GROUSER BOLTS ON R/H SIDE TRACK	7,918HR COMPLETE JHA, OXY CUT OUT BROKEN BOLT. CLEAN UP GROUSER FACE AND INSTALL NEW BOLTS. GROUSER PLATE IS IN VERY BAD CONDITION.	10/01/2024
DZR00016	WO-GTP-163-047	REPLACE MISSING STABILISER BOLT	REPLACE MISSING STABILISER BOLT	7,918HRS SOURCE NEW BOLTS AND REPLACE IN STABILISER BAR	10/01/2024
DZR00016	WO-GTP-162-993	SNAPPED GROUSER BOLT L/H TRACK	SNAPPED GROUSER BOLT L/H TRACK	7891 HR CUT OLD BOLT / NUT OUT WITH OXY, GROUSER FACE WORN BADLY, CLEAN UP WITH GRINDER AND SMOOTH OUT, FIT SECOND HAND BOLT, DO UP WITH 3/4 RATTLE GUN, RECHECK NEXT MORNING- STILL TIGHT	09/28/2024
DZR00016	WO-GTP-162-914	LOOSE GROUSER BOLTS	LOOSE GROUSER BOLTS	7872 HR CLEANED UP AND AROUND 6 LOOSE BOLTS AND UNDER BOLT HEADS AND RE TORQUED BOLTS ON LH TRACK. RH TRACK WAS MISSING A BOLT HEAD SO HAD TO REMOVE THE REST OF THE BOLT WITH OXY AND CLEAN SURFACE UP AND INSTALL NEW BOLT AND TORQUE WITH HI TORQUE	09/25/2024
DZR00016	WO-GTP-162-675	A/C NOT WORKING	A/C NOT WORKING	BREAK DOWN A/C NOT WORKING FOUND A BLOWN FUSE REPLACED AND CHECKED A/C WAS OPERATING CORRECTLY .	09/21/2024
DZR00016	WO-GTP-162-654	A Service - Dozer	Service as per attached Service Sheet	7834HRS COMPELTE A SERVICE	09/24/2024
DZR00016	WO-GTP-162-513	LOOSE GROUSER BOLTS IN L/H TRACK	LOOSE GROUSER BOLTS IN L/H TRACK	7783 HR TIGHTEN LOOSE GROUSER BOLTS WITH 1 INCH RATTLE GUN	09/17/2024
DZR00016	WO-GTP-161-314	LHS TILT CYLINDER BEARING FAILED	LHS TILT CYLINDER BEARING FAILED	REPAIRED BY WESTRAC DURING DZR15 UNDERCARRIAGE REBUILD	09/17/2024
DZR00016	WO-GTP-161-240	REPLACE GOANNAS	REPLACE GOANNAS	10/3 - BOILY CUT OFF SEIZED OLD GOANNAS, CLEAN UP MOUNT SURFACES, INSTALL NEW GOANNAS WITH NEW HARDWARE.	03/10/2025
DZR00016	WO-GTP-161-093	MISSING DIESEL FAST FILL CAP	MISSING DIESEL FAST FILL CAP	REPLACED FAST FILL CAP	10/01/2024

DZR00016	WO-GTP-160-558	OIL LEAK FROM LHS TILT CYLINDER	OIL LEAK FROM LHS TILT CYLINDER	CORRODED STEEL PIPE ON LHS TILT CYLINDER LEAKING. REMOVE PIPE, FIND SPARE PREVIOUSLY REPAIRED OUT AT TRANSPORT YARD. GIVE FAILED PIPE TO BOILYS TO REPAIR. FIT REPLACEMENT PIPE AND REPLACE SEALS. TEST - OK. 7437 hrs	08/11/2024
DZR00016	WO-GTP-160-545	EXCESSIVE DECELL PEDAL MOUNT MOVEMENT	EXCESSIVE DECELL PEDAL MOUNT MOVEMENT	REMOVED FOOT PLATE AND MOUNT PLATE ADJUSTED DECELL PEDAL TO CORRECT POSITION AND TENSIONED AND TESTED OPERATION WAS CORRECT . RE TENSIONED MOUNT PLATE. HRS 7445	08/10/2024
DZR00016	WO-GTP-160-511	FUEL FILTER PLUGGED CODES	FUEL FILTER PLUGGED CODES	FUEL FILTER PLUGGED CODES COMING UP DURING OPERATION. REPLACE FUEL WATER SEP AND BOTH SECONDARY FUEL FILTERS. FIND CHUNK OF FOAM IN FUEL WATER SEP, LOOKS TO BE FROM FUEL TANK BREATHER, CLEAN OUT, RE ASSEMBLE AND PRIME, ALL OK.	08/09/2024
DZR00016	WO-GTP-160-468	B Service - Dozer	Service as per attached Service Sheet	7554HRS CARRY OUT B-SERVICE - SAMPLE ALL COMPARTMENTS CHANGE ENG, HYD, CAB, FUEL AND AIR FILTERS CHANGE ENG AND FINAL DRIVE OILS CLEAN AND REPLACE FUEL, TRANS, AND PIVOT SHAFT BEATHERS.	08/24/2024
DZR00016	WO-GTP-160-409	LOOSE LHS GROUSER BOLTS	LOOSE LHS GROUSER BOLTS	CUT OUT BROKEN BOLT LHS TRACK, CLEAN UP MATE SURFACES. HEAVY CORROSION ON GROUSER TO LINK MATE SURFACE ALSO UNDER BOLT HEAD. INSTALL NEW BOLT AND NUT. 21/09 CLEANED UNDER BOLT HEADS AND RE TORQUE WITH HI TORQUE AND CHECKING FOR MOVEMENT.	08/22/2024
DZR00016	WO-GTP-160-385	FIRE SUPPRESSION BOTTLE MOUNT CRACKED	FIRE SUPPRESSION BOTTLE MOUNT CRACKED	REMOVED AFFF BOTTLE P CLAMPS AND BOTTLE STRAP, LIFTED BOTTLE OUT AND PLACED ON TO COUNTER WEIGHT, REMOVED FRAME AND CLEANED UP AROUND CRACKS AND CHASE CRACKS ,GRIND OUT AND WELD AND FILL , CLEAN UP FACE AND PLACED NEW MOUNTING FRAME AND DRILL OUT NEW MOUNTING HOLES . PRIMED AND TOP COATED AND TENSIONED TO FRAME , LIFTED AND FITTED AFFF FRAME TENSION TO NEW FRAME . LIFTED BOTTLE ONTO FRAME AND TENSIONED CLAMP AND P CLAMPS . HRS 7418	08/08/2024
DZR00016	WO-GTP-160-225	LOOSE GROUSER PLATE BOLTS	TIGHTEN LOOSE GROUSER PLATE BOLTS	7383HRS TIGHTEN 9X LOOSE GROUSER PLATE BOLTS ON L/H TRACK AS BEST AS POSSIBLE WITH RATTLE GUN. WILL NEED RETORQUEING WITH HIGH TORQUE.	08/04/2024
DZR00016	WO-GTP-160-224	ADJUST TRACK TENSION	ADJUST TRACK TENSION	7383HRS ADJUST TRACK TENSION ON LEFT AND RIGHT HAND TRACK	08/04/2024
DZR00016	WO-GTP-160-103	CLEAN COOLER PACK	CLEAN COOLER PACK	CLEANED COOLER PACK WITH HIGH PRESSURE AIR HRS 7343	08/01/2024

DZR00016	WO-GTP-160-048	COOLER FAN FAULT	OPERATOR REPORTED COOLER FAN FAULT	CHECKED FOR BLOCKAGES AND REVERSE CYCLED FAN , PLACED IT ON TO ECM AND CHECKED FOR FAULT CODES AND CALIBRATED FAN . REMOVED FAN SPOOLS CHECKING FOR DAMAGED SEALS AND SPOOL DAMAGE REPLACED, CHECKED BYPASS SPOOLS AND CHECKED FOR DAMAGED SEALS AND SPOOL DAMAGE REPLACED AND TENSIONED. STARTED ENGINE AND CHECKED SYSTEM , GOT THE HYDRULICS HOT AND FAN KICKED IN AND OUT AS IT SHOULD DURING OPERATION. SENT BACK TO WORK. HRS 7333	07/31/2024
DZR00016	WO-GTP-160-020	RHS LIGHT BRACKET BOLTS MISSING	REPLACE MISSING BOLTS	REMOVE SNAPPED BOLTS SOURCE NEW BOLTS AND REPLACE	07/26/2024
DZR00016	WO-GTP-159-795	L/H TRACK HAND RAIL REPAIR	L/H TRACK HAND RAIL REPAIR	REMOVED AND CLEANED METAL MOUNT CUT CYLINDER ROD FOR NEW HANDLE AND PREPPED METAL FOR WELDING, WELDED AND CLEANED PREPPED FOR PAINTING, PAINTED AND DRYED . HRS 7327	07/29/2024
DZR00016	WO-GTP-159-794	A Service - Dozer	Service as per attached Service Sheet	A SERVICE COMPLETED AND ENGINE SAMPLE TAKEN, LH FINAL REQUIRED 10 LITRES OIL TRACKS ADJUSTED INSPECTION COMPLETED. HRS 7327	07/27/2024
DZR00016	WO-GTP-159-458	REPLACE BOLTS ON TRACK CANNON COVER PLATE	REPLACE BOLTS ON TRACK CANNON COVER PLATE	7,256HRS REPLACE 6X RUSTED BOLTS ON TRACK CANNON COVER PLATES	07/21/2024
DZR00016	WO-GTP-159-411	ADJUST TRACKS	ADJUST TRACKS	7,256HRS ADJUST TRACKS TO MANUFACTURES SPECS	07/19/2024
DZR00016	WO-GTP-159-410	CHECK HYDRAULIC HOSE CONDITION IN GRILL AREA	CHECK HYDRAULIC HOSE CONDITION IN GRILL AREA	7,256HR REMOVE GRILL AND FRONT PLATES, HOSE OUT IRON ORE BUILD UP. CHECK HOSE CONDITION AND ROUTING. INSULATE RUB POINTS TO PREVENT FUTURE RUBBING. REFIT GRILL AND PLATES	07/19/2024
DZR00016	WO-GTP-158-942	Fire Suppression Service	Service Fire Suppression System - Contractor to Complete	WORKS COMPLETED BY MITCHELL AND BROWN	06/25/2024
DZR00016	WO-GTP-158-365	LOOSE GROUSER BOLTS LHS TRACK	LOOSE GROUSER BOLTS LHS TRACK	TIGHTEN 2 LOOSE GROUSER BOLTS WITH INCH RATTLE GUN IDENTIFIED BY OPERATOR AT END OF SHIFT. 01/07/24 WENT TO JMH AND GOT THE HI TORQUE, REMOVED ALL FOUR BOLTS AND CLEANED UP FACES OF GROUSER CLEANED BOLTS AND NUTS, DUE TO DAMAGE UNDER BOLT HEAD ON GROUSER FACE CLEANED UP FACE AND HAD TO GRIND DOWN TO GET IT FLAT. RE INSTALLED GROUSER AND HARDWARE TENSIONED BOLTS INSURING NUTS WERE SEATED CORRECTLY CHECKED TENSION AND MARKED GROUSER FOR EASY VISUAL. HRS 7090	07/01/2024

DZR00016	WO-GTP-158-359	COOLANT LEAK RHS UPPER RADIATOR	COOLANT LEAK RHS UPPER RADIATOR	COOLANT BLEED HOSE SPLIT TO UPPER RHS RADIATOR. CUT BACK AND RE ATTACH. TEST OP ALL OK	06/29/2024
DZR00016	WO-GTP-157-864	C Service - Dozer	Service as per attached Service Sheet	WORKS COMPELTED	07/07/2024
DZR00016	WO-GTP-157-836	BROKEN GROUSER BOLTS	BROKEN GROUSER BOLTS	HIRED HI TORQUE FROM JMH , COMPLETED JHA, HOT WORKS PERMIT NEDDLE GUNNED AROUND REMAINING GROUSR BOLTS AND REMOVED WITH HI TORQUE AND BROKEN BOLTS WITH OXY, LIFTED DOWN TRACK GROUSERS AND CLEAN ALL MATING SERVICES. USED NEW HARDWARE AND INSTALL GROUSERS BACK TO BOTH SIDES OF THE TRACK 1500 FTLBS + 90 DEGREES. DE MOB AREA CLEAN AND INSPECTED TOOLING AND RETURNED HI TORQUE TO JMH HRS 6966	06/19/2024
DZR00016	WO-GTP-157-591	CLEAN OUT COOLER PACK	CLEAN OUT COOLER PACK	CLEANED OUT COOLER PACK , REMOVED INTERCOOLER MOUNTING BOLTS MOVED BACK AND FORWARD AND CLEANED OUT WITH HIGH PRESSURE AIR. REMOVED ALL THE BUILD UP PRODUCT AND RE FITTED MOUNTING BOLTS . HRS 6967	06/13/2024
DZR00016	WO-GTP-157-563	Dozer 3rd Party Assessment of Track and Undercarriage	3rd Party Assessment of Track and Undercarriage	8115HRS COMPLETED BY WESTRAC	10/25/2024
DZR00016	WO-GTP-157-562	Smoke Bomb Cab	Smoke bomb cab and reseal if required.	DUE TO SUPPLIER ISSUES THESE WERE UNABLE TO BE COMPLETED - SMOKE MACHINE AQIRED OCTOBER 2024 - GOING FOWARD THESE WILL BE COMPLETED	10/13/2024
DZR00016	WO-GTP-157-211	REPLACE DRIVE SEGMENTS	REPLACE DRIVE SEGMENTS	6862HRS COLLECT TOOLING FROM JMH, COMPLETE JHA. REPLACE DRIVE SEGMENTS ON MACHINE. CHANGE OUT TOOLING FROM JMH AS HI TORQUE WAS FAULTY. ADJUST TRACK TENSION. 06/06/24 RE TORQUED BOLT'S	06/05/2024
DZR00016	WO-GTP-156-941	Fire Equipment Service - Site	Inspect, test and tag fire equipment - Midwest Fire	WORK COMPLETED BY MITCHELL AND BROWN	06/30/2024
DZR00016	WO-GTP-156-495	A Service - Dozer	Service as per attached Service Sheet	6803HRS CARRY OUT 'A' SERVICE AS PER MANUFACTURES SPEC	05/27/2024
DZR00016	WO-GTP-156-303	ADJUST TRACK TENSION	ADJUST TRACK TENSION	6,764HRS ADJUST TRACK TENSION TO MANUFACTURES SPEC	05/22/2024
DZR00016	WO-GTP-156-302	A/C NOT WORKING	A/C NOT WORKING	A/C WAS NOT WORKING . CHECKED FUSE PANEL AND FOUND A BLOWIN FUSE FOR A/C AND REPLACED WITH NEW FUSE AND CHECKED SYSTEM WAS WORKING CORRECTLY.	05/22/2024
DZR00016	WO-GTP-155-779	ADJUST TRACKS	ADJUST TRACKS	6,677HRS ADJUST TRACKS TO MANUFACTURES SPEC	05/13/2024
DZR00016	WO-GTP-155-017	B Service - Dozer	Service as per attached Service Sheet	6552 HR COMPLETE SERVICE AS PER MANUFACTURERS SCHEDULE	05/01/2024

DZR00016	WO-GTP-155-001	REPAIR AUX DRIVE SHAFT GUARD	REPAIR AUX DRIVE SHAFT GUARD	6537 HR REMOVE FLOOR, REMOVE GUARDS, TAKE BACK TO CONTAINER YARD AND REPAIR, REFIT GUARDS, REFIT FLOOR	04/29/2024
DZR00016	WO-GTP-154-614	RUBBED BOOST HOSE	RUBBED BOOST HOSE RHS AFTERCOOLER TO INTAKE MANIFOLD L PIECE	REMOVED OLD CLAMPS AND HOSE AND REPLACED WITH NEW HOSE AND CLAMPS. STARTED DZR16 AFTER REPAIR , NO LEAK FOUND.	05/02/2024
DZR00016	WO-GTP-154-350	CLEAN OUT COOLER PACKS	CLEAN OUT COOLER PACKS	HRS 6552 REMOVE AFTERCOOLERS, REPOSITION HYDRAULIC COOLER, CLEAN HEAVY BUILD UP FROM RADIATOR CORES. RE-ASSEMBLE.	04/17/2024
DZR00016	WO-GTP-153-933	BROKEN RHS/R TILT CYLINDER BEARING	BROKEN RHS/R TILT CYLINDER BEARING	6554 HR REMOVE PIN, LIFT UP CYLINDER, REMOVE CIRCLIPS, REMOVE U/S SPHERICAL BEARING, FIT SPHERICAL BEARING AND CIRCLIPS, APPROX. 6MM PLAY IN DRAFT ARM PIN BORES, WELD UP BORES AND DIE GRIND OUT, ABOUT 0.5MM TO 1MM PLAY, LOWER CYLINDER AND REFIT PIN AND RETAINER	05/02/2024
DZR00016	WO-GTP-153-903	Alternator Replacement	Replace alternator, belt and belt tensioner.	REMOVE FLOOR, REMOVE ENGINE COVERS. REPLACE ALTERNATOR, DRIVE BELT AND TENSIONER. CHECK CHARGE RATE - 27.7V. REFIT ENGINE COVERS AND FLOOR.	04/29/2024
DZR00016	WO-GTP-153-901	REPLACE THERMOSTATS	REPLACE THERMOSTATS	6537HRS FLUSH COOLING SYSTEM WITH DESCALER AND DRAIN SYSTEM. REMOVE HOSES/ LINES. REMOVE THERMOSTAT HOUSING. DISASSEMBLE AND CLEAN HOUSING, INSTALL NEW SEALS AND THERMOSTATS, RE-INSTALL HOUSING, BRACKETS AND HOSES. FLUSH SYSTEM AGAIN WITH DESCALER DUE TO RUST / SCALE BUILD UP INSIDE ENGINE. FLUSH WITH FRESH WATER 4-5 TIMES. REFILL WITH COOLANT AND ADD SCA TREATMENT TO TRY PREVENT FURTHER NITRITE LOSS AS EVIDENT IN PAST SAMPLES.	04/19/2024
DZR00016	WO-GTP-153-707	RECTIFY LOOSE DPF MUFFLERS	RECTIFY LOOSE DPF MUFFLERS	RUN UP TEST, OK. 6302HRS FOUND DPF MUFFLER SECTIONS HAVE COME LOOSE, TIGHTEN ALL LOOSES CLAMPS.	04/02/2024
DZR00016	WO-GTP-153-302	BLISTERED TRANS FILTER HOSE	TRANS HOSE FROM PRIMARY FILTER HOUSING TO REAR OF TRANS CASE BLISTERED AND WEEPING	REMOVE OLD HOSE, CLEAN UP SEALING FACES AND HARDWARE, INSTALL NEW HOSE WITH NEW SEALS. POSITION SO NO RUBBING, INSTALL P-CLAMP. DEGREASE AND WASH HELL HOLE, RUN UP CHECK FOR LEAKS, ALL OK. REINSTALL FLOOR.	03/26/2024
DZR00016	WO-GTP-153-208	A Service - Dozer	Service as per attached Service Sheet	6204HRS COMPLETED AS PER SERVICE SHEET	03/23/2024
DZR00016	WO-GTP-152-928	RECTIFY WORK LIGHTS U/S	RECTIFY WORK LIGHTS U/S	FRONT LOWER WORK LIGHTS U/S, FOUND BLOWN FUSE. REPLACE FUSE AND TEST - NOT BLOWING NEW FUSE. HAD VISUAL CHECK OVER WIRING HARNESS. CANT SEE ANY RUB MARKS. 6125HRS	03/16/2024

DZR00016	WO-GTP-152-831	FLAT BATTERIES	FLAT BATTERIES	CHECK NO START FAULT, FOUND BATTERIES U/S. SOURCE BATTERIES FROM TRANSPORT YARD. FIT TO MACHINE AND CHECK CHARGE RATE - 27.81V 6102.2HRS	03/14/2024
DZR00016	WO-GTP-152-679	RUBBED SECONDARY TRANS FILTER HOSES	RUBBED SECONDARY TRANS FILTER HOSES	REMOVE FLOOR, REMOVE OLD HOSES, INSTALL NEW HOSES, O-RINGS, ENSURE SECURE AND NO RUB POINTS WITH NEW P CLAMPS AND CABLE TIES. TEST OP ALL OK	03/23/2024
DZR00016	WO-GTP-152-619	BOTH KNUCKLE JOINTS FROM BLADE TO DRAFT ARM WORN , NEEDING RE BUSHING AND PINS	BOTH KNUCKLE JOINTS FROM BLADE TO DRAFT ARM WORN , NEEDING RE BUSHING AND PINS	REMOVE LEFT AND RIGHT HAND SIDE BLADE KNUCKLE JOINT REPLACE ALL BUSHES IN JOINT AND BUSHES IN DRAFT ARMS AND BACK OF BLADE , REFIT JOINT BACK TO MACHINE WITH NEW PINS AND RETAINERS AND SHIM ACCORDINGLY , TORQUE ALL BOLT TO SPEC. COMPLETED AT 6102 HRS	03/18/2024
DZR00016	WO-GTP-152-586	TRANS SUCTION SCREEN REMOVED INSPECTION AND CLEAN	TRANS SUCTION SCREEN REMOVED INSPECTION AND CLEAN	REMOVED FLOOR BOARDS ,PLATE ,SEAL AND SCREEN INSPECTED SCREEN AND CLEANED RE FITTED AND SEALED PLATE TENSIONED BOLTS.	03/10/2024
DZR00016	WO-GTP-152-549	RE SHIM STABILIZER BAR	RE SHIM STABILIZER BAR	CLEAN AND REMOVE CAP, ADJUST SHIM PACK AS PER PROCEDURE, BALL/JOINT VERY WORN ONLY INSTALLED 1 SHIM. TIGHTEN BOLTS TO SPEC. TEST OP ALL OK. 6102 HRS	03/11/2024
DZR00016	WO-GTP-152-548	REPLACE BROKEN GROUSER BOLT LHS TRACK	REPLACE BROKEN GROUSER BOLT LHS TRACK	CUT OUT BROKEN BOLT, REPLACE WITH NEW BOLT AND NUT ASSEMBLY.	03/11/2024
DZR00016	WO-GTP-152-547	HELL HOLE CLEAN AND HOSE INSPECTION	HELL HOLE CLEAN AND HOSE INSPECTION	REMOVE FLOOR, WASH OUT HELL HOLE, INSPECT HOSE AND HARNESS CONDITION.	03/11/2024
DZR00016	WO-GTP-152-509	CHANGE HYDRAULIC OIL	CHANGE HYDRAULIC OIL	CHANGE OUT HYDRAULIC OIL WITH CASTROL TRANSMAX 30 6091 HRS	03/08/2024
DZR00016	WO-GTP-152-508	CLEAN COOLER PACK	CLEAN COOLER PACK	CLEAN OUT PRODUCT BUILD UP FROM COOLER PACK	03/11/2024
DZR00016	WO-GTP-152-507	BROKEN RHS LIGHT BRACKET	BROKEN RHS LIGHT BRACKET	REMOVE BROKEN LIGHT BRACKET, INSTALL HEAVY DUTY BRACKET AND REFIT. SECURE HARNESS AND HARDWARE. 6091 HRS	03/08/2024
DZR00016	WO-GTP-152-488	LHS PIVOT SHAFT LEAKING OIL	LHS PIVOT SHAFT LEAKING OIL	REMOVE SEAL GUARD, CLEAN UP AROUND SEAL. SEAL TORN AT TOP 1 OCLOCK LOCATION. SUCK VACUUM IN COMPARTMENT AND CLEAN OUT SPLIT IN SEAL WITH BRAKE CLEANER. APPLY GREYMAX SEALANT INTO SPLIT AND OVER LEAK AREA TO TRY SEAL UP UNTIL MAJOR REPAIRS CAN BE COMPLETED. REPLACE CORRODED BOLTS FOR SEAL GUARD AND REINSTALL. CHECK SEAL AFTER 1 SHIFT, STILL LEAKING. 12/3 APPLIED LAYERS OF SIKAFLEX EACH DAY WHILE MACHINE WAS DOWN FOR 3 DAYS. DRAINED COMPARTMENT, CLEANED OUT OIL FROM SEAL. RE-FILL COMPARTMENT. PIVOT SHAFT SEAL NEEDS TO BE REPLACED.	03/12/2024

DZR00016	WO-GTP-152-470	Hydraulic Oil Replacement	Drain hydraulic oil and refill with new oil.	DRAIN AND REFILL HYDRAULIC OIL WITH CASTROL TRANSMAX 30 6091 HRS	03/08/2024
DZR00016	WO-GTP-152-075	Dozer 3rd Party Assessment of Track and Undercarriage	3rd Party Assessment of Track and Undercarriage	WORK COMPELTED BY WESTRAC 12.03.24	03/12/2024
DZR00016	WO-GTP-151-533	D Service - Dozer	Service as per attached Service Sheet	6082HRS CARRY OUT D-SERVICE & INSPECTIONS AS PER OMM	03/08/2024
DZR00016	WO-GTP-150-310	RHS UPPER WORKLIGHT HANGING OFF	RHS UPPER WORKLIGHT HANGING OFF - FAILED ISOLATION RUBBERS NEED REPLACING	26/1 - ISOLATION MOUNT RUBBERS FOR LIGHT BRACKETS BROKEN. CABLE TIE LIGHT BRACKET INTO PLACE UNTILL WE CAN SOURCE NEW MOUNTS. 9/2 - REPLACE RUBBERS ON RHS UPPER WORKLIGHT AND LHS INNER. TEST OP - OK	02/09/2024
DZR00016	WO-GTP-150-057	REPAIR R/H ACCESS HANDLE ON DRAFT ARM	REPAIR R/H ACCESS HANDLE ON DRAFT ARM	REMOVE SNAPPED HANDLE FROM R/H SIDE OF MACHINE, WELD BACK TOGETHER AND PAINT. REFIT TO MACHINE. 5,697HRS	01/22/2024
DZR00016	WO-GTP-149-775	REPLACE WEAR PADS ON ACCESS LADDER	REPLACE WEAR PADS ON ACCESS LADDER AND ADJUST LOCKING PINS AS REQUIRED	REPLACE LADDER WEAR PADS AND REPAIR BENT BRACKETS ON LADDER RECEIVER. CHECK OPERATION - ALL GOOD. 5671HRS	01/17/2024
DZR00016	WO-GTP-149-614	LADDER GETTING STUCK IN LOCKS	LADDER GETTING STUCK IN LOCKS	UN JAMMED AND LOWERED LADDER AND RE POSITIONED LOCK LOCATORS AND BORED OUT HOLES CLEANED UP PIN AND TESTED ,SYSTEM WORKING	01/13/2024
DZR00016	WO-GTP-149-613	DPF CLEAN OUT	DPF CLEAN OUT	REMOVE LEFT AND RIGHT EXHAUST DPF AND CLEAN OUT WITH WATER AND THEN AIR TILL BOTH WERE CLEAN RE FITTED AND RAN DOZER TILL HOT CHECKING SYSTEM .	01/13/2024
DZR00016	WO-GTP-149-166	INSPECT/REPAIR WASTEGATE HOSE	INSPECT/REPAIR WASTEGATE HOSE	INSPECT TURBO WASTE GATE HOSES, FOUND R/H SIDE SHOWING AGE AND CRACKS. CUT HOSE BACK AND REFIT TO ACTUATOR. 5,605HRS	01/05/2024
DZR00016	WO-GTP-148-632	AIR CON BLOWING WARM	AIR CON BLOWING WARM	INSPECT FOR AC BLOWING WARM, MONITORING CIRCUIT OPEN WHEN ARRIVED AT MACHINE, COMP NOT CUTTING IN. STARTED CHECKING CONTINUITY OF PRESSURE SWITCHES, A/C STARTED WORKING. COULDN'T ISOLATE / REPRODUCE FAULT. CHECKED HARNESS AND PRESSURE SWITCHES, FOUND RESISTANCE OF CIRCUIT JUMPING AROUND 1-15 OHMS WHEN LOW PRESSURE SWITCH CONNECTED, REMOVED AND BRIDGED SWITCH, OHMS IN CIRCUIT STEADY 0.2-0.4 OHMS. BRIDGED OUT LOW PRESSURE SWITCH TO TEST. CHECK OPERATION, STILL WORKING AND CYCLING CORRECTLY. MONITOR FAULT. FITTED NEW LOW PRESSURE SWITCH AND TESTED SYSTEM A/C WORKING IN SPEC	01/13/2024
DZR00016	WO-GTP-148-064	WORKLIGHT BROKE OFF	WORKLIGHT BROKE OFF	WELDS BROKEN ON FORWARD WORKLIGHT, REMOVE LIGHT, UPGRADE TO HEAVY DUTY BRACKET, REINSTALL LIGHT.	12/17/2023
DZR00016	WO-GTP-147-788	Fire Suppression Service	Service Fire Suppression System - Contractor to Complete	WORK COMPELTED BY MITCHELL AND BROWN	11/30/2023

DZR00016	WO-GTP-147-655	B Service - Dozer	Service as per attached Service Sheet	5458h carry out b service as per manufacturers spec. adjust tracks, blow out cooler pack	12/24/2023
DZR00016	WO-GTP-147-325	DIAGNOSE JOYSTICK FAULT	DIAGNOSE JOYSTICK AS FAULTY REPLACE JOYS STICK TO RECTIFY	REPLACE JOYSTICK AND TEST OPERATION - WORKING AS PER NORMAL	12/09/2023
DZR00016	WO-GTP-147-318	REPLACE CUTTING EDGE	REPLACE CUTTING EDGE	5346HRS REMOVE OLD EDGES AND BOLTS , CLEAN OFF SCALE ON BLADE , CLEAN OFF PAINT ON BACK OF CUTTING EDGES , FIT NEW EDGES AND CORNER TIPS WITH NEW BOLTS , WASHERS AND NUTS. ANTI SEIZE ALL BOLTS AND TORQUE TO 2400NM . COMPLETED AT 5642HRS	01/09/2024
DZR00016	WO-GTP-147-304	WELD CHOCKY BAR TO SIDE'S OF BLADE	WELD CHOCKY BAR TO SIDE OF BLADE TO HELP SLOW DOWN THE WEAR OF THE TILT CYLINDER AND EQUALIZER NUCKLES	CLEANED UP SIDES OF THE BLADE , WELDED CHOCKY BAR TO SIDES OF BLADE IDENTIFIED WASHED AREAS TO SLOW DOWN WEAR OF TILT CYLINDERS AND EQUALIZER NUCKLES	11/30/2023
DZR00016	WO-GTP-147-203	Fire Equipment Service - Site	Inspect, test and tag fire equipment - Midwest Fire	Fire equipment serviced by Mitchell and Brown	12/22/2023
DZR00016	WO-GTP-146-613	Smoke Bomb Cab	Smoke bomb cab and reseal if required.	CARRY OUT SMOKE BOMB TEST ON OPERATORS CAB	11/23/2023
DZR00016	WO-GTP-146-612	A Service - Dozer	Service as per attached Service Sheet	5219HRS CARRY OUT 'A' SERVICE AS PER SERVICE SHEET	11/23/2023
DZR00016	WO-GTP-146-482	REMOVE AFTERCOOLERS AND FLUSH COOLER PACKS	REMOVE AFTER COOLERS AND FLUSH COOLER PACKS	REMOVE AFTERCOOLERS FROM MACHINE, WASH OUT ATER COOLERS AND COOLER PACK WITH CONDENSED AIR AND HIGH PRESSURE WATER. REFIT AFTERCOOLERS, RUN UP MACHINE. 5199HRS	11/21/2023
DZR00016	WO-GTP-146-236	COOLANT HOSES TO TURBO U/S	CHANGE COOLANT HOSES	REPLACE COOLANT HOSES BETWEEN TURBO AND HEADER TANK, TOP UP COOLANT AND RUN UP. CHECK FOR LEAKS	11/21/2023
DZR00016	WO-GTP-146-167	Dozer 3rd Party Assessment of Track and Undercarriage	3rd Party Assessment of Track and Undercarriage	5200HRS COMPLETED BY WESTRAC	11/21/2023
DZR00016	WO-GTP-145-948	REPLACE LANYARD ON FUEL CAP	REPLACE LANYARD ON FUEL CAP	MAKE NEW LANYARD AND FIT TO FAST FILL CAP TO PREVENT CAP BEING LOST. 5126HRS	11/11/2023
DZR00016	WO-GTP-145-605	CLEAN OUT COOLER PACK	CLEAN OUT COOLER PACK	REMOVE GUARDS, USE COMPRESSED AIR TO CLEAN OUT PRODUCT BUILDUP FROM RADIATOR CORES. FOLLOW UP USING CLEAN HIGH FLOW WATER TO FLUSH COOLERS. RE-ASSEMBLE AND RUN DOZER.	11/06/2023
DZR00016	WO-GTP-145-545	MISSING RHS AIR FILTER COVER SEAL	MISSING RHS AIR FILTER COVER SEAL	PARTS REQ SENT 5/11 REPLACED AIR CLEANER LID SEALS ON L/H AND R/H AIR CLEANERS 5126HRS	11/10/2023
DZR00016	WO-GTP-145-544	AIRCON INTERMITTENTLY CUTTING OUT	AIRCON INTERMITTENTLY CUTTING OUT	CHECK AIR CON OPERATION, CANT GET SYSTEM TO FAULT. SUSPECT SYSTEM CUTTING OUT ON HIGH PRESSURE. WASH OUT CONDENSER AND TEST - ALL SEEMS OK. 5,199HRS	11/23/2023

DZR00016	WO-GTP-145-497	EXCESSIVE LHS ARMREST MOVEMENT	EXCESSIVE LHS ARMREST MOVEMENT AND CREEPING DOWN	PARTS ORDERED 3/11 REMOVE SEAT, PANELS, ADJUSTABLE ARMREST ASSEMBLY. DISASSEMBLE OLD SEALS AND BEARINGS. REPLACE SEALS AND BEARINGS. REPLACE ACTUATOR. GREASE AND RE-ASSEMBLE. INSTALL SEAT, TIDY WIRING, TEST OPERATION, ALL OK. 5250 HRS	11/29/2023
DZR00016	WO-GTP-145-405	WORKLIGHTS INOP	WORKLIGHTS INOP	BLOWN FUSE TO FRONT UPPER WORKLIGHTS ON LIFT CYLINDERS. FIND RUBBED WIRE ON Y-PIECE ADAPTER ON LHS LIFT CYLINDER WORKLIGHTS. REMOVE AND REPAIR RUBBED WIRE. RE-INSTALL, TIDY AND SECURE WIRING. REPLACE FUSE, CHECK OPERATION, ALL OK.	11/01/2023
DZR00016	WO-GTP-145-404	MIRROR FALLING OFF	MIRROR FALLING OFF	REPLACE MISSING HARDWARE AND RE-INSTALL RHS MIRROR MOUNTED TO LIFT CYLINDER BRACKET	11/01/2023
DZR00016	WO-GTP-145-050	OPERATOR COMPLAINED OF VIBRATION THROUGH ENGINE	OPERATOR COMPLAINED OF VIBRATION THROUGH ENGINE	CHANGED OUT PRIMARY FUEL FILTERS AND WATER SEPERATION FUEL FILTER , CONNECTED ET AND PROCEEDED THROUGH DIAGNOSIS TESTS , CYLINDER CUT OUT AND TRANS STALL TESTS TO FIND FAULT , NO FAULT FOUND HRS 4988	10/26/2023
DZR00016	WO-GTP-144-642	MULTIPLE RUBBED HYDRAULIC HOSES BELOW ENGINE	LOWER BELLY PLATES AND REPLACE ALL RUBBED HOSES	REPLACE RUBBED HOSES FOUND IN HELL HOLE.	10/19/2023
DZR00016	WO-GTP-144-538	BLADE DROPPING QUICKLY	CALIBRATE BLADE SOLENOIDS	CALIBRATE BLADE SOLENOIDS	10/17/2023
DZR00016	WO-GTP-144-053	C Service - Dozer	Service as per attached Service Sheet	COMPLETED AS PER CAT SERVICE SHEET	10/27/2023
DZR00016	WO-GTP-143-999	LHS EXHAUST LEAK	LHS EXHAUST LEAK	LOCATE EXHAUST LEAK AT LHS TURBO OUTLET. REMOVE GUARDS / PANELS. REMOVE EXHAUST SHIELDING. REMOVE AND RE-SEAT CLAMP, ADJUST EXHAUST ELBOW POSITION FOR BETTER CLAMPING. RE-INSTALL AND TEST, ALL OK.	10/06/2023
DZR00016	WO-GTP-143-547	BLOWN COOLANT HOSE	REPAIR BLOWN COOLANT HOSE	REPLACE COOLANT HOSE EXITING TOP FRONT OF ENGINE. RUBBED THROUGH ON STEEL SUPPORT RINGS OF HOSE.	09/24/2023
DZR00016	WO-GTP-143-247	A Service - Dozer	Service as per attached Service Sheet	4774Hrs Carry out service as per service sheet. Blow out cooler packs, adjust track tension and replace air filters. Found pilot filter leaking - sourced and replaced.	09/28/2023
DZR00016	WO-GTP-143-128	ADJUST TRACK TENSION	ADJUST TRACK TENSION	4652Hrs Adjust track tension to spec.	09/14/2023
DZR00016	WO-GTP-143-126	CLEAN OUT COOLER PACK	CLEAN OUT COOLER PACK	4652Hrs Clean cooler pack out externally.	09/14/2023
DZR00016	WO-GTP-142-568	Dozer 3rd Party Assessment of Track and Undercarriage	3rd Party Assessment of Track and Undercarriage	4585HRS COPMPLETED BY WESTRAC	09/06/2023
DZR00016	WO-GTP-142-076	REPLACE MISSING BELLY GAURD HARDWARE	REPLACE MISSING BELLY GAURD HARDWARE	4652Hrs Replace missing bolts in front belly plate.	09/14/2023
DZR00016	WO-GTP-142-074	REPLACE FAULTY A/C THERMISTOR	REPLACE FAULTY A/C THERMISTOR, READING INCORRECTLY.	4652Hrs Replace A/C thermistor and test - all good.	09/14/2023
DZR00016	WO-GTP-142-061	FLUSH COOLING SYSTEM AND ADD ADDITIVE	FLUSH COOLING SYSTEM AND ADD ADDITIVE	Flush cooling system, refill with new ELC and add CCAC additive. Run up machine and recheck level.	08/22/2023
DZR00016	WO-GTP-141-743	CLEAN COOLER PACK	CLEAN OUT RADIATOR AND COOLER PACK	4385Hrs Clean out cooler pack.	08/14/2023
DZR00016	WO-GTP-141-659	REPLACE FAST FILL CAP	REPLACE MISSING DIESEL FAST FILL CAP	4390Hrs Replace fast fill cap & lanyard.	08/16/2023
DZR00016	WO-GTP-141-629	REPAIR SERVICE CENTRE DOOR	REPAIR SERVICE CENTRE DOOR	REMOVE BROKEN RIVETS AND BOLTS. REPLACE WITH NEW BOLTS.	08/09/2023
DZR00016	WO-GTP-141-493	B Service - Dozer	Service as per attached Service Sheet	Carry out B service as per attached checklist.	08/22/2023

DZR00016	WO-GTP-141-440	TRANSMISSION LEVER POSITION SENSOR FAULT CODE	TRANSMISSION LEVER POSITION SENSOR FAULT CODE	INSPECT INTERMITTENT FAULT. RECALIBRATE FNR SWITCH. CHECK OPERATION, COULDNT FAULT.	08/10/2023
DZR00016	WO-GTP-141-381	A Service - Dozer	Service as per attached Service Sheet	4385Hrs Carry out A service.	08/14/2023
DZR00016	WO-GTP-141-258	PLUGGED FUEL FILTER CODE SHOWING	REPLACE FUEL FILTERS	Pick up filters from westrac, fill out JSA, replace filters, test run all ok. hrs-4296	08/03/2023
DZR00016	WO-GTP-140-918	Track Assembly and bogie roller Replacement	Track Assembly and bogie roller Replacement	JACK MACHINE UP REMOVE OLD TRACKS ,BOGIE ROLLERS AND IDLERS .BUFF UP ALL CAPS AND MOUNTING SURFACES RUN TAP THROUGH ALL THREADS . REFIT ROLLERS AND IDLERS WITH COPPER ANTI-SEIZE AND NEW BOLTS . TORQUE TO SPEC FIT NEW TRACK ASSEMBLY'S . REPLACE FRONT AND REAR IDLER SCRAPERS .	07/28/2023
DZR00016	WO-GTP-140-891	INSPECT WEAR IN TRACK LINK	INSPECT WEAR IN L/H TRACK LINKS	CHECK WEAR IN L/H TRACK LINKS, FOUND ONE LINK IS STRETCHING AND THE BUSH IS CRACKING. CHECKED THROUGH PARTS AND ETA ON NEW TRACKS. PUT MACHINE BACK TO WORK UNTILL NEW TRACKS ARRIVE.	08/11/2023
DZR00016	WO-GTP-140-768	AUX DRIVESHAFT COUPLINGS U/S	AUX DRIVESHAFT COUPLINGS U/S	4188Hrs Replace couplings & bolts during alternator replacement.	07/20/2023
DZR00016	WO-GTP-140-602	Alternator Replacement	Replace alternator, belt and belt tensioner.	4188Hrs Replace belt, alternator & belt tensioner. Check charge voltage once complete - 27.8V.	07/20/2023
DZR00016	WO-GTP-140-601	Dozer 3rd Party Assessment of Track and Undercarriage	3rd Party Assessment of Track and Undercarriage	COMPLETED BY WESTRAC	07/05/2023
DZR00016	WO-GTP-140-461	HYDRAULIC LEAK	INSPECT AND RECTIFY HYDRAULIC LEAK	INSPECT MACHINE FINDING SNAPPED BOLT IN STEEL PIPE FITTING ON TOP OF LIFT CYLINDER . REMOVE SNAPPED BOLT REPLACE O-RING AND FIT 2 NEW BOLT RECTIFYING LEAK .	07/13/2023
DZR00016	WO-GTP-140-457	FIT NEW REVERSE CAMERA BRACKET	FIT NEW REVERSE CAMERA BRACKET	4101Hrs Fabricate and fit new reverse camera bracket out of ally. Remove old bracket and fit new bracket. Check camera view, all ok.	07/13/2023
DZR00016	WO-GTP-140-262	DOOR LATCH MISSING OFF PIVOT SHAFT RESERVOIR DOOR	ORDER AND REPLACE DOOR LATCH	REPLACE DAMAGED DOOR LATCH ON PIVOT SHAFT RESERVOIR DOOR. 4186HRS	07/19/2023
DZR00016	WO-GTP-140-153F.1	COMPLETE VALVE SET AT NEXT SERVICE	COMPLETE VALVE SET	4774Hrs Remove engine bay doors and panels. Complete valve set as per manufactures specs. Re-fit doors and panels. Run up and check over.	09/27/2023
DZR00016	WO-GTP-140-153	D Service - Dozer	Service as per attached Service Sheet	4050Hrs Completed service as per service sheet. Replaced belt & tensioner.	07/13/2023
DZR00016	WO-GTP-139-198	SHIM DRAFT ARM CAPS AND BLADE STABILISER CAPS	SHIM DRAFT ARM CAPS AND BLADE STABILISER CAPS	3826Hrs Loose draft arm caps, clean up bolts and re-shim as per procedure. Torque bolts to spec. Check blade stabilizer caps- all ok. Don't require shimming. Pack up and return hy-torque to JMH.	06/16/2023
DZR00016	WO-GTP-138-788	A Service - Dozer	Service as per attached Service Sheet	3785Hrs Complete service.	06/16/2023
DZR00016	WO-GTP-138-787	Smoke Bomb Cab	Smoke bomb cab and reseal if required.	3805Hr Smoke bomb cab, seal up any leaks around cab grommets. Fit new cab pressurizer filter.	06/16/2023

DZR00016	WO-GTP-138-650	CHANGE OUT LHS SPROKET SEGMENTS	CHANGE OUT LHS SPROKET SEGMENTS	3740HRS COLLECT TOOLING FROM JMH, CONDUCT JHA, SET UP MACHINE, REMOVE BOLTS AND SPROKET SEGMENTS, CLEAN SURFACES ON FINAL DRIVE AND NEW SEGMENTS AND INSTALL WITH NEW BOLTS TORQUE TO 650FTLB AND THEN TORQUE TURN A FUTHER 120 DEGREES, RE ADJUST TRACK, PACK UP WORK AREA	06/06/2023
DZR00016	WO-GTP-138-529	EXHAUST OVER PRESSURE FAULT	EXHAUST OVER PRESSURE FAULT	3700HRS REMOVE DPF'S, BLOW OUT WITH AIR UNTIL CLEAN. RE-FIT. TEST RUN/CHECK FOR EXHAUST LEAKS, CHECK SENSORS - CONNECTED TO WRONG SIDES. SWAP AROUND AND CHECK, ALL OK.	06/01/2023
DZR00016	WO-GTP-137-618	Fire Suppression Service	Service Fire Suppression System - Contractor to Complete	COMPLETED BY MITCHELL & BROWN FIRE	07/12/2023
DZR00016	WO-GTP-137-616	Fire Equipment Service	Inspect, test and tag fire equipment - Midwest Fire	Completed by Mitchell & Brown Fire.	07/17/2023
DZR00016	WO-GTP-137-411	RESEAL AND RE OIL LEAKING RHS TRACK LINK	RESEAL AND RE OIL LEAKING RHS TRACK LINK	3559HRS OIL LEAKING FROM ENDS OF TRACK PIN. VAC OUT PIN, BUFF/CLEAN ENDS OF PIN. SEAL UP WITH RTV. VAC TEST - HELD FOR 10-15 MINS. OIL PIN, PUT BUNG IN AND CHECK FOR LEAKS - NO LEAKS.	05/17/2023
DZR00016	WO-GTP-137-410	REPLACE RHS SPROCKET SEGMENTS	REPLACE RHS SPROCKET SEGMENTS	3559HRS REMOVE OLD AND INSTALL NEW SPROCKET SEGMENTS AND HARDWARE. ENSURE BUFFED AND CLEANED MATING SURFACES. TORQUE TO SPEC.	05/17/2023
DZR00016	WO-GTP-137-031	FUSE BLOWING FOR FRONT WORK LIGHTS	DIAGNOSE AND REPAIR SHORT IN FRONT WORK LIGHT CIRCUIT	REPLACE BLOWN FUSE FOR FRONT WORK LIGHTS , NO SHORT PRESENT . INSPECT FRONT WORK LIGHT HARNESS FINDING MAIN POWER WIRE RUBBED THROUGH ON GREASE LINE . REMOVE WIRE FROM PLUG , HEAT SHRINK AND RE FIT AND CABLE TIE HARNESS	05/10/2023
DZR00016	WO-GTP-136-921	REPAIR BROKEN SERVICE DOOR HINGES	REPAIR BROKEN SERVICE DOOR HINGES	REMOVE BROKEN RIVETS. DRILL OUT HOLES, INSTALL BOLTS.	05/07/2023
DZR00016	WO-GTP-136-706	Dozer 3rd Party Assessment of Track and Undercarriage	3rd Party Assessment of Track and Undercarriage	3413HRS COMPLETED BY WESTRAC	05/03/2023
DZR00016	WO-GTP-136-637	REPLACE FAILED LHS TRACK LINK	REMOVE AND REPLACE FAILED LHS TRACK LINK	3400HRS ASSIST WESTRAC REPLACING FAILED TRACK LINK ON LHS TRACK.	05/01/2023
DZR00016	WO-GTP-136-322	B Service - Dozer	Service as per attached Service Sheet	3481HRS COMPLETE B SERVICE AS PER MANUFACTURE SPECS.	05/11/2023
DZR00016	WO-GTP-136-289	GREASE LEAK IN BELLY PAN	GREASE LEAK IN BELLY PAN	FIND GREASE LEAK IN BELLY PAN FROM RUBBED THROUGH LHS EQUALIZER BAR PIN GREASE LINE. REMOVE CAB FLOOR. DISCONNECT UPPER PORTION OF HOSE, PULL DOWN TO ACCESS FROM BOTTOM, CUT AND INSTALL JOINER. REASSEMBLE AND TEST OPERATION, ALL OK.	04/21/2023
DZR00016	WO-GTP-136-192	REPAIR BROKEN WORKLIGHT BRACKET	REPAIR BROKEN WORKLIGHT BRACKET	3346HRS REPAIR BROKEN WORKLIGHT BRACKET, UPGRADE TO HEAVY DUTY BRACKET.	04/19/2023
DZR00016	WO-GTP-136-191	TIGHTEN RHS TRACK	TIGHTEN RHS TRACK	3346HRS TIGHTEN RHS TRACK TO SPEC	04/19/2023

DZR00016	WO-GTP-135-935	MODIFY FIRE SURPRESSION BOTTLE STRAPS	REMOVE FIRE SURPRESSION BOTTLE STRAPS AND MODIFY TO PREVENT BREAKAGE	3277HRS REMOVE RHS FIRE SURPRESSION BOTTLE STRAP FROM DOZER 16 AND INSTALL ONTO RHS BOTTLE OF DOZER 15 AS HAS ALREADY BEEN REPAIRED. TAKE STRAPS BACK TO CONTAINER YARD, COLLECT 12MM THREADED ROD FROM BOLTS'R'US, CUT OFF 10MM THREADED ROD AND WELD ON NEW 12MM LENGTHS. RE INSTALL BOTH BACK ON DOZER 16	04/14/2023
DZR00016	WO-GTP-135-630	CAMERA FAULT	CAMERA FAULT	3247HRS INSPECT REVERSE CAMERAS BLUE-SCREENING INTERMITTENTLY. FIND LOOSE CONNECTION AT REAR OF CAB, REMOVE AND CLEAN, RE ASSEMBLE WITH DIELECTRIC GREASE. TEST OPERATION ALL OK.	04/10/2023
DZR00016	WO-GTP-135-601	TIGHTEN LHS TRACK	TIGHTEN LHS TRACK	3229HRS TIGHTENED LHS TRACK TO SPEC	04/08/2023
DZR00016	WO-GTP-135-257	RHS FIRE EXTINGUISHER BOTTLE STRAP BROKEN	INSPECT FOR REPORTED RHS FIRE EXTINGUISHER BOTTLE STRAP BROKEN AND REPAIR AS REQUIRED	3176HRS INSPECT FOR REPORTED RHS FIRE EXTINGUISHER BOTTLE STRAP BROKEN REMOVE STRAP FROM MACHINE, CUT OFF BROKEN THREADED ROD AND WELD ON NEW BOLTS, PAINT AND RE INSTALL ON TO MACHINE	04/02/2023
DZR00016	WO-GTP-135-051	A Service - Dozer	Service as per attached Service Sheet	3277HRS TAKE ENGINE OIL SAMPLE & CONDUCT A SERVICE AS PER SERVICE SHEET.	04/14/2023
DZR00016	WO-GTP-134-911	HYDRAULIC LEAK	INSPECT AND RECTIFY HYDRAULIC LEAK	TOP RIGHT HAND LIFT CYLINDER FLANGE BOLT SNAPPED . DRILL OUT SNAPPED BOLT AND REMOVE .REPLACE D-RINGS IN FLANGE BLOCK REFIT AND TEST . SEND MACHINE BACK TO WORK	03/29/2023
DZR00016	WO-GTP-134-294	HYDRAULIC OIL LEAKING FROM COOLING FAN CONTROL VALVE	INSPECT FOR REPORTED HYDRAULIC OIL LEAKING FROM COOLING FAN CONTROL VALVE AND REPAIR AS REQUIRED	3023HRS INSPECT FOR REPORTED HYDRAULIC OIL LEAKING FROM COOLING FAN CONTROL VALVE, UNBOLT AND OPEN UP GRILL, INSPECT AND RUN UP TO LOCATE OIL LEAK, FOUND LEAK COMING FROM REVERSING FAN RELIEF VALVE, VALVE WAS LOOSE/SEAL PINCHED/BLOWN OUT, REMOVED VALVE AND INSTALLED NEW SEAL, AND RE INSTALLED, REPLACED SEAL ON THE SECOND RELIEF VALVE AS FOUND THAT TO ALSO BE LOOSE, CLEANED OFF VALVE BLOCK AND RAN UP AND TESTED, ALL OKAY, TOPPED UP HYDRAULIC OIL AND CLOSED UP GRILL	03/16/2023
DZR00016	WO-GTP-133-895	REPAIR LADDER NOT LOWERING	REPAIR LADDER NOT LOWERING	2959HRS LADDER LOCK PINS SEIZED, RELEASE PINS, FIND LOWER LADDER STOW BRACKET BENT. REMOVE AN STRAIGHTEN BRACKET. ADJUST LOCK MECHANISM AND PIN LOCK BRACKETS. CLEAN UP PINS AND APPLY DRY LUBE. TEST OPERATION, ALL OK.	03/11/2023
DZR00016	WO-GTP-133-846	GREASE FITTING LEAKING	R/H LIFT RAM TRUNNION OUTER GREASE FITTING LEAKING	2935HRS FITTING AND HOLE THREADS STRIPPED. DRILL OUT, TAP TO 1/4 BSP. FIT NEW FITTINGS.	03/09/2023
DZR00016	WO-GTP-133-845	MODIFY FOOT RESTS	MODIFY FOOT RESTS	2935HRS REMOVE FLOOR PANELS, CUT SPACERS OFF FLOOR PLATE, DRILL & TAP FLOOR PLATE FOR FOOT RESTS. PAINT, RE-FIT FLOOR PLATES & FOOT RESTS.	03/09/2023
DZR00016	WO-GTP-133-821	REPLACE ISOLATION SWITCH WITH HIGH AMPERAGE CONTACT UNIT TO PREVENT FUTURE FAILURES.	REPLACE ISOLATION SWITCH WITH HIGH AMPERAGE CONTACT UNIT TO PREVENT FUTURE FAILURES. DUE TO INCORRECT AMPERAGE ISOLATION SWITCH BEING FITTED FROM FIT OUT	2936HRS REPLACED MAIN BATTERY ISOLATOR WITH HIGHER AMPERAGE UNIT. DRILL OUT TERMINAL EYES TO SUIT LARGER POSTS. TEST, ALL OK.	03/09/2023

DZR00016	WO-GTP-133-731	WELD ON WEAR PLATE TO BLADE	WELD ON WEAR PLATE TO BLADE	2935HRS WELD ON CHOCCY BAR WEAR PLATE TO BLADE SIDES	03/09/2023
DZR00016	WO-GTP-133-405	C Service - Dozer	Service as per attached Service Sheet	2935HRS COMPLETE SERVICE AS PER CAT SERVICE SCHEDULE	03/08/2023
DZR00016	WO-GTP-133-138	Dozer 3rd Party Assessment of Track and Undercarriage	3rd Party Assessment of Track and Undercarriage	2935HRS COMPLETED BY WESTRAC	03/08/2023
DZR00016	WO-GTP-133-091	TIGHTEN LHS AND RHS TRACKS	TIGHTEN LHS AND RHS TRACKS	TIGHTEN LHS AND RHS TRACKS TO SPEC	02/27/2023
DZR00016	WO-GTP-132-896	REPAIR DAMAGE WORKLIGHT WIRING TOP RHS OUTER	REPAIR DAMAGE WORKLIGHT WIRING TOP RHS OUTER	2847HRS REPAIR BROKEN WORKLIGHT WIRING. CUT BACK, INSTALL NEW PLUG.	02/22/2023
DZR00016	WO-GTP-132-895	CLEAN OUT COOLER PACKAGE	CLEAN OUT COOLER PACKAGE	2846HRS BLOW OUT DIRT BUILD UP FROM RADIATOR CORES.	02/22/2023
DZR00016	WO-GTP-132-893	WASH OUT BELLY PLATES	WASH OUT BELLY PLATES	2847HRS WASH DIRT OUT OF BELLOW PLATES.	02/22/2023
DZR00016	WO-GTP-132-716	BOLTS MISSING FROM GUARDS	BOLTS MISSING FROM GUARDS	REPLACED MISSING BOLTS FROM TILT CYLINDER GUARDS	02/22/2023
DZR00016	WO-GTP-132-599	FUEL/SERVICE POINT ON COUNTERWEIGHT LID BROKEN OFF	INSPECT FOR REPORTED LID ON FUEL/SERVICE POINT ON COUNTERWEIGHT BROKEN OFF	2809HRS INSPECT FOR REPORTED LID ON FUEL/SERVICE POINT ON COUNTERWEIGHT BROKEN OFF, DRILL OUT BROKEN RIVITS, STRAIGHTEN HINGE AND RE INSTALL LID AND REPLACE ALL OTHER POP RIVITS	02/18/2023
DZR00016	WO-GTP-132-454	NO POWER TO MACHINE	DIAGNOSE ELECTRICAL FAULT AND RECTIFY	2789HRS ISOLATOR U/S. REMOVE ISOLATOR & FIT NEW. TEST ALL OK.	02/16/2023
DZR00016	WO-GTP-132-292	CHANGE OUT PIVOT SHAFT OIL	DRAIN PIVOT SHAFT OIL COMPARTMENT, AND RE FILL WITH TRANSMAX OFFROAD 50W , BLEED AIR OUT OF SYSTEM AND TOP UP OIL	2789HRS DRAIN PIVOT SHAFT OIL COMPARTMENT, AND RE FILL WITH TRANSMAX OFFROAD 50W , BLEED AIR OUT OF SYSTEM AND TOP UP OIL	02/16/2023
DZR00016	WO-GTP-132-290	BAD COOLANT SAMPLE	DRAIN COOLANT, RE FILL COOLING SYSTEM WITH NEW CAT ELC COOLANT, RUN UP MACHINE AND GET TO OPERATING TEMPERATURE AND TOP UP COOLANT	2846HRS DRAIN COOLANT, RE FILL COOLING SYSTEM WITH NEW CAT ELC COOLANT, RUN UP MACHINE AND GET TO OPERATING TEMPERATURE AND TOP UP COOLANT, PACK UP WORK AREA	02/22/2023
DZR00016	WO-GTP-132-111	A Service - Dozer	Service as per attached Service Sheet	2790HRS COMPLETED SERVICE AS PER SERVICE SHEET.	02/16/2023
DZR00016	WO-GTP-131-667	MASTER LINKS ON LEFT AND RIGHT TRACKS WORN EXCESSIVELY CAUSING BOLTS TO SNAP	REMOVE 3 GROUSER PLATES, PRESS PINS OUT OF MASTER LINKS , FIT STANDARD LINKS IN PLACE , PRESS PINS IN , REFIT GROUSER PLATES	2653HRS REPLACED MASTER LINKS WITH SOLID LINKS. PRESS IN NEW PINS, TORQUE UP GROUSERS.	02/23/2023
DZR00016	WO-GTP-131-370	REPLACE BROKEN BOLT RHS TRACK MASTER LINK	REPLACE BROKEN BOLT RHS TRACK MASTER LINK	2605HRS REPLACE UPPER LHS BOLT ON RHS TRACK MASTERLINK. TORQUE 1100FTLBS + 90 DEG.	01/28/2023
DZR00016	WO-GTP-131-369	REPLACE 2 BROKEN MASTERLINK BOLTS LHS TRACK	REPLACE 2 BROKEN MASTERLINK BOLTS LHS TRACK	2596HRS REMOVE 2 BROKEN BOLTS FROM LHS MASTERLINK. CLEAN THREADS, INSTALL NEW BOLTS AND TORQUE 1100FT LBS + 90DEG.	01/28/2023
DZR00016	WO-GTP-131-281	REPAIR LADDER STICKING IN STOWED POSITION	REPAIR LADDER STICKING IN STOWED POSITION	2576HRS CLEANED PIN BORES AND PINS. LUBE WITH DRY LUBE. TEST OPERATION, ALL OK.	01/25/2023
DZR00016	WO-GTP-131-260	FIT REMOTE BREATHER FOR PIVOT SHAFT RESERVOIR	FIT REMOTE BREATHER FOR PIVOT SHAFT RESERVOIR	2576HRS REMOVE & INSPECT RESERVOIR FOR LEAKS, NONE FOUND. SETUP FITTINGS TO REMOTE MOUNT BREATHER.	02/22/2023
DZR00016	WO-GTP-130-737	TIGHTEN LOOSE TRACKS	TIGHTEN LOOSE TRACKS	2475HRS TIGHTEN BOTH LHS AND RHS TRACKS TO SPEC OF 150MM OVERALL SAG.	01/17/2023

DZR00016	WO-GTP-130-736	REPLACE BROKEN TOP RIGHT MASTERLINK BOLT - LHS TRACK	REPLACE BROKEN TOP RIGHT MASTERLINK BOLT - LHS TRACK	2475HRS FIND BROKEN BOLT. REMOVE BOLT, CLEAN UP THREADS AND FACE. LUBE NEW BOLT WITH COPPER ANTI SEIZE. TORQUE 1100FT LBS + 90 DEGREES.	01/17/2023
DZR00016	WO-GTP-130-296	RHS TOP LEFT MASTER LINK BOLT SNAPPED	RHS TOP LEFT MASTER LINK BOLT SNAPPED, REMOVE BROKEN BOLT AND INSTALL NEW BOLT	2380HRS COLLECT TOOLING FROM JMH, TRAVEL TO KARARA. WRITE UP JHA. DRILL & EXTRACT BROKEN MASTER LINK BOLT. CLEAN OUT THREADS. INSTALL NEW BOLT WITH COPPER ANTI SIEZE & TORQUE BOLT. PACK UP WORK AREA & RETURN TOOLING TO JMH.	01/07/2023
DZR00016	WO-GTP-130-231	CORNER TIP REPLACEMENT	CARRY OUT CORNER TIP REPLACEMENT	2432HRS CARRY OUT CORNER TIPS, ROTATE OTHER CUTTING EDGES.	01/13/2023
DZR00016	WO-GTP-130-200	Dozer 3rd Party Assessment of Track and Undercarriage	3rd Party Assessment of Track and Undercarriage	2408HRS WESTRAC COMPLETED UNDERCARRIAGE & TRACK ASSESSMENT.	01/10/2023
DZR00016	WO-GTP-129-861	B Service - Dozer	Service as per attached Service Sheet	2432HRS CARRY OUT 500HR SERVICE AS PER SERVICE CHECKLIST.	01/13/2023
DZR00016	WO-GTP-129-762	INSPECT FOR COMPLAINT OF LADDER STICKING UP INTERMITTENTLY	INSPECT FOR COMPLAINT OF LADDER STICKING UP INTERMITTENTLY	2310HRS CLEAN PRODUCT FROM PINS & BUSHES, CLEAN MAGNETS. APPLY DRY FILM LUBE TO PINS & BUSHES. OPERATE LADDER THROUGH RANGE OF MOVEMENT, ALL OK.	12/29/2022
DZR00016	WO-GTP-129-761	REPAIR WORKLIGHTS UPPER RHS	REPAIR WORKLIGHTS UPPER RHS	2310HRS REMOVE LIGHT, REMOVE WIRING, FIND WIRES STRIPPED IN BACK OF LIGHT. TOO CLOSE TO BOARD TO REPLACE. INSTALL HEAT SHRINK OVER EXPOSED WIRING. INSTALL NEW TAIL & PLUG. TEST OPERATION, ALL OK. RE-INSTALL.	12/29/2022
DZR00016	WO-GTP-129-677	MACHINE SHUTTIND DOWN/ FIRE SURPRESSION ALARMING	DIAGNOSE AND REPAIR REPORTED MACHINE SHUTTIN DOWN AND FIRE SURPRESSION ALARMING	2267HRS INSPECT REPORTED MACHINE SHUTTIN DOWN AND FIRE SURPRESSION ALARMING, FOUND DEUTCHE PUG TO RHS SURPRESSION BOTTLKE PRESSURE SWITCH WORN/ LOOSING CONTACT AND HARNESS RAN POORLY, REPLACED WITH NEW DEUTCH PLUG AND RE-ROUTED HARNESS, TEST OPERATION, ALL OKAY 30/12 ALARMING FOR LOW PRESSURE, FIND BROKEN WIRE IN INTERNAL SHEATHING NEAR RHS BOTTLE PRESSURE SWITCH. STRIP BACK & LOCATE BREAK. REPAIR WIRE, APPLY HEAT SHRINK, MOUNT SECURELY TO PREVENT ANY FUTHER FLEXING OF WIRING.	12/31/2022
DZR00016	WO-GTP-129-332	A Service - Dozer	Service as per attached Service Sheet	2222HRS CARRY OUT 250HR SERVICE.	12/20/2022
DZR00016	WO-GTP-129-248	TIGHTEN LOOSE LHS FUEL TANK MOUNT BOLTS	TIGHTEN LOOSE LHS FUEL TANK MOUNT BOLTS	2179HRS OPERATOR COMPLAINT OF KNOCKING SOUND INTERMITTENTLY, CHECK OVER MACHINE. FIND REAR LHS BOLT FOR FUEL TANK MOUNT HAD COME OUT. RE-INSTALL, GO AROUND & TIGHTEN OTHER TANK MOUNTS & HARDWARE IN AREA. REMOVE INNER CAB LINING & TORQUE CHECK CAB MOUNT BOLTS - ALL OK.	12/15/2022
DZR00016	WO-GTP-129-215	REPAIR MISSING BOLTS ON 9KG FIRE EXTINGUISHER BRACKET	REPAIR MISSING BOLTS ON 9KG FIRE EXTINGUISHER BRACKET	2173HRS REPLACED MISSING BOLTS ON 9KG FIRE EXTINGUISHER BRACKET, ADJUST ACCORDINGLY.	12/14/2022

DZR00016	WO-GTP-129-012	RHS TRACK LOOSE	SET UP MACHINE AND TENTION TRACK TO SPECIFICATION	2143HRS SET UP MACHINE CLEAN OFF TRACK FRAME, REMOVE COVER AND TENTION TRACK TO SPECIFICATION	12/11/2022
DZR00016	WO-GTP-128-930	Smoke Bomb Cab	Smoke bomb cab and reseal if required.	2158HRS SMOKE BOMB CAB & SEAL ANY LEAKS WITH SIKAFLEX. CAB PRESSURE 157 PASCALS.	12/12/2022
DZR00016	WO-GTP-128-816	REMOTE FUEL FILL POINT BOX LID LOOSE	INSPECT FOR REPORTED REMOTE FUEL FILL POINT BOX LID LOOSE AND REPAIR AS REQUIRED	2085HRS DRILL OUT FAILED POP RIVETS AND INSTALL NEW RIVETS INTO LID AND BOX FOR HINGE	12/07/2022
DZR00016	WO-GTP-128-626	REPAIR BROKEN LOWER LHS LIGHT BRACKET	REPAIR BROKEN LOWER LHS LIGHT BRACKET	2083HRS REMOVE BROKEN LIGHT BRACKET, WELD UP, RE-INSTALL & ADJUST.	12/06/2022
DZR00016	WO-GTP-128-480	SNAPPED MASTER LINK BOLT	REMOVE AND REPLACE SNAPPED MASTER LINK BOLT	2048HRS NOTICE BROKEN BOLT ON RHS TRACK MASTER LINK. REMOVE BROKEN BOLT, CLEAN UP SURFACES & THREAD. INSTALL NEW BOLT & TORQUE TO SPEC.	12/01/2022
DZR00016	WO-GTP-128-182	ENGINE DOOR HARD TO OPEN / CLOSE	RECTIFY ENGINE DOOR HARD TO OPEN / CLOSE	2012HRS DOOR HITTING AT BOTTOM - SPACE UP WITH WASHERS, LUBE HINGES AND LATCHES.	11/25/2022
DZR00016	WO-GTP-128-181	EQ BAR PAD BOLTS MISSING	EQ BAR PAD BOLTS MISSING	2012HRS REPLACE MISSING BOLTS, CHECK OTHER BOLTS.	11/25/2022
DZR00016	WO-GTP-128-143	MACHINE RUNNING HOT RADIATOR PARTIALLY BLOCKED	WASH OUT RADIATOR AND AFTER COOLER	1985HRS CONDUCTED JHA, OPEN UP RADIATOR GRILLS SCRAPE OUT PRODUCT FROM INFRONT OF RADIATOR, USE AIR TO BLOW OUT RADIATORS AND AFTER COOLERS, CLOSE UP GRILL	11/25/2022
DZR00016	WO-GTP-127-838	REPAIR RADIO / CAMERA BRACKET BROKEN OFF RHS CAB	REPAIR RADIO / CAMERA BRACKET BROKEN OFF RHS CAB	1930HRS FOUND BROKEN BOLTS IN MOUNT PLATE. REMOVE BOLTS AND REPLACE, INSTALL BRACKET.	11/19/2022
DZR00016	WO-GTP-127-431	Fire Suppression Service	Service Fire Suppression System - Contractor to Complete	COMPLETED BY MITCHELL & BROWN FIRE	12/31/2022
DZR00016	WO-GTP-127-422	Fire Equipment Service	Inspect, test and tag fire equipment - Midwest Fire	COMPLETED BY MITCHELL & BROWN FIRE	12/31/2022
DZR00016	WO-GTP-126-649	Dozer 3rd Party Assessment of Track and Undercarriage	3rd Party Assessment of Track and Undercarriage	1885HRS WESTRAC COMPLETED TRACK AND UNDERCARRIAGE ASSESSMENT.	11/15/2022
DZR00016	WO-GTP-126-646	Alternator Replacement	Replace alternator, belt and belt tensioner.	1969HRS REMOVE CAB FLOOR AND SIDE GUARDS, REMOVE DRIVE SHAFT GUARDS & UNBOLT END OF SHAFT. REPLACE ALTERNATOR BELT, ALTERNATOR AND BELT TENSIONER. RE-INSTALL FLOOR & GUARDS.	11/23/2022
DZR00016	WO-GTP-126-645	D Service - Dozer	Service as per attached Service Sheet	1969HRS CONDUCT 2000HR SERVICE. CHANGE ALL FILTERS, OILS CONDUCT CHECKS.	11/23/2022
DZR00016	WO-GTP-126-588	SNAPPED MASTER LINK BOLT	SNAPPED MASTER LINK BOLT	1.783HRS NOTICE R/H TRACK MASTER LINK SHORT BOLT BROKEN ON PRE START. BORROW J.M.H RAD GUN, REMOVE MASTER LINK AND GROUSER. REMOVE BROKEN BOLT. NO BOLTS IN STOCK AT WESTRAC, ORDER PARTS, FIT INTRIM BOLT, TORQUE TO 1100FT LBS AND 90 DEGREES. PICK UP BOLTS FROM WESTRAC AND FIT AND TORQUE, RETURN RAD GUN AND HYTORQUE TO JMH.	11/03/2022
DZR00016	WO-GTP-126-045	BAD SAMPLE RETURN FOR COOLANT	FIT 5L OF ELC COOLANT EXTENDER TO COOLANT	1.814HRS ADD 5 LITRES OF COOLANT EXTENDER TO COOLANT	10/27/2022

DZR00016	WO-GTP-126-035	LEFT HAND TRACK LOOSE	TENSION LEFT HAND TRACK	1.629HR NOTICED L/H TRACK SLACK, MEASURE 110 + 105 (215MM OVERALL) TIGHTEN TO 85/85 (170MM)	10/20/2022
DZR00016	WO-GTP-125-793	RADIATOR PARTIALLY BLOCKED	SET UP MACHINE AND WASH OUT RADIATOR	CONDUCT JHA SET UP MACHINE AND WASH OUT RADIATOR 1.582HRS	10/14/2022
DZR00016	WO-GTP-125-544	LADDER PINS WON'T RETRACT/LADDER WON'T GO DOWN	INSPECT FOR REPORTED LADDER PINS WON'T RETRACT/LADDER WON'T GO DOWN AND REPAIR AS REQUIRED	INSPECT AND TEST FOR REPORTED LADDER PINS WON'T RETRACT/LADDER WON'T GO DOWN, FOUND THREE WIRES TO LADDER PIN ACTUATOR MOTOR RUBBED THROUGH/BROKEN AND SHORTING ON MOUNT BRACKET, REPAIR/ RE TERMINATE WIRES INTO DEUTCH PLUG, TEST OPERATION, ALL OKAY	10/12/2022
DZR00016	WO-GTP-124-448	REPLACE DAMAGED/LEAKING TRACK LINKS	WRITE UP JHA,M REMOVE GROUSER PLATES, PRESS OUT TRACK PINS AND REPLACE TRACK LINKS, PRESS IN NEW PINS AND INSTALL GROUSER PLATES	1.331HRS MOVE MACHINE OUT OF STORAGE SHED WASH OFF TRACKS REMOVE PIN BUNG PUT PIN IN VACCUME APPLY 3 BOND TO END OF PINS AND RE FILL OIL. INSTALL BUNG, PACK UP WORK AREA, RETURN MACHINE TO WORK.	09/22/2022
DZR00016	WO-GTP-124-301	B Service - Dozer	Service as per attached Service Sheet	1492HRS COMPLETE 500HR SERVICE AS PER SERVICE SHEET.	10/05/2022
DZR00016	WO-GTP-123-668	SERVICE TRANSMISSION	DRAIN TRANSMISSION OIL , CHECK SCREEN , CHANGE FILTERS AND REFILL WITH 50W	1197 HRS DRAIN OIL, PULL SUCTION SCREEN AND INSPECT CONTAINED METAL FLAKES, SHAVINGS AND POINT FLAKES. CLEAN SCREEN. REFIT, CHANGE FILTERS, REFILL WITH OIL. TRANSPORT OIL TO/FROM CONTAINER PORT/KET	09/08/2022
DZR00016	WO-GTP-123-631	TENSION LOOSE TRACKS	MEASURE AND TENSION LOOSE TRACKS TO SPEC	1192 HRS SET UP MACHINE ON PAD, MEASURE TRACKS AND TENTION TO CAT SPEC	09/05/2022
DZR00016	WO-GTP-123-622	ISOLATER FAILED TO ISOLATE MACHINE	DIAGNOSE AND RECTIFY ISOLATION FAULT	1197 HRS FIT NEW ISOLATOR - FAULT RECTIFIED	09/06/2022
DZR00016	WO-GTP-123-565	TRACK PIN/LINK WORN	TRACK PIN/LINK WORN , WESTRAC TO COME IN AND CHANGE LINKAGE	1197 HRS WASH OFF TRACKS, REMOVE GROUSERS, PRESS OUT TRACK PINS. WESTRAC - TRACK PRESS NOT ENOUGH TONNAGE, GO TO JMH PICKUP 200T PRESS, FIND NEXT TRACK LINK ALSO U/S. PRESS OUT NEXT LINK, ASSEMBLE NEW LINKS. PRESS IN PINS AND PPR LOCK RINGS. LAST PICKED UP AND GOT STUCK. PRESS PIN BACK OUT. BUFF LINKS, BUFF ANOTHER OLD OPIN, PRESS PIN IN AND LOCK RINGS. VAC TEST AND OIL PINS, RWFIT GROUSERS. HYTORQUE FITTING STARTED LEAKING, SWAP FITTINGS, STILL LEAKING. SWAP PRESSURE AND RETURN SIDE FITTINGS AND HOSE QUICK COUPLERS. FINISH TORQUING GROUSERS.	09/07/2022
DZR00016	WO-GTP-123-528	REAR VIEW CAMERA DROPPING IN AND OUT	DIAGNOSE AND REPAIR REAR VIEW CAMERA DROPPING IN AND OUT	1161 HRS INSPECT FOR REPORTED REAR VIEW CAMERA DROPPING IN AND OUT. INSPECT CAMERAS AND CABLING/CONNECTIONS FOUND DUAL CAMERA ADAPTOR ON BACK OF FUEL TANK COVERED IN DIESEL. DIESEL INSIDE PLUGS, CLEAN OUT PLUGS WITH CONTACT CLEANER. RECONNECT AND TEST - ALL OK	09/02/2022

DZR00016	WO-GTP-123-521	LHS TRACK WONT DRIVE	INSPECT FOR REPORTED LHS TRACK WONT DRIVE AND REPAIR AS REQUIRED	1194 HRS INSPECT/TEST FOR REPORTED TRACK WONT DRIVE, REMOVE FLOOR PANELS, CONNECT GUAGES TO CONTROL VALVES. WHILE CONDUCTING TEST FAULT DISAPPEARE. INSTALL FLOOR AND RETURN MACHINE TO WORK. RE ATTEND MACHINE WITH RHS TRACK WONT TURN/DRIVE. REMOVE FLOOR CONNECT PRESSURE GUAGES, FOUND RHS STEERING CLUTCH NOT BUILDING PRESSURE. REMOVE SPOOL AND FOUND SPOOL STUCK OPEN WITH A BIT OF METAL. REMOVE METAL, FREE UP SPOOL, REINSTALL TEST OPERATION. ALL OK. REINSTALL FLOOR AND RETURN MACHINE TO WORK	09/05/2022
DZR00016	WO-GTP-123-248	A Service - Dozer	Service as per attached Service Sheet	1197 HRS COMPLETE SERVICE - FOUND LOOSE BOLTS HOLDING BOTTOM ENGINE SIDE PANELS TO CHASSIS AND COOLANT LEAK ON TOP RADIATOR JOINER HOSE	09/07/2022
DZR00016	WO-GTP-123-212	MACHINE RUNNING HOT	DIAGNOSE MACHINE RUNNING HOT FAULT	1129 HRS FABRICATE LANCE/NOZZLE TO GET INTO RADIATOR. WASH OIT RADIATOR - FAUL;T RESOLVED	08/29/2022
DZR00016	WO-GTP-122-756	BLADE THUMB CONTROL ELECTRICAL FAULT	DIAGNOSE AND REPAIR BLADE THUMB CONTROL ELECTRICAL FAULT	1055.9 HRS TEST ALL WIRING, FINDING CORROSION IN IMPLEMENT ECM PLUG, CLEAN CORROSION AWAY WITH VINEGAR. RETEST FAULT - STILL ACTIVE. REPLACE BLADE TILT JOYSTICK RESOLVING FAULT	08/22/2022
DZR00016	WO-GTP-122-609	Smoke Bomb Cab	Smoke bomb cab and reseal if required.	1143 HRS SMOKE BOMB CAB AND SEAL ANY LEAKS WITH SIKAFLEX	08/31/2022
DZR00016	WO-GTP-122-541	RHS TRACK WONT DRIVE/STEER	INSPECT FOR REPORTED RHS TRACK WONT DRIVE/STEER AND REPAIR AS REQUIRED	1004 HRS INSPECT FOR REPORTED RHS TRACK WONT DRIVE/STEER TRY TO CALIBRATE BUT DID NOT SOLVE ISSUE. REMOVE CAB FLOOR, FOLLOW SIS TO CONDUCT PRESSURE TESTS, FOUND RHS STEERING CLUTCH NOT BUILDING PRESSURE, TEST ANS SWAP SOLINOID, THEN SWAP SPOOL FROM RHS TO LHS AND FAULT FOLLOWED, REMOVE RHS SPOOL AND INSPECT FOUND SPOOL STUCK OPEN JAMMED BY A SMSALL PIECE OF METAL, CLEANED OUT METAL, RE INSTALLED SPOOL AND RE TESTED, ALL OKAY RE INSGTALL FLOOR AND RETURNED TO WORK	09/02/2022
DZR00016	WO-GTP-121-786	ADJUST LOOSE TRACKS	MEASURE AND ADJUST TRACKS TO SPEC	919 HRS SET UP MACHINE, MEASURE TRACKS AND FOUND TO BE AT 190MM AND ADJUST TRACKS TO SPEC 150MM COMBINED MEASUREMENT	08/02/2022
DZR00016	WO-GTP-121-568	Dozer 3rd Party Assessment of Track and Undercarriage	3rd Party Assessment of Track and Undercarriage	1273.6 HRS WESTRAC COMPLETED 3rd Party Assessment of Track and Undercarriage 1276 HRS ESCORT WESTRAC, CONDUCT JHA, ASSIST TO CONDUCT TRACK INSPECTIONS. WASH MACHINES AND WAH PAD BEFORE INSPECTION	09/14/2022
DZR00016	WO-GTP-121-094	A Service - Dozer	Service as per attached Service Sheet	876 HRS CONDUCT A SERVICE AS PER SERVICE SHEET	07/25/2022
DZR00016	WO-GTP-121-091	C Service - Dozer	Service as per attached Service Sheet	919 HRS CONDUCT C SERVICE AS PER SERVICE SHEET	08/02/2022
DZR00016	WO-GTP-119-928	WEAR PLATE BROKEN OFF BOTTOM OF DRAFT ARM	INSPECT FOR REPORTED WEAR PLATE BROKEN OFF OF BOTTOM OF LHS DRAFT ARM	671 HRS MOVE MACHINE OUT OF SHED, PUT BLADE UP ON STANDS,INSPECT DRAFT ARMS FOR MORE POSSIBLE WEAR PLATE CRAKS AND INSPECT WHERE WEAR PLATE CRACKED AND BROKE OFF. COLLECT WEAR PLATE PIECE FROM SOUTH END OF SHED. WESTRAC NDT ALL WEAR PLATES AND WELDED NEW PLATE TO DRAFT ARM	07/25/2022
DZR00016	WO-GTP-119-927	TRACKS REQUIRE ADJUSTING	ADJUST TRACKS AS PER SPECIFICATION	671 HRS MOVE MACHINE OUT TO WASH PAD, MEASURE AND ADJUST TRACKS AS PER SPECIFICATION	06/27/2022

DZR00016	WO-GTP-119-864	REAR TOW PIN SEIZED IN TOW POINT	REMOVE SEIZED REAR TOW PIN FROM TOW POINT CLEAN UP SURFACES AND RE INSTALL	659 HRS REMOVED SEIZED REAR TOW PIN FROM TOW POINT CLEAN UP SURFACES WITH WIRE WHEEL AND RE INSTALL PIN WITH ANTI SEIZE	06/26/2022
DZR00016	WO-GTP-119-764	INSPECT BOARDING LADDER FOR FAULT CAUSING LADDER TO LOAD UP BEFORE LOCKING PINS ARE RELEASED	INSPECT BOARDING LADDER FOR FAULT CAUSING LADDER TO LOAD UP BEFORE LOCKING PINS ARE RELEASED	659 HRS INSPCTED BNOARDING LADDER LOADING UP BEFORE LATCH PINS RELEASE. TESTED/INSPECTED WIRING, FOUND NO POWER GETTING TO MOTOR DISABLE RLAY. FOUND WIRE PIN HALF OUT OF DEUTSCH PLUG, REINSTALL PIN AND RE- TEST ALL OK	06/23/2022
DZR00016	WO-GTP-119-437	WORK LIGHT BRACKET SNAPPED	WORK LIGHT BRACKET SNAPPED	612 HRS WORK LIGHT UNDER STEP BRACKED SNAPPED, DRILL AMD MOUNT LIGHT DIRECTLY TO STEP FRAME	06/16/2022
DZR00016	WO-GTP-118-821	CARRY OUT INITIAL ENGINE VALVE SET CHECK AND ADJUSTMET	CARRY OUT INITIAL ENGINE VALVE SET CHECK AND ADJUSTMET	516 HRS CARRY OUT INITIAL ENGINE VALVE SET CHECK AND ADJUSTMET. CARRY OUT INJECTOR HEIGHT CHECK AND ADJUSTMENT	06/04/2022
DZR00016	WO-GTP-118-583	OPERATOR REPORTED TRACK SLAPPING	CHECK AND ADJUST TRACKS TO SPEC	495 HRS CHECK AND ADJUST TRACKS	05/31/2022
DZR00016	WO-GTP-118-522	Fire Suppression Service	Service Fire Suppression System - Contractor to Complete	COMPLETED BY MIDWEST FIRE	06/30/2022
DZR00016	WO-GTP-118-519	Fire Equipment Service	Inspect, test and tag fire equipment - Midwest Fire	COMPLETED BY MIDWEST FIRE	06/30/2022
DZR00016	WO-GTP-118-260	B Service - Dozer	Service as per attached Service Sheet	516 HRS CARRY OUT B SERVICE. RUN MACHINE, REFIT PANELS AND CLEAN UP	06/05/2022
DZR00016	WO-GTP-117-628	QUICK FILL NOT TANKING FUEL AND SHUTTING OFF BEFORE TANK IS FULL	DIAGNOSE QUICK FILL FAULT	364 HRS DISMANTLE BREATHING ASSEMBLY, REMOVE RESTRICTOR SPRING FROM PRESSURE UNIT, ALLOWING GUN TO RUN AT A LOWER PRESSURE. RESOLVING ISSUE	05/18/2022
DZR00016	WO-GTP-117-345	OPERATOR REPORTED HEAVY 2WAY STATIC	DIAGNOSE 2 WAY ISSUE	326 HRS INSPECT 2 WAY, FOUND AUTOMATIC TRANSPONDER SYSTEM ON. TURN OFF, TEST AGAIN, CANT FAULT	05/10/2022
DZR00016	WO-GTP-117-344	OPERATOR REPORTED LOOSE TRACKS	OPERATOR REPORTED LOOSE TRACKS	326 HRS CHECK TRACK TENSION AS PER CAT D11T TRACK TENSION PROCEDURE. TRACKS WERE NOT LOOSE. TRACKS WERE TO FOUND TO BE TIGHT, OUT OF SPEC. ADJUSTED TRACKS TO SPECS. TRACKS WITH CARRIER ROLLER MEASUREMENT A + B AVERAGE 75MM + - 10	05/10/2022
DZR00016	WO-GTP-117-340	Dozer 3rd Party Assessment of Track and Undercarriage	3rd Party Assessment of Track and Undercarriage	516HRS WESTRAC COMPLETED TRACK AND UNDERCARRIAGE ASSESSMENT	06/04/2022
DZR00016	WO-GTP-117-071	POWER TRAIN FILTER PLUGGED	POWER TRAIN FILTER PLUGGED CODE	249 HRS REMOVE FLOOR - INSPECT WIRING ETC. LOOK UP FILTER NUMBER AND ORDER SPARE FILTER. FAULT NO LONGER ACTIVE, GET OPERATORS TO KEEP RUNNING MACHINE. HAS NOT FAULTED AGAIN. CONTINUE TO MONITOR	05/04/2022
DZR00016	WO-GTP-117-070	OPERATORS REPORT MINE 2 WAY SPEAKER NOT WORKIUNG	OPERATORS REPORT MINE 2 WAY SPEAKER NOT WORKIUNG	249 HRS BROKEN WIRE AT BACK OF 2 WAY PLUG, DE-PIN PLUG, SOLDER WIRE TO PIN. TEST - ALL OK	05/04/2022
DZR00016	WO-GTP-117-048	REINFORCE 2 WAY MOUNTING BRACKET	REINFORCE 2 WAY MOUNTING BRACKET	263 HRS MEASURE BRACKET, FABRICATE AND PAINT NEW BRACKET. REMOVE OLD BRACKET, FIT NEW BRACKET TO DOZER	05/12/2022
DZR00016	WO-GTP-117-045	PLATFORM LADDER LOADING UP BEFORE PINS RELEASE TO LOWER LADDER	INSPECT/DIAGNOSE PLATFORM LADDER LOADING UP BEFORE PINS RELEASE TO LOWER LADDER	326 HRS INSPECT LADDER MECHANISM AND CHECL SLS, NO ADJUSTMENT AVAILABLE TO STOP LADDER FROM LOADING UP BEFORE LOCKING PINS RELEASE. CHECK PRESSURE WITHIN SPEC	05/10/2022
DZR00016	WO-GTP-117-044	OPERATOR REPORTED ROUGH GEAR SHIFT FROM REVERSE TO FORWARDS	INSPECT/DIAGNOSE REPORTED ROUGH GEAR SHIFT FROM REVERSE TO FORWARDS	249 HOURS CARRIED OUT DIAGNOSIS OF ROUGH GEAR SHIFT. INSPECTED OPERATION OF DECELERATOR PEDAL - ONLY GOING DOWN TO 1200 RPM. REMOVED AND SPUN DECEL FOOT. STEP 180 DEGREES - TESTED MACHINE FOR EASE OF OPERATION OF DECEL PEDAL. DECEL TO 900 RPM OK	05/04/2022

DZR00016	WO-GTP-116-929	WET COMMISSIONING CHECKS	WET COMMISSIONING CHECKS	COMPLETED COMMISSIONING CHECK	04/19/2022
DZR00016	WO-GTP-116-897	A Service - Dozer	Service as per attached Service Sheet	282 HRS CONDUCT INITIAL 250 HRS (A) SERVICE AS PER SERVICE SHEET. ADJUSTED RHS TRACK. FOUND COOLANT LEAK FROM BOTTOM RADIATOR CROSSOVER HOSE. TIGHTENED CLAMPS - ALL OK	05/01/2022
DZR00016	WO-GTP-116-790	FIRE SUPPRESSION LOW PRESSURE ON GUAGE	TOP UP FIRE SUPPRESSION	MIDWEST FIRE TOPPED UP PRESSURE SO GUAGE IS READING CORRECTLY	04/26/2022
DZR00016	WO-GTP-116-525	FIT EXTENSION SPEAKERS TO UHF RADIO	FIT EXTENSION SPEAKERS TO UHF RADIO	177 HRS FIT TWO WAY EXTENSION SPEAKER TO UHF RADIO, MOUNT TO SIDE OF RADIO BRACKET	04/26/2022
DZR00016	WO-GTP-116-438	NOISE COMING FROM UNDER CAB WHILE TRACKING	NOISE COMING FROM UNDER CAB WHILE TRACKING	228 HRS INSPECTION OF MACHINE FOUND ALL REAR CAB BOLTS FROM FROM FRONT DOORS BACKWARDS MISSING. FIT NEW BOLTS, REMOVE CAB PANELS, BOLTS AND INSTALL CAT M12 10.9 BOLTS TORQUE TO 75 LBFT. RE-INSTALL CAB PANELS	05/01/2022
DZR00016	WO-GTP-116-406	2 WAY WONT TRANSMIT SOMETIMES	2 WAY WONT TRANSMIT SOMETIMES	124 HRS INSPECT 2 WAY FINDING AERIAL HAS BEEN MOUNTED HALF WAY DOWN ROP'S , REMOVE AND REMOUNT ON TOP OF ROP'S RESOLVING ISSUE	04/21/2022
DZR00016	WO-GTP-116-405	ACCESS LADDER WONT RETRACT	ACCESS LADDER WONT RETRACT	124 HRS ACCESS LADDER NOT RETRACTING PROPERLY - CHECK PRESSURES - 1200PI SPEC IS 3000PSI. ADJUST RELIEF VALVE - PRESSURE NOT CHANGING. EXCESSIVE BRASS IN OIL, SUSPECT PUMP FAILURE. WESTRAC TO REPLAIR UNDER WARRANTY	04/21/2022
DZR00016	WO-GTP-115-346	PRE OPERATION FIT OUT AND INSPECTION	FIT CORNER TIPS AND GOANNA BARS TO BLADES , FIT WORK LIGHTS AND MINE 2 WAY ADJUST INCHING PEDALS AND DECELERATOR	95 HRS Fabricate cover plate as per drawings	04/16/2022