

5907 51st Ave Killam, AB T0B 2L0 Phone: 780-385-3993

PROVOST P.O. Box 299 3403 57 Ave Provost, AB T0B 3S0 Phone: 780-753-2278

WAINWRIGHT: 1601 - 23 Street Wainwright, AB T9W 1L2 Phone: 780-842-2171

| Ship To: | | |
|----------|--|--|
|----------|--|--|

Invoice To: BRI CAMROSE INTERNAL

X0X 0X0 . AB

| Branch | | | | | |
|------------|----------|----------|-------|--------|------|
| CAMROSE | | *REPR | INT* | | |
| Date | Time | | | | Page |
| 03/20/24 | 22: | 20:06 | (B) | | 01 |
| Account No | Phone No | | | Inv N | 10 |
| | | | | | |
| Ship Via | | Purchase | Order | | |
| | | | | | |
| Tax ID No | | | | | |
| | | | | | |
| | | | Sales | sperso | n |
| | | | | 137 | |
| | | | | | |

SERVICE INVOICE

STK#/FLEET# HRS PIN/EIN WARRANTY DATE HRS

C015649 727 S790 STS COMBINE 1H0S790SJMT815179 08/02/22

> S790 572 RG6135U033549 HH011 08/01/25 1000 P

GST# 895703353

SEGMENT# 1 C 188 10-900-010 03/08/24 03/08/24

BRI INSPECTION

9.00 HRS

-Unit came with BP15 815254 needs to be swapped with S790 Stk#C015647, s/n 815189

> 1485.00 LABOR

16001000 SEGMENT TOTAL ==> 1485.00

SEGMENT# 2 C 188

FEEDER HOUSE

CORRECTION:

03/12/24 03/12/24

9.50 HRS

Loosened off the feeder chain. Removed the worn out upper chain guides. Installed the new chain guides. and tightened to specification. Rolled feeder chain down to the opening lining the master links up with the front opening. removed the master links. Removed a half link from each chain. reconnected the chain with the master links. tightened links to specification. Removed the damaged feeder slat and replaced with the new feeder slat torqued hardware to specification. Tensioned the feeder chain to the gauge specification. Loosened off the jack shaft bearing and removed. Cleaned up the surface of the shaft. Installed the new bearing and secured into position. Removed the old feeder drive chain, installed the new drive chain. Tensioned the drive chain. Replace the missing sheer bolts from the multi face coupler. Removed the left hand drive shaft to gain access to the shoe auger drive shaft. Loosened off each drive gears and slid out of the way and

CONTINUED ON PAGE 02

| Signature: | | |
|------------|--|--|
| | | |
| | | |



KILLAM: 5907 51st Ave Killam, AB T0B 2L0 Phone: 780-385-3993

PROVOST: P.O. Box 299 3403 57 Ave Provost, AB T0B 3S0 Phone: 780-753-2278

WAINWRIGHT: 1601 - 23 Street Wainwright, AB T9W 1L2 Phone: 780-842-2171

| Ship To: |
|----------|
|----------|

Invoice To: BRI CAMROSE INTERNAL

X0X 0X0 . AB

| в . | | | | | |
|------------|----------|----------|-------|--------|------|
| Branch | | | | | |
| CAMROSE | | | | | |
| Date | Time | | | | Page |
| 03/20/24 | 22: | 20:06 | (B) | | 02 |
| Account No | Phone No | | | Inv N | 10 |
| | | | | | |
| Ship Via | | Purchase | Order | | |
| | | | | | |
| Tax ID No | | | | | |
| | | | | | |
| | | | Sale | sperso | n |
| | | | | 137 | |

SERVICE INVOICE

STK#/FLEET# HRS PIN/EIN WARRANTY DATE HRS C015649 S790 STS COMBINE 727 1H0S790SJMT815179 08/02/22 572 RG6135U033549 HH011 08/01/25 1000 P

replaced the key. Adjusted the backlash on each gear. Tested the back lash on each auger. Reinstalled the drive axle. Replaced the missing shear bolts from the multi coupler.

ADDITIONAL DESCRIPTION:

- -REPLACE FEEDER DRIVE CHAIN (0.75)DA
- -REPLACE HEADER JACK SHAFT BEARING RHS (1.5) DA
- -REPLACE UPPER PLASTIC CHAIN GUIDES (1.5) DA
- -REMOVE 1/2 LINK FROM FEEDER CHAIN (1.0) DA
- -REPLACE SHOE AUGER KEYS (4.0) DA
- -REPLACE BENT FEEDER SLAT (0.5) DA

NA

| -REPLACE MULTI FACE COUPLER | SHEAR BOLTS (0.25) DA | | | |
|-----------------------------|-----------------------|------------------|----------|---------|
| AXE68018 | Bearing With Ho | 1 | 368.95 | 368.95 |
| Bearing With | n Housing | · vanishillings. | | |
| AXE80368 | Link Chain | 1 | 255.59 | 255.59 |
| HXE42402 | Slat : ' ' | 1 N | 84.88 | 84.88 |
| H171960 | STRIP | 4 | 38.60 | 154.40 |
| M48583 | SHAFT KEY | 4 | 15.43 | 61.72 |
| 11M7032 | COTTER PIN | 1 | 1.38 | 1.38 |
| 14M7264 | LOCK NUT | 2 | .74 | 1.48 |
| 19M9326 | HEX SOCK 4MX30M | 2 | 3.02 | 6.04 |
| | | | PARTS | 934.44 |
| | | | LABOR | 1567.50 |
| 16001000 | | SEGMENT | TOTAL==> | 2501.94 |

SEGMENT# 3 C 188

03/12/24 03/12/24

FEED ACCELERATOR

7.50 HRS

CORRECTION:

Removed the serrated wear bars from the supports being replaced. Loosened off the supports and removed the damaged

CONTINUED ON PAGE 03



KILLAM: 5907 51st Ave Killam, AB T0B 2L0 Phone: 780-385-3993

PROVOST P.O. Box 299 3403 57 Ave Provost, AB T0B 3S0 Phone: 780-753-2278

WAINWRIGHT: 1601 - 23 Street Wainwright, AB T9W 1L2 Phone: 780-842-2171

| Ship To: | |
|----------|--|
| | |

Invoice To: BRI CAMROSE INTERNAL

. AB X0X 0X0

| Branch | | | | | |
|------------|----------|----------|-------|--------|------|
| CAMROSE | | | | | |
| Date | Time | | | | Page |
| 03/20/24 | 22: | 20:06 | (B) | | 03 |
| Account No | Phone No | | | Inv N | lo |
| | | | | | |
| Ship Via | | Purchase | Order | | |
| | | | | | |
| Tax ID No | | | | | |
| | | | | | |
| | | | Sales | sperso | n |
| | | | | 137 | |
| | | | | | |

SERVICE INVOICE

STK#/FLEET# HRS PIN/EIN WARRANTY DATE HRS

C015649 S790 STS COMBINE 727 1H0S790SJMT815179 08/02/22

> 572 RG6135U033549 HH011 08/01/25 1000 P

supports. Installed the new supports. Reinstalled the wear bars and tightened all hardware to specification. Reinstalled the feeder house upper cover. Removed the

support located over top of the drive belts. Loosened off the outer belts and removed from the pulley. Installed the new feed accelerator drive belt Reinstalled the other belts previously removed. Tensioned the belts to specification. Reinstalled the support previously removed.

ADDITIONAL DESCRIPTION:

-REPLACE FEED ACCELERATOR DRIVE BELTS (1.5)

| -REPLACE BENT FEED ACCELER | | | | |
|----------------------------|-----------------|---|--------|---------|
| HXE54503 | BELT 3 RIB COGS | 1 | 301.61 | 301.61 |
| HXE84113 | Support | 2 | 337.69 | 675.38 |
| HXE84114 | Support | 2 | 337.69 | 675.38 |
| H137329 | LOCK NUT M12 C | 2 | 2.77 | 5.54 |
| L215374 | | | 5.70 | 11.40 |
| BOLT 12MMX | 35MM 10.9 | | | |
| | 7000000 | | PARTS | 1669.31 |
| | | | LABOR | 1237.50 |

16001000 2906.81 SEGMENT TOTAL ==>

SEGMENT# 4 C 188 NA 03/12/24 03/12/24

LEFT HAND SIDE

11.00 HRS **CORRECTION:**

Removed the drive chain from the clean out cross auger drive. Loosened off the auger drive sprockets and removed. Loosened off the bearing mounting plate and removed cleaned up the end of the shaft of the auger. Installed the new bearing and flange to the mounting plate replaced foam seal around the plate and installed plate into position

CONTINUED ON PAGE 04

| N: 4 | | |
|------------|--|--|
| Signature: | | |
| | | |



KILLAM: 5907 51st Ave Killam, AB T0B 2L0 Phone: 780-385-3993

PROVOST P.O. Box 299 3403 57 Ave Provost, AB T0B 3S0 Phone: 780-753-2278

WAINWRIGHT: 1601 - 23 Street Wainwright, AB T9W 1L2 Phone: 780-842-2171

| Ship To: | |
|----------|--|
|----------|--|

Invoice To: BRI CAMROSE INTERNAL

X0X 0X0 AB

| Dun u ala | | | |
|------------|----------|------------|-------------|
| Branch | | | |
| CAMROSE | | | |
| Date | Time | | Page |
| 03/20/24 | | | |
| Account No | Phone No |) | Inv No |
| | | | |
| Ship Via | | Purchase (| Order |
| | | | |
| Tax ID No | | | |
| | | | |
| | | | Salesperson |
| | | | 137 |
| L | | | 1 |

SERVICE INVOICE

STK#/FLEET# HRS PIN/EIN WARRANTY DATE HRS C015649 S790 STS COMBINE 727 1H0S790SJMT815179 08/02/22 572 RG6135U033549 HH011 08/01/25 1000 P

with the new bearing. Secured bearing to the shaft with the set screws. Reinstalled the drive sprockets and secured into position. Reinstalled the drive chain and tensioned the chain to the gauge. Tightened up the loose hardware on the tie rod. Performed chaffer and sieve opening calibration.

Removed the concaves from the unit and cleaned out debris build up allowing the concaves to bind up slightly. Noticed the front panel was bulging out slightly allowing the concave to catch and prevent it from opening all the was as well. straightened out the panel. Reinstalled the concaves bolted them up into position.

Performed the zero and level procedure on the concaves. Performed the calibration on the concave opening.

ADDITIONAL DESCRIPTION:

-ZERO AND LEVEL CONCAVES (2.5) DA

-CLEAN CONCAVE OF DEBRIS (1.5) DA

-CHAFFER AND SIEVE OPENING CALIBRATION (0.5)

-REPLACE BEARINGS ON CLEAN OUT AUGER (6.0) DA

-TIGHTEN UP HARD WARE ON TIE ROD (0.5) BS

122.38 AXE68514 Ball Bearing 2 N 61.19 H161529 PRESSED FLAN 9.84 39.36 Pressed Flanged Housing PARTS 161.74

LABOR 1815.00 16001000 SEGMENT TOTAL ==> 1976.74

03/12/24 03/12/24 SEGMENT# 5 C 188 NA

CHOPPER

CORRECTION:

1.00 HRS

CONTINUED ON PAGE 05

| N: 4 | | |
|------------|--|--|
| Signature: | | |
| | | |



KILLAM: 5907 51st Ave Killam, AB T0B 2L0 Phone: 780-385-3993 PROVOST: P.O. Box 299 3403 57 Ave Provost, AB T0B 3S0 Phone: 780-753-2278 **WAINWRIGHT:** 1601 - 23 Street Wainwright, AB T9W 1L2 Phone: 780-842-2171

Ship To:

Invoice To:

. AB X0X 0X0

Date

Time
Page

Account No
Phone No
Inv No
Ship Via
Purchase Order

Tax ID No
Salesperson
137

SERVICE INVOICE

STK#/FLEET# HRS PIN/EIN WARRANTY DATE HRS

C015649 S790 STS COMBINE 727 1H0S790SJMT815179 08/02/22

S790 572 RG6135U033549 HH011 08/01/25 1000 P

Loosened off the rear deflector rod and retained hardware. Installed the new rod into position and installed hardware. Tightened hardware to specification.

ADDITIONAL DESCRIPTION:

-REPLACE DAMAGED DEFLECTOR RODS

AXE20424 Barrier 1 N 989.51 989.51

PARTS 989.51 LABOR 165.00

16001000 SEGMENT TOTAL==> 1154.51

SEGMENT# 6 C 188 N

RIGH HAND SIDE CORRECTION:

03/12/24 03/12/24

7.50 HRS

- -PULLED COVER OFF AND BEARING RETAINER BOLTS OFF
- -BEARING WAS SEIZED ON
- -PULLED CHAIN OFF AND SLID GEAR OUT OF THE WAY
- -PUT NEW KEY IN AND SET GEAR ON SHAFT
- -PUT RETAINER AND NEW BEARING ON ALSO A NEW LOCK COLLAR
- -SET CHAIN TO CORRECT TENSION AND REINSTALLED COVERS
- -PULLED COVER OFF AND SLID BEARING OUT
- -LOOSENED CHAIN ON CLEAN GRAIN ELEVATOR AND SLID GEAR OUT OF THE WAY
- -PUT NEW KEY IN AND PUT GEAR ON
- -PUT BEARING AND COVER BACK ON AND TIGHTENED CHAIN TO SPEC
- -REPLACED CHAIN ON RE THRESHER DRIVE
- -REPLACED IDLER SPROCKETS FOR RE THRASHER CHAIN

Removed and replaced the ISO mount applied lock tight to the mounting hardware. Replaced the desiccants located in the activation cameras

ADDITIONAL DESCRIPTION:

CONTINUED ON PAGE 06



KILLAM: 5907 51st Ave Killam, AB T0B 2L0 Phone: 780-385-3993 PROVOST: P.O. Box 299 3403 57 Ave Provost, AB T0B 3S0 Phone: 780-753-2278 **WAINWRIGHT:** 1601 - 23 Street Wainwright, AB T9W 1L2 Phone: 780-842-2171

| Ship To: | |
|----------|--|
| | |

Invoice To:

. AB X0X 0X0

| Time | | | | Page |
|----------|----------|----------------------|--|-----------------------------|
| 22: | 20:06 | (B) | | 06 |
| Phone No | | | Inv N | 10 |
| | | | | |
| | Purchase | Order | | ' |
| | | | | |
| | | | | |
| | | | | |
| | | Sales | sperso | n |
| | | | 137 | |
| | 22: | 22:20:06 Phone No | 22:20:06 (B) Phone No Purchase Order Sales | 22:20:06 (B) Phone No Inv N |

SERVICE INVOICE

STK#/FLEET# HRS PIN/EIN WARRANTY DATE HRS C015649 S790 STS COMBINE 727 1H0S790SJMT815179 08/02/22 S790 572 RG6135U033549 HH011 08/01/25 1000 P -REPLACE KEY ON TAILINGS LOWER SPROCKET (1.5) CB -REPLACE KEY ON CLEAN GRAIN ELEVATOR LOWER SPROCKET (1.5) -REPLACE CHAIN ON RE THRESHER DRIVE (1.0) CB -REPLACE IDLER SPROCKETS (1.0) CB -REPLACE OVER SHOT BEATER ISO MOUNT (1.5) DA -REPLACE ACTIVISION DESICCANT (1.0) DA Idler Sprocket 62.95 125.90 AXE23133 288.09 AXE54619 Roller Chain 1 288.09 AZ10045 ECCENTRIC 1 17.11 17.11 Eccentric Locking Collar H137329 LOCK NUT M12 C 8 2.77 22.16 H150269 1 20.77 20.77 SHAFT KEY 1 JD10384 BRG/ELV/TAIL/98 84.58 84.58 2 KXE10744 296.73 593.46 Desiccant L215374 BOLT 12MMX35MM 8 5.70 45.60 BOLT 12MMX35MM 10.9 T41770 Isolator 75.32 75.32 1272.99 PARTS LABOR 1237.50 16001000 SEGMENT TOTAL ==> 2510.49

SEGMENT# 7 C 188 N.

03/12/24 03/12/24

SERVICE

15.00 HRS

CORRECTION:

Drained the engine oil, removed and replace filter. Filled unit with new oil and marked hours on filter. Removed the old fuel filters and replaced with new filters. Removed the fuel sediment bowl, cleaned out the bowl while removing the filter element from the assembly noticed that the

CONTINUED ON PAGE 07



5907 51st Ave Killam, AB T0B 2L0 Phone: 780-385-3993 PROVOST: P.O. Box 299 3403 57 Ave Provost, AB T0B 3S0 Phone: 780-753-2278 **WAINWRIGHT:** 1601 - 23 Street Wainwright, AB T9W 1L2 Phone: 780-842-2171

| Ship 1 | Го: | |
|--------|-----|--|
| | | |

Invoice To:

. AB X0X 0X0

| Branch | | | | | |
|------------|----------|----------|-------|--------|------|
| CAMROSE | | | | | |
| Date | Time | | | | Page |
| 03/20/24 | 22: | 20:06 | (B) | | 07 |
| Account No | Phone No | | | Inv N | lo |
| | | | | | |
| Ship Via | | Purchase | Order | | |
| | | | | | |
| Tax ID No | | | | | |
| | | | | | |
| | | | Sales | sperso | n |
| | | | | 137 | |

SERVICE INVOICE

STK#/FLEET# HRS PIN/EIN WARRANTY DATE HRS

C015649 S790 STS COMBINE 727 1H0S790SJMT815179 08/02/22

572 RG6135U033549 HH011 08/01/25 1000 P

filter was full of slug, Replaced the filter element. Replaced the hydro drive filter, replaced the hydraulic return filter and replaced the pro drive filter. Removed and replaced the outer engine air filter. Removed and replaced the outer debris management filter. Blown off the filter housing cover. Removed the cab filter blown off the cover and installed the new cab filter. Replaced the cab recirculation filter.

Replaced the oil in the primary counter shaft gear box.

Replaced the oil in the feeder reverser gear box. Replaced

the fuel and DEF tank breathers. Topped up the oil level in

the overshot beater gear box.

Updated the software on the unit.

Tightened the hose clamps located on the lower rad hose.

Topped up the coolant level.

Blown out the cooling package.

ADDITIONAL DESCRIPTION:

- -CHANGE ENGINE OIL AND FILTER (1.0) DA
- -CHANGE FUEL FILTERS (1.0) DA
- -CLEAN OUT FUEL SEDIMENT BOWL (0.5) DA
- -CHANGE OUTER ENGINE AIR FILTER (0.5) DA
- -CHANGE OUTER DEBRIS MANAGEMENT AIR FILTER (0.5) DA
- -CHANGE CAB AIR FILTER (0.5) DA
- -CHANGE CAB RE CIRCULATION FILTER (0.5) DA
- -CHANGE PRIMARY COUNTER SHAFT GEAR OIL (1.5) DA
- -CHANGE FEEDER REVERSER GEAR OIL (1.5) DA
- -CHANGE PRO DRIVE HYDRAULIC OIL FILTER (0.5) DA
- -CHANGE HYDROSTATIC OIL FILTER (0.5) DA
- -CHANGE HYDRAULIC RESERVOIR OIL FILTER (0.5) DA
- -TOP UP OVER SHOT BEATER GEAR BOX (0.5) DA

CONTINUED ON PAGE 08

| Signature: | | |
|------------|--|--|
| | | |
| | | |



KILLAM: 5907 51st Ave Killam, AB T0B 2L0 Phone: 780-385-3993 PROVOST: P.O. Box 299 3403 57 Ave Provost, AB T0B 3S0 Phone: 780-753-2278 **WAINWRIGHT:** 1601 - 23 Street Wainwright, AB T9W 1L2 Phone: 780-842-2171

Ship To:

Invoice To:

. AB X0X 0X0

Branch
CAMROSE

Date
03/20/24

Account No
Phone No
Inv No
Ship Via

Purchase Order

Tax ID No
Salesperson
137

SERVICE INVOICE

| STK#/FLEET# | HRS PIN/EIN | | |
|---|---------------------|-------------|-----------|
| C015649 S790 STS COMBINE | 727 1H0S790SJMT8151 | | |
| S790 | 572 RG6135U033549 H | H011 08/01/ | 25 1000 P |
| -REPAIR COOLANT LEAK ON LOWER HOS | E (1.0) DA | | |
| -TOP UP COOLANT (0.5) DA | _ | | |
| -BLOW OUT COOLING PACKAGE (1.5) D | | | |
| -REPLACE FUEL AND DEF TANK BREATH | , , | | |
| -UPDATE CONTROLLER SOFTWARE (2.0) AH128449 FI | DA LTER HYDRAUL | 1 106. | 106 40 |
| Hydraulic Filter | LTER HYDRAUL | 1 106. | 106.42 |
| —————————————————————————————————————— | LTER HYDRAULI | 1 140. | 84 140.84 |
| Hydraulic Filter | LIER HIDRAULI | 1 140. | 140.04 |
| —————————————————————————————————————— | LTER HYDRAUL | 1 128. | 30 128.30 |
| Hydraulic Filter | | 1 120. | |
| | LTER AIR DEBR | 1 175. | 66 175.66 |
| DEBRIS MANAGEMENT | | " | |
| | LTER FUEL | 1 170. | 52 170.52 |
| | CYC FEE OIL | | 50 1.50 |
| | CYC FEE OIL | | 00 |
| | CYC FEE OIL | | 10 .60 |
| | CYC FEE OIL | | 00 4.00 |
| HXE11090 FI | LTER AIR | | 77 333.77 |
| H216169 FU | EL TANK VENT | 2 29. | 88 59.76 |
| L214634 FI | LTER CAB AIR | 1 34. | 90 34.90 |
| RE284091 FI | LTER CAB AIR | 1 93. | 27 93.27 |
| RE539465 FI | LTER FUEL | 1 135. | 67 135.67 |
| RE572785 FI | LTER ENG OIL | 1 109. | 109.46 |
| R502778 FI | LTER FUEL | 1 37. | 32 37.32 |
| TY26372 80 | W140GL SYN 1L | 2 36. | 99 73.98 |
| TY26408 HD | 460 GL SYN | 4 58. | 58 234.32 |
| TY26576 CO | OL GARD 9.46L | 1 51. | 99 51.99 |
| | W40 PLUS 9.46 | 1 71. | 99 71.99 |
| Plus-50 II Oil 15 | W40 CJ4/SN | | |

CONTINUED ON PAGE 09



STK#/FLEET#

CAMROSE: 4717 38th St. Camrose, AB T4V 3W9 Phone: 780-672-4463

KILLAM: 5907 51st Ave Killam, AB T0B 2L0 Phone: 780-385-3993

WARRANTY DATE

PROVOST: P.O. Box 299 3403 57 Ave Provost, AB T0B 3S0 Phone: 780-753-2278

WAINWRIGHT: 1601 - 23 Street Wainwright, AB T9W 1L2 Phone: 780-842-2171

| Ship To: | |
|----------|--|
|----------|--|

Invoice To: BRI CAMROSE INTERNAL

AB X0X 0X0

| Time | | | | Page | |
|----------|-------|----------------------|--|--|--|
| 22: | 20:06 | (B) | | 09 | |
| Phone No | | | Inv N | No. | |
| | | | | | |
| Ship Via | | Purchase Order | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | Sale | Salesperson | | |
| | | | 137 | | |
| | 22: | 22:20:06 Phone No | 22:20:06 (B) Phone No Purchase Order Sale: | 22:20:06 (B) Phone No Inv N Purchase Order Salesperso | |

HRS

SERVICE INVOICE

PIN/EIN

HRS

| C015649 | S790 STS COMBINE | 727 1H0S790SJM | T815179 | 08/02/22 | | |
|--|---------------------|------------------------|-----------|----------|--|--|
| | S790 | 572 RG6135U033 | 549 HH011 | 08/01/25 | 1000 P | |
| TY26679 | | 15W40 PLUS 18.9 | 2 | 134.99 | 269.98 | |
| | Plus-50 II (| oil 15w40 CJ4/SN | | | | |
| TY6341 | | GREASE | 1 | 11.34 | 11.34 | |
| | SD POLYUREA | GREASE, 140Z: 397G | | | | |
| | | | | PARTS | 2251.59 | |
| | | | | LABOR | 2475.00 | |
| | 16001000 | | SEGMENT | TOTAL==> | 4726.59 | |
| | | | | | | |
| SEGMENT# 8 | C 196 NA | 03/12/24 03/12/24 | | | | |
| HEADER | | | | 2.50 H | IRS | |
| -REPLACE | MISSING AUGER HEIGH | T BUSHINGS (1.5) - Lo | wered | | | |
| auger down, added height bushings. Raised auger back up to | | | | | | |
| spec JB | | | | | | |
| -REPLACE | MISSING HARDWARE OF | I FRONT PICKUP BELT (C |).5) - JB | | ······································ | |
| -ADJUST A | UGER DRIVE CHAIN ((|).5) - JB | | | | |
| HXE120389 | | Sleeve | 4 N | 30.68 | 122.72 | |

H169913 SPRING LOC 1 2.30 2.30 Spring Locking H85934 .95 1.90 BOLT FINGER 1/4 N10217 NUT 1/4" FLANG 2 1.09 2.18 24H1290 2 WASHER .74 1.48

> 412.50 LABOR 16001000 SEGMENT TOTAL ==> 543.08

SEGMENT# 9 C 188 NA 03/12/24 03/19/24

2.00 HRS

130.58

RUN AND CHECK **CORRECTION:**

Ran unit up through all functions and verified full operations. No trouble codes generated during run up.

CONTINUED ON PAGE 10

PARTS

| N: 4 | | |
|------------|--|--|
| Sianature: | | |
| | | |



KILLAM: 5907 51st Ave Killam, AB T0B 2L0 Phone: 780-385-3993 PROVOST:
P.O. Box 299
3403 57 Ave
Provost, AB T0B 3S0
Phone: 780-753-2278

WAINWRIGHT: 1601 - 23 Street Wainwright, AB T9W 1L2 Phone: 780-842-2171

| Ship To: | |
|----------|--|
| - | |

Invoice To:

. AB X0X 0X0

| Branch | | | | | |
|------------|----------|----------------|--------|-------|------|
| CAMROSE | | | | | |
| Date | Time | | | | Page |
| 03/20/24 | 22: | 20:06 | (B) | | 10 |
| Account No | Phone No | | Inv No | | |
| | | | | | |
| Ship Via | | Purchase Order | | | |
| | | | | | |
| Tax ID No | | | | | |
| | | | | | |
| | | | Sales | perso | n |
| | | | | 137 | |

SERVICE INVOICE

STK#/FLEET# HRS PIN/EIN WARRANTY DATE HRS

C015649 S790 STS COMBINE 727 1H0S790SJMT815179 08/02/22

S790 572 RG6135U033549 HH011 08/01/25 1000 P

Installed all safety shields and panels. Parked unit in line up. Unit needs header swapped with sister combine..

LABOR 330.00

16001000 SEGMENT TOTAL==> 330.00

***** WORK ORDER TOTALS *****

CUSTOMER

INTERNAL PARTS 7410.16

LABOR 10725.00

SERV ACCESORIES 100.00

INTERNAL TOTAL 18235.16

| Signature: | |
|------------|---|
| 0.9 | _ |