

KILLAM: 5907 51st Ave Killam, AB T0B 2L0 Phone: 780-385-3993

PROVOST P.O. Box 299 3403 57 Ave Provost, AB T0B 3S0 Phone: 780-753-2278

WAINWRIGHT: 1601 - 23 Street Wainwright, AB T9W 1L2 Phone: 780-842-2171

Ship To:	

Invoice To:

X0X 0X0 . AB

Branch					
CAMROSE		*REPF	*TNI		
Date	Time				Page
01/21/25	22:	20:06	(B)		01
Account No	Phone No			Inv N	No
Ship Via		Purchase	Order		
Tax ID No					
			Sale	sperso	n
				137	

SERVICE INVOICE

STK#/FLEET# HRS PIN/EIN WARRANTY DATE HRS

C016707 1H0S790SPJ0800465 S790 STS COMBINE 1612 08/26/19

> S790 1189 2000

GST# 895703353

SEGMENT# 1 C 188 10-900-010 01/02/25 01/02/25

BRI INSPECTION 11.40 HRS

> LABOR 1995.00

16001000 SEGMENT TOTAL ==> 1995.00

SEGMENT# 2 C 188 01/07/25 01/07/25 NA

FEEDER HOUSE

CORRECTION:

- -REMOVED AXLE TO ACSESS UNDERSIDE OF THE SHAFT
- -REPLACED SHOE AUGER KEYS AND ADJUST BACK LASH
- -LOOSENED EACH ONE AND MOVED GEAR AND REMOVED KEY
- -RESET LASH AND TIGHTENED CLAMP
- -HAD TO REMOVE LEFT SIDE AUGERS TO BE ABLE TO MOVE THE

GEARS ENOUGH TO REMOVE THE KEY

- -REASSEMBLED LEFT SIDE
- -PUT AXLE BACK IN

Freed up the lower sprocket.

Replaced the missing shear bolts located on the multi coupler handle. Removed bearing from lower back shaft, installed new bearing and tightened into place. Changed the reverser gear oil.

ADDITIONAL DESCRIPTION:

- -REPLACE UPPER SPROCKETS (10.0) Removed feeder house onto stand, took out top shaft. Changed sprockets and keys. - JB
- -REPLACE UPPER CHAIN GUIDES (2.0) Changed upper chain quides - JB
- -REPLACE BEARING ON LOWER BACKSHAFT (1.5) KS

CONTINUED ON PAGE 02

20.00 HRS

N: 4		
Signature:		



KILLAM: 5907 51st Ave Killam, AB T0B 2L0 Phone: 780-385-3993 PROVOST: P.O. Box 299 3403 57 Ave Provost, AB T0B 3S0 Phone: 780-753-2278 **WAINWRIGHT:** 1601 - 23 Street Wainwright, AB T9W 1L2 Phone: 780-842-2171

a –	
Ship To:	
p	

Invoice To:

. AB X0X 0X0

Branch					
CAMROSE					
Date	Time				Page
01/21/25	22:	20:06	(B)		02
Account No	Phone No			Inv N	10
Ship Via		Purchase	Order		,
Tax ID No					
			Sales	sperso	n
				137	

SERVICE INVOICE

STK#/FLEET# HRS PIN/EIN WARRANTY DATE HRS C016707 1H0S790SPJ0800465 S790 STS COMBINE 1612 08/26/19 S790 1189 2000 -FREE UP SPROCKET ON LOWER SHAFT (1.0) DA . -REPLACE SHOE AUGER KEYS AND ADJUST BACK LASH (4.0) CB -CHANGE REVERSER GEAR OIL (1.0) - KS --Fill with 4L HD460 -REPLACE MISSING SHEAR BOLTS FOR MULTI COUPLER (0.5) DA 399.55 399.55 AXE68018 Bearing With Ho Bearing With Housing EF4664 RECYC FEE OIL .40 4 .10 186.83 747.32 HXE123463 SPROCKET 4 H156580 SET SCREW 16 5.52 88.32 H171960 127.40 STRIP 4 31.85 H229470 SHAFT KEY 4 16.45 65.80 M48583 SHAFT KEY 4 15.76 63.04 TY26408 HD460 GL SYN 58.58 234.32 11M7032 1 1.47 COTTER PIN 1.47 1727.62 PARTS 3500.00 LABOR 16001000 SEGMENT TOTAL ==> 5227.62

SEGMENT# 3 C 188 NA

01/07/25 01/07/25

FEED ACCELERATOR

CORRECTION:

Loosened off and moved the shielding to remove all the belts. Loosened off all the belts surrounding the feed accelerator drive belt. Removed and replaced the drive belt. Reinstalled all belts previously removed and tensioned the belts, Reinstalled the shielding.

ADDITIONAL DESCRIPTION:

- -REPLACE BENT SUPPORTS X8 (6.0) JB
- -REPLACE DRIVE BELT (1.5)DA

CONTINUED ON PAGE 03

7.50 HRS

N: 4		
Signature:		



KILLAM: 5907 51st Ave Killam, AB T0B 2L0 Phone: 780-385-3993 PROVOST: P.O. Box 299 3403 57 Ave Provost, AB T0B 3S0 Phone: 780-753-2278 **WAINWRIGHT:** 1601 - 23 Street Wainwright, AB T9W 1L2 Phone: 780-842-2171

Ship To:

Invoice To:			
_	AB	xox	0X0

Time				Page
Phone No	ı		Inv N	No.
	Purchase C	rder		
	·	Sales	perso	on
		-	137	
		Phone No	Phone No Purchase Order Sales	Phone No Inv N

SERVICE INVOICE

STK#/FLEET#			HRS	PIN/EIN	WARR	ANTY DATE	HRS
C016707	S790 S	rs combine	1612	1H0S790SF	J0800465	08/26/19	
	S790		1189				2000
HXE54503			BELT 3	RIB COGS	1	326.63	326.63
HXE84113			Suppor	t	4	307.17	1228.68
HXE84114			Suppor	t	4	307.17	1228.68
						PARTS	2783.99
						LABOR	1312.50
		16001000			SEGMENT	TOTAL==>	4096.49

SEGMENT# 4 C 188 NA

01/07/25 01/07/25

LHS

9.00 HRS

CORRECTION:

Changed the primary counter shaft gear oil.

Removed the cross auger drive sprockets, removed the old

bearings and replaced with new parts. Reassembled in reverse order.

Removed the chaffer, Loosened off and removed the

pre-chaffer insert missing the louver. Disassemble the

insert and replaced the missing louvers. Reinstalled the

insert and tightened into place.

Reinstalled the chaffer and secured into position.

Performed the sieve and chaffer opening calibration.

Adjusted the belt tension on the chopper drive belts.

Replaced the tensioner arm and idler pulley. Reinstalled

the belt and shield over the drive belt.

ADDITIONAL DESCRIPTION:

- -REPLACE GRAIN TANK CROSS AUGER BEARINGS (4.0) DA
- -CHANGE PRIMARY COUNTER SHAFT GEAR OIL (1.0) DA
- -REPLACE MISSING LOUVER ON PRE CHAFFER ELEMENT (2.0) DA
- -CALIBRATE CHAFFER AND SIEVE (0.5) DA
- -ADJUST CHOPPER BELT TENSION (0.5) DA
- -REPLACE BLOWER TENSIONR AND IDLER $(1.0)\,\mathrm{DA}$

CONTINUED ON PAGE 04



KILLAM: 5907 51st Ave Killam, AB T0B 2L0 Phone: 780-385-3993 PROVOST: P.O. Box 299 3403 57 Ave Provost, AB T0B 3S0 Phone: 780-753-2278 **WAINWRIGHT:** 1601 - 23 Street Wainwright, AB T9W 1L2 Phone: 780-842-2171

Ship To:	

Invoice T

. AB X0X 0X0

Branch CAMROSE Date Time Page 01/21/25 22:20:06 (B) 04 Account No Phone No Inv No Ship Via Purchase Order Tax ID No Salesperson 137

SERVICE INVOICE

STK#/FLEET#			HRS	PIN/EIN	WA	ARRANI	Y DATE	HRS	
C016707	S790 STS	COMBINE	1612	1H0S790SPJ080	00465	9.0	3/26/19		
	S790		1189					2000	
AH133191			ECCENTR:	IC	2		25.25	50	0.50
	Ecce	entric Lock	ing Colla	ar					
AXE37647			Idler		1	N	272.86	272	2.86
AXE64513			Belt Te	nsioner	1		365.40	365	5.40
EF4664			RECYC F	EE OIL	6		.10		.60
JD39104			BALL BE	ARI	2		60.59	121	1.18
TY26372			80W140G	L SYN 1L	6		43.62	261	1.72
							PARTS	1072	2.26
							LABOR	1575	5.00
	16	5001000			SEGME	ENT TO	TAL==>	2647	7.26

SEGMENT# 5 C 197 CHOPER/SPREADER 01/07/25 01/07/25

9.50 HRS

CORRECTION:

- -FLIPED STATIONARY KNIFE BANK
- -REPLACED EXTRA KNIFE
- -CHECKED KEYS ON SPREADERS, RHS HAS SOME PLAY
- -REMOVED TOP COVER AND CLAMPED THE SPREADERS UP
- -REMOVED THE FLOOR AND THEN REMOVED EACH SPREADER
- -RIGTH SIDE KEY WORE OUT THE MOROTR SHAFT AND THE HUB
- -REPCAED BOTH
- -TEST FIT NEW MOTOR TO HUB AND MADE SURE KEY FIT
- -INSTALLED NEW MOETOR AND SWAPPED OVER FITTINGS
- -SWITCHED OVER ALL REMAINING PARTS ON THE HUB
- -CLEANED UP BOTH SHAFTS AND KEY WAYS
- -PUT NEVER SEIZE ON AND REINSTALLED THE SPREADERS
- -PUT FLOOR BCAK ON AND BOLTED EVERYTHING BACK UP
- -REPLACED INCORRECT HARDWARE AND ADD EXTRA HARDWARE FOR REAR

DEFLECTORS

CONTINUED ON PAGE 05



KILLAM: 5907 51st Ave Killam, AB T0B 2L0 Phone: 780-385-3993 PROVOST: P.O. Box 299 3403 57 Ave Provost, AB T0B 3S0 Phone: 780-753-2278 **WAINWRIGHT:** 1601 - 23 Street Wainwright, AB T9W 1L2 Phone: 780-842-2171

Ship To:	

Invoice To:		
	x0x 0x0	

Branch					
CAMROSE					
Date	Time				Page
01/21/25	22:	20:06	(B)		05
Account No	Phone No			Inv ľ	٧o
Ship Via		Purchase	Order		
Tax ID No					
			Sale	sperso	on
				137	

SERVICE INVOICE

STK#/FLEET# HRS PIN/EIN WARRANTY DATE HRS

C016707 S790 STS COMBINE 1612 1H0S790SPJ0800465 08/26/19

S790 1189 2000

-HAD TO DRILL HOLES FOR ADDED NEW BOLTS

ADDITIONAL DESCRIPTION:

- -FLIP STATIONARY KNIFE BANK (1.0) cb
- -REPLACE EXTRA KNIFE (0.5) cb
- -CHECK KEYS ON SPREADERS, RHS HAS SOME PLAY (6.0)
- -REPLACE INCORRECT HARDWARE AND ADD EXTRA HARDWARE FOR REAR

DEFLECTORS (2.0) cb

AH224093	Wheel	1	71.71	71.71
AXE24027	Disk	1	1424.94	1424.94
AXE47577	Hydraulic Motor	1	1495.75	1495.75
HXE21494	Blade	1	122.67	122.67
JD39102	BALL BEARI	1	33.09	33.09
KK54762	M8 Lock Nut	2	.79	1.58
L77963	Washer	2	7.80	15.60
19M7798	BOLT M8X40 FLNG	1	4.06	4.06
19M7866	8-20 MET	2	2.59	5.18
19M7868	8X30 FLANGE	2	2.74	5.48
49M7061	Shaft Key	1	1.98	1.98
			PARTS	3182.04
			LABOR	1662.50
16001000		SEGMENT	TOTAL==>	4844.54

SEGMENT# 6 C 197 NA

01/07/25 01/07/25

RHS

17.00 HRS

CORRECTION:

- -took bearing cover off and lock collar
- -loosened bearing housing and loosened chain
- -took connector link off and then removed bearing from the shaft
- -removed shaft spacer and moved gear off the key

CONTINUED ON PAGE 06

Signature:		



KILLAM: 5907 51st Ave Killam, AB T0B 2L0 Phone: 780-385-3993 PROVOST: P.O. Box 299 3403 57 Ave Provost, AB T0B 3S0 Phone: 780-753-2278 **WAINWRIGHT:** 1601 - 23 Street Wainwright, AB T9W 1L2 Phone: 780-842-2171

Ship To:	

Invoice To:

. AB X0X 0X0

Branch					
CAMROSE					
Date	Time				Page
01/21/25	22:	20:06	(B)		06
Account No	Phone No			Inv N	lo
Ship Via		Purchase	Order		<u> </u>
Tax ID No					
			Sales	sperso	n
				137	

SERVICE INVOICE

STK#/FLEET# HRS PIN/EIN WARRANTY DATE HRS

C016707 S790 STS COMBINE 1612 1H0S790SPJ0800465 08/26/19

S790 1189 2000

- -REPLACED KEY ON LOWER CLEAN GRAIN SPROCKET
- -put gear back onto the key and put spacer back on
- -put new bearing on
- -and tensioned everything accordingly
- -WELDED UP CRACK ON LOWER CLEAN GRAIN HOUSING
- -took bearing cover off and lock collar
- -loosened bearing housing and loosened chain
- -took connector link off and then removed bearing from the shaft
- -removed shaft spacer and moved gear off the key
- -REPLACED KEY ON LOWER TAILINGS ELEVATOR
- -left chain loose and began removing top key
- -removed the inside bearing and shaft spacer
- -removed shaft and replaced the shaft and gear
- -installed new shaft and made sure of correct gear
- alignment
- -REPLACED KEY ON UPPER TAILINGS ELEVATOR SHAFT
- -put gear back onto the key and put spacer back on
- -put new bearing on
- -and tensioned everything accordingly
- -put cover back on and put paddle chain connector back in and tensioned it to spec
- -REPLACED RE THRESHER DRIVE CHAIN AND IDLER SPROCKETS
- -REPLACED ENGINE ACCESSORY MOUNT BRACKET AND INSTALLED NEW BOLTS
- -REPLACED VAC FAN DRIVE BELT AND IDLER
- -REPLACED ISOLATOR ON OVER SHOT BEATER GEAR BOX MOUNTS
- -FOUND TETIONER PULLEY ARE TO BE BROKE AND NEEDED REMOVAL
- -TO REMOVE IT I HAD TO TAKE THE PULLEY OFF THE GEAR BOX WITH A PULLER

CONTINUED ON PAGE 07





KILLAM: 5907 51st Ave Killam, AB T0B 2L0 Phone: 780-385-3993 PROVOST: P.O. Box 299 3403 57 Ave Provost, AB T0B 3S0 Phone: 780-753-2278 **WAINWRIGHT:** 1601 - 23 Street Wainwright, AB T9W 1L2 Phone: 780-842-2171

Ship To:

Invoice To:

AB X0X 0X0

Branch
CAMROSE

Date
01/21/25

Account No
Phone No
Inv No
Ship Via

Purchase Order

Tax ID No

Salesperson
137

SERVICE INVOICE

STK#/FLEET# HRS PIN/EIN WARRANTY DATE HRS

C016707 S790 STS COMBINE 1612 1H0S790SPJ0800465 08/26/19

S790 1189 2000

- -REPLACED THE PULLEY ON THE GEAR BOX
- -REPLACED THE TENTIONER ARM AND SPRING
- -PUT EVERYTHING BACK TOGETHER AND TIGHTENED BOLTS TO SPEC
- -PUT BELT BACK ON AND TETIONED IT AND ADDED MISSING NUT
- -TOPED UP OVER SHOT GEAR BOX OIL
- -FLIPED WEAR STRIPS ON OVER SHOT BEATER AND ADJUSTED THEM

OUT AS MUCH AS THEY COULD

- -CLEANED CAMERA LENSES
- -ADJUST BELT TENSION

ADDITIONAL DESCRIPTION:

- -REPLACE KEY ON LOWER CLEAN GRAIN SPROCKET (1.5) cb
- -WELD UP CRACK ON LOWER CLEAN GRAIN HOUSING (1.5) cb
- -REPLACE KEY ON LOWER TAILINGS ELEVATOR (1.5) cb
- -REPLACE KEY ON UPPER TAILINGS ELEVATOR SHAFT (2.0) cb
- -REPLACE RE THRESHER DRIVE CHAIN AND IDLER SPROCKETS (1.0)

cb

- -REPLACE ENGINE ACCESSORY MOUNT BRACKET (1.0) cb
- -REPLACE VAC FAN DRIVE BELT AND IDLER (2.0)
- -REPLACE ISOLATOR ON OVER SHOT BEATER GEAR BOX MOUNTS (1.0)

cb

- -TOP UP OVER SHOT GEAR BOX OIL (0.5) cb
- -FLIP WEAR STRIPS ON OVER SHOT BEATER (4.0) cb
- -CLEAN CAMERA LENSES (0.5) cb
- -ADJUST BELT TENSION (0.5)

AH163830	ARM	1 N	307.06	307.06
AH202007	Pulley	1 N	525.56	525.56
AXE23133	Idler Sprocket	2	68.20	136.40
AXE23392	Bearing With Ho	1	266.48	266.48
	Bearing With Housing			
AXE24984	IDLER	1	347.65	347.65
		CONTI	NUED ON PAG	E 08

N: 4		
Signature:		



KILLAM: 5907 51st Ave Killam, AB T0B 2L0 Phone: 780-385-3993 PROVOST: P.O. Box 299 3403 57 Ave Provost, AB T0B 3S0 Phone: 780-753-2278 **WAINWRIGHT:** 1601 - 23 Street Wainwright, AB T9W 1L2 Phone: 780-842-2171

Ship To:	

Invoice To:

. AB X0X 0X0

Time				Page
22:	20:06	(B)		08
Phone No			Inv N	10
	Purchase	Order		
		Sales	sperso	n
			137	
	22:	22:20:06 Phone No	22:20:06 (B) Phone No Purchase Order Sales	22:20:06 (B) Phone No Inv N

SERVICE INVOICE

STK#/FLEET#		HRS PIN/EIN	WARR	ANTY DATE	HRS	
C016707	S790 STS COMBINE	1612 1H0S790SPJ0	800465	08/26/19		
	S790	1189			2000	
AXE54619		Roller Chain	1	247.23	247.23	
AZ10045		ECCENTRIC	1	14.95	14.95	
	Eccentric Lock	ing Collar				
GX21790		Cap Screw	1	27.16	27.16	
HXE11401		Shaft	1	500.71	500.71	
HXE149943		Bracket	1	117.15	117.15	
HXE38073		V-Belt	1	36.92	36.92	
Н150269		SHAFT KEY	1	20.35	20.35	
Н164796		SPROCKET TOP	1	69.14	69.14	
	CLEAN GRAIN EL	EVATOR TOP SPROCKET				
Н26552		COMPRESSION	1	27.26	27.26	
	Compression Sp	ring				
H81462		SPRING	1	10.42	10.42	
JD10384		BRG/ELV/TAIL/98	3	73.98	221.94	
т41770		Isolator	1	75.32	75.32	
11M7015		COTTER/1/8/1	<u> </u>	.61	.61	
11M7079		COTTER PIN	3	.35	1.05	
14M7275		NUT M12	:::::: 1 ::::::	2.59	2.59	
26M4228		SHAFT KEY	1	11.20	11.20	
49M6480		SHAFT KEY	1	6.20	6.20	
				PARTS	2973.35	
				LABOR	2975.00	
	16001000		SEGMENT	TOTAL==>	5948.35	

SEGMENT# 7 C 196 N

01/07/25 01/07/25

SERVICE 15.50 HRS

CORRECTION:

Trouble shoot the operation of the wiper blade operation, Searched diagnostics for the wiper circuit. Located a breakdown of how the circuit works and located a break down

CONTINUED ON PAGE 09

N: 4		
Signature:		



KILLAM: 5907 51st Ave Killam, AB T0B 2L0 Phone: 780-385-3993 PROVOST: P.O. Box 299 3403 57 Ave Provost, AB T0B 3S0 Phone: 780-753-2278 **WAINWRIGHT:** 1601 - 23 Street Wainwright, AB T9W 1L2 Phone: 780-842-2171

Ship To:	

Invoice To:

. AB X0X 0X0

Branch					
CAMROSE					
Date	Time				Page
01/21/25	22:	20:06	(B)		09
Account No	Phone No	ı		Inv N	lo
Ship Via		Purchase (Order		,
Tax ID No					
			Sales	perso	n
				137	

SERVICE INVOICE

STK#/FLEET# HRS PIN/EIN WARRANTY DATE HRS C016707 S790 STS COMBINE 1612 1H0S790SPJ0800465 08/26/19 S790 1189 2000

of what addresses in the specific controller controlled the wiper functions. Pulled up the controller in tech mode and checked out the address settings verified what each address was set at and noticed the address was incorrectly configured telling the unit that there was no wipers installed, changed the address number from 0 to 1 to tell the controller that there is a wiper installed. Checked the operation of the wiper and verified that operation has been corrected. Cleaned out the open threaded holes on the final drive, applied Loctite to the new bolts and tightened to specification. Performed software updates to the controllers needing updates. to perform the display software unit had to have a factory reset to allow storage space to perform the update.

ADDITIONAL DESCRIPTION:

- -UPDATE SOFTWARE (4.0) DA
- -CHANGE ENGINE OIL AND FILTER (1.5) Drained engine oil, changed filter and added oil. JB
- -CHANGE FUEL FILTERS, CLEAN OUT FUEL SEDIMENT BOWL (1.0) -Cleaned sediment bowl with varsol, changed both fuel filters. JB
- -CHANGE HYDRAULIC FILTERS AND HYDRO FILTER (1.0) Replaced old hydro and hydraulic filter. JB
- -CHANGE FUEL AND DEF TANK BREATHERS (0.5) Took off old breathers, put new ones on. JB
- -CHANGE OUTER ENGINE AIR FILTER (0.5) JB
- -CHANGE DEBRIS MANAGEMENT FILTERS INNER AND OUTER (0.5) -
- Changed inner and outer debris filters and cleaned out housing. JB
- -CHANGE CAB FILTER AND RE CIRCULATION FILTER (0.5) JB

CONTINUED ON PAGE 10

Signature:		




KILLAM: 5907 51st Ave Killam, AB T0B 2L0 Phone: 780-385-3993 PROVOST: P.O. Box 299 3403 57 Ave Provost, AB T0B 3S0 Phone: 780-753-2278 **WAINWRIGHT:** 1601 - 23 Street Wainwright, AB T9W 1L2 Phone: 780-842-2171

Ship To:

Invoice To:

. AB X0X 0X0

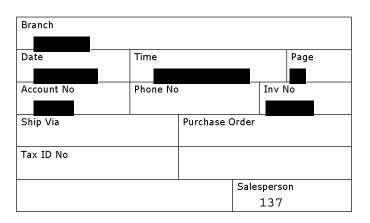

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WAR	RANTY DATE	HRS
C016707 S790	STS COMBINE	1612	1H0S790SPJ0	800465	08/26/19	
S79	0	1189				2000
-ADD BREATHERS	TO FINAL DRIVES (1.0) -	Removed old	cap, pu	t	
-	reathers and insta					
	TS TO FINAL DRIVES					
	LEVEL (0.5) - Ad					
	IVE FILTER (0.5) -	Chang	ed pro drive	filter.		
- JB						
	LIC OIL LEVEL (0.5		/0			
	FUNCTION OF WIPER				105 50	4.05
AH128449			HYDRAUL	1	135.73	135.73
7770000000	Hydraulic Filter			1	1.00	1.50
AN207368			HYDRAULI		179.61	179.61
7 VEL 1 0 0 C 4	Hydraulic Filter		HVDD ATH	1	162.62	1.62.62
AXE12964	Hydraulic Filter		HYDRAUL	· · · · · · · · · · · · · · · · · · ·	163.62	163.62
AXE42065	_		SEC DEBR	1	136.31	136.31
AAE42005	DEBRIS MANAGEMEN			Δ.	130.31	130.31
AXE42066			AIR DEBR	1	213.44	213.44
AAL42000	DEBRIS MANAGEMEN				ZIJ.II	210.14
DZ112918		ILTER		1	217.47	217.47
DZ130550			Element	1	214.05	214.05
EF4662			EE OIL	2	.50	1.00
EF4663	R	ECYC F	EE OIL	6	1.00	6.00
EF4665	R	ECYC F	EE OIL	1	.40	.40
EF4666	R	ECYC F	EE OIL	2	2.00	4.00
HXE11090	F	ILTER .	AIR	1	425.66	425.66
н163561	S	pacer		4	31.41	125.64
н216169	F	UEL TA	NK VENT	2	37.67	75.34
JD5801	P.	RESSUR	E RELIEF	2 N	3.91	7.82
	Pressure Relief	Fittin	g			
L214634	F	ILTER	CAB AIR	1	46.19	46.19
				CON	TINUED ON P	AGE 11

Signature:	



KILLAM: 5907 51st Ave Killam, AB T0B 2L0 Phone: 780-385-3993

PROVOST: P.O. Box 299 3403 57 Ave Provost, AB T0B 3S0 Phone: 780-753-2278

WAINWRIGHT: 1601 - 23 Street Wainwright, AB T9W 1L2 Phone: 780-842-2171

Ship To:

Invoice To:

X0X 0X0 . AB

Branch CAMROSE Date Time Page 01/21/25 Account No Phone No Inv No Ship Via Purchase Order Tax ID No Salesperson 137

SERVICE INVOICE

STK#/FLEET#		HRS PIN/EIN	WARR	ANTY DATE	HRS
C016707	S790 STS COMBINE	1612 1H0S790SPJ0	800465	08/26/19	
	S790	1189			2000
RE572785		FILTER ENG OIL	1	139.60	139.60
TA32591		Air Filter	1	112.22	112.22
TY22062		HY-GARD 10L	1	83.11	83.11
TY26576		COOL GARD 9.46L	1	60.89	60.89
TY26673		15W40 PLUS 3.8	1	37.14	37.14
	Plus-50 II Oil	. 15W40 CK4/SN			
TY26679		15W40 PLUS 18.9	2	159.28	318.56
	Plus-50 II Oil	. 15W40 CJ4/SN			
15H514		PIPE BUSHING	2	19.53	39.06
15Н602		1/2"90 ST ELBOW	2	36.08	72.16
19M7889		CAP SCREW24MX80	4	23.14	92.56
				PARTS	2907.58
				LABOR	2712.50
	16001000	hove and and the second	SEGMENT	TOTAL==>	5620.08

SEGMENT# 8 C 197

NA

01/07/25 01/07/25

9.50 HRS

GRAIN TANK **CORRECTION:**

- -removed loading auger from the bear box
- -began removal of the gear box
- -removed covers and mounting bolts
- -removed dip stick to aid in gear box removal
- -once removed I opened the front cover and began draining
- -disassembled the gearbox
- -once gear box was all broken down I cleaned up all the parts

reinstalled new bearings and bearing races

installed shafts and gears and new seals

-filled with a bit of oil to make sure they hold in the oil

CONTINUED ON PAGE 12



KILLAM: 5907 51st Ave Killam, AB T0B 2L0 Phone: 780-385-3993

113.93

CONTINUED ON PAGE 13

113.93

PROVOST: P.O. Box 299 3403 57 Ave Provost, AB T0B 3S0 Phone: 780-753-2278 **WAINWRIGHT:** 1601 - 23 Street Wainwright, AB T9W 1L2 Phone: 780-842-2171

Invoice To:

. AB X0X 0X0

Branch CAMROSE Date Time Page 01/21/25 22:20:06 (B) 12 Account No Phone No Inv No Ship Via Purchase Order Tax ID No Salesperson 137

SERVICE INVOICE

STK#/FLEET# HRS PIN/EIN WARRANTY DATE HRS C016707 S790 STS COMBINE 1612 1H0S790SPJ0800465 08/26/19 S790 1189 2000

- -cleaned up cover and put rtv on it
- -bolted it on and put a total of 41 in the gear box
- -reinstalled the gear box back into the grain tank
- -bolted it up and reinstalled all covers
- -reinstalled the new auger driver
- -and reinstalled the loading auger
- -took bearing off the auger and straitened the hoop added a deflector washer and reinstalled new bearing $% \left(1\right) =\left(1\right) +\left(1\right) +\left$

ADDITIONAL DESCRIPTION:

- -REBUILD GEAR BOX (8.0) cb
- -CHANGE DRIVER AND NUT (0.5) cb
- -STRAIGHTEN LOAD AUGER BEARING MOUNT (0.5) cb
 -ADD DEFLECTOR WASHER TO END OF AUGER (0.5) cb

-ADD DEFLECTOR	WASHER TO END OF	AUGER (0.5) cb	
AE42998	EXPER. 1. TEXTERNITORS . EXERT	TAPER ROLL BRG	1

	Tapered Roller	Bearing			
AH131860		SEAL	1	61.44	61.44
AH21815		SEAL.AUGER.BOX	1	17.72	17.72
CE21767		Shaft Key	2	6.01	12.02
F40406		Ball Bearing	2	153.39	306.78
HXE127153		Deflector	1	63.52	63.52
HXE84650		DRIVER SGL WIDE	1	168.79	168.79
JD10384		BRG/ELV/TAIL/98	1	73.98	73.98
N31537		Washer	2	9.88	19.76
03M7216		BOLT	2	3.60	7.20
14M7264		LOCK NUT	3	.75	2.25
14M7396		LOCK NUT 8MM	2	2.45	4.90
19М9326		HEX SOCK 4MX30M	3	3.09	9.27
24M7024		WASHER	2	2.88	5.76
49M4821		SHAFT KEY 6MX32	1	4.75	4.75
				PARTS	872.07

N: 4		
Sianature:		



KILLAM: 5907 51st Ave Killam, AB T0B 2L0 Phone: 780-385-3993 PROVOST:
P.O. Box 299
3403 57 Ave
Provost, AB T0B 3S0
Phone: 780-753-2278

WAINWRIGHT: 1601 - 23 Street Wainwright, AB T9W 1L2 Phone: 780-842-2171

Invoice To:

. AB X0X 0X0

Branch				
CAMROSE				
Date	Time			Page
01/21/25				
Account No	Phone No	ı	Inv	No
Ship Via		Purchase C	Order	
Tax ID No				
			Salespers	on
			137	
			1	

SERVICE INVOICE

STK#/FLEET# HRS PIN/EIN WARRANTY DATE HRS

C016707 S790 STS COMBINE 1612 1H0S790SPJ0800465 08/26/19

S790 1189 2000

LABOR 1662.50

16001000 SEGMENT TOTAL==> 2534.57

SEGMENT# 9 C 188 NA 01/07/25 01/07/25

PLATFORM 2.00 HRS

CORRECTION:

Adjusted the auger drive chain tension, adjusted the auger to stripper clearance. Adjusted the belt tension. Replaced the missing hardware from the front deflector.

ADDITIONAL DESCRIPTION:

- -ADJUST DRIVE CHAIN (0.5) DA
- -ADJUST AUGER TO STRIPPER CLEARANCE (0.5) DA
- -REPLACE MISSING BOLT ON FRONT DEFLECTOR (0.5) DA
- -ADJUST BELT TENSION (0.5)DA

03M7183 1.70 1.70 C 8-16 1 14M7298 8MM FLNGE NUT 2.16 4.32 PARTS 6.02 LABOR 350.00 16001000 SEGMENT TOTAL ==> 356.02

SEGMENT#10 C 188 NA 01/07/25 01/15/25 RUN AND CHECK

CORRECTION:

Installed header onto unit. Ran unit up and checked operation of all functions, operation was normal. Installed shields onto unit.

LABOR 350.00 16001000 SEGMENT TOTAL=> 350.00

***** WORK ORDER TOTALS *****

CONTINUED ON PAGE 14

2.00 HRS

N: 4		
Sianature:		



KILLAM: 5907 51st Ave Killam, AB T0B 2L0 Phone: 780-385-3993 PROVOST:
P.O. Box 299
3403 57 Ave
Provost, AB T0B 3S0
Phone: 780-753-2278

WAINWRIGHT: 1601 - 23 Street Wainwright, AB T9W 1L2 Phone: 780-842-2171

Ship To:	

Invoice To:			
	X0X	0X0	

Branch					
CAMROSE					
Date	Time				Page
01/21/25	22:	20:06	(B)		14
Account No	Phone No	ı		Inv N	No
Ship Via		Purchase	Order		
Tax ID No					
			Sale	sperso	on
				137	

SERVICE INVOICE

STK#/FLEET# HRS PIN/EIN WARRANTY DATE HRS C016707 S790 STS COMBINE 1612 1H0S790SPJ0800465 08/26/19

\$790 1189 2000

INTERNAL CUSTOMER

PARTS 15524.93 LABOR 18095.00 SERV ACCESORIES 100.00 INTERNAL TOTAL 33719.93

Signature:		