

ADAPT-A-LIFT GROUP PTY LTD

Service History Listing Active Units

Date: 13/03/2024
Time: 11:07:59AM

For Equipment Code From: H13326 To: H13326
For Date Posted From: All To: All
Don't Show Cost

For Customer Code From: All To: All
For Branch Code From: All To: All

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1548631	DECOMMISSION, REMOVAL AND DAMAGES QUOTE	DHEAD	12/07/2023	External	16890.0	DECOMMISSION, REMOVAL AND DAMAGES QUOTE
1544127	invoice for cancelled JN 1496060-aircon blowing hot air	611 Planning B	23/06/2023	Internal	16890.0	
1531499	Tyre inspection	BIG TRUCK WA	30/05/2023	Internal	16890.0	
1519389	17000 II 1000hr service Hyster Laden Container Handler H117 - 1000hr Service Kit. 1000 Hour Service	611 Planning B	5/04/2023	Internal	16890.0	
1511103	16750 II 250hr service 0250 Hour Service	611 Planning A	2/03/2023	Internal	16763.0	
1510134	Further works	611 Planning B	27/02/2023	Internal	16715.0	
1513264	Wire harness repairs	AWijeweera	10/02/2023	Internal	16874.0	Carry out Inspection and Diagnosis of Electrical System
1505722	16000 II 3000hr service	DHEAD	11/01/2023	Internal	16555.0	Replaced Arm rest wire harness. 3000hr Service 2000hr Service Carry out 16,000hr service Take oil samples Replace engine oil and filter Replace fuel and air filters Replace transmission oil and filters. Calibrate clutch packs and inching. Hydraulic brake filter replaced. Grease up and check mast. Repair Radiator as required,
1505218	coolant filter leaking	DHEAD	5/01/2023	Internal	16555.0	Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Replace leaking coolant filter

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1501788	FL401- needs a new fuel cap	BPIGGOTT	14/12/2022	Internal	16522.0	travel to workshop, order part, travel to site, sign in and see warren. gave fuel cap to warren to fit
						Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,
						Carry out New Equipment Predelivery to correct specification.
1492217	Further works - Replacement joystick & Installation of armrest harness.	DHEAD	1/12/2022	Internal	15920.0	Remove ancillary items and Potentiometer, Replace Potentiometer and Refit to unit, Refit ancillary items,
						Fit new jotstick and calibrate
1470137	Further works; Wear pads, retainers, bolts, nordlock, electro valve stripd and covers.	DHEAD	1/12/2022	Internal	15920.0	Repair Attachment as necessary,
						Replace wear pads and retainers due to cracks through them.
1498148	Replace twist locks	DHEAD	30/11/2022	Internal	15920.0	Replace electrovalves and broken covers.
						Repair Attachment as necessary,
						Fit new twistlocks from service. Service job posted before service was complete.
1497452	FLH401 - Machine stalling when taking a lift	BPIGGOTT	28/11/2022	Internal	15876.0	Adjust twistlocks to spec
						Carry out Inspection and Diagnosis of Attachment
						machine reported to be stalling when lifting.
						travel to site, sign in and go to workshop,
						after speaking to glen and warren they hadnt heard anything about the machine faulting since friday, due to the amount of machines down in there workshop at the moment, they were unable to stand the machine down for me the test any further, and they were happy to leave it in service.
1496060	Air con blowing hot air	611 Planning B	23/11/2022	Internal	15791.0	
1494271	Replace wire harness	611 Planning B	16/11/2022	Internal	15679.0	
1480086	6 Monthly Fire Suppression Service	611 Planning A	14/11/2022	Internal	15245.0	
	Fire Suppression System Service - 6 Months					
1479419	500hr service inc twistlocks Hyster	GSEMILLA	14/11/2022	Internal	15150.0	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
	Laden Container Handler H117 -					Start Service. Change engine oil and filter. Check mast and fit chain lubricator. Lubricate chain. Drop EWP at PN.
	500hr Service Kit. 0500 Hour Service					
						Remove ancillary items and repair Engine Oil Leaks as required, Refit ancillary items,

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1491065	Twist lock issues	GSEMILLA	4/11/2022	Internal	15587.0	Carry out Inspection and Diagnosis of Attachment Repair Attachment as necessary, Diagnos machine with a twistlock issue and losing lights. Start machine, install clamp in the landing pins, test the locking mechanism, ok, but losing a green light when press the unlock button softly. Checked bar sensor and left hand side is losing light. Adjust bar sensor. Ok. Adjust twistlock cylinder. Test ok. Put machine back on service,. Joystick throwing out of calibration code. Recalibrate joy stick. OK,
1489478	Fire Suppression Fault	611 Planning A	28/10/2022	Internal	15539.0	Remove ancillary items and Sideshift Cylinder, Strip, Inspect and report, Reseal Sideshift Cylinder as necessary, Refit Sideshift Cylinder and ancillary items, travel to site, sign in and locate machine. Check side shift and found cylinder bypassing. Remove cylinder and take to work shop. Strip down and get new seals. Reseal and paint. Travel back to site and refit. Test operation. All okay Repair Attachment Cylinder as necessary , Assist dan on side shift cylinder repair. Repair Attachment as necessary,
1487571	Side shift cylinder reseal and inspection.	DHEAD	28/10/2022	Internal	15540.0	
1488412	Twist lock adjustment needed	WCOMLEY	24/10/2022	Internal	15590.0	Travel to site, sign in and inspect unit found twist lock adjustment way out on left side rectified and adjusted right hand side, waited onsite until customer tested on box no further locking issues signed off site

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1485813	customer damage to attachment cylinder	GSEMILLA	20/10/2022	External	15505.0	Remove ancillary items and Attachment Cylinder , Strip, Inspect and report, Reseal Attachment Cylinder as necessary , Pull out cylinder. Washed. Reseal cylinder. Replaced hydraulic hose. Travel to site, Repair Attachment Cylinder as necessary , Replace Attachment Cylinder , Travel to site. Pull out bent cylinder. REmove cat track and hoses. Replaced grease hoses. Refit new cylinder. Refit cat track . Refit both pins. Test machine. Wash. Top up oil. Labour
1484556	H13326- blown 20-40 cylinder hoses and has lost oil	BPIGGOTT	10/10/2022	Internal	15502.0	Travel to site, Repair Attachment as necessary, SStart at PN to organise parts. Order parts and pick to store. Wait for paul hosemaster to make the 20/40 hoses. Travel to site. Sign in and sign up work permit. Set up machine and start doing the job. Pull out pins and cylinders. Replaced hose and cat track. Refit cylinder. Refit mounting bolts. WHen refitting the pin for the t-bar we found out the cylinder is bent. Extend cylinder to see how bent and its really worse. Ring supervisor that the cylinder is bent badly. Inspect t-bar and found there is dent on the Right hand side t-bar. Tag out machine. Pack up and clean work area. Dispose waster and oil.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1484468	H13326- repair hydraulic leak	BPIGGOTT	7/10/2022	Internal	15502.0	Check/Inspect/Diagnose Hydraulic Oil Leak and test operation, unit reported with attachment oil leak, travel to site, sign in and locate machine diagnose oil leak coming from attachment, 20-40 cylinder hose has been split, will require cylinder removal and replace hoses and brackets. travel back to workshop. Labour Travel to site, Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,
1481996	repair hydraulic leak	DHEAD	27/09/2022	Internal	15335.0	Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,
1481789	window popped out from the seal	611 Planning B	27/09/2022	Internal	15330.0	Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,
1481252	TECHNICIAN INITIATED JOB	GSEMILLA	24/09/2022	External	15330.0	Replace Windscreen,
1481087	H13326-Call out	GSEMILLA	21/09/2022	External	15286.0	Call out, travel to site. Sign in and proceed to workshop. Inspect machine. Found the windscreen front window left hand side pop out from the seal. Tagged out machine and inform customer need a glass fitter to secure glass properly, inform senior tech about the machine. Carry out Inspection and Diagnosis of Electrical System Got call out, machine has fault code. E0135 and E435 pertaining to engine oil pressure sensor. Travel to PN to pick up oil pressure sensor and travel to site. Sign in, speak to contact and proceed to machine. Check machine and fault code is active. Replaced sensor, test and ok. Advise site contact that machine is good to go. Overhaul Brakes components as required, Replaced park brake disc, pads and caliper. Supply 4* drive rims Repair Attachment as necessary,
1460480	Damage to park brake after site incident	DHEAD	16/09/2022	External	15228.0	Overhaul Brakes components as required,
1479675	Replace 4* Drive rims	611 Planning B	15/09/2022	External	15228.0	Replaced park brake disc, pads and caliper.
1472665	Further works; Mast cable, filter, filter head, hinges, plates,latches and LED lights	DHEAD	14/09/2022	Internal	14889.0	Supply 4* drive rims
1470639	Further works; oil pressure sensor, speed sensor o-rings, flange, seals, o-rings, wahser, nuts, bearings, lock nuts and pins.	611 Planning B	6/09/2022	Internal	14774.0	Repair Attachment as necessary,

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1470409	15000 II 5000hr service Hyster Laden Container Handler H117 - 5000hr Service Kit. 5000 Hour Service	DHEAD	5/09/2022	Internal	15228.0	5000hr Service Adjust Wheel Bearings to correct specification, Carry out 15,000hr service Replace engine oil and filter Replace transmission oil and filter. Re-torque front and rear wheel bearings Replace diff,plantary and steer hub oils Replace hydraulic oil and filters Replace various hoses, including suction, fan and aux pump pressure hose. Removed armrest harness and check wiring, Wash down machine. Check over Recieve callout for machine throwing hydraulic fault codes and no functions travel to site sign in and locate machine, identify fault calibrate joystick test unit send unit back to service Replace alternator,
1476918	H13326-Call out	BPIGGOTT	4/09/2022	External	15106.0	pick up parts travel to site Replace alternator and batteries
1476685	replace alternator and batteries	DHEAD	2/09/2022	Internal	15089.0	
1472320	15000 II 5000hr service Hyster Laden Container Handler H117 - 5000hr Service Kit. 5000 Hour Service	611 Planning A	30/08/2022	Internal	14871.0	
1474387	check hydraulics overheating. Cleaned coolers, repair oil leak.	DHEAD	24/08/2022	Internal	15150.0	Travel to site and check over unit, Found leakiing hydraulic oil. Repaired leak. No overheating codes present. Wash down coolers as was extremely dirty. adjust potentiometer to correct specification, Check/Inspect/Diagnose Hydraulic Oil Leak and test operation, Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Had a call out 11:30pm 19-08-22 DP world machine break down. Travel to site, Site in and proceed to workshop. Diagnos machine. Fault code H0416 display on the dash. Joy stick out of calibration. Check harness connection. Do manual calibration but won't go through. Connect tablet and calibrate using hyster hydarulic interface program. Ok. ANother report is the oil leak from the hydraulic valve block. diagnos oil leak. Run machine to heat hydraulic oil and inspect where the oil leak came from. Leak found 1 hose in manifold. Replaced O-ring. Test. clean oil stuck in the frame. run machine again. Put machine back on service.
1473594	TECHNICIAN INITIATED JOB	GSEMILLA	20/08/2022	External	14926.0	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1472817	Replace lights	BPIGGOTT	17/08/2022	Internal	15228.0	Replace Light/s
1472662	Further works; Plates, shims, oil seals, spacers, bearing cup & cone, shaft, lower & top anchor, nuts, pins and chains.	611 Planning A	17/08/2022	Internal	14889.0	Replace Front drive lights with nordic lights
1471851	TECHNICIAN INITIATED JOB	GSEMILLA	14/08/2022	External	14851.0	Carry out Inspection and Diagnosis of Attachment
1471277	FM1 antenna required.	DHEAD	11/08/2022	Internal	15228.0	Call out. Travel to site, sign in and proceed to workshop. Machine parked up due to twistlock bar sensor snap. Remove sensor plate mounting. Replaced sensor and adjust correct height, Refit plate. Landing pin sensor mounting is missing. Replaced bolt. Checked all sensor. Tighten bolts as it was loose a little bit. DP guy test on a box. OK. sign off. Repair Visual display unit as necessary,
1471223	having faults on screen and no hoist, lower, etc functions.	DHEAD	11/08/2022	Internal	15505.0	Pick up parts. Antenna not for this unit. Required for H12711, FM1 also not working and antenna had been cut. Once time allows will get new job created. Check fault with machine. Found fault in the fire suppression. E-fire sent out for repairs. VP to add times due to tech online down
1467580	14500 II 500hr service Hyster Laden Container Handler H117 - 500hr Service Kit. 0500 Hour Service	611 Planning A	9/08/2022	Internal	14764.0	Labour Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Travel to site, Repair Attachment as necessary, Pick up parts at store. Need to wait due to parts has not been pick yet. Travel to site. Log in. Performed service. Repair attachment.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1469370	no reverse lights, brake lights are white not red and seat switch is temperamental	DHEAD	3/08/2022	Internal	14725.0	Carry out equipment condition assessment Labour Fit Seat Belt, Change Engine Oil as required, Travel to site and sign in. Set up work area. Check faults wioth machine, found lights where not working with the correct signal. Checked wiring and found that the wires had been installed incorrectly. Wire up lights to correct lights. Test operation. All tail lights working. Check seat switch fault. Couldnt fault at time. Ordered seat belt and seat base. Buckle replaced to spring type as operators have been wrapping belt around the back of seat. 4/8/22. Travel and picked up parts. Borrowed seat belt kit from PN stock until new kit arrives. Travelled to parts and picked up seat base. Travelled to site, sign in, locate machine and move machine to workshop. Replaced seat base and seat belt kit. Replaced engine oil and filter. Topped up grease pods. Labour book on this job number. 1467719
1468000	hydraulics fault	GSEMILLA	28/07/2022	Internal	14630.0	
1467719	brake alarm going off	DHEAD	27/07/2022	Internal	15228.0	Repair Hydraulic Control Valve as necessary , Replace Hydraulic Control Valve, Assist Dan to swap hydraulic nmanifolds both machines and testing. Carry out repaiors to manifold. Run up and test when hot. Machine still losing brake pressure . Email sent to get manifold ordered for H12711 as this is the faulty manifold Repair Hydraulic Control Valve as necessary ,
1466929	Slow slew, side shifting issues - Issue with latch / unlatch intermittently	DHEAD	22/07/2022	Internal	14620.0	Travel to site and sign in, locate machine and fill in paperwork. Check issue with unit. Machine in operation. Checked fault and couldnt get to fault. With talking to the operator side shift and functions slow. Check pressures, all okay. Replace AUX pilot solenoids with second hand ones.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1462536	H13326-Call out	DHEAD	2/07/2022	External	14266.0	Replace Hydraulic Hose/s and ancillary items, travelled to site. Rang Pirtek, remove and replaced both over mast hoses. Fit new hoses and adjust as required. Adjust cable. Clean up oil spill. Wash machine. Function test and put back into operation Top up oil.
1462322	Spreader sideshift not functional. Total travel in both directions being only approx. 80 / 100mm.	WCOMLEY	1/07/2022	Internal	14286.0	Travelled to site, carried out inspection of slow 20/40 cylinder operation and slow side shift operation, removed electro coils and found coils seized to shafts removed whole block and cleaned coils and dissassembled and cleaned spool valves refitted and tested with no fuerther fault on side shift circut operation within spec, the 20/40 slow function as NO GREASE on T bar assemblies and someone had applied hi-tac basically way to much friction causing slow operation greased and operated several times with no further faults
1458734	Replace worn hoses	DHEAD	15/06/2022	Internal	14127.0	Replace Hydraulic Hose/s and ancillary items, REPLACE WORN AND EXTREMELY HARD HYDRAULIC HOSES. REPLACED 3 X PUMP PRESSURE HOSES 1 X BRAKE ACCUMULATOR HOSE 1 X MAIN MANIFOLD TO PARK BRAKE CALIPER HOSE. 1 X MAIN MANIFOLD TO TANK RETURN 1 X CONTROL VALVE TO TANK 1 X FRONT TO BACK OF CONTROL VALVE 2000hr Service
1451255	14000 II 2000hr service.	DHEAD	15/06/2022	Internal	14126.0	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1457111	Brakes Innop and cab alarm too loud	DHEAD	8/06/2022	Internal	12265.0	Carry out equipment condition assessment Repair Brake components as required, -Travel to site and inspect unit, machine has made contact with customer shed. On site tech drove through park brake, and low brake pressure light and alarm on. Tested fine once cold. suspected crack in main brake manifold. Replace brake pads for park brake Replace Hydraulic Control Valve, Replace Hydraulic Valve Section, Travelled to site , carried out brake charge valve block swap like instructed , marked all hosing the same on both machines so install of new valve can be sorted easy , cleaned down and replaced all fitting o-rings with replacements , installed valve block into 13326 travelled to wash bay cleaned unit Carry out Inspection and Diagnosis of Brake System
1455531	Replace t/lock cylinders and test hydraulic functions	EBLAKE	3/06/2022	Internal	14125.0	Replaced hydraulic brake valve assambly. Part fitted to H12711 as per request from JG. Test operation. Parked at workshop ready for service Replace Sideshift Cylinder, Check/Inspect/Diagnose Cylinder Check/Inspect/Diagnose Hydraulic Tilt Valve Section and test operation, travelled to pick up parts , travelled to site carried out replacement of twist lock cylinders and damaged adjusters , adjuster nuts required as they where installed incorectly , missing nordlock washers. carried out test and adjustment , carried out inspection of hydraulic system found unit pressure at 205bar dropping to 170bar and charging back up to 205bar ordered parts required that were in stock travelled to stores and collected . travelled to techs house, travelled to site carried out install of previosly diagnosed parts and newly diagnosed parts , found charge valve o-rings badly damaged replaced complete valve , replaced acc coil , replaced check valve o-rings replaced pressure transducer and replaced filter , unit still intermitatly faulting advised LH seal kit Travelled to site , replaced park brake spool , LH advised to strip other parts from block and inspect valves , could not get a hold of hyster suppourt , carried out pressure adjustments and fault has rectified still suspect valve block is cracked and slightly raised pressure is masking advised to return to service Repair Hydraulic Control Valve as necessary , assist Ethan with diagnosis of hydraulic issues

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1455384	Replace 4 hoses after the call out	611 Planning A	31/05/2022	Internal	14102.0	
1455082	TECHNICIAN INITIATED JOB	WCOMLEY	30/05/2022	Internal	14096.0	Repair Attachment as necessary,
1454941	FLH 401 - Top up Hyd oil + inspect joystick functions	DHEAD	30/05/2022	Internal	14127.0	Call out inspect slow functions greased T bars as where binding and carried out a trans calibration as requested by operator. please refer to email sent 31-5-22 Top up Hydraulic Oil to correct level, Carry out Inspection and Diagnosis of Electrical System Pick up trailer and travel to site. Check level and top up. Check fault with functions. Losing calibration. Re calibrate and check wiring. Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,
1454736	TECHNICIAN INITIATED JOB	DSHARLAND	27/05/2022	Internal	14070.0	traveled to site signed in located unit on site concern - unit has bad hydraulic oil leak from main control valve cause - cleaned down area to locate leak found big high pressure flange leaking due to failed oring removed hose replaced oring washed down and retested found 1x steering hose still leaking pirtek to attend in the am
1451759	Supply new fuel cap	DHEAD	17/05/2022	External	13908.0	
1450487	Fault showing engine oil light & transmission	BPIGGOTT	12/05/2022	Internal	13840.0	Travel to site,
1450248	Transmission fault T5304	DHEAD	11/05/2022	Internal	13908.0	travel to site travel back to workshop due to machine not faulting, Repair Transmission as necessary,
1450128	Replace drive tyres	611 Planning A	11/05/2022	Internal	13837.0	13841 Hrs Travel to site and sign in, locate machine and fill out permit to work. Set up machine and carry out inching adjustment and calibration. Test inching and fault code not re-appearing
1446344	Complete Further repairs after delivery to site.	DHEAD	22/04/2022	Internal	14630.0	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Labour Repair Light/s
1433114	TRANSPORT AND MOBILISATION @ DP WORLD FREMANTLE WA	DHEAD	21/02/2022	External	13809.0	H13326 - TRANSPORT AND MOBILISATION (DEMOBILISATION) OF UNIT AT FREMANTLE WA - KERRY GRACE

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1394514	DE-HIRE, DECOMMISSION AND REMOVAL OF UNIT	BIG TRUCKS QLD	6/08/2021	External	12419.0	DISMANTLE AND REMOVAL OF UNIT FROM TENNYSON
1383729	H13326: Replace Drive Tyres * 4 & Drive Rims * 4 (new rims) -	411 Planning A	19/07/2021	External	12419.0	
1384394	Scheduled Service - 13,500hr service II 500hr type. - parts ord 24/06	411 Planning A	6/07/2021	Internal	12419.0	
1375701	H13326: FM1/ Telemetry not reporting - please investigate further.	411 Planning A	2/07/2021	Internal	12419.0	
1386416	Adjust twist lock proxy sensor	DBDENNING	1/07/2021	Internal	13564.0	Travel to site,
						Repair Attachment as necessary,
						Travel to site, find faulty landing pin sensor, replace sensor with part on site
1386415	Repair Hydraulic leak & clean machine	AFLOWERS	1/07/2021	Internal	13564.0	
1385225	H13326 - Drain diesel tank and get weld repairs done	BIG TRUCKS QLD SUB	25/06/2021	Internal	13564.0	Repair Attachment as necessary,
						Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,
						Drain tank, firespot welder, refill tank
1379576	H13326: Replace Steer Tyres * 2 & Steer Rims * 2 (new rims) - 1545 Hours Achieved on steer tyres & rims.	411 Planning A	24/06/2021	External	13523.0	
1373859	Scheduled Service - 13,250hr service II 250hr type.	411 Planning A	10/06/2021	Internal	12419.0	
1379945	H13326 - Handbrake not holding even after engine is turned off	DBDENNING	1/06/2021	Internal	12419.0	Carry out Inspection and Diagnosis of Brake System
1378561	Trans fault code	DBDENNING	25/05/2021	Internal	12419.0	
1378310	H13326: Call out to site on 20/5/21 - Remove container pins that had become lodged in Pos 2 & 5 tyres.	411 Planning A	20/05/2021	External	13256.0	
1375509	H13326 - Slew has ceased to function on unit	JNAUMANN	10/05/2021	Internal	12419.0	Travel to site,
						Repair Attachment as necessary,
						Travel to site, inspect and find slow wires in over mast hose broken, replace with spare wires in harness, test-all ok
						Check unit for slew not working, joystick lost calibration, found damaged over mast wiring, repair. return unit to servic.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1372407	H13326 - No lift	DBDENNING	27/04/2021	Internal	13054.0	Repair Attachment as necessary,
1370519	H13326 - Transmission output shaft seal leaking, wear pads on attachment are broken, park brake pads need replacing	DBDENNING	15/04/2021	Internal	12950.0	Adjust twistlocks, re-calibrate joystick Repair Transmission as necessary,
1361331	Scheduled Service - 12,500hr service II 500hr type .Level B Service	DBDENNING	15/04/2021	Internal	12951.0	Re-seal transmission output shaft o'ring, replace p/brake pads, replace broken wear pad bolts Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1368093	H13326 - Forktrack not updating. Pls contact Mike at Speedshield on 0458 405 016 when inspecting unit.	DBDENNING	12/04/2021	Internal	12951.0	Carry out service Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,
1367382	Tilt sometimes does not work	ESOTOMAYOR	30/03/2021	Internal	12437.0	Find antenna and GPS wires pulled out of plug, refit and ring speedshield-now reporting hours Travel to site,
1366094	Faulty wiper motor	ESOTOMAYOR	29/03/2021	Internal	12489.0	Carry out Inspection and Diagnosis of Electrical System Report to David at the office, get access to unit, established safe work area, Tilt sometimes doesn't work, operate unit to get out the fault, calibrate joystick, test functionality, unit return to service. Informed office that unit is up and running. Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,
1366448	H13326 - Blown hose on the head	DBDENNING	25/03/2021	Internal	12753.0	Fitted new wiper motor ass'y, tested motor, found wiper motor is just clicking and not rotating, travel to workshop pinch out wiper motor from F4, travel back to site, replace wiper motor, tested and wiper motor found ok. Report to spare parts for wiper motor replacement.(Part NO1493332) Travel to site, travel to workshop, fit replacement part wiper motor assembly to F4 in workshop. Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Remove blown hose, source from pirtek, replace hose, degrease and wash

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1365862	H13326 - No lights front right on mudguards	DBDENNING	23/03/2021	Internal	12743.0	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Replace 3x faulty lights and inspect horn not working-find air hose fallen off compressor, refit and test 250hr Service
1359941	Scheduled Service - 12,250hr service II 250hr type.	DBDENNING	12/03/2021	Internal	12480.0	Carry out service adjust potentiometer to correct specification, Receved callout at 17:50pm Travel to site, Locate unit, make safe work area Inspect unit - joystick losing calibration, swap joystick with tagged out F3 and calibrate, test operation-all ok, Return unit to service
1361265	Out of Hours Callout - Unit displaying error codes H0416, H0216	DBDENNING	1/03/2021	External	12461.0	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,
1357525	H13326 - Seat height adjuster missing	DBDENNING	11/02/2021	Internal	12250.0	Refit adjuster knob Remove and Replace Reverse buzzer, Refit to unit,
1355667	H13326 - Reverse alarm too loud	DBDENNING	3/02/2021	Internal	12203.0	Remove reverse buzzer from F4 and fit to unit Replace Switch/es
1354940	Hydraulic faults	DBDENNING	1/02/2021	Internal	12113.0	Multiple hydraulic functions having intermitten issues, travel to w/shop and get joystck from F4, return to site and fit, go back to w/shop and fit faulty joystick to F4
1349788	Scheduled Service - 12 Monthly Fire Suppression Service Fire Suppresion Service; LOP type; Level 2 - 12 monthly. Fire Suppression System Service	411 Planning A	29/01/2021	Internal	11978.0	
1302455	Damaged Battery Box and Steps	DBDENNING	22/01/2021	External	12113.0	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Pick parts up from w/shop Travel to site Locate and isolate unit Use forklift to change out running board, fender and steps Replace damaged panels Replace battery box tray All batteries and misc items removed and changed to new running board. Test unit - all ok Return to service
1353087	H13326 - Weld repairs to cracks in mast and attachment	DBDENNING	21/01/2021	Internal	12000.0	Repair Attachment as necessary, Firespot welder

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1352849	H13326 - Computer not working. Switch with computer from F5 (H10209) as per request from customer.	DBDENNING	20/01/2021	Internal	12000.0	Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Swap computer and ariel between units, test with operator through yard-still dropping out, inspect and find damaged antenna cable, repair and test-all ok Pick parts up, carry out service
1346882	Scheduled Service - 12,000hr service II 3000hr type.	DBDENNING	20/01/2021	Internal	12113.0	
1350531	H13326 - Attachment functions are slow	DBDENNING	8/01/2021	Internal	12113.0	Adjust Hydraulic Pressure Settings to correct specification, Check/adjust pressures at main control valve, attachment manifold block Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,
1350243	H13326 - Horn is not working and computer continually drops out as it travels down the pad	DBDENNING	7/01/2021	Internal	12150.0	Check wi-fi antenna to VM1-all ok, replace blown fuse for horn
1349800	Unit has sprung a hydraulic leak and is parked up	AIRIPA	5/01/2021	Internal	11978.0	
1346582	H13326 - Unit has no horn, scales dont work, its not speed limited, seat doesnt raise and lower	DBDENNING	4/01/2021	Internal	11978.0	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Carry out Inspection and Diagnosis of Transmission Find faulty horn compressor and replace, try to adjust speed limiting-wait on phone with IT support while updating software-tablet still unable to connect Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items,
1347226	Hydraulic oil leak	DBDENNING	16/12/2020	Internal	11995.0	Re-seal leaking fitting on control valve, remove main manifold and re-seal leaking plug on bottom Prepare For Hire - Field
1345293	TRANSPORT AND MOBILISE UNIT AT TENNYSON	DBDENNING	8/12/2020	Internal	12457.0	Remove ancillary items and Mast, Strip, Inspect and report, Travel to site, Refit Mast and ancillary items, Refit Carriage and ancillary items, Fit Fleet Management System as required, Labour

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1332463	Refit missing parts, check functionality of unit, prepare for rental	AIRIPA	7/10/2020	Internal	11588.0	Travel to site, Refit Hydraulic Control Valve and ancillary items , travel to site, refit manifold and hose up, fit apc, fit frame controller Labour pick up parts Refit Hydraulic Pump and ancillary items, pick up parts Prepare For Hire - Field refit hyd pump fittings, fill hyd tank, fit manifold pressure reliefs, replace batteries, reassemble unit try start unit, bypass forktrack, test and found unit had no brakes, replace relif valve and unit test fine
1319486	sublet credit, JN 1293157 - Cummins Core deposit	411 Planning D	10/08/2020	Internal	11971.0	
1309296	DECOMMISSION AND REMOVE UNIT FROM QUBE POB - TRANSPORT & CRANE CHARGES TO BE ADVISE	AFLOWERS	24/07/2020	External	11971.0	DECOMMISSION AND DISMANTLE OF UNIT
1314829	CARRY OUT CUST DAMAGE REPAIRS ON THE UNIT, FOUND DURING THE DE-HIRE & TYRE INSPECTION	BIG TRUCKS QLD	20/07/2020	External	11581.0	CARRY OUT CUST DAMAGE REPAIRS, FOUND DURING THE DE-HIRE & TYRE INSPECTIONS
1302570	Scheduled Service - 11,750hr service II 250hr type.	JNAUMANN	17/06/2020	Internal	11731.0	250hr Service
1303081	Losing attachment functions	JNAUMANN	3/06/2020	Internal	11700.0	Carry out Inspection and Diagnosis of Attachment Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Repair Attachment as necessary, Travel to site test operation finf no rotation on attachment , carry out test on wiring and find wiring harness on top of attachment need of repairs strip back and carry out reapiers as needed, test still not working. carry out mroe checks and find only 19volts going to pcb, trace fault back to over mast cable need to come back and look at it again run out of time

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1298489	Seatbelt is faulty	ESOTOMAYOR	15/05/2020	Internal	11568.0	Travel to site, Repair Seat Switch Wiring, Fit Seat Belt, Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1292333	Scheduled Service - 11,500hr service II 500hr type. Level B Service	ESOTOMAYOR	14/05/2020	Internal	11478.0	
1294879	Broken hose, hose guard missing - Customer Damage	ESOTOMAYOR	1/05/2020	External	11347.0	1000hr Service Replace Hydraulic Hose/s and ancillary items, Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Locate machine Make safe work area Conduct inspection of machine Found Over mast hosing ripped off and found damaged fitting - customer damage, Replaced hose assembly and fitting, Installed new hose guard. Tested unit - all ok Returned to service
1294238	Job raised to capture oils used on 5000hr service that were not booked to original job - JN 1151218	BIG TRUCKS QLD	29/04/2020	Internal	11315.0	
1293157	Unit has a diesel leak - please inspect ASAP	ESOTOMAYOR	24/04/2020	Internal	11512.0	Repair Fuel Line as necessary, Repair Fuel Pump, Carry out Inspection and Diagnosis of Electrical System Steam clean equipment as necessary. Fuel leak on fuel pump, repaired fuel pump, replace seal of shut-off solenoid. Replace Fuel Pump, Labour Seals are replaced once and it looks like it is a repeated failure. Must be worn solenoid valve housing and fuel pump housing. Removed fuel pump assembly, clean pump gasket that attached to engine block, remove fuel line fittings and fitted to new pump. Fitted fuel pump. Test run engine at low idle and high rpm with load. No leaks found. Unit back to service.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1287980	Scheduled Service - 11,250hr service II 250hr type.	JNAUMANN	23/04/2020	Internal	10964.0	250hr Service
1292322	Adjust lift chains	JNAUMANN	21/04/2020	Internal	11098.0	Adjust Lift Chain to correct specification,
1286013	FW - Replace chains, replace wear pads & brackets, snapped bolts in brackets, attachment and carriage need welding	ESOTOMAYOR	23/03/2020	Internal	10966.0	Adjust Lift Chain to correct specification, Repair Attachment as necessary, Set-up cherry picker, counted links on lift chains, (62 Links) attachment inspection found broken brackets part no 6990436 and missing wear pads 1332310. Extracted broken bolts for wear pad retainers using welding, not successful need to drill and use easy out tool. Check/Inspect/Diagnose Hydraulic Oil Leak and test operation, Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Steam clean equipment as necessary.
1285616	2 x missing wheel nuts, 2 x missing wheel studs, 1 x cleat	JNAUMANN	20/03/2020	External	10965.0	Replace Lift Chain, Carry out Inspection and Diagnosis of Wheel Remove ancillary items and Remove Drive Wheel from unit, Locate H13326 Make safe work area Check over unit Found wheel clamp, wheel stud and 2 nuts missing, Found thread stripped, Arrange contractor Assist contractor onsite, Require wheel off to repair, Contact MB organise for wheel fitter for 24.03.20 8am, Told contractor to come back in morning to repair . Carried out repairs as necessary Arrange wheels to be re-fitted Test machine - all ok Return unit to service Clean work area and remove rubbish from site Repair Hub/s as necessary, 1000hr Service
1280993	Scheduled Service - 11,000hr service II 1000hr type. Level C Service	JNAUMANN	20/03/2020	Internal	10965.0	
1279286	Scheduled Service - 10,750hr service II 250hr type.	JNAUMANN	10/03/2020	Internal	10817.0	250hr Service

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1272936	Scheduled Service - 10,500hr service II 500hr type. Level B Service	JNAUMANN	19/02/2020	Internal	10624.0	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Check/Inspect/Diagnose Hydraulic Oil Leak and test operation,
1275490	Blown over-mast hydraulic hose	CDIRUSSO	7/02/2020	Internal	10503.0	Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, TRAVEL TO PICK UP CHERRY PICKER, TRAVEL TO SITE, inspect leak, found on overmast hose, set up cherry picker, remove hoses take to pirtek, travel back, fit hoses replacing orings, clean unit and windscreen, test all okay, take cheery picker back Check/Inspect/Diagnose Hydraulic Oil Leak and test operation, Remove ancillary items and Hydraulic Hose/s, inspect and report, Replace Hydraulic Hose/s and ancillary items, Diagnose oil leak, found hose has been hit by customer, remove attachment hoses and bracketts, take hoses down to pirtek, new hoses made up return to site, fit new hoses and spiral wrap, refit stauff clamps, clean up, load and function test - ok.
1272713	Blown a hose	JNAUMANN	29/01/2020	External	10370.0	Informed customer of damage and they were to send purchase order number through., Mechanic JNAUMANN replaced order number Q74150 with TBC Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Carry out Inspection and Diagnosis of Brake System Overhaul Brakes components as required, Block up unit, Adjust brakes and handbrake, Check for park brake jammed on, found solenoid faulty, picked up new one from db, travel to site, fit new solenoid, adjust park brake, recommend fitting new pads at next service. Load and functin test - ok. Return unit to sevice.
1270457	Park brake not disengaging	JNAUMANN	20/01/2020	Internal	10266.0	
1262163	3 Monthly Wash	411 Planning C	15/01/2020	Internal	9810.0	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1262164	Scheduled Service - 10,000hr service II 5000hr type. Level F Service	JNAUMANN	14/01/2020	Internal	9810.0	Labour Travel to site, 5000hr Service Replace Hydraulic Hose/s and ancillary items,
1265719	Over-Mast Hydraulic Hose Rupture RH Slew	DBDENNING	19/12/2019	Internal	9765.0	Attachment supply hoses crushed, extract broken bolts in carriage, remove hoses, wait for pirtek to supply, fit new hoses and stauff clamps, test, clean oil spill on site. Labour
1262091	Greaseline broken	JNAUMANN	9/12/2019	Internal	9815.0	Check/Inspect/Diagnose Hydraulic Oil Leak and test operation, Replace Hydraulic Hose/s and ancillary items, CHECK FOR LEAK, FOUND GREASE HOSE BLOWN ON ATTACHMENT, REMOVE, TAKE TO PIRTEK, RETURN TO SITE, FIT NEW HOSE. LOAD ND FUNCTION TEST - OK. RETURN UNIT TO SERVICE.
1256390	Scheduled Service - 9750hr service II 250hr type	411 Planning C	5/12/2019	Internal	9507.0	
1242808	Scheduled Service - 9000hr service II 3000hr type. Level E Service	JNAUMANN	25/11/2019	Internal	9487.0	3000hr Service
1252620	Operator reporting loss of lift/lower function. Error codes: LE501, LE300, HO401	JNAUMANN	4/11/2019	Internal	9487.0	Carry out Inspection and Diagnosis of Attachment Repair Attachment as necessary, Carry out Inspection and Diagnosis of Electrical System
1245997	Scheduled Service - 9250hr service II 250hr type	411 Planning C	4/11/2019	Internal	8919.0	
1240916	Scheduled Service - Fire Suppresion Service; LOP type; Level 1 - 6 monthly. Fire Suppression System Service	411 Planning C	1/10/2019	Internal	8645.0	
1239499	3 Monthly Wash	411 Planning C	27/09/2019	Internal	8570.0	
1239498	Scheduled Service - 8750hr service II 250hr type	411 Planning C	27/09/2019	Internal	8570.0	
1242976	Funny noise driver thinks it's either the gearbox or diff	AIRIPA	24/09/2019	Internal	8768.0	Carry out Inspection and Diagnosis of Transmission diagnose unit noise, found transmission slipping from 3rd to 4th, order trans, cut out 4th gear Replace alternator,
1238358	Check Charge Rate and Batteries	JNAUMANN	5/09/2019	Internal	8590.0	replace alternator, check charge rate, return to service Grease All Points on Unit,
1236548	Top Up Grease Pots	JNAUMANN	29/08/2019	Internal	8590.0	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1220258	Scheduled Service - 8000hr service II 2000hr type. Level D Service	411 Planning C	23/08/2019	Internal	7816.0	Labour 2000hr Service perform 2000hrs service
1200835	3 Monthly Wash	411 Planning C	9/08/2019	Internal	6973.0	3 Monthly Wash
1221724	Field Service Bulletin - FPI 18-807	BIG TRUCKS QLD	28/07/2019	External	7420.0	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, fit fire blanket to unit
1225967	Inspect Wheel studs	JNAUMANN	19/07/2019	Internal	8023.0	Carry out Inspection and Diagnosis of Drive Axle
1210914	Scheduled Service - 7750hr service II 250hr type.	JNAUMANN	12/07/2019	Internal	7420.0	Scheduled Service - 7750hr service II 250hr type 250hr Service
1223966	Fault code EE300. Machine stuck in 2nd gear when holding a container.	CDIRUSSO	11/07/2019	Internal	7923.0	Repair Switch/es Repair Steer Axle as necessary, G117E01634M
1223578	Fault code EE300. Machine stuck in 2nd gear when holding a container.	CDIRUSSO	11/07/2019	Internal	7923.0	
1218555	20-40 Mode not always working. Grease hose broken LH steer	JNAUMANN	24/06/2019	Internal	7825.0	Carry out Inspection and Diagnosis of Attachment Repair Attachment as necessary, Remove and replace joystick, calibrate joystick, load and function test - ok. Return unit to service.
1203690	Scheduled Service - 7500hr service II 500hr type. Level B Service	411 Planning A	28/05/2019	Internal	7083.0	Scheduled Service - 7500hr service II 500hr type. Level B Service Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1210153	Cracks on attachment	BIG TRUCKS QLD SUB	22/05/2019	Internal	7362.0	Cracks on attachment
1199047	Scheduled Service - INTERIM SAFETY CHECK- 7250hrs	411 Planning C	6/05/2019	Internal	6880.0	Scheduled Service - INTERIM SAFETY CHECK- 7250hrs Service job missed, job has been cancelled. Next service job has been brought forward. Jas Hayer- NMP 23/5/19.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1203121	Air Con not working	JNAUMANN	24/04/2019	Internal	7098.0	Air Con not working Repair Air Conditioner as necessary, TRAVEL TO SITE CARRY OUT TEST AND TRACE FAULT BACK TO BLOWER MOTOR, REMOVE AND REPLACE TEST OPERATION ALL OK Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Head frame won't raise or lower Repair Attachment as necessary,
1201700	Head frame won't raise or lower	JNAUMANN	16/04/2019	Internal	7027.0	
1195308	Scheduled Service - 7000hr service II 1000hr type. Level C Service	RDASS	16/04/2019	Internal	7019.0	Carry out Inspection and Diagnosis of Mast/Carriage Scheduled Service - 7000hr service II 1000hr type. Level C Service 1000hr Service
1200144	No Lights	AFLOWERS	10/04/2019	Internal	6935.0	collect oil and other material for service No Lights Replace Light/s CHECK UNIT OVER FIND LIGHTS NOT WORKING REPLACE FAULTY LIGHTS
1199733	Issues with the 20/40 mode	RDASS	9/04/2019	Internal	7057.0	Issues with the 20/40 mode Carry out Inspection and Diagnosis of Attachment Check/Inspect/Diagnose Cylinder Check and diagnose fault 20/40 switch , and order parts . Replace brake shoe/s, Remove and Replace Direction Switch, Remove and Replace Park Brake Pads , Remove and Replace 20 / 40 switch .

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1193835	Scheduled Service - INTERIM SAFETY CHECK- 6750hrs	JNAUMANN	1/04/2019	Internal	6923.0	Scheduled Service - INTERIM SAFETY CHECK- 6750hrs 250hr Service 5000hr Service carried out safety checks, topped up grease pots, grease as required, tourqe the wheel nuts, blow out air cleaner, drivers cabin, cabin filter and inter cooler, radiator and other coolers. Ordered parts for futher work. Hand brake jammed
1195705	Hand brake jammed	JNAUMANN	26/03/2019	Internal	6660.0	Carry out Inspection and Diagnosis of Brake System Adjust Handbrake/Park Brake travel to site, check for park brake locked on, test park brake switch, got unit to release brake. drive to work area, remove solenoid, found water scale over them, cleaned up, refit, test - ok. New solenoid and spool valve ordered. Brakes locking up
1193465	Brakes locking up	CDIRUSSO	18/03/2019	Internal	6630.0	Travel to site, Carry out Inspection and Diagnosis of Brake System hand brake engaging on friday, test drive all ok, check solenoid found water in plug, clean grease and retest all ok Weight gauge not working
1193107	Weight gauge not working	JNAUMANN	15/03/2019	Internal	6804.0	Check/Inspect/Diagnose Cylinder Repair Brake components as required, REMOVE AND REPLACE PARK BRAKE SOLENOID Scheduled Service -
1189725	Scheduled Service - Fire Suppresion Service; LOP type; Level 2 - 12 monthly.	411 Planning C	14/03/2019	Internal	6435.0	
1183923	Scheduled Service - 6500hr service II 500hr type. Level B Service 6500hr service II 500hr type . Level B Service	JNAUMANN	8/03/2019	Internal	6517.0	Scheduled Service - 6500hr service II 500hr type. Level B Service Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1187235	No Attachement fuction	AFLOWERS	21/02/2019	Internal	6306.0	No Attachement fuction Adjust Attachment to correct specification , No red light on attachment, check over and find prox sensor out of adjustment adjust up, all working fine INTERIM SAFETY CHECK- 6250hrs Completed on the 14/2/19, labour booked on further works job,
1176343	INTERIM SAFETY CHECK- 6250hrs	NPRICE	14/02/2019	Internal	5857.0	Work done by James Naumann. 3 Monthly Wash 250hr Service Repair Attachment as necessary, Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Steam clean equipment as necessary. perform inpection, remove broken wear pad bolts and replace, wash unit, load and function test - ok
1176333	3 Monthly Wash	411 Planning C	14/02/2019	Internal	5857.0	Scheduled Service - 6000hr service II 3000hr type. Level E Service 3000hr Service carry out 3000hr sm Travel to site, Labour Pick service kit/oils up, travel to site, start service, drop pumps back at qube. Service not complete-sent to breakdowns INTERIM SAFETY CHECK- 5750hrs 250hr Service 250sm
1181321	Repair blown transmission hose	BIG TRUCKS QLD SUB	1/02/2019	Internal	6100.0	
1171259	Scheduled Service - 6000hr service II 3000hr type. Level E Service	DBDENNING	22/01/2019	Internal	6000.0	
1166851	INTERIM SAFETY CHECK- 5750hrs	CDIRUSSO	27/12/2018	Internal	5640.0	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1171388	Not going into reverse	JNAUMANN	18/12/2018	Internal	6100.0	Carry out Inspection and Diagnosis of Transmission Ordered new fwd/ rev lever 18/12/18. Replace Transmission Control Lever,
1171195	Oil Leaks	DBDENNING	17/12/2018	Internal	5638.0	Adjust Transmission Control Valve to correct specification , Remove ancillary items and Repair Hydraulic Oil Leak as necessary. Refit ancillary items, Steam clean equipment as necessary.
1164774	Scheduled Service - 5500hr service II 500hr type. Level B Service	JNAUMANN	17/12/2018	Internal	5625.0	Re-seal leaking fittings on control valve, degrease and wash unit. Scheduled Service - 5500hr service II 500hr type. Level B Service Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Error codes E-SHE & E-7102
1167281	Error codes E-SHE & E-7102	NPRICE	4/12/2018	Internal	11124.0	Carry out Inspection and Diagnosis of Electrical System drain water trap and plug in. inspect dpf system on truck. suspect pressure sensor module faulty. retest machine, ok. INTERIM SAFETY CHECK- 5250hrs
1156876	INTERIM SAFETY CHECK- 5250hrs	JNAUMANN	28/11/2018	Internal	5295.0	250hr Service Perform check, check fluids, top up grease, tighten loose fitting. load nf function test - ok 3 Monthly Wash
1156875	3 Monthly Wash	JNAUMANN	28/11/2018	Internal	5295.0	Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Steam clean equipment as necessary. Fit bolts to steps as had come out, degrease and wash unit

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1164763	Error code 4006 / Joystick issue	JNAUMANN	26/11/2018	Internal	5295.0	Error code 4006 / Joystick issue Carry out Inspection and Diagnosis of Transmission Repair Transmission Control Lever as necessary , Check error code, vheck select lever and wiring, found pin not all the way in, refit lever and plug. Load and function test ok. Scheduled Service - 5000hr service II 5000hr type **Inc Twistlocks**. Level F Service 5000hr Service Overhaul Drive Axle components as required , Strip and re tension drive axle hub bearings . remove and strip hubs, perform hub nut tension, reassemble and top up oils, remove all waste oils, wait for tyres to be fitted, retension wheel nuts Repair Wheel/s as necessary, retension wheels Perform service, extra time going getting hydraulic oil 205l drums in vand and then having to pump out oil and taking off sote back to qube site. Extra time as no forklift on site to do hubs.
1151218	Scheduled Service - 5000hr service II 5000hr type **Inc Twistlocks**. Level F Service	JNAUMANN	5/11/2018	Internal	5196.0	Wear pad has fallen out LHS spreader Travel to site, Repair Attachment as necessary,
1158349	Wear pad has fallen out LHS spreader	DBDENNING	2/11/2018	Internal	4006.0	Travel to site, remove broken bolt and refit wear pad. Repair Drive Tyre/s as necessary, retension wheel nuts
1156434	Check & Retention 4 Drive Wheel	AIRIPA	26/10/2018	External	4868.0	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1154148	Needs new wiper blades, Front, back and top please	JNAUMANN	18/10/2018	Internal	4841.0	Needs new wiper blades, Front, back and top please Repair Windscreen Wiper as necessary, Replace Windscreen Wiper, Check for no front wipers, found nuts were loose, remove wiper assy and check splines, some wear, refit wiper assy, function test ok. INTERIM SAFETY CHECK- 4750hrs 250hr Service
1144731	INTERIM SAFETY CHECK- 4750hrs	JNAUMANN	15/10/2018	Internal	4741.0	perform 250 service CAMPAIGN: INSTALLATION OF TYRE DEFLATION WARNING DECALS
1152738	CAMPAIGN: INSTALLATION OF TYRE DEFLATION WARNING DECALS	411 Planning C	12/10/2018	Internal	4708.0	
1149858	Handbrake stuck on & Slew not working	AIRIPA	3/10/2018	Internal	4573.0	Handbrake stuck on Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, inspect unit, order parts Block up unit, Adjust brakes and handbrake, Check/Inspect/Diagnose Cylinder Carry out Inspection and Diagnosis of Attachment
1149772	TECHNICIAN INITIATED JOB	AJOHNS	3/10/2018	External	4569.0	Repair Attachment as necessary, TECHNICIAN INITIATED JOB Check/Inspect/Diagnose Cylinder machine reported as having park brake locked on, travelled to site, signed in, diagnosed faulty parkbrake, tested all electrics all ok, found that park brake solenoid had died, customer required the forklift as backup unit is down, backed off park brake started tested all ok Scheduled Service - 4500hr service II 500hr type. Level B Service
1143856	Scheduled Service - 4500hr service II 500hr type. Level B Service	JNAUMANN	2/10/2018	Internal	4613.0	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. carry out service, get further works job as well

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1140600	Scheduled Service - Fire Suppresion Service *SUBLET TO QTEC*; LOP type; Level 1 - 6 monthly. Fire Suppression System Service	411 Planning C	12/09/2018	Internal	4056.0	Scheduled Service -
1140343	INTERIM SAFETY CHECK-4250hrs	AIRIPA	12/09/2018	Internal	4309.0	Scheduled Service - INTERIM SAFETY CHECK-4250hrs 250hr Service
1129231	Scheduled Service - 4000hr service II 2000hr type. Level D Service	411 Planning C	23/08/2018	Internal	3392.0	perform 250hrs check Scheduled Service - 4000hr service II 2000hr type 2000hr Service
1138800	Twistlocks need adjusting	DBDENNING	21/08/2018	Internal	3937.0	Travel to site, Twistlocks need adjusting Travel to site, Repair Attachment as necessary, DBD-Travel to site, inspect and find l/h twistlock need adjusting, adjust and test on box. Twistlock vylinder rod mushroomed and now out of adjustment-parts ordered. 3 Monthly Wash Steam clean equipment as necessary.
1127567	3 Monthly Wash	AFLOWERS	9/08/2018	Internal	3846.0	wash unit Scheduled Service - Scheduled Service - 3750hr service II 250hr type. Level A Service 250hr Service
1127550	Scheduled Service - 3750hr service II 250hr type. Level A Service	AFLOWERS	9/08/2018	Internal	3846.0	perform 250hrs service Missing tags on fire suppression system
1129977	Missing tags on fire suppression system	BIG TRUCKS QLD SUB	18/07/2018	Internal	3392.0	Jimmy from QTEC will send out service tech to fit new tags Further works (Following service 1120750)
1129961	Further works (Following service 1120750)	BIG TRUCKS QLD SUB	18/07/2018	Internal	3392.0	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1120750	Scheduled Service - 3500hr service II 500hr type (inc 250hr). Level B Service	AIRIPA	18/07/2018	Internal	3532.0	Scheduled Service - 3500hr service II 500hr type (inc 250hr). Level B Service Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. JN Perform 500hr service as per instructions. Found damaged hoses, call pirtek to come out and replace> Adjust mounting point for hose clamp lower mast to stop from hitting.
1120690	Replace trans return hose	BIG TRUCKS QLD SUB	15/06/2018	Internal	3083.0	perform 500hrs service Replace trans return hose
1114874	Scheduled Service - 3000hr service II 3000hr type. Level E Service	JNAUMANN	14/06/2018	Internal	3091.0	Scheduled Service - 3000hr service II 3000hr type 3000hr Service clean out vans prepare oils for service perform 3000hrs service perform 3000hrs service
1119703	Wear pads have come out of the spreaders	NPRICE	13/06/2018	Internal	3044.0	JN AI Perform 300ohr service, replace leaking transmission return ghose, adjust lights. Wear pads have come out of the spreaders Repair Attachment as necessary, Carry out Inspection and Diagnosis of Transmission inspect and found rear wear pad fallen out. block n tackle extn beam up and refit wear bracket. loctite bolts. retorque all other wear pad bolts. trans leaking oil. found both filters leaking. replaced both filters. stauff clamps for hoses not refitted correctly yesterday . swapped out clamps and refitted. tested operation ok.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1119206	Blown hose	AJOHNS	12/06/2018	Internal	3022.0	Blown hose Replace Hydraulic Hose/s and ancillary items, diagnosed blown hose on attachment, found to be overmast to attachment hose, removed and capped hose, had pirtek come out and make replacement, fitted new hose secured all wiring grease lines and hydraulic lines, started tested all ok
1110305	Scheduled Service - 2750hr service II 250hr type. Level A Service	AFLOWERS	24/05/2018	Internal	2753.0	Scheduled Service - 2750hr service II 250hr type 250hr Service carry out 250hr service and replace missing indicator on left twist lock, test operation all ok
1111630	Blown Hydraulic Hose	JNAUMANN	16/05/2018	Internal	2645.0	Blown Hydraulic Hose Check/Inspect/Diagnose Hydraulic Oil Leak and test operation, Remove ancillary items and Hydraulic Hose/s, inspect and report, Replace Hydraulic Hose/s and ancillary items, Check/Inspect/Diagnose Cylinder Labour Top up Hydraulic Oil to correct level, Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, Travel to site, check over unit, found mast hoses blown due to overtighten of stauff clamps from factory. Travel to get EWP, return to site set up EWP, Remove mast hoses and hose clamps up mast, pirtek make up new hosing, refit new hoses, due to larger diameter hose require new clamps travel to site get new hose clamps, return to site, fit new hose clamps, re-route hosing and electrical cabling, refit electrical plugs, top up hydraulic oil, load and function test ok
1108650	Scheduled Service - 3 Monthly Wash.	JNAUMANN	9/05/2018	Internal	2573.0	Scheduled Service - 3 Monthly Wash Steam clean equipment as necessary.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1103429	Scheduled Service - 2500hr service II 500hr type **Refer to Notes** Level B Service	AFLOWERS	9/05/2018	Internal	2574.0	Scheduled Service - 2500hr service II 500hr type **Refer to Notes** Please note the 2250hr service II 250hr type was missed due to planning error. Jas Hayer- NMP 17/4/18. Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Field Service Bulletin - BT_PTSB_030(1)
1101565	Field Service Bulletin - BT_PTSB_030(1)	BIG TRUCKS QLD	18/04/2018	External	1900.0	Mechanic JNAUMANN replaced order number CM 171211-000030 with CM 171211-00003
1097563	Scheduled Service - 2000hr service II 2000hr type. Level D Service	411 Planning C	12/04/2018	Internal	1900.0	Repair Transmission as necessary, Scheduled Service - 2000hr service II 2000hr type 2000hr Service lubricate chains and inspect mast, chains at 0.02% Carry out 2000hr service as per sheet
1097443	Refer job 1083609	411 Planning A	23/03/2018	External	1900.0	Scheduled Service - 1750hr service II 250hr type Carry out Inspection and Diagnosis of Attachment Repair Attachment as necessary, Repair Mast as necessary, check for lights damage, found attachment light bracket broken, repair and order new bracket, repair bent mast hose arm
1091720	Scheduled Service - 1750hr service II 250hr type. Level A Service	411 Planning C	23/03/2018	Internal	1650.0	
1094705	Headframe stopped working last night. Could be low on oil Started working again once cooled down	AJOHNS	15/03/2018	Internal	1882.0	250hr Service Headframe stopped working last night. Could be low on oil Started working again once cooled down Load software as required to calibrate the unit, Adjust Inching Valve to correct specification , diagnosed joystick functions not working, found that joystick had gone out of calibration, calibrated joystick tested all ok, checked inching adjusted pedal and calibrated inching pedal tested all ok

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1091005	Campaign 024b: BT-PTSB_024b - Qube Naitonal Speed Limit Campaign - H117 Standard Units	DBDENNING	15/03/2018	Internal	9285.0	Campaign 024b: BT-PTSB_024b - Qube Naitonal Speed Limit Campaign - H117 Standard Units Qube have initiated a campaign to speed limit equipment on rent from Adaptalift, in a uniformed approach Nationally. All units within this campaign should have Vehicle Speed Reduction (VSR) system fitted to the truck. This system is identified by Proximity switches mounted to the outer channel of the mast the tilt cylinder, and also 2 "Slewed Rearward" sensors mounted on the push/pull/rotation cylinders. Adjust Fleet Management System as required,
1090818	FM1 Connectivity Issues	CDIRUSSO	8/03/2018	Internal	1900.0	Carry out speed reduction campaign FM1 Connectivity Issues This truck has been identified as having FM1 connectivity issues as it is not registering Telemetry readings . Please investigate further and rectify issues. Jas Hayer- National Maintenance Planner 1/3/18.
1085611	Scheduled Service - 1500hr service II 500hr type. Level B Service	JNAUMANN	1/03/2018	Internal	1436.0	Carry out Inspection and Diagnosis of Telemetry System Scheduled Service - 1500hr service II 500hr type Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1090534	Blown Hose	JNAUMANN	28/02/2018	External	1650.0	Blown Hose Replace Hydraulic Hose/s and ancillary items, Replace hose to valve block on attachment. Check/Inspect/Diagnose Cylinder Remove ancillary items and Hydraulic Hose/s, inspect and report, Repair Attachment as necessary, Travel to site check for blown hose, found hose from lower mast to attachment has been squashed, reort it to Chris and Dave. Remove hose, clamps, greass lines, pirtex make up new hose, refit hose and associated parts, test no leak. Dave came down asked to do tests, we checked lug on container on attachment is ok, possible what has happened driver has either parked up unit with mast up and has hit container, or has come into container to pick up box mised holes nd hit container. Pictures sent to Chris b, rob r
1083389	Scheduled Service - 1250hr service II 250hr type. Level A Service	AFLOWERS	13/02/2018	Internal	1449.0	Scheduled Service - 1250hr service II 250hr type 250hr Service
1084488	RATTLE / KNOCKING NOISE COMING FROM FORK LIKE SOMETHING IS LOOSE	AFLOWERS	7/02/2018	Internal	1308.0	RATTLE / KNOCKING NOISE COMING FROM FORK LIKE SOMETHING IS LOOSE Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, Check unit over find rattle in cabin when driving, strip down tighten up bolts retest noise gone
1083609	Repalce Wiper Motor	JNAUMANN	2/02/2018	Internal	1270.0	Carry out Inspection and Diagnosis of Electrical System Repair Windscreen Wiper as necessary, carry out dignostics of elecrical sytem for wiper motor, remov roof panel check for power to wiper motor, tracel problem back to bent pin in in harness, repair pin, refit and test, ok

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1075923	Scheduled Service - 1000hr service II 1000hr type. Level C Service	JNAUMANN	22/01/2018	Internal	1270.0	Scheduled Service - 1000hr service II 1000hr type **Please note this service is being done a little bit behind schedule due to this truck not being patched to the correct area. 250hr service completed on 4/1/18.** Jas Hayer-NMP 4/1/18. 1000hr Service Travel to site, carried out 1000hr service as per checklist Check/Inspect/Diagnose Cylinder
1075668	Sideshift Issues	JNAUMANN	10/01/2018	External	1006.0	Replace joystick on unit and test operation, Scheduled Service - 750hr service II 250hr type 250hr Service
1071718	Scheduled Service - 750hr service II 250hr type	JNAUMANN	5/01/2018	Internal	931.0	perform sevice, top up tranny and engine oil. Load and function test - ok Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,
1073880	Speed Limit Testing	NPRICE	19/12/2017	Internal	806.0	carried out speed check with brad remotely. Adjust Hydraulic Tilt Cylinder to correct specification , Check unit over and find right cylinder had come losse and wound out abit, tried to adjust but tool broke when adjusting, try to find another tool at sites buut couldnt find any, order another tool. Carry out Inspection and Diagnosis of Attachment Adjust tilt cylinder on right side, test operation all ok. Also replace joystick with test one to see if fix problem. T Cullen 9/1/18 - Adjustments are not covered under warranty beyond 90 days or 500 hours.
1070699	Tilt Cylinder needs adjusting	AFLOWERS	7/12/2017	Internal	694.0	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1065935	Scheduled Service - 500hr service II 500hr type	JNAUMANN	6/12/2017	Internal	641.0	Scheduled Service - 500hr service II 500hr type Travel to site, Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. Travel to site and carry out service, NOTE TILT CYLINDER NEEDS ADJUSTING travel to site, perform 50hr service, found tilt rhs cylinder out require tool to adjust No mast functions
1063736	No mast functions	DBDENNING	14/11/2017	Internal	384.0	Carry out Inspection and Diagnosis of Attachment Repair Hydraulic Control Card/Controller Carry out Inspection and Diagnosis of Mast/Carriage Inspect hyd fault codes, calibrate joytick and test. Check unit over, no function with joy stick, Codes on dash h416 h216. plug in tablet. check controller recalibration for joy stick again, test all functions. NOTE IF UNIT PLAYS UP AGAIN WILL NEED TO RAISE WITH TECH SURPORT.
1059709	Scheduled Service - 250hr service II 250hr type	AFLOWERS	10/11/2017	Internal	325.0	hook up via tablet took photo of dtc and details of truck, carried out calibration Scheduled Service - 250hr service II 250hr type 250hr Service Carry out Inspection and Diagnosis of Telemetry System Repair Fleet Management System as required, Carry out 250hr service, Also check forktrack operation, plug back in and test operation, get unit to play up, trace fault back to wiring plug that goes into cabin, repair as needed, test operation all seems ok.
1060503	install lights on attachment	DBDENNING	2/11/2017	Internal	259.0	Carry out service Install Light/s

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1059161	increase speed limiting	JNAUMANN	30/10/2017	Internal	238.0	Adjust Fleet Management System as required, hook up tablet, check speed on unit 15kmh. Adjust to 16kmh as per customer request, check nd drive unit overmast cables fallen off
1057851	overmast cables fallen off	DBDENNING	25/10/2017	Internal	188.0	Repair Hydraulic Hose/s as necessary, travel to site found inner hydraulic overmast cable has come off roller , set up ewp, reatacch hose, adjust bracke loand nd function test, Refit Hydraulic Hose/s and ancillary items, Recheck hose again find off rollers , get picker and go up and refit, test operation and find hoses twisting off roller , lossen hose free twist, test again all good, Head frame won't go up or down and no tilt
1056992	Head frame won't go up or down and no tilt	DBDENNING	23/10/2017	Internal	185.0	Load software as required to calibrate the unit, Blow water out of plugs on attachment sensors, calibrate joystick, test operation.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1054173	Unit is cutting out	AJOHNS	12/10/2017	External	77.0	Carry out Inspection and Diagnosis of Telemetry System Repair Fleet Management System as required, diagnosed machine cutting out found sequencing error, further diagnostics foud aulty relay, had chris di russo supply relay , replaced relay tested all ok Carry out Inspection and Diagnosis of Electrical System Repair Main Electrical Control Panel as necessary, Diagnosed machine cutting out, unit powered up normally but joystick had lost calibration (H0116,H0216, H0316 H0416, calibrated joystick and tested all ok, went through fault codes, found t_con, t_sht T3100, H4601, These codes relate to power supply lower than 5v for excessive time, checked alternator charge and condition all ok, checked batteries load tested batteries all ok, checked fuses found 125amp fuse retaining nut loose (refer to images) checked continuity on fuse posts found that it was possible to get no continuity in the right position, retensioned nuts started tested no issues have operator test unit, no issues unit returned back to work
1053302	Has Shut down in middle of yard won't restart	AJOHNS	10/10/2017	Internal	38.0	Mechanic AJOHNS replaced order number 2028846 with Warranty Diagnosed machine stopped, pulled seat up and bypassed seat switch fm1 would not activate, inspected fm1 relays, found poor position of relay bank causing relay to sit slightly ajar, relocated tested all ok
1052860	FAULT twistlocks not locking	AJOHNS	9/10/2017	Internal	33.0	Repair Attachment as necessary, diagnosed twist lock issue, inspected all sensors and stops all ok, found grease system was not supplying enough grease, ran on tested mode all ok, tested machine twist locks are working
1097655	Additional Sublet charge missed on original Job # 1003469	BIG TRUCKS QLD	21/09/2017	Internal	1900.0	Additional Sublet charge missed on original Job # 1003469

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	
Owner: ADAP001						
Equip. Code: H13326		Description: HYSTER H52.00XM-16CH				
Make: HYSTER		Model: H52.00XM-16CH		Serial No.: H117E01620R		
1003469	Prep for rental - Qube	JNAUMANN	21/09/2017	Cap Prep	9.0	Prepare For Hire - Field waiting for unit. wait for unit, lifted cab n bolted inplace, fitted exhaust stack, fitted rotaying beacon n bracket, ok. waiting for unit assemble unit Travel to site, travel to site, fit burst protection, PDI unit, clean up hosing and wiring Adjust Lift Chain to correct specification, Set up cherry picker on site ,welder ,gen set, grinder etc . Assemble chain oiler system . Weld brackets on to top section of mast ,paint,fit and adjust oilers . Pack up and return cherry picker to ACFS . Fit Fleet Management System as required, asissted in fitting fm1 kit Install Fleet Management System (Basic), assisted in fitting fm1 unit fitted exhaust and turbo lagging, assisted fire suppression tech in finalising fire suppression, cleaned up cab and prepared for handover cleaned around machine checked over unit for hire Paint fleet numbers on unit, adjust twistlock speed, wait for tyre fitter to finish on machine to be able to check twistlock adjustment.