



Repair Order Detail

RO: RO07-0353479

Status: CLOSED

Repair Class: SCHEDULED

Shop: SAL

SALINA SHOP

Repair Site: FACILITY

Unit: B1422

PETERBILT 579 14X+ X15E BENDIX
AIRTRAC

Opened: 4/29/2025

Customer PO #:

Completed: 4/30/2025

Domicile: SAL

Make: PTRBL

Odometer: 424,119

Cost Cntr: 105

Model: 579

License: Z085450

Year: 2023

VIN: 1XPBD49XPD854169

In Service: 8/18/2022

Section: 1	Priority: 5	Complaint: KNOCKING	Rep Reason: DRIVERREPORT
Component: 026-012		Cmp Descr: Transmission Assembly - Manual	
War Type: EXTENDED		Unit War: None	
Comments: driver says transmission is making a knocking noise and its worse when shifting and between gears			

Comment

Date	Comment Text					
4/30/2025	driver said tranny was making noise took for ride could here noise in tranny drained oil found the main gears was missing teeth pulled tranny out and found the pilot bearing and shaft was wore causing teeth to chip in tranny swapped everything over to new tranny and filled with oil replaced the flywheel also replaced clutch and fork and clutch brake installed new pilot baring and put tranny back in bolted everything up and took for test drive					

Labor

Date	Mechanic	Description	Hours	Rate	Total
4/30/2025	PAG300	PAG300 - Transmission Assembly - Manual, WORN OUT, REPLACED REB	4.33	95.00	411.66

Part

Date	Part ID	Description	After	Qty	Unit Price	Total
4/30/2025	FRO18210C-PET	Transmission Assembly 10 Speed Metric Peterbilt Rebuild	Before	1.00	5070.63	5,070.63
4/30/2025	308925-25	Clutch Assembly, 2050 Torque lb-ft		1.00	907.37	907.37
4/30/2025	A7786	Fork - Clutch Release		1.00	214.04	214.04
4/30/2025	SB200	Brake - Clutch Plate		1.00	48.16	48.16



Task Details

US\$ - United States Dollars

Repair Total:	6,942.84
----------------------	-----------------

LABOR	411.66
PART	6,531.18

