

Adapt-A-Lift Forklift Rentals & Sales Limited

Service History Listing Active Units

Date: 6/03/2026

Time: 9:09:04AM

For Equipment Code From: H8109 To: H8109

For Customer Code From: All To: All

For Date Posted From: All To: All

For Branch Code From: All To: All

Don't Show Cost

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H8109		Description: HYSTER H25XMS-9 (EQ142464)					
Make: HYSTER		Model: H25XMS-9		Serial No.: J008E01522V			
1518394	8109 - Transportation to Richie Bros Auckland	11801 SUBC	23/02/2026	Internal	13081.0	\$0.00	
1516224	Carry out appraisal	BMAGGS	14/01/2026	Internal	13081.0	\$0.00	14/1 - BM - Carry out equipment condition assessment 14/1 - BM - Carry out appraisal.
1515111	Battery replacement	JDUPREEZ	12/12/2025	Internal	13080.0	\$0.00	12/12 - JD - Replace Battery, 12/12 - JD - Remove batterys and clean the battery tray fit 2 new batterys.
1511162	8109 - Removal of mast and prep for transport	JWILLS	19/09/2025	Internal	13080.0	\$0.00	Repair Starter Circuit as required, 19/09 - VM - Jump start machine and then transport it across to Hutech engineering. 19/9 - JW - Assisted Vernon with transport of machine to Hutech. Had to jumpstart. Escorted to Hutech. Signed out and travelled back. to Tauranga 23/09 - VM - Travel to Hutech and start machine. 24/9 - JW -Remove ancillary items and Remove and Replace Fuse/s, Refit ancillary items, 24/9 - JW - Travelled to site and signed in. Set up work area. Removed faulty fuse box. Cleaned connectors. Installed good used fuse box into machine. Removed isolation to check machine operation - ok, but found left sideshift not working. Removed lock out and cleaned work area.
1507176	Accident damage to air conditioning condensor	118SUBC	10/07/2025	External	13080.0	\$984.98	Inspect machine for damage to the a/c condenser core, tested ok, Damage is only to rear external corners and plastic covers and work light supports, Connect test gauges to check for system pressures and correct refrigerant charge, Confirm a/c system has full charge and operates correctly,
1506349	Remove belly plate	BMAGGS	25/06/2025	Internal	13079.0	\$0.00	25/6 - BM - Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, 25/6 - BM - Travel to site, 25/6 - BM - Proceeded to isolate machine and remove bottom belly plate.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H8109		Description: HYSTER H25XMS-9 (EQ142464)					
Make: HYSTER		Model: H25XMS-9		Serial No.: J008E01522V			
1505240	Hydraulic leavers	JWILLS	4/06/2025	Internal	13079.0	\$0.00	04/6 - JW - Travel to site. Replace Switch/es Reinstalled removed batteries. Cleaned battery terminals. Inspected machine to see what was removed. Travelled to site and signed in. Disasennbled armrest/controller. I got to a point where i could not proceed due to not having the correct tool. Went looking for tool locally, but could not find it. Tidied up work area. 05/6 - NW - Problem : Attend to mini lever replacement. Cause: levers faulty. Remedy: proceed to site, sign in. proceed to Hu tec and remove mini levers from 8110. fit levers to 8109.test functions. 05/6 - LB - Remove and Replace Direction Switch, Sign in at site,get parts from 8110 at utec. came back to site. fit the secondhand minilever consol test the machine all the funtions work correct. Prepare For Sale - Workshop Travel to site, Prepare For Sale - Field
1504914	Carry out dehire checks	VMORTA	27/05/2025	Internal	13080.0	\$0.00	Sent to VM - 26/05 - Jason to take 1 x 4272691 transferred to V004. 1 x 4272696 in V004 stock 25/6 - BM - Repair Steering Column as required, 25/06 - BM - Proceeded to strip steering coloum. Found shaft siezed that holds shock. Used heat to extract pin. Removed pin replaced shock and components test ok. Travel to site, Top up cooling system, Travelled to site and found the machine parked up . After inspecting the machine I discovered that there is low coolant in the machine. Topped up the coolant . Found damage to steering column. Parts will be ordered.
1504873	Damaged steering column	VMORTA	26/05/2025	External	13080.0	\$347.44	01/05 - VM - Machine had a Hydraulic leak. Removed the leaking hose and drove to vendor. I had a hose made up , returned to site and installed it on the machine Tested the machine and returned it to service .
1504816	Troubleshoot fault codes	VMORTA	26/05/2025	Internal	13060.0	\$0.00	01/05 - VM - Assist Jason with service. 1 x A4277150 used (no stock in BP) 01/5 - JW - Worked with Vernon. Travel to site. Carry out A service as required. Follow checklist as per above. Carry out brake, hydraulic, coolant & transmission fluid level inspection. Top up as required. Check Cab air filter. Carry out lubrication service, grease forks steering linkages rams etc, lubricate lift chains. Carry out function tests – all ok. Return unit to operation. Clean work area.
1503606	Hydraulic leak	VMORTA	1/05/2025	Internal	12823.0	\$0.00	29/4 - JW - Travel to site. Greased and inspected machine as required.
1503605	250hr Service	VMORTA	1/05/2025	Internal	12823.0	\$0.00	
1503477	Grease machine	JWILLS	29/04/2025	Internal	12823.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H8109		Description: HYSTER H25XMS-9 (EQ142464)					
Make: HYSTER		Model: H25XMS-9		Serial No.: J008E01522V			
1503282	Check coolant and top up	VMORTA	24/04/2025	Internal	12756.0	\$0.00	23/04 - VM - The machine came to the workshop wanting a coolant top up. Checked the machine over for leaks. Non could be found Topped up the coolant and sent the machine back to service.
1503078	Grease machine	JWILLS	16/04/2025	Internal	12729.0	\$0.00	16/4 - JW - Greased machine as required
1501676	Hydraulic leak - steering cylinder	VMORTA	20/03/2025	Internal	12692.0	\$0.00	20/03 - VM - Travel to site, found the machine down with a hydraulic leak. Cleaned the area and inspected the machine. Found a leak on the steering cylinder. I tried to repair it but found that the cylinder barrel was cracked. So I got the customers engineers to weld the steering cylinder. 21/03 - VM - Worked with the engineers to try and repair the cylinder. The cylinder kept cracking in different areas. I will remove the cylinder at a later stage. Set machine up safely, Jacked machine up and placed it on blocks. 24/03 - VM - Travelled to site, removed the steering cylinder and took it to Hutec for repair. Clean area. Note: Was working in an area with heavy traffic. So had to cordon off area, to work safely , mounting bolts were extremely tight, hence the lengthy time. 24/3 - JW - Worked with Vernon. Travelled to site and removed the steering cylinder and took it to Hutec for repair. Clean area. Note: Was working in an area with heavy traffic. So had to cordon off area, to work safely, mounting bolts were extremely tight, hence the lengthy time. 14/04 - BM - Travel to engineering to pick up the steer cylinder. Assist JD. Jack the machine. Sling the steer cylinder and lift it into place. Bolt the cylinder to the machine and torque the bolts to spec. Connect the hydraulic hoses and connect the grease line. Fit the steer pins. Test the machine Found mast hoses loose and cable readjust machine and tidy up area. 14/04 - JD - Travel to engineering to pick up the steer cylinder. Travel to site. Jack the machine. Sling the steer cylinder and lift it into place. Bolt the cylinder to the machine and torque the bolts to spec. Connect the hydraulic hoses and connect the grease line. Fit the steer pins. Test the machine.
1501625	Side shift issues	VMORTA	19/03/2025	Internal	12667.0	\$0.00	19/03 - VM - Machine was brought into the workshop by the operator, he stated the machine does not side shift. I hade to explain to him that the machine has no side shift function on it. This turned out to be a training purpose.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H8109		Description: HYSTER H25XMS-9 (EQ142464)					
Make: HYSTER		Model: H25XMS-9		Serial No.: J008E01522V			
1501457	500hr Service	JWILLS	17/03/2025	Internal	12633.0	\$0.00	Travel to site. Carry out B service as required. Follow checklist as per above. Drain & replace engine oil & filter. Replace air filters as needed. Carry out brake, hydraulic, coolant & transmission fluid level inspection. Top up as required. Replace fuel filters. Carry out lubrication service, grease forks steering linkages rams etc, lubricate lift chains and check for wear using guage. Check attachements and measure forks for wear using guage. Carry out function tests – all ok. Return unit to operation. Clean work area. Note: Parking brake pads worn. To be replaced soon. Inside RH front tyre has a gash in it. Greased the mast, tie rods , drive shaft and carriage. Inspected the machine and then released it back into service.
1500544	Grease up machine	VMORTA	3/03/2025	Internal	12423.0	\$0.00	
316262	8109 - Hydraulic leak	Vernon Morta	25/02/2025	Internal	12453.0	\$0.00	
316034	8109 - Trouble shoot grease system	Vernon Morta	19/02/2025	Internal	12423.0	\$0.00	
316033	8109 - Broken side shift bolts	Vernon Morta	19/02/2025	Internal	12423.0	\$0.00	
314976	8109 - 2000hr service	Vernon Morta	3/02/2025	Internal	12268.0	\$0.00	
314796	8109 - Condition report	Vernon Morta	30/01/2025	Internal	12260.0	\$0.00	
314779	8109 - Fork positioning cylinder leaking	Vernon Morta	29/01/2025	Internal	12260.0	\$0.00	
314716	8109 - Hydraulic leak	Vernon Morta	29/01/2025	Internal	12244.0	\$0.00	
314242	8109 - Grease up machine	Jason Wills	21/01/2025	Internal	12180.0	\$0.00	
313579	8109 - Repair hydraulic leaks	Vernon Morta	8/01/2025	Internal	12159.0	\$0.00	
312259	8109 - Fault codes (CM) Part 2 - Valve bank	Vernon Morta	5/12/2024	Internal	12159.0	\$0.00	
311837	8109 - Replaced air con filters	Jason Wills	1/12/2024	Internal	12159.0	\$0.00	
311630	8109 - Damaged metal hoses	Vernon Morta	27/11/2024	External	12103.0	\$0.00	PRIMARY MECHANIC: Vernon Morta SYMPTOM: Rent device CAUSE: 04/12 - VM The metal hoses on this machine were damaged by the operator. After consulting my leading hand, it was decided that the metal hoses will not be ordered, they will be replaced by flexible hoses.03/12 - BD No, this repair external WO is complete and can be closed.Hi Sam, Yes, I've discussed this with Vernon.Please disregard his part order requestPlease order 1 x 4292979 tube 1 x 1687053 tube 1 x 1687054 Tube SOLUTION:

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H8109		Description: HYSTER H25XMS-9 (EQ142464)					
Make: HYSTER		Model: H25XMS-9		Serial No.: J008E01522V			
311412	8109 - Repair damaged armrest and window	Vernon Morta	24/11/2024	External	12159.0	\$0.00	PRIMARY MECHANIC: Vernon Morta SYMPTOM: Rent device CAUSE: Hi Vernon,RE the parts for 8109 - WO311412, parts 1 x 4295612 (cable) and 1475419 x 2 (nuts) have been ordered from 15H.As per your discussion with Brett, part 4295609 (gas spring) you have in stock, part 1347597 (wheel clamp) you will have a look for it as 18HV04 shows 12 in stock.The washer has not been ordered as per Brett.Please let me know if you do not find the clamps. Please order 1 x 4295609 Gas Spring and 1 x Cable . This was damaged by Customer. 2 x 1347597-wheel clamp and 2x 1475419 Nut and 2 x 268980 washer SOLUTION:
311336	8109 - Transferred to WO 311336 fter service repairs	Vernon Morta	21/11/2024	Internal	11997.0	\$0.00	
311335	8109 - 250-hr service	Vernon Morta	21/11/2024	Internal	11997.0	\$0.00	
311018	8109 - Electrical Fault / Troubleshooting	Vernon Morta	18/11/2024	Internal	11943.0	\$0.00	
310384	8109 - Remove mast lift cylinder and chain replacement	Jason Wills	7/11/2024	Internal	11823.0	\$0.00	
310078	8109 - Fault codes (CM)	Vernon Morta	4/11/2024	Internal	11823.0	\$0.00	
309858	8109 - Replace aircon filter	Jason Wills	31/10/2024	Internal	11943.0	\$0.00	
Equipment Total:						\$1,332.42	
Customer Total:						\$1,332.42	