

Adapt-A-Lift Forklift Rentals & Sales Limited

Service History Listing Active Units

Date: 6/03/2026
Time: 9:08:05AM

For Equipment Code From: H8110 To: H8110
For Date Posted From: All To: All
Don't Show Cost

For Customer Code From: All To: All
For Branch Code From: All To: All

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H8110		Description: HYSTER H25XMS-9 (EQ142465)					
Make: HYSTER		Model: H25XMS-9		Serial No.: J008E01524V			
1518396	8110 - Transportation to Ritchie Bros Auckland	11801 SUBC	23/02/2026	Internal	13000.0	\$0.00	
1515118	Battery replacement	JDUPREEZ	12/12/2025	Internal	13000.0	\$0.00	12/12 - JD - Replace Battery, 12/12 - JD - Replace batteries, Clean batter tray and fit 2 new batteries
1511219	Removal of mast and prep for transport	BMAGGS	22/09/2025	Internal	13000.0	\$0.00	22/9 - BM - Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items, 23/9 - BM - Proceeded to blank of mast hoses. Proceeded sort out all bolts pins and sort and place them in cab of truck. Shift machines around. Pkace mast in back yard with the carriage and forks 23/9 - BM - Repair Main Electrical Control Panel as necessary, 23/9 - BM - Proceeded to isolate truck andvremove complete fuse box andvrepair fuse box cover. 05/11 - BM - Replace fuse box . Proceeded to replace fuse box test ok.
1511207	8110 - Non start	VMORTA	22/09/2025	Internal	13000.0	\$0.00	Repair Starter Circuit as required, 22/09 - VM - Order parts and travel back to Rotorua Please add 2 x batteries to this job Thanks
1509743	8110 - Lift cylinder repair	118 PLANNING	28/08/2025	Internal	1618.0	\$0.00	
1509073	Refit levers taken off machine for RFH	JWILLS	14/08/2025	Internal	1618.0	\$0.00	14/8 - JW - Remove ancillary items and Repair Wiring as necessary, Refit ancillary items, 14/8 - JW - Travelled to site and signed in. Collected mini levers and arm rest control unit from CHH. Refitted as required. Screws for assembly were missing, replaced with equivalent spares from van. Assembled armrest. Unable to test operation due to machine being down for mast repairs.
1504915	Carry out dehire checks	118 PLANNING	27/05/2025	Internal	16818.0	\$0.00	Prepare For Sale - Workshop 14/8 - JW - Carry out equipment condition assessment 14/8 - JW - Carried out assesment of machine as required. Machine is inoperable to to mast repairs taking place. Took photos of all damage, checked oil levels, inspected frame. Condition report and photos emailed.
1504668	Mast and carriage repairs	VMORTA	21/05/2025	External	16818.0	\$103,740.50	20/05 - VM - Inspected the machine and drew up parts list

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001 Equip. Code: H8110 Description: HYSTER H25XMS-9 (EQ142465) Make: HYSTER Model: H25XMS-9 Serial No.: J008E01524V							
1504356	250hr Service	VMORTA	15/05/2025	Internal	16818.0	\$0.00	16/5 - JW - Travel to site. Carry out A service as required. Follow checklist as per above. Carry out brake, hydraulic, coolant & transmission fluid level inspection. Top up as required. Check Cab air filter. Carry out lubrication service, grease forks steering linkages rams etc, lubricate lift chains. Carry out function tests – all ok. Return unit to operation. Clean work area. Note: Tie-rods worn, LHS lift cylinder leaking, air filter replaced as it was dirty.
1504122	CM updates and Telemetry issue	118 PLANNING	12/05/2025	Internal	3797.0	\$0.00	09/5 - SR - Travel to site and check over telemetry system issues and update CM with findings and photo. Couldn't not operate machine as it was on blocks from tyres being replaced. Check telemetry system and adjust as per CM. Paul Grinter to monitor hours so cm can be updated.
1504032	Telemetry issues	SRAFFEL	9/05/2025	Internal	3797.0	\$0.00	08/5 - SR - Travel to site. Check over telemetry system issues. Update CM with findings and photos Note: Hour meter is displaying incorrect hours after the new VSM swap that JD did. Have spoken to Nathaniel on tis however, there is no current fix.
1503917	Fork position cylinder failure	VMORTA	7/05/2025	Internal	12980.0	\$0.00	07/05 - VM - Traveled to site and found machine 8110 down with fork positioning issues. After troubleshooting the system, I discovered that the left cylinder was damaged. Changed the cylinder out. With the swing /spare cylinder on site. Topped up oil tested the system and then released it back into service. Note: Job delayed as I am alone with no lifting equipment. Please order:- 1 x 1704241 kit. When the cylinder is sent in for repairs
1503847	Brake fault code	VMORTA	6/05/2025	Internal	12980.0	\$0.00	Part 1676975 not in the system (BP) 06/05 - VM - Machine arrived in the workshop with a overheating fault. Cleaned the radiator. Changed the brake filter as this code was also coming up. Topped up oil. Did calibrations on the machine. Tested and released the machine back into service.
1503825	Load factory reset software	JDUPREEZ	6/05/2025	Internal	12932.0	\$0.00	05/05 - JD - Travel to the site. Wait for the machine. Load the factory reset software onto the machine to wipe the display. Load the new display software. The hour meter went from 99999 to 3745 hours. Spoke with Nathaniel and he said he will talk to someone to see if it can be corrected.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001 Equip. Code: H8110 Description: HYSTER H25XMS-9 (EQ142465) Make: HYSTER Model: H25XMS-9 Serial No.: J008E01524V							
1503607	250hr Service	VMORTA	1/05/2025	Internal	12932.0	\$0.00	01/5 - JW - Travel to site. Carry out A service as required. Follow checklist as per above. Carry out brake, hydraulic, coolant & transmission fluid level inspection. Top up as required. Check Cab air filter. Carry out lubrication service, grease forks steering linkages rams etc, lubricate lift chains. Carry out function tests – all ok. Return unit to operation. Clean work area. Note: Tie-rods worn, LHS lift cylinder leaking, air filter and air con filters replaced as they were dirty. 01/05 - Assist Jason with service. 24/04 - VM - Machine arrived in the w/shop overheating.Removed covers and cleaned the Radiator core with water and soap.Replaced covers and sent machine back into service.
1503287	Machine overheating	VMORTA	24/04/2025	Internal	12932.0	\$0.00	22/04 - VM - Travel to site and troubleshoot machine. Discovered ZF issue. - Tried and troubleshoot the system however I need the ZF tooling and dongle to work on the machine. So locked machine out waiting for tooling. 28/04 - JD - Travel to the site. Remove the interior cab panels. Remove the old VCM and fit the new one. Download the new software from hypass and upload the new software to the controller. The machine came up with inch and acc calibration faults. Calibrate the 2 pedals but failed. Try installing the new software updates. failed again. Remove the new controller and inspect the connector's pins. Found that the tension spring in the pins are all flattened, retention the pins and assemble the machine. Carry out the calibrations and it was successful. The machine hours now showing 99999. Call Nethaniel to assist with the fault. Reinstall the new software to see if it will resolve the problem. Did not work, the hours are still showing 99999. Send the machine out to be tested. Travel home.
1503196	No gears	VMORTA	22/04/2025	Internal	12932.0	\$0.00	23/04 - JD - Travel to site, carry out diagnosis. Check the fault codes on Hypass. The fault is related to Canbus. Check the wiring harness and connecting plugs, Start at the bottom of the harness and work my way up. Remove the cab covers to get to the VSM. Found the VSM plug holders damaged. Remove the VSM and cable tie the plugs to the controller. Assemble the machine and send the machine out with a driver to test it. The machine did not fault again. The VCM will need to be replaced for future issue.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H8110		Description: HYSTER H25XMS-9 (EQ142465)					
Make: HYSTER		Model: H25XMS-9		Serial No.: J008E01524V			
1502617	Damage - Non start	VMORTA	8/04/2025	External	12774.0	\$1,354.86	08/04 - VM - Travel to site and troubleshoot machine. Discovered it was the wiring harness in the cab that was damaged. I removed the harness from 18v004 stock and gave it to the electrician to install. Note: This is a customer charge/damage. The cabs are dirty and untidy. Metal objects are kept behind the seat. These items come in contact with the harness and cause the damage. This harness had been repaired before.
1502394	Work carried out by external vendor	118 PLANNING	3/04/2025	Internal	12774.0	\$0.00	Diagnosis: Connect test gauges, found a/c system has enough refrigerant to operate Found no power to a/c compressor Found no cabin cooling fan operating Remedy: Disassemble A/c hvac unit Remove and replace failed thermostat and cabin cooling fan assembly, Clean Evaporator core Reassemble all panels and retest Adjust thermostat System cycling at 6 degree's Run engine and check cooling temperatures and system pressures, All found to be operating correctly.
1502264	Hydraulic leak	JWILLS	2/04/2025	Internal	12774.0	\$0.00	01/4 - JW - Machine came in with a hydraulic leak at the front. Found the source of the leak to be loose fittings. Removed fittings, installed new o-rings and tightened fittings up. Tested function to ensure leak had been repaired.
1502167	Grease up	VMORTA	31/03/2025	Internal	12756.0	\$0.00	02/04 - VM - Machine came to the workshop with a hydraulic leak. Changed the O-rings on the hoses and tested the machine. Discovered that the metal hose was damaged. Removed one from 8109 and installed it on 8110. Called vendor out to make a hose and install it on the machine. Top up hydraulic oil.
1502018	Transmission shift lever failure	VMORTA	27/03/2025	Internal	12700.0	\$0.00	31/03 - VM - Machine came to the workshop for grease. Greased the machine and returned it to service. 27/03 - VM - Travelled to site, found machine 8110 parked up with transmission not going into neutral. Troubleshoot machine. Discovered that the directional lever was faulty. Changed the lever and calibrated the machine transmission. Called the supervisors and explained /trained them on how to use the machine. Released the machine back into service.
1501896	Turbo repair	VMORTA	25/03/2025	Internal	12708.0	\$0.00	25/03 - VM - Travel to vendor to source turbo.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H8110		Description: HYSTER H25XMS-9 (EQ142465)					
Make: HYSTER		Model: H25XMS-9		Serial No.: J008E01524V			
1501787	Hydraulic leak	VMORTA	24/03/2025	Internal	12661.0	\$0.00	24/03 - VM - Machine was down with a hydraulic leak. Removed the hoses and replaced the O-rings. Fitted hoses back and sent machine back into service after topping up 10 l hydraulic oil.
1501533	Telemetry system issues	SRAFFEL	18/03/2025	Internal	12708.0	\$0.00	Machine having issues with telemetry system, updated CM and followed Hyster guidance to find solutions to this. Couldn't get machine to report correctly, have updated the CM once again with findings. Checked machine hours not tracking correctly. Checked both truck recorded hours against tracker reports. Called Jason in Singapore for guidance and went through all the steps with him and updated VSM, display etc. Made some changes to the settings on the truck. Need to monitor this for a week to check if it makes any changes. Travel back to Rotorua.
1501229	Carry out 500hr service	VMORTA	13/03/2025	Internal	12661.0	\$0.00	VM - Travel to site. Carry out B service as required. Follow checklist as per above. Drain & replace engine oil & filter. Replace air filters as needed. Carry out brake, hydraulic, coolant & transmission fluid level inspection. Top up as required. Replace fuel filters. Carry out lubrication service, grease forks steering linkages rams etc, lubricate lift chains and check for wear using guage. Check attachments and measure forks for wear using guage. Carry out function tests – all ok. Return unit to operation. Clean work area. Return to workshop and correctly dispose of any waste oil, filters etc.
316036	8110 - Assist with removing tyres	Vernon Morta	19/02/2025	Internal	12362.0	\$0.00	PRIMARY MECHANIC: 118 PLANNING SYMPTOM: Rent device CAUSE: Hi Sam,I have discussed this cylinder repair with Vernon.This charge relates to the repair to WO WO311850 : 8110 - Fork positioning cylinder crackedThis Wo has now been closed , but you can open another (external charge) with the same description and load it against this job. SOLUTION: Work carried out by external vendor.
315180	8110 - Condition report	Vernon Morta	4/02/2025	Internal	12362.0	\$0.00	
315179	8110 - 250hr service	Vernon Morta	4/02/2025	Internal	12362.0	\$0.00	
314638	8110 - Aircon Issues	Vernon Morta	28/01/2025	Internal	12280.0	\$0.00	
314239	8110 - Machine transmission over heating	Jason Wills	21/01/2025	Internal	12239.0	\$0.00	
313816	8110 - Fork positioning cylinder cracked	118 PLANNING	14/01/2025	External	0.0	\$0.00	
313485	8110 - Transferred to WO313Fork positioning cylinder cracked	118 PLANNING	8/01/2025	Internal	0.0	\$0.00	
312380	8110 - Vendor invoice (Fork positioning cylinder)	118 PLANNING	9/12/2024	Internal	0.0	\$0.00	
311850	8110 - Fork positioning cylinder cracked	Vernon Morta	1/12/2024	Internal	12116.0	\$0.00	
311839	8110 - Replaced air con filters	Jason Wills	1/12/2024	Internal	12219.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
Owner: ADAP001							
Equip. Code: H8110		Description: HYSTER H25XMS-9 (EQ142465)					
Make: HYSTER		Model: H25XMS-9		Serial No.: J008E01524V			
311604	8110 - Poor air conditioning cooling	118 PLANNING	27/11/2024	Internal	0.0	\$0.00	PRIMARY MECHANIC: Vernon Morta 144889 SYMPTOM: Rent device CAUSE: 27/11 - BD Yes, please just order it on a stock order. Part # 4275935 SOLUTION: 26/11 - VM Machine was not starting: - Discovered that harness was damaged. Tooling from the operators is stored down the gap between the operator's seat and control console. As a result, these items have damaged the electrical harness that runs between the two. Call vendor to repair the harness. He repaired the harness and got the machine moving.
311564	8110 - Check machine not starting / harness damaged	VMORTA	26/11/2024	External	11985.0	\$0.00	
310899	8110 - Park brake pads worn	Vernon Morta	14/11/2024	Internal	12138.0	\$0.00	PRIMARY MECHANIC: Vernon Morta 144889 SYMPTOM: Rent device CAUSE: SOLUTION: 04/12 - VM & JW Set machine safely. Removed the damaged handle and cable. Installed the new parts and tested the door. Released the machine back into service.
310897	8110 - Repair damaged door cable	VMORTA	14/11/2024	External	12138.0	\$0.00	
310797	8110 - 2000-hr service	Jason Wills	13/11/2024	Internal	11985.0	\$0.00	
310736	8110 - Not required Steering links and mast repairs - Part 2	118 PLANNING	13/11/2024	Internal	0.0	\$0.00	
309857	8110 - Replace aircon filter	Vernon Morta	31/10/2024	Internal	11928.0	\$0.00	
309485	8110 - Hydraulic leak due to blown hose	Vernon Morta	24/10/2024	Internal	11812.0	\$0.00	
309106	8110 - 1000-hr service	Jason Wills	17/10/2024	Internal	11757.0	\$0.00	
308486	8110 - Cancelled Investigate non start	118 PLANNING	8/10/2024	Internal	0.0	\$0.00	
307995	8110 - Inspect mast, door & AC repair	Barry Maggs	30/09/2024	Internal	11553.0	\$0.00	
Equipment Total:						\$105,095.36	
Customer Total:						\$105,095.36	