



UNITED DIESEL SERVICE
REMIT PAYMENTS TO P.O. BOX 26803, SALT LAKE
CITY UTAH, 84126
1905 PIONEER ROAD
Salt Lake City, UT 84104
(801) 972-2378
ar@uniteddieselservice.net

500931
400968

Invoice #

Payment Term: Net 30

Service Writer: Kacey Cotner Office Manager

2013 INTERNATIONAL SF567 (Brown)

VIN: 1HTGRSJTXDJ161841
Last Recorded Mileage: 340,000
Mileage In: 340,262
Mileage Out: 340,262

61841F

CHECK ENGINE LIGHT - CHECK AND ADVISE

Had 2 codes permanently

Cold Start Fuel Ignitor (CSF1) open load/circuit

Cold Start Relay return (relay, or igniter, or circuit failure). Found that the relay was bad . Ordered a new relay

Description	HRS	Subtotal
1	1	\$125.00
EPA (3.5%): \$4.38 Shop Supplies (7%): \$8.75		Total: \$138.13

HORN IN STEERING WHEEL FALLS OUT

Steering wheel cover is broken were it connects to the rest of the wheel order a new cover

---Craig---Installed New Center Cover With Horn Working.

Description	Price	QTY	HRS	Subtotal
1			1	\$125.00
2 PAD, STEERING WHEEL HORN-BLACK Part #: 3616382C3	\$201.50	1		\$201.50
EPA (3.5%): \$11.43 Shop Supplies (7%): \$22.86				Total: \$360.79

POSSIBLE AIR LEAK WHEN BRAKES SET

Air is leaking from 3 spots both brake valves are staying open even when brake is released . Need to change out . And lift axle relay is leaking air as well

PM 08/26/ 24 I found a leak in the 04 brake valve fittings and replaced them.

Description	HRS	Subtotal
1	1	\$125.00
EPA (3.5%): \$4.38 Shop Supplies (7%): \$8.75		Total: \$138.13

Replace Cold start ad relay. For CEL being on

---Craig---Installed New Relay Behind ECM. Reinstalled Front Driver Side 1/4 Fender And Air Filter Assembly.

Description	Price	QTY	HRS	Subtotal
1 Replace Cold start ad relay.			3	\$375.00
2 RELAY, COLD START IGNITER Part #: 3008240C1	\$143.00	1		\$143.00
3 INBOUND FREIGHT FOR SOLENOID	\$93.89	1		\$93.89
EPA (3.5%): \$21.42 Shop Supplies (7%): \$42.83				Total: \$676.14



UNITED DIESEL SERVICE

REMIT PAYMENTS TO P.O. BOX 26803, SALT LAKE
CITY UTAH, 84126
1905 PIONEER ROAD
Salt Lake City, UT 84104
(801) 972-2378
ar@uniteddieselservice.net

Invoice #

Payment Term: Net 30

Service Writer: Kacey Cotner Office Manager

Authorizations

CEL being on
+ Replace Brake valve for drive
axles.
+ Replace relay valve on last lift
axle for leaking.