

		Branch			
	IN STORE PICKUP	ST. PAUL		*REPRIN	т*
to:		Date	Time		Page
Ship t		01/06/25	23:	06:26 (B) 01
Ś		Account No.	Phone N	0.	Invoice No.
		INTER01A	780	8754471	W00713
		Ship Via		Purchase O	der
ë	INTERNAL CUSTOMER				
	Horizon Ag & Turf				
nvoice	Lloydminster AB T9V 3A2				
-				5	alesperson
					KK

STK#/FLEET#	:	HRS	PIN/EIN W	VARRANTY DATE	HRS
032842	JOHN DEERE S790	1920	1H0S790SJJ0800243	8 08/02/19	
	S790	1376		08/01/21	1500

Have you heard about MyDealer yet? We have a great new way to help you stay connected to your equipment. Either mobile or laptop - look up parts, order them online, view past purchases, or book a service appointment, you are in control. Ask a parts or service member about MyDealer today!

SEGMENT# 1 C 9670 10-000-601 11/19/24 12/09/24 AGLAND RENTAL / DEMO RETURN COMBINE CHECKLIST 4.00 HRS MACHINE JUST RETURNED FROM RENT / DEMO PERFORM THE FOLLOWING: ** New Checklist on the Service Velocity to follow **** CHECKS TO ENSURE COMBINE IS READY TO GO] GREASE MACHINE COMPLETE Г] CHECK ENGINE OIL LEVEL (ADVISE IF NEEDS CHANGED-Γ SEPARATE SEGMENT NEEDED)] CHECK HYD AND COOLANT LEVEL Γ] INSPECT ENGINE AIR FILTER FOR DIRT OR DEBRIS QUICK Γ CLEAN] CHECK RADIATOR SCREENS Г] NOTE ANY OBVIOUS REPAIRS NEEDED (SEPERATE SEGMENT Γ NEEDED) [] NOTIFY SERVICE DEPARTMENT TO GET WASHBAY TO CLEAN EXTERIOR AND INTERIOR] ******INSPECT COMBINE FOR ANY DAMAGE- SEPARATE Г SEGMENT *Ran unit up and completed running checks. Ensured all *speed ranges and adjustments worked. Brought unit into shop * *and completed rental return inspection as per inspection CONTINUED ON PAGE 02

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH
(24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, Inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,



		Branch				
	IN STORE PICKUP	ST. PAUL				
to:		Date	Time			Page
Ship		01/06/25	23:	06:26 (B)	02
S		Account No.	Phone N	0.	Invo	ice No.
		INTER01A	780	8754471	W0	0713
		Ship Via		Purchase Or	der	
to:	INTERNAL CUSTOMER					
<u>8</u>	Horizon Ag & Turf					
nvoice	Lloydminster AB T9V 3A2					
=				S	alespers	on
					KK	

STK#/FLEE	г#	HRS	PIN/EIN	WARRA	ANTY DATE	HRS	
032842	JOHN DEERE S790	1920	1H0S790SJJ08002	43	08/02/19		
	S790	1376			08/01/21	1500	
*checklis	st. Adjusted chains, be	elts and	elevators as		*		
*require	d. Topped up all fluids	as req	uired. Blew out		*		
*engine,	aftertreatment and cak	o air fi	lters. Greased e	entire	*		
*unit. C	reated estimate and for	warded	to service offic	e.	*		
*					*		
* * * * * * * * *	* * * * * * * * * * * * * * * * * * * *	******	* * * * * * * * * * * * * * * *	*****	* * *		
TY27786		FUELCON	D.WINTER	1	31.43	31.43	
	Fuel Conditione	er					
					PARTS	31.43	
					LABOR	720.00	
	16001001		SE	GMENT	TOTAL==>	751.43	

SEGMENT# 2 C 9670 NA	12/11/24 12/11/2	4			
COOLANT LEAKING FROM BOTTO	OM FRONT CORNER OF THE	RADIATOR	2.50 HH	RS	
DIAGNOSE AND REPAIR AS REQ	QUIRED.				
**** TECHNICIANS COMMENTS	3 *****	* * * * * * * * * * * * *	* * *		
*			*		
*Rotated and tightened loc	ose clamp. Pressured u	p system.	*		
*Monitored and no leaks ap	opeared.		*		
*			*		
*****	* * * * * * * * * * * * * * * * * * * *	*****	* * *		
			LABOR	131.04	
16001001	L	SEGMENT	TOTAL==>	131.04	

SEGMENT# 3 C 9662 NA 12/11/24 12/11/24	
OIL LEAKING FROM ROTOR DRIVE SHEAVES	3.50 HRS
APPEARS TO BE FROM THE MEG OUTPUT SHAFT SEAL. REPAIR AS	
REQUIRED.	
***** TECHNICIANS COMMENTS ************************************	
* *	

CONTINUED ON PAGE 03

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH (24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, Inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,



		Branch				
	IN STORE PICKUP	ST. PAUL				
to:		Date	Time			Page
Ship		01/06/25	23:	06:26 (B)		03
S		Account No.	Phone No	0.	Invo	ice No.
		INTER01A	780	8754471	WO	0713
		Ship Via		Purchase Ord	ler	
to:	INTERNAL CUSTOMER					
Invoice	Horizon Ag & Turf					
٥٨	Lloydminster AB T9V 3A2					
=				Sa	alespers	on
					KK	

STK#/FLEET#	HR	S PIN/EIN	WARRA	NTY DATE	HRS	
	ERE S790 192	•		08/02/19	III(b	
\$790	137			08/01/21	1500	
*Removed rotor sup	plv line and rotar	v union. Remo [,]		*		
*airbox bolts. Rem				*		
*oil. Disassembled				*		
*rings and install	-	—		*		
*piston nut. Insta	lled line. Install	ed airbox har	dware.	*		
*				*		
****	*****	* * * * * * * * * * * * *	******	* *		
AHC11302	Hydra	ulic Cyl.	1	1234.90	1234.90	
Ну	draulic Cylinder					
R1225R	PACKI	NG	1	6.78	6.78	
				PARTS	1241.68	
				LABOR	630.00	
	16001001		SEGMENT	TOTAL==>	1871.68	
SEGMENT# 4 C 9662	NA 12/11	/24 12/11/24				
LH TRANSMISSION OU		, , ,		1.50	HRS	
REPLACE LH TRANSMI	SSION OUTPUT SEAL.					
***** TECHNICIANS	COMMENTS ********	* * * * * * * * * * * * *	******	* *		
*				*		
*Removed axle shaf	ts. Removed seal.	Cleaned and p	olished	*		
	ousing. Installed			*		
*output and seal n				*		
*output and seal n *axle shaft.						
				*		
*axle shaft.	* * * * * * * * * * * * * * * * * * * *	* * * * * * * * * * * * * * *	* * * * * * * * * * *			
*axle shaft. *	**************************************	*****	********** 1		46.98	
*axle shaft. * ******		****		**	46.98 46.98	
*axle shaft. * *********		****		** 46.98		
*axle shaft. * **********************************		*****	1	** 46.98 PARTS	46.98	

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH (24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, Inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,

CONTINUED ON PAGE 04

SIGNATURE RECEIVED ABOVE IN GOOD ORDER AND TERMS AGREED TO



		Branch				
to:	IN STORE PICKUP	ST. PAUL Date	Time			Page
Ship t		01/06/25 Account No.	23: Phone N	<u>06:26 (в</u> о.		04 ce No.
		INTER01A	780	8754471		713
		Ship Via		Purchase Or	der	
ice to:	INTERNAL CUSTOMER Horizon Ag & Turf					
nvoice	Lloydminster AB T9V 3A2					
_				S	alesperso	on
					KK	

STK#/FLEET#		ирс	PIN/EIN	WADD	א אודע האידבי	HRS	
			•			пкр	
032842 JOHN DE S790	EERE S790	1920 1376	TUN2/20202080	0243	08/02/19	1500	
					08/01/21		
8 NEW SOFTWARE PAY		-			2.00	HRS	
DOWNLOAD AND INSTA							
***** TECHNICIANS	COMMENTS *****	*****	* * * * * * * * * * * * * *	******			
*			C. 3	7	*		
*Download and inst	alled all availa	able s	oftware paylo	ads.	*		
*					*		
* * * * * * * * * * * * * * * * * * * *	*****	*****	**********	******			
					LABOR	360.00	
	16001001			SEGMENT	TOTAL==>	360.00	
SEGMENT# 6 C 23001	NA 12	/11/24	12/12/24				
AIRSCREEN DRIVE BE	LT BROKE-SCREEN	WAS F	ROZEN AND BRC	KE BELT			
REPLACE BELT							
***** TECHNICIANS	COMMENTS *****	* * * * * *	*****	******	* * *		
*					*		
*Removed belt cove	er to replace be	lt. Re	placed one nu	t (fell	*		
*into the wash bay	/ drain).		_		*		
-					*		
*							
* ************	*****	* * * * * *	* * * * * * * * * * * * *	******	* * *		
	**************************************		* * * * * * * * * * * * * *	******* 1	*** 67.97	67.97	
****	BEI					67.97 1.65	
**************************************	BEI	LT		1	67.97		
**************************************	BEI	LT		1	67.97 1.65	1.65	

***** WORK ORDER TOTALS ****** INTERNAL CUSTOMER PARTS 1389.71 CONTINUED ON PAGE 05

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH (24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, Inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,



		Branch			
	IN STORE PICKUP	ST. PAUL			
to:		Date	Time		Page
Ship		01/06/25	23:	06:26 (B)	05
S		Account No.	Phone N	0.	Invoice No.
		INTER01A	780	8754471	W00713
		Ship Via		Purchase Orde	er
5. .:	INTERNAL CUSTOMER				
	Horizon Ag & Turf				
nvoice	Lloydminster AB T9V 3A2				
=				Sa	esperson
					KK

STK#/FLEET#			HRS	PIN/EIN	WARRANTY DAT	E HRS
032842	JOHN DEERE	S790	1920	1H0S790SJJ080024	43 08/02/1	.9
	S790		1376		08/01/2	1 1500
					LABC	DR 2294.64
					Shop Supplie	es 229.46
				1	INTERNAL TOTA	L 3913.81

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH (24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, Inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,



Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

w	ww.agland.ca	780-645-4437 • 1-877-645-9933		78	0-853-5361 •	• 1-877-	-853-0922	
ſ	IN STORE PICKUP		Branch ST. PAU		*REPRI			
: To:	IN STORE PICKUP		Date	Time	^KEPKI		Page	
Ship			06/12/2	24 23:	31:41	(B)	01	
S			Account No	Phone No			Inv No	
L			INTER0	1 780	8754471	L	D95694	
			Ship Via		Purchase Or	der		
.: To	INTERNAL CUSTOMER							
e T	Agland							
Invoice	Lloydminster AB T	9V 3A2						
Ľ						Salesp	erson	
L						ĸ	KSK	

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

780-645-4437 • 1-877-645-9933

DESCRIPTION OF WORK & PARTS

STK#/FLEET# 032842	S790 STS DJ HOG S790 STS	HRS 1791 1310	PIN/EIN 1H0S790SJJ08(ANTY DATE 08/02/19 08/01/21	HRS 1500	Fold
WINDSHIELD	SHIELD CRACKED. BLACK	ACE TO		LACE	* * *		
*					*		
*Removed t	rim and parts as requi	red. H	elped install		*		
*windshiel			-		*		
*					*		
* * * * * * * * * *	* * * * * * * * * * * * * * * * * * * *	*****	* * * * * * * * * * * * * *	* * * * * * * * *	* * *		
KXE10402	Ā	Indshi	eld Lamn	1 N	2294.03	2294.03	
SUBLET	?	- 526	5QB	1	370.00	370.00	
					PARTS	2294.03	
					LABOR	141.04	
					SUBLET	370.00	
	16001			SEGMENT	TOTAL==>	2805.07	

***** WORK ORDER TOTALS *****

	INTERNAL	CUSTOMER
PARTS	2294.03	
LABOR	141.04	
SUBLET	370.00	
SHOP SUPPLIES	10.00	
INTERNAL TOTAL	2815.07	

- I hereby certify the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.
- Terms: Full payment due immediately upon completion of work or service charge on overdue account at the rate of 1.5% per month (18% per annum)
 It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.

X	
Signature	Date



		Branch			
	IN STORE PICKUP	ST. PAUL		*REPRIN	т*
to:		Date	Time		Page
Ship t		10/23/24	23:	07:39 (B) 01
S		Account No.	Phone N	0.	Invoice No.
		INTER01A	780	8754471	W00499
		Ship Via		Purchase Or	der
ë	INTERNAL CUSTOMER				
Invoice	Horizon Ag & Turf				
٥٨٢	Lloydminster AB T9V 3A2				
=				S	alesperson
					KK

STK#/FLEET#		HRS	PIN/EIN V	WARRANTY DATE	HRS
032842	S790 STS DJ HOG	1310	1H0S790SJJ0800243	3 08/02/19	
	S790 STS	1310		08/01/21	1500

Have you heard about MyDealer yet? We have a great new way to help you stay connected to your equipment. Either mobile or laptop - look up parts, order them online, view past purchases, or book a service appointment, you are in control. Ask a parts or service member about MyDealer today!

SEGMENT# 1 C 9670 NA 10/08/24 10/08/24

UNIT IS GOING ON DEMO:

- ENSURE UNIT IS FUELED UP AND DEF IS FULL

- CHECK ALL OIL LEVELS

- PERFORM QUICK RUNNING AND OPERATION CHECKS.

DEF 2.5GAL. 2 15.70 31.40 PARTS 31.40 LABOR 536.40 52000223 SEGMENT TOTAL==> 567.80

SEGMENT# 2 C 9671 NA 10/08/24 10/08/24 CLEAN GRAIN ELEVATOR CHAIN BROKE AND DRIVE BELT BURNT. REPLACE ELEVATOR CHAIN AND DRIVE BELT.

CONTINUED ON PAGE 02

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH (24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, Inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,



		Branch				
to:	IN STORE PICKUP	ST. PAUL Date	Time			Page
Ship		10/23/24		07:39 (B)		02
S		Account No.	Phone No	D.	Invoi	ice No.
		INTER01A	780	8754471	W00	0499
		Ship Via		Purchase Orde	er	
to:	INTERNAL CUSTOMER					
	Horizon Ag & Turf					
Invoice	Lloydminster AB T9V 3A2					
=				Sa	lesperso	on
					KK	

STK#/FLEET#		HRS	PIN/EIN	WARR	ANTY DATE	HRS
032842	S790 STS DJ HOG	1310	1H0S790SJJ080	0243	08/02/19	
	S790 STS	1310			08/01/21	1500
**** TECH	NICIANS COMMENTS ****	******	* * * * * * * * * * * * * *	******	* * *	
*					*	
*Brought u	nit up to 30ft bay. Re	emoved c	old clean grai	n	*	
*elevator	chain. It was jammed i	in place	e and had to p	ry it	*	
*out 1 lin	k at a time. Dropped h	nopper a	auger. Ran a r	ope down	1 *	
*the eleva	tor and connected it t	to a nev	v chain. Pulle	d new	*	
*chain thr	ough and connected it.	. Set cł	nain tension a	s per	*	
*service a	dvisor. Removed 2 pane	els in f	nopper to acce	ss belt	*	
*pulleys.	Installed belt and rou	ited com	rrectly. Adjus	t belt	*	
*tension.	Installed all shields	back ir	n place. Ran u	nit and	*	
*found gra	in tank auger not turr	ning. Fo	ound top beari	ng was	*	
*completel	y pushed out of the fl	lange. (Got all requir	ed parts	5 *	
*for repai	r. Installed new bear	ings and	d flanges. Adj	ust load	1 *	
*auger for	proper coupling. Test	c operat	tion all worke	d	*	
*properly.					*	
*					*	
*******	****	* * * * * * * * *	*****	******	* * *	
AXE16681	(CG CHAIN	۸	1 0	1582.69	1582.69
HXE20763	I	Belt 2BV	7	1	375.88	375.88
JD10384	I	BEARING		1	75.87	75.87
N15764	I	FLANGETT	ГЕ	2	8.37	16.74
	Pressed Flanged	Housing	3			
					PARTS	2051.18
					LABOR	1123.20
	16001001			SEGMENT	TOTAL==>	3174.38

****** WORK ORDER TOTALS ****** INTERNAL CUSTOMER

CONTINUED ON PAGE 03

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH (24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, Inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,



		Branch				
	IN STORE PICKUP	ST. PAUL				
to:		Date	Time			Page
Ship		10/23/24	23:	07:39 (B		03
S		Account No.	Phone N	D.	Invo	ice No.
		INTER01A	780	8754471	W0	0499
		Ship Via		Purchase Or	der	
ë	INTERNAL CUSTOMER					
<u>6</u>	Horizon Ag & Turf					
nvoice	Lloydminster AB T9V 3A2					
-				S	alespers	on
					KK	

STK#/FLEET	ŧ	HRS	PIN/EIN	WARRANTY DATE	HRS
032842	S790 STS DJ HOG	1310	1H0S790SJJ08002	243 08/02/19	
	S790 STS	1310		08/01/21	1500
				PARTS	2082.58
				LABOR	1659.60
				Shop Supplies	165.96
				INTERNAL TOTAL	3908.14

A SERVICE CHARGE ON OVERDUE ACCOUNTS AT THE RATE OF 2 % PER MONTH (24 % PER ANNUM). STORAGE FEES WILL BE CHARGED AFTER 30 DAYS.

I hereby authorize the above work to be done along with the use of necessary materials, You and your employees may operate above machine for purposes of testing, Inspection or delivery at my risk, I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanics lien is acknowledged on above machine to secure the amount of repairs thereto, It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair or while field testing, Items left for 30 days after completion date will be subject to storage fees,



Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

W١	ww.agland.ca	780-645-4437 • 1-877-645-9933		78	0-853-5361	• 1-877-85	3-0922
_			Branch				
	IN STORE PICKUP		ST. PAUL		*REPRI	ENT*	
ĽĽ			Date	Time			Page
Ship			12/29/23	23:	32:12	(B)	01
S			Account No	Phone No		Inv	' No
L			INTER01	780	8754471		95587
_			Ship Via		Purchase Or	der	
.: To:	INTERNAL CUSTOMER						
	Agland						
Invoice	Lloydminster AB T	9V 3A2					
Í						Salespers	on
L						KS	К

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

780-645-4437 • 1-877-645-9933

DESCRIPTION OF WORK & PARTS

STK#/FLEET# 032842 S790 STS DJ HOG S790 STS	HRS PIN/EIN 1791 1H0S790SJJ080 1310		ANTY DATE 08/02/19 08/01/21	HRS 1500	Fold
<pre>TRADE UNIT - USE TRADE CHECKLIST *ONCE CHECKLIST IS COMPLETED PLEX APPROVAL OF REPAIRS TO BE DONE. ***** TECHNICIANS COMMENTS ****** * *Bring unit up to shop. *+Remove all panels off combine. *+Inspect combine, compose estimated.</pre>	ASE GO OVER WITH SAL	ES FOR	14.00 *** * * *	HRS	
*+Take all old parts out.			*		
*Completed final running checks			*		
*			*		
***********	* * * * * * * * * * * * * * * * * * * *	******	* * *		
			LABOR	2408.00	
16001		SEGMENT	TOTAL==>	2408.00	
SEGMENT# 2 C 670 10-000-003 11 TRADE COMBINE- CLEAN AND WASH EXT TOUCH UP PAINT ON COMBINE LUBE ALL CHAINS GREASE MACHINE ENTIRELY AFTER WAS PARK IN LINE UP DETAIL AS NEEDED ***** TECHNICIANS COMMENTS ****** * Brought combine to yard compress *complete combine prior to inspect	SH ******************************** sor in field. Blow o ction.	******* ff *******	* * *		
• I hereby certify the above work to be done along with the u	use of necessary materials. You and vo	our	х		
employees may operate above machine for purposes of tes agree to pay cash on delivery of machine or on terms satis	ting, inspection, or delivery at my risk	. I -	Signature		Date

express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.

Terms: Full payment due immediately upon completion of work or service the another or overdue account at the rate of 1.5% per month (18% per annum)
It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.



Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

WW	vw.agland.ca	780-645-4437 • 1-877-645-9933		78	0-853-5361	1-877-85	3-0922
Г	IN STORE PICKUP		Branch ST. PAUL				
p To:	IN DIONE FICKOF		Date	Time			Page
Ship			12/29/23	23 : Phone No	32:12	. ,	02 No
			Account No				
			INTER01	780	8754471	ם ב	95587
_			Ship Via		Purchase Or	der	
Ë	INTERNAL CUSTOMER						
	Agland						
Invoice	Lloydminster AB T9	V 3A2					
Ë						Salespers	on
						KS	К

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

DESCRIPTION OF WORK & PARTS

STK#/FLEE	T#	HRS	PIN/EIN	WARR	ANTY DATE	HRS	Fold
032842	S790 STS DJ HOG	1791	1H0S790SJJ08	300243	08/02/19		
	S790 STS	1310			08/01/21	1500	
					LABOR	576.20	
	16001			SEGMENT	TOTAL==>	576.20	
SEGMENT#	3 C 670 NA	11/15/	23 12/13/23			······	
	OVER TIME - SEE MESSA						
	nit likely has an issu			ISE			
	Parts were swapped f						
	and the problem follow						
	ht swapped Y3 float va						
	lve P/N AN279596. We b						
valve as	the D29 was already r	replaced	earlier. You	can take			
a look a	t S78345 and S77538 fo	or refere	ence.				
**** TE	CHNICIANS COMMENTS ***	******	* * * * * * * * * * * * * *	********	* * *		
*					*		
*Confirm	ed FH did leak down, S	wapped Y	Y3 float valve	e	*		
*+with D	DJ Hog unit 1 s/n 80013	4. Lower	red FH down ar	nd	*		
*measure	ed 23 1/4" @8:45 AM (Ur	nit 1). :	Installed unit	: 1 float	*		
*valve i	n unit 2. Lowered FH a	ind measu	ured. 23 1/4"	8:51 AM	*		
*(Unit 2	.)				*		
*Monitor	ed both fh's for sever	al days	- no change.	After	*		
_	ing all repairs checke	ed fh aga	ain and it sti	ill did	*		
*not dro	qq				*		
*					*		
******	****	*****	* * * * * * * * * * * * * * *	*******			
					LABOR	682.15	
	16001			SEGMENT	TOTAL==>	682.15	

SEGMENT# 5 C 670 12/14/23 12/14/23 NA FRONT WINDSHIELD CRACKED. GET CORWIN TO COME MAKE INSTALL ON NEW WINDSHIELD.

CONTINUED ON PAGE 03

Signature

Х

• I hereby certify the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.

Terms: Full payment due immediately upon completion of work or service charge on overdue account at the rate of 1.5% per month (18% per annum)
It is understood that this company assumes no responsibility for loss or damage by theft or fire to

machine placed with them for storage, sale, repair, or while field testing.

Solutions from the Ground Up



LLOYDMINSTER

Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

г		Branch				
	IN STORE PICKUP	ST. PAUL				
ے ۲		Date	Time			Page
Ship		12/29/23	23:	32:12	(B)	03
ν N		Account No	Phone No		I	Inv No
L		INTER01	780	8754471	L	D95587
		Ship Via		Purchase Or	der	
ö	INTERNAL CUSTOMER					
e E	Agland					
Invoice	Lloydminster AB T9V 3A2					
Ľ					Salespe	erson
L					K	SK

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

780-645-4437 • 1-877-645-9933

DESCRIPTION OF WORK & PARTS

STK#/FLEE 032842	S790 STS DJ HOG	HRS PIN/EIN 1791 1H0S790		ANTY DATE 08/02/19	HRS	Fold
	S790 STS	1310		08/01/21	1500	
	CHNICIANS COMMENTS **	*****	******			
*				*		
	pair Moved to w/o D95	694		*		
*				*		
******	*****	*****	* * * * * * * * * * * * *	* * *		
SEGMENT#	6 C 670 NA	12/14/23 12/15/	23			
	PPLY LINE LEAKING FUR			1.50	HRS	
**** TE	CHNICIANS COMMENTS **	*****	*****	* * *		
*				*		
	all clamps on line,			n *		
*+parts.	Installed new line.	Re clamped line is	n several	*		
*spots w	ith clamps.			*		
*				*		
******	* * * * * * * * * * * * * * * * * * * *	*****	*****	* * *		
INST		ASSY/ENV CHG.	2	4.00	8.00	
R49921		CLAMP	1	8.35	8.35	
X1JS43-6	- 8	11/16"FFF-1/2"H	1	28.59	28.59	
X1J143-1	0 - 8	5/8FS/LK90L-1/2	1	51.12	51.12	
X487TC-8	-RL	1/2" HYD HOSE	17	9.44	160.48	
				PARTS	256.54	
				LABOR	490.20	
	16001		SEGMENT	TOTAL==>	746.74	
SEGMENT#	7 C 670 NA	12/14/23 12/27/	23			
ACTIVE H	HC CODE. FURTHER DIA	GNOSE AND ADVISE		1.50	HRS	
**** TE	CHNICIANS COMMENTS **	****	* * * * * * * * * * * * *	* * *		
*				*		
*Hooked	combine up to pickup	and confirmed HHC		*		
	d air bag pressures.			*		
				INUED ON PA	AGE 04	

• I hereby certify the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.

Terms: Full payment due immediately upon completion of work or service charge on overdue account at the rate of 1.5% per month (18% per annum)
It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.

Solutions from the Ground Up

Х

Signature



LLOYDMINSTER

Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

> > Date

		 Branch					
	IN STORE PICKUP	ST. PAUL					
°⊑		Date	Time				Page
Ship		12/29/23	23:	32:12 ((в)		04
S		Account No	Phone No			Inv No)
I		 INTER01	780	8754471	.	D95	587
		 Ship Via	·	Purchase Or	der		
To:	INTERNAL CUSTOMER						
	Agland						
Invoice	Lloydminster AB T9V 3A2						
In					Salesp	person	
l]	KSK	

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

780-645-4437 • 1-877-645-9933

DESCRIPTION OF WORK & PARTS

Signed String Link Link Link Link Link Link Link Link	STK#/FLEE	Ͳ#	HRS	PIN/EIN	WARR	ANTY DAT	РF:	HRS	
S790 STS 1310 08/01/21 1500 **Adjusted air bag pressures and cleared codes * *+Codes did not come back. * * * 16001 LABOR 240.80 SEGMENT# 8 C 662 NA 12/14/23 EXHAUST MANIFOLD LEAK OUT OF #1 HOLE. INSTALL NEW MANIFOLD 18.00 HRS GASKETS AND EGR GASKETS AS REQUIRED. ************************************								into	Fold
<pre>*+Adjusted air bag pressures and cleared codes *+Codes did not come back. * * * * LABOR 240.80 16001 SEGMENT TOTAL==> 240.80 16001 SEGMENT TOTAL==> 240.80 SEGMENT# & C 662 NA 12/14/23 12/14/23 EXHAUST MANIFOLD LEAK OUT OF #1 HOLE. INSTALL NEW MANIFOLD GASKETS AND EGR GASKETS AS REQUIRED. ***** TECHNICIANS COMMENTS ************************************</pre>	002042		-	11100790000	0000245			1500	
*+Codes did not come back. * * * * * * * * * * * * * * * * * * *	*+Adiuste			red codes					
<pre>* ***********************************</pre>	-					*			
LABOR 1600240.80SEGMENT TOTAL==>240.80SEGMENT# & C G62N12/14/23 12/14/23EXHAUST MANIFOLD LEAK OUT OF #1 HOLE. INSTALL NEW MANIFOLD GASKETS AND EGR GASKETS AS REQUIRED.18.00 HRS***********************************						*			
16001EGMENT TOTAL=>>240.80SEGMENT# 8 C 662NA12/14/23 12/14/23EXHAUST MANIFOLD LEAK OUT OF #1 HOLE. INSTALL NEW MANIFOLD GASKETS AND EGR GASKETS AS REQUIRED.18.00 HRS****** TECHNICIANS COMMENTS ************************************	* * * * * * * *	* * * * * * * * * * * * * * * * * * * *	******	* * * * * * * * * * * *	* * * * * * * * * *	* * *			
SEGMENT# 8 C 662 NA 12/14/23 12/14/23 EXHAUST MANIFOLD LEAK OUT OF #1 HOLE. INSTALL NEW MANIFOLD 18.00 HRS GASKETS AND EGR GASKETS AS REQUIRED. ***** ***** TECHNICIANS COMMENTS ************************************						LABO	OR	240.80	
EXHAUST MANIFOLD LEAK OUT OF #1 HOLE. INSTALL NEW MANIFOLD GASKETS AND EGR GASKETS AS REQUIRED. ****** TECHNICIANS COMMENTS ************************************		16001			SEGMENT	TOTAL==	=>	240.80	
EXHAUST MANIFOLD LEAK OUT OF #1 HOLE. INSTALL NEW MANIFOLD GASKETS AND EGR GASKETS AS REQUIRED. ****** TECHNICIANS COMMENTS ************************************									
GASKETS AND EGR GASKETS AS REQUIRED. ***** TECHNICIANS COMMENTS ************************************	SEGMENT#	8 C 662 NA	12/14/2	23 12/14/23					
<pre>***** TECHNICIANS COMMENTS ************************************</pre>	EXHAUST I	MANIFOLD LEAK OUT OF #	1 HOLE.	INSTALL NEW	MANIFOLD	18	.00 HRS	5	
 * * * * * * * * * * * * * * * * * * *	GASKETS 2	AND EGR GASKETS AS REQ	JIRED.						
<pre>*Remove air intake plumbine, some egr plumbing. Remove * +turbo charger lube and cooling lines. Remove VGT turbo. * +Remove fuel dosing line. Remove exhaust manifold * +tbolts and spacers. Remove all Exhaust manifold * +tstuds. Remove manifold. +Remove VGT turbo studs out of * manifold. Chase all +threads on manifold. Clean manifold * mating surfaces. +Clean all threads on head, clean mating * *surfaces. Clean and dry with brake clean. * +tFound broken CAC upper cooler line clamp broken, ordered * +tclamp. +Install manifold into position and rest on EGR * *cooler. +Line up all gaskets and studs, ensure all gaskets * *were +aligned. Initially torqued all studs to spec. * *Isntalled * +tuts. Torque turned all manifold nuts. Installed turbo * *tstuds in manifold. Installed new turbo gasket. Installed * *+YGT onto manifold and torqued. Installed new inlet * ++and outlet gaskets. Installed turbo cross over tube and * </pre>	**** TE	CHNICIANS COMMENTS ***	******	****	*****	* * *			
<pre>*+turbo charger lube and cooling lines. Remove VGT turbo. *+Remove fuel dosing line. Remove exhaust manifold *+Bemove fuel dosing line. Remove exhaust manifold *+bolts and spacers. Remove all Exhaust manifold *+studs. Remove manifold. +Remove VGT turbo studs out of *manifold. Chase all +threads on manifold. Clean manifold *mating surfaces. +Clean all threads on head, clean mating *surfaces. Clean and dry with brake clean. **+Found broken CAC upper cooler line clamp broken, ordered *+clamp. +Install manifold into position and rest on EGR *cooler. +Line up all gaskets and studs, ensure all gaskets *were +aligned. Initially torqued all studs to spec. *Isintalled *+all spacers and manifold nuts. Initially torqued manifold *+nuts. Torque turned all manifold nuts. Installed turbo *+studs in manifold. Installed new turbo gasket. Installed *+VGT onto manifold and torqued. Installed new inlet *+and outlet gaskets. Installed turbo cross over tube and *</pre>	*					*			
<pre>*+Remove fuel dosing line. Remove exhaust manifold * *+bolts and spacers. Remove all Exhaust manifold * *+studs. Remove manifold. +Remove VGT turbo studs out of * *manifold. Chase all +threads on manifold. Clean manifold * *mating surfaces. +Clean all threads on head, clean mating * *surfaces. Clean and dry with brake clean. * *+Found broken CAC upper cooler line clamp broken, ordered * *+clamp. +Install manifold into position and rest on EGR * *cooler. +Line up all gaskets and studs, ensure all gaskets * *were +aligned. Initially torqued all studs to spec. * *Isstalled * *+all spacers and manifold nuts. Initially torqued manifold * *+studs in manifold. Installed new turbo gasket. Installed * *+turb = turbed all manifold nuts. Installed turbo * *+studs in manifold and torqued. Installed new inlet * *+and outlet gaskets. Installed turbo cross over tube and * </pre>		-	-			*			
<pre>*+bolts and spacers. Remove all Exhaust manifold * *+studs. Remove manifold. +Remove VGT turbo studs out of * manifold. Chase all +threads on manifold. Clean manifold * *mating surfaces. +Clean all threads on head, clean mating * surfaces. Clean and dry with brake clean. * *+Found broken CAC upper cooler line clamp broken, ordered * *+clamp. +Install manifold into position and rest on EGR * *cooler. +Line up all gaskets and studs, ensure all gaskets * *were +aligned. Initially torqued all studs to spec. * *Isntalled * *+all spacers and manifold nuts. Initially torqued manifold * *+studs in manifold. Installed new turbo gasket. Installed * *+VGT onto manifold and torqued. Installed new inlet * *+and outlet gaskets. Installed turbo cross over tube and * </pre>	*+turbo (charger lube and cooli:	ng lines	s. Remove VG	F turbo.	*			
<pre>*+studs. Remove manifold. +Remove VGT turbo studs out of * manifold. Chase all +threads on manifold. Clean manifold * mating surfaces. +Clean all threads on head, clean mating * surfaces. Clean and dry with brake clean. * *+Found broken CAC upper cooler line clamp broken, ordered * *+clamp. +Install manifold into position and rest on EGR * *cooler. +Line up all gaskets and studs, ensure all gaskets * *were +aligned. Initially torqued all studs to spec. * *Isntalled * *+all spacers and manifold nuts. Initially torqued manifold * *+studs in manifold. Installed new turbo gasket. Installed * *+VGT onto manifold and torqued. Installed new inlet * *+and outlet gaskets. Installed turbo cross over tube and * </pre>		-			£	*			
<pre>*manifold. Chase all +threads on manifold. Clean manifold * *mating surfaces. +Clean all threads on head, clean mating * *surfaces. Clean and dry with brake clean. * *+Found broken CAC upper cooler line clamp broken, ordered * *+clamp. +Install manifold into position and rest on EGR * *cooler. +Line up all gaskets and studs, ensure all gaskets * *were +aligned. Initially torqued all studs to spec. * *Isntalled * *+all spacers and manifold nuts. Initially torqued manifold * *+studs in manifold. Installed new turbo gasket. Installed * *+VGT onto manifold and torqued. Installed new inlet * *+and outlet gaskets. Installed turbo cross over tube and *</pre>						*			
<pre>*mating surfaces. +Clean all threads on head, clean mating * *surfaces. Clean and dry with brake clean. * *+Found broken CAC upper cooler line clamp broken, ordered * *+clamp. +Install manifold into position and rest on EGR * *cooler. +Line up all gaskets and studs, ensure all gaskets * *were +aligned. Initially torqued all studs to spec. * *Isntalled * *+all spacers and manifold nuts. Initially torqued manifold * *+studs in manifold. Installed new turbo gasket. Installed * *+VGT onto manifold and torqued. Installed new inlet * *+and outlet gaskets. Installed turbo cross over tube and *</pre>						*			
<pre>*surfaces. Clean and dry with brake clean. * *+Found broken CAC upper cooler line clamp broken, ordered * *+clamp. +Install manifold into position and rest on EGR * *cooler. +Line up all gaskets and studs, ensure all gaskets * *were +aligned. Initially torqued all studs to spec. * *Isntalled * *+all spacers and manifold nuts. Initially torqued manifold * *+nuts. Torque turned all manifold nuts. Installed turbo * *+studs in manifold. Installed new turbo gasket. Installed * *+VGT onto manifold and torqued. Installed new inlet * *+and outlet gaskets. Installed turbo cross over tube and *</pre>									
<pre>*+Found broken CAC upper cooler line clamp broken, ordered * *+clamp. +Install manifold into position and rest on EGR * *cooler. +Line up all gaskets and studs, ensure all gaskets * *were +aligned. Initially torqued all studs to spec. * *Isntalled * *+all spacers and manifold nuts. Initially torqued manifold * *+nuts. Torque turned all manifold nuts. Installed turbo * *+studs in manifold. Installed new turbo gasket. Installed * *+VGT onto manifold and torqued. Installed new inlet * *+and outlet gaskets. Installed turbo cross over tube and *</pre>	-				an mating				
<pre>*+clamp. +Install manifold into position and rest on EGR * *cooler. +Line up all gaskets and studs, ensure all gaskets * *were +aligned. Initially torqued all studs to spec. * *Isntalled * *+all spacers and manifold nuts. Initially torqued manifold * *+nuts. Torque turned all manifold nuts. Installed turbo * *+studs in manifold. Installed new turbo gasket. Installed * *+VGT onto manifold and torqued. Installed new inlet * *+and outlet gaskets. Installed turbo cross over tube and *</pre>		—							
<pre>*cooler. +Line up all gaskets and studs, ensure all gaskets * *were +aligned. Initially torqued all studs to spec. * *Isntalled * *+all spacers and manifold nuts. Initially torqued manifold * *+nuts. Torque turned all manifold nuts. Installed turbo * *+studs in manifold. Installed new turbo gasket. Installed * *+VGT onto manifold and torqued. Installed new inlet * *+and outlet gaskets. Installed turbo cross over tube and *</pre>				—					
<pre>*were +aligned. Initially torqued all studs to spec. * *Isntalled * *+all spacers and manifold nuts. Initially torqued manifold * *+nuts. Torque turned all manifold nuts. Installed turbo * *+studs in manifold. Installed new turbo gasket. Installed * *+VGT onto manifold and torqued. Installed new inlet * *+and outlet gaskets. Installed turbo cross over tube and *</pre>	-		-						
<pre>*Isntalled * *Isntalled * *+all spacers and manifold nuts. Initially torqued manifold * *+nuts. Torque turned all manifold nuts. Installed turbo * *+studs in manifold. Installed new turbo gasket. Installed * *+VGT onto manifold and torqued. Installed new inlet * *+and outlet gaskets. Installed turbo cross over tube and *</pre>					-				
<pre>*+all spacers and manifold nuts. Initially torqued manifold * *+all spacers and manifold nuts. Installed turbo * *+nuts. Torque turned all manifold nuts. Installed turbo * *+studs in manifold. Installed new turbo gasket. Installed * *+VGT onto manifold and torqued. Installed new inlet * *+and outlet gaskets. Installed turbo cross over tube and *</pre>			ued all	studs to spe	ec.				
<pre>*+nuts. Torque turned all manifold nuts. Installed turbo * *+studs in manifold. Installed new turbo gasket. Installed * *+VGT onto manifold and torqued. Installed new inlet * *+and outlet gaskets. Installed turbo cross over tube and *</pre>									
*+studs in manifold. Installed new turbo gasket. Installed * *+VGT onto manifold and torqued. Installed new inlet * *+and outlet gaskets. Installed turbo cross over tube and *									
*+VGT onto manifold and torqued. Installed new inlet * *+and outlet gaskets. Installed turbo cross over tube and *									
*+and outlet gaskets. Installed turbo cross over tube and *				-					
and outlet gashees. Installed tubb closs over tabe and		_							
CONTINUED ON PAGE US	*+and out	tiet gaskets. Installe	a turbo	cross over				0.5	
					CONT	TNUED OI	N PAGE	05	

• I hereby certify the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.

Terms: Full payment due immediately upon completion of work or service charge on overdue account at the rate of 1.5% per month (18% per annum)
It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.

Solutions from the Ground Up

Х

Signature



Agland

Invoice To:

LLOYDMINSTER

Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

v	www.ag	land.ca		780-645-4437	•	1-877-64
Ship To:	IN	STORE	PICKUP			

INTERNAL CUSTOMER

Lloydminster AB T9V 3A2

	Branch					
	ST. PAUL					
	Date	Time				Page
	12/29/23	23:	32 : 12	(B)		05
	Account No	Phone No			Inv N	0
	INTER01	780	875447	71	D95	5587
_	Ship Via		Purchase (Order		
				Sales	person	
					KSK	

DESCRIPTION OF WORK & PARTS

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

780-645-4437 • 1-877-645-9933

STK#/FLEET#	ŧ	HRS	PIN/EIN	WARR	ANTY DATE	HRS	
032842	S790 STS DJ HOG	1791	1H0S790SJJ08002	43	08/02/19		
	S790 STS	1310			08/01/21	1500	
*+torqued.	Installed inlet cla	mp and t	corqued.		*		
*+Replaced	l turbo cooling line :	seals on	n both lines. Ins	talle	d *		
	bo and installed cla	-			e *		
*+line and	l clamp. Installed co	olant cr	coss over tube be	hind	*		
*manifold	and clamped. Went to	install	egr inlet pipe	and	*		
*found a +	crack on backside of	pipe. C	Ordered pipe.		*		
*Installed	l new EGR tube and cla	amped to	cooler, torque	tube	*		
*+bolts in	to manifold. Install	egr sen	nsor tube. Instal	1	*		
*turbo +lu	be lines. Re install	all pan	neling and air in	take	*		
*plumbing	+mount air filter how	using. R	Re fill cooing sy	stem.	*		
*Ran unit	+verified no leaks.	All was	well.		*		
*					*		
*******	*****	* * * * * * * *	*****	* * * * *	* * *		
AXE40877		Latch		1 N	21.26	21.26	
A4730R		O-RING		3	3.56	10.68	
DZ100375		Gasket		3	15.99	47.97	
DZ10229		Stud		12 N	46.16	553.92	
DZ112908		Tube		1 M	1180.75	1180.75	
DZ114164		O-Ring		2 0	35.64	71.28	
HXE79975		Clamp		1 N	33.06	33.06	
RE540355		Gasket		1	27.23	27.23	
RE548047		Gasket		6 N	29.93	179.58	
RE553167		Gasket		1 N	74.01	74.01	
RE568261		Clamp		1 N	58.02	58.02	
R163559		O-Ring		2	2.54	5.08	
R28776		O-RING		5	3.01	15.05	
R522023		GASKET		1	61.31	61.31	
R526831		EGR Gas	sket	5	19.38	96.90	
R528237		Sealing	y Ring	1 N	58.97	58.97	
R528619		Stud		4 N	22.90	91.60	
				CONT	INUED ON PAG	E 06	

• I hereby certify the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.

Terms: Full payment due immediately upon completion of work or service charge on overdue account at the rate of 1.5% per month (18% per annum)
It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.

Solutions from the Ground Up

Х



Fold



Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

Date

www.agland.ca	780-645-4437 • 1-877-645-9933		780	0-853-5361 • 1-	877-853-	0922
		Branch				
IN STORE PICKU	2	ST. PAUL				
Ë		Date	Time			Page
Ship		12/29/23	23:	32:12 (B))	06
N		Account No	Phone No		Inv N	lo
		INTER01	780	8754471	D9	5587
		Ship Via		Purchase Order		
internal Custon	IER					
u Agland						
g Agiand Lloydminster Al	3 T9V 3A2					
Ë				Sa	lespersor	ı
L					KSK	

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

780-645-4437 • 1-877-645-9933

DESCRIPTION OF WORK & PARTS

032842 S790 STS DJ HOG 1791 1H0S790SJJ0800243 08/01/21 1500 R528620 Gaaket 1 100.62 100.62 R528620 Clamp 1 N 8.93 8.93 R532305 O-Ring 3 N 7.71 23.13 R536559 Gasket 1 N 28.92 28.92 R533762 Flange Nut 16 6.26 100.16 R542509 FLANCE BOLT 6 N 4.80 28.80 R551118 O-Ring 1 N 10.65 10.65 R65185 O-RING 3 5.36 16.08 T77613 F/F-ORING #6 2 2.95 5.90 19M7866 BOLT M8X20 2 1.58 3.16 19M7868 FL/BOLT-M8X30MM 1 1.92 1.92 SEGMENT# 9 C 662 NA 12/14/23 12/14/23 REVERSER DOES NOT REVERSE. SWEATING AT SPLIT. SUSPECT 4.00 HRS SHEARED RIVETS: SUFTARED DIAGNOSE. * * * ************************************	STK#/FLEE		HRS PIN/EIN		ANTY DATE	HRS	Fold
R528620 Gasket 1 100.62 100.62 R529067 Clamp 1 N 8.93 8.93 R533205 O-Ring 3 N 7.71 23.13 R536559 Gasket 1 N 28.92 28.92 R533762 Flange Nut 16 6.26 100.16 R542509 FLANGE BOLT 6 N 4.80 28.80 R551118 O-Ring 1 N 10.65 10.65 R63185 O-RING 3 5.36 16.08 T77613 F/F-ORING #6 2 2.95 5.90 19M7866 BOLT M8X20 2 1.58 3.16 19M7868 FL/BOLT-M8X30MM 1 1.92 1.92 PARTS 2914.94 LABOR 3104.60 16001 SEGMENT TOTAL==> 6019.54 SEGMENT#9 C 662 NA 12/14/23 REVERSER DOES NOT REVERSE. SWEATING AT SPLIT. SUSPECT 4.00 HRS SHEARED RIVETS. FURTHER DIAGNOSE. * * * ************************************	032842	S790 STS DJ HOG	1791 1H0S790SJJ	0800243	08/02/19		
R529067 Clamp 1 N 8.93 8.93 R532305 O-Ring 3 N 7.71 23.13 R536559 Gasket 1 N 28.92 28.92 R539762 Flange Nut 16 6.26 100.16 R542509 FLANGE BOLT 6 N 4.80 28.80 R551118 O-Ring 1 N 10.65 10.65 R63185 O-RING 3 5.36 16.08 T77613 F/F-ORING #6 2 2.95 5.90 19M7866 BOLT M8X20 2 1.58 3.16 19M7868 FL/BOLT-M8X30MM 1 1.92 1.92 PARTS 2914.94 LABOR 3104.60 16001 SEGMENT TOTAL==> 6019.54 SEGMENT# 9 C 662 NA 12/14/23 12/14/23 4.00 HRS SHEARED RIVETS. FURTHER DIAGNOSE. * * * ************************************		S790 STS	1310			1500	
R532305 0-Ring 3 N 7.71 23.13 R536559 Gasket 1 N 28.92 28.92 R539762 Flange Nut 16 6.26 100.16 R542509 FLANGE BOLT 6 N 4.80 28.80 R551118 0-Ring 1 N 10.65 10.65 R63185 0-RING 3 5.36 16.08 T77613 F/F-ORING #6 2 2.95 5.90 19M7866 BOLT M8X20 2 1.58 3.16 19M7868 FL/BOLT-M8X30MM 1 1.92 1.92 PARTS 2914.94 LABOR 3104.60 16001 SEGMENT TOTAL==> 6019.54 SEGMENT# 9 C 662 NA 12/14/23 12/14/23 REVERSER DOES NOT REVERSE. SWEATING AT SPLIT. SUSPECT 4.00 HRS SHEARED RIVETS. FUNTHER DIAGNOSE. * ************************************	R528620		Gasket	1	100.62	100.62	
R536559 Gasket 1 N 28.92 28.92 R533762 Flange Nut 16 6.26 100.16 R542509 FLANGE BOLT 6 N 4.80 28.80 R551118 O-Ring 1 N 10.65 10.65 R63185 O-RING 3 5.36 16.08 T77613 F/F-ORING #6 2 2.95 5.90 19M7866 BOLT M8X20 2 1.58 3.16 19M7868 FL/BOLT-M8X30MM 1 1.92 1.92 PARTS 2914.94 LABOR 3104.60 16001 SEGMENT TOTAL==> 6019.54 SECMENT# 9 C 662 NA 12/14/23 12/14/23 REVERSER DOES NOT REVERSE. SWEATING AT SPLIT. SUSPECT 4.00 HRS SHEARED RIVERS. FURTHER DIAGNOSE. * ************************************	R529067		Clamp	1 N	8.93	8.93	
R539762 Flange Nut 16 6.26 100.16 R542509 FLANGE BOLT 6 N 4.80 28.80 R551118 O-RING 1 N 10.65 10.65 R63185 O-RING 3 5.36 16.08 T77613 F/F-ORING #6 2 2.95 5.90 19M7866 BOLT M8X20 2 1.58 3.16 19M7868 FL/BOLT-M8X30MM 1 1.92 1.92 PARTS 2914.94 LABOR 3104.60 16001 SEGMENT TOTAL==> 6019.54 * <td>R532305</td> <td></td> <td>O-Ring</td> <td>3 N</td> <td>7.71</td> <td>23.13</td> <td></td>	R532305		O-Ring	3 N	7.71	23.13	
R542509 FLANCE BOLT 6 N 4.80 28.80 R551118 O-Ring 1 N 10.65 10.65 R63185 O-RING 3 5.36 16.08 T77613 F/F-ORING #6 2 2.95 5.90 19M7866 BOLT M8X20 2 1.58 3.16 19M7868 FL/BOLT-M8X30MM 1 1.92 1.92 PARTS 2914.94 LABOR 3104.60 LABOR 3104.60 16001 SEGMENT TOTAL==> 6019.54 SEGMENT# 9 C 662 NA 12/14/23 12/14/23 4.00 HRS SHEARED RIVETS. FURTHER DIAGNOSE. * * ******* TECHNICIANS COMMENTS ************************************	R536559		Gasket	1 N	28.92	28.92	
R551118 0-Ring 1 N 10.65 10.65 R63185 0-RING 3 5.36 16.08 T77613 F/F-ORING #6 2 2.95 5.90 19M7866 BOLT M8X20 2 1.58 3.16 19M7868 FL/BOLT-M8X30MM 1 1.92 1.92 PARTS 2914.94 LABOR 3104.60 16001 SEGMENT TOTAL==> 6019.54 SEGMENT# 9 C 662 NA 12/14/23 12/14/23 REVERSER DOES NOT REVERSE. SWEATING AT SPLIT. SUSPECT 4.00 HRS SHEARED RIVETS. FURTHER DIAGNOSE. * ******* TECHNICIANS COMMENTS ************************************	R539762		Flange Nut	16	6.26	100.16	
R63185 O-RING 3 5.36 16.08 T77613 F/F-ORING #6 2 2.95 5.90 19M7866 BOLT M8X20 2 1.58 3.16 19M7868 FL/BOLT-M8X30MM 1 1.92 1.92 PARTS 2914.94 LABOR 3104.60 16001 SEGMENT TOTAL==> 6019.54 SEGMENT# 9 C 662 NA 12/14/23 12/14/23 REVERSER DOES NOT REVERSE. SWEATING AT SPLIT. SUSPECT A.00 HRS SHEARED RIVETS. FURTHER DIAGNOSE. ******* TECHNICIANS COMMENTS ************************************	R542509		FLANGE BOLT	6 N	4.80	28.80	
T77613F/F-ORING #622.955.9019M7866BOLT M8X2021.583.1619M7868FL/BOLT-M8X30MM11.921.92PARTS2914.94LABOR3104.6016001SEGMENT TOTAL==>6019.54SEGMENT# 9 C 662 NA12/14/23 12/14/23REVERSER DOES NOT REVERSE. SWEATING AT SPLIT. SUSPECT4.00 HRSSHEARED RIVETS. FURTHER DIAGNOSE.***********************************	R551118		O-Ring	1 N	10.65	10.65	
19M7866EOLT M8X2021.583.1619M7868FL/BOLT-M8X30MM11.921.92PARTS2914.94LABOR3104.6016001SEGMENT TOTAL=>6019.54SEGMENT# 9 C 662 NA 12/14/23 12/14/23REVERSER DOES NOT REVERSE. SWEATING AT SPLIT. SUSPECT4.00 HRSSHEARED RIVETS. FURTHER DIAGNOSE.****** TECHNICIANS COMMENTS ************************************	R63185		O-RING	3	5.36	16.08	
19M7868 FL/BOLT-M8X30MM 1 1.92 1.92 PARTS 2914.94 LABOR 3104.60 16001 SEGMENT TOTAL==> 6019.54 SEGMENT# 9 C 662 NA 12/14/23 12/14/23 REVERSER DOES NOT REVERSE. SWEATING AT SPLIT. SUSPECT 4.00 HRS SHEARED RIVETS. FURTHER DIAGNOSE. * ****** * *Disassembled gearcase and found rivets on backing plate * *broken. Clean gearcase and all sealing surfaces. Rivet ring * * *gear back on. Heated water to heat up piston seals. * *Installed new piston seal. Installed shift seal carefully. * *Installed shift fork and +collar. Applied sealant and mated * * *connected reverser lines. Ran FH and verified correct * *operation *	т77613		F/F-ORING #6	2	2.95	5.90	
PARTS 2914.94 LABOR 3104.60 16001 SEGMENT TOTAL==> 6019.54	19M7866		BOLT M8X20	2	1.58	3.16	
LABOR 3104.60 6019.54 SEGMENT# 9 C 662 NA 12/14/23 12/14/23 REVERSER DOES NOT REVERSE. SWEATING AT SPLIT. SUSPECT 4.00 HRS SHEARED RIVETS. FURTHER DIAGNOSE. ***** TECHNICIANS COMMENTS ************************************	19M7868		FL/BOLT-M8X30MM	1	1.92	1.92	
1601SEGMENT TOTAL==>6019.54SEGMENT# 9 C 662 NA12/14/23 12/14/23REVERSER DOES NOT REVERSE. SWEATING AT SPLIT. SUSPECT4.00 HRSSHEARED RIVETS. FURTHER DIAGNOSE.****** TECHNICIANS COMMENTS ************************************					PARTS	2914.94	
SEGMENT# 9 C 662 NA 12/14/23 12/14/23 REVERSER DOES NOT REVERSE. SWEATING AT SPLIT. SUSPECT 4.00 HRS SHEARED RIVETS. FURTHER DIAGNOSE. ****** TECHNICIANS COMMENTS ************************************					LABOR	3104.60	
REVERSER DOES NOT REVERSE. SWEATING AT SPLIT. SUSPECT4.00 HRSSHEARED RIVETS. FURTHER DIAGNOSE.******* TECHNICIANS COMMENTS ************************************		16001		SEGMENT	TOTAL==>	6019.54	
REVERSER DOES NOT REVERSE. SWEATING AT SPLIT. SUSPECT4.00 HRSSHEARED RIVETS. FURTHER DIAGNOSE.************ TECHNICIANS COMMENTS ************************************	SEGMENT#	9 C 662 NA	12/14/23 12/14/23				
SHEARED RIVETS. FURTHER DIAGNOSE. ***** TECHNICIANS COMMENTS ************************************				PECT	4.00	HRS	
<pre>***** TECHNICIANS COMMENTS ************************************</pre>	SHEARED	RIVETS. FURTHER DIAG	NOSE.	-			
<pre>* * * *Disassembled gearcase and found rivets on backing plate *broken. Clean gearcase and all sealing surfaces. Rivet ring *gear back on. Heated water to heat up piston seals. *+Installed new piston seal. Installed shift seal carefully. *Installed shift fork and +collar. Applied sealant and mated *cases together. Torqued +bolts. Re mounted reverser on *feederhouse. Intalled +drive belt and mounted breather. Re *connected reverser lines. Ran FH and verified correct *operation * *</pre>				*****	* * *		
<pre>*broken. Clean gearcase and all sealing surfaces. Rivet ring * *gear back on. Heated water to heat up piston seals. * *+Installed new piston seal. Installed shift seal carefully. * *Installed shift fork and +collar. Applied sealant and mated * *cases together. Torqued +bolts. Re mounted reverser on * *feederhouse. Intalled +drive belt and mounted breather. Re *connected reverser lines. Ran FH and verified correct * *operation * *</pre>							
<pre>*broken. Clean gearcase and all sealing surfaces. Rivet ring * *gear back on. Heated water to heat up piston seals. * *+Installed new piston seal. Installed shift seal carefully. * *Installed shift fork and +collar. Applied sealant and mated * *cases together. Torqued +bolts. Re mounted reverser on * *feederhouse. Intalled +drive belt and mounted breather. Re *connected reverser lines. Ran FH and verified correct * *operation * *</pre>	*Disasse	mbled gearcase and fo	ound rivets on backin	g plate	*		
<pre>*gear back on. Heated water to heat up piston seals. * *Hinstalled new piston seal. Installed shift seal carefully. *Installed shift fork and +collar. Applied sealant and mated * *cases together. Torqued +bolts. Re mounted reverser on * *feederhouse. Intalled +drive belt and mounted breather. Re *connected reverser lines. Ran FH and verified correct * *operation * *</pre>					a *		
<pre>*+Installed new piston seal. Installed shift seal carefully. * *Installed shift fork and +collar. Applied sealant and mated * *cases together. Torqued +bolts. Re mounted reverser on * *feederhouse. Intalled +drive belt and mounted breather. Re *connected reverser lines. Ran FH and verified correct * *operation * *</pre>		-	-		-		
<pre>*Installed shift fork and +collar. Applied sealant and mated * *cases together. Torqued +bolts. Re mounted reverser on * *feederhouse. Intalled +drive belt and mounted breather. Re *connected reverser lines. Ran FH and verified correct * *operation * *</pre>					* *		
<pre>*cases together. Torqued +bolts. Re mounted reverser on * *feederhouse. Intalled +drive belt and mounted breather. Re *connected reverser lines. Ran FH and verified correct * *operation * *</pre>		_		-			
<pre>*feederhouse. Intalled +drive belt and mounted breather. Re * *connected reverser lines. Ran FH and verified correct * *operation * *</pre>							
<pre>*connected reverser lines. Ran FH and verified correct * *operation * *</pre>					*		
*operation * * *							
* *				11000			
	-	011					
				CONT		GE 07	
• I baraby particulate shows work to be done along with the use of processory materials. You and your \mathbf{V}							

• I hereby certify the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.

Terms: Full payment due immediately upon completion of work or service charge on overdue account at the rate of 1.5% per month (18% per annum)
It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.

Solutions from the Ground Up

Х

Signature



STRIPS.

LLOYDMINSTER

Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

www.a	agland.ca	780-645-4437 • 1-877-645-9933		78	0-853-5361 •	1-877-853	-0922
			Branch				
II	N STORE PICKUP		ST. PAUL				
			Date	Time			Page
Ship			12/29/23	23:	32:12 (1	в)	07
S			Account No	Phone No		Inv N	lo
			INTER01	780	8754471	D9	5587
			Ship Via		Purchase Ord	er	
Ë II	NTERNAL CUSTOMER						
⊢ Aq	gland						
DA LINA	loydminster AB T9	7 3A2					
In						Salespersor	٦
						KSK	

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

780-645-4437 • 1-877-645-9933

DESCRIPTION OF WORK & PARTS

STK#/FLEET#		HRS	PIN/EIN	WARR	ANTY DATE	HRS	Fold
032842	S790 STS DJ HOG	1791	1H0S790SJJ08	300243	08/02/19		
	S790 STS	1310			08/01/21	1500	
*******	* * * * * * * * * * * * * * * * * * * *	******	*****	******	* * *		
DE30216		Seal		3 O	33.78	101.34	
Т22828		O RING		1	3.42	3.42	
Z70692		Piston		1 N	71.59	71.59	
Z70694		SEAL		1	48.73	48.73	
16M2556		RIVET		6 S	1.17	7.02	
19M7407		#8BOLT-	M8X25MM	1	1.43	1.43	
					PARTS	233.53	
					LABOR	758.52	
	16001			SEGMENT	TOTAL==>	992.05	

SEGMENT#10 C 670 NA 12/14/23 12/14/23 TOP SPROCKETS 90% WORN. FEEDERCHAIN ROLLERS WORN AND 5.00 HRS HOURGLASSED. REPLACE CHAIN, SPROCEKTS, KEYS, AND WEAR

*Loosened feeder chain tensioners. Removed feeder chain end *+links and removed feeder chain from feeder house. Remove *+cotter pin shaft nut and feeder slip clutch from top

*shaft. +Loosened top sprocket sets screws and slid *sprockets away +from bearing housings. Note set screws and *sprockets were seized and hard to remove - required extra *time. Removed bearing housing hardware *+and removed top shaft from the feeder house. Removed *+bearings and top sprockets from top shaft. Removed and *+installed new bearings into bearing housings. Installed *new +sprockets and bearings onto top shaft. Reinstalled top *+shaft into feeder house. Installed and torqued bearing *+housing hardware. Reinstalled feeder slip clutch and

• I hereby certify the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.

• Terms: Full payment due immediately upon completion of work or service charge on overdue account at the rate of 1.5% per month (18% per annum)

• It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.

Solutions from the Ground Up

Signature Date

CONTINUED ON PAGE 08



LLOYDMINSTER

Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

W	ww.agland.ca	780-645-4437 • 1-877-645-9933		78	0-853-5361 •	1-877-853	-0922
			Branch				
	IN STORE PICKUP		ST. PAUL				
۴			Date	Time			Page
Ship			12/29/23	23	:32:12 (1	В)	08
S			Account No	Phone No		Inv N	No
L			INTER01	780	08754471	D9	5587
			Ship Via		Purchase Ord	er	
To:	INTERNAL CUSTOMER						
	Agland						
Invoice	Lloydminster AB	19V 3A2					
I						Salesperso	n
L						KSK	

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

DESCRIPTION OF WORK & PARTS

STK#/FLEE	Ͳ #	HRS PIN/EIN	WAR	RANTY DATE	HRS	Fold
032842	S790 STS DJ HOG	1791 1H0S790SJJ		08/02/19		1010
	S790 STS	1310		08/01/21	1500	
*+shaft	nut onto the shaft.	Torqued nut and insta	lled new	*		
	pin. Replaced top f	-		*		
*+Pulled	new feeder chain in	to the feeder house as	nd	*		
*+instal	led new end links. T	ensioned feeder chain	and	*		
*+rolled	feeder house over t	o set chain into top	sprockets	*		
*+Center	ed top sprockets in	feeder chain and torg	ued down	*		
*+the se	t screws.			*		
*				*		
* * * * * * * *	* * * * * * * * * * * * * * * * * * * *	* * * * * * * * * * * * * * * * * * * *	* * * * * * * * * *	* * * *		
AH220541		CON.LK557 BLTED	4	19.34	77.36	
AXE27247		FEEDER CHAIN	1	3162.97	3162.97	
HXE12346	3	Chain Sprocket	4	200.28	801.12	
Н156580		SET SCREW	16	5.92	94.72	
Н171960		STRIP	4	34.14	136.56	
H229470		SHAFT KEY	4	16.65	66.60	
JD10020		BEARING-1.50"ID	1	76.20	76.20	
JD9373		BRG-1.25 HEX ID	1	66.54	66.54	
11M7032		COTTER-3/16X2"	2	.86	1.72	
				PARTS	4483.79	
				LABOR	908.16	
	16001		SEGMEN'	T TOTAL==>	5391.95	
SEGMENT#1	1 C 670 NA	12/14/23 12/14/23				
FEEDERHO	USE DRIVE CHAIN STRE	TCHED, IDLER AND TENS	IONER	2.00	HRS	
SPRCKET	BEARINGS WORN. REPLA	CE CHAIN, AND SPROCKE	TS.			
**** TE	CHNICIANS COMMENTS *	* * * * * * * * * * * * * * * * * * * *	*******	* * * *		
*				*		
*Removed	drive chain. Replac	ed tension and idler	sprockets	*		
*+Instal	led and adjusted new	feeder drive chain.		*		
*				*		
			CON	TINUED ON PA	GE 09	
		vith the use of necessary materials. You a		X		
		es of testing, inspection, or delivery at m ms satisfactory with you and until paid i		Signature		Date

agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.

Terms: Full payment due immediately upon completion of work or service charge on overdue account at the rate of 1.5% per month (18% per annum)
It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.



Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

w	ww.agland.ca	780-645-4437 • 1-877-645-9933		780	0-853-5361 •	1-877-85	3-0922
٢	TN CHODE DICKUD		Branch				
Ц	IN STORE PICKUP		Date	Time			Page
Ship			12/29/23	23:	32:12 ((В)	09
s			Account No	Phone No		Inv	No
L			INTER01	780	8754471	. D	95587
_			Ship Via		Purchase Or	der	
ö	INTERNAL CUSTOMER						
e I	Agland						
Invoice	Lloydminster AB	T9V 3A2					
Ē						Salespers	on
L						KS	К

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

DESCRIPTION OF WORK & PARTS

STK#/FLEET#			PIN/EIN		ANTY DATE	HRS	Fol
032842	S790 STS DJ HOG		1H0S790SJJ	0800243	08/02/19		
	S790 STS	1310			08/01/21	1500	
	* * * * * * * * * * * * * * * * * * * *						
AXE19940			procket	2 N	71.15	142.30	
AXE80368		60H 181	LINKS	1	242.91	242.91	
					PARTS	385.21	
					LABOR	414.86	
	16001			SEGMENT	TOTAL==>	800.07	
SEGMENT#12	C 670 NA	12/14/2	3 12/14/23				
SPREADER \	/IBRATION. PLAY IN B	OTH SPINN	ER HUBS. RE	MOVE AND	6.00	HRS	
INSPECT HU	JBS. REPLACE IF REQU	IRED. MIS	SING SHOCK	PIN.			
**** TECH	INICIANS COMMENTS **	******	* * * * * * * * * * *	*****	* * *		
*					*		
*Lifted ch	nopper and tail boar	d all the	way up and	l removed	*		
*+spreader	shocks. Removed sp	reader an	d dog tail		*		
-	housings from lower				*		
*+and lowe	er spreader support	off of ta	il board. R	lemoved	*		
*+spreader	rs from the motor sh	afts and	set on benc	h to	*		
*+inspect.	Inspected spreader	hubs and	motors for	wear and	*		
*+damage.	both spreader hubs	have exce	ssive wear		*		
_	ways are pounding o				*		
*+(Advise	replacing both spre	ader hubs)		*		
*+Installe	ed new spinner hubs	into spre	ader disks.		*		
*+installe	ed new tone wheels a	nd bearin	gs onto		*		
*+hubs. Re	einstalled hubs onto	motors w	ith new key	s.	*		
*+Reinstal	lled spreader lower	support o	nto tailboa	rd	*		
*+and inst	all bearing housing	s. Reinst	alled sprea	der shocks	*		
*+onto tai	l board. replaced m	issing sh	ock pin		*		
*					*		
********	* * * * * * * * * * * * * * * * * * * *	******	* * * * * * * * * * *	****	* * *		
A-HPC08		HAIR PI	N CLIP	1	.29	.29	
				CONT	INUED ON PA	GE 10	
• 1 · · · · · · ·	the shows work to be done slong wit				~		

I hereby certify the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.

Terms: Full payment due immediately upon completion of work or service charge on overdue account at the rate of 1.5% per month (18% per annum)
It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.

Solutions from the Ground Up

Signature



LLOYDMINSTER

Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

		Branch				
	IN STORE PICKUP	ST. PAUL				
۴		Date	Time			Page
Ship		12/29/23	23:	32:12 (H	3)	10
S		Account No	Phone No		Inv N	lo
l		INTER01	780	8754471	D9	5587
		Ship Via		Purchase Orde	er	
To:	INTERNAL CUSTOMER					
	Agland					
Invoice	Lloydminster AB T9V 3A2					
In					Salespersor	1
I					KSK	

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

780-645-4437 • 1-877-645-9933

DESCRIPTION OF WORK & PARTS

STK#/FLEET#	ŧ	HRS	PIN/EIN	WARR	ANTY DATE	HRS	Fold
032842	S790 STS DJ HOG	1791	1H0S790SJJ0	800243	08/02/19		
	S790 STS	1310			08/01/21	1500	
AXE23329		Disk		1 N	1293.08	1293.08	
AXE24027		Disk		1 N	1258.59	1258.59	
HXE25673		SPACER		2 N	11.49	22.98	
JD39102		BEARING	-25MM	2	33.48	66.96	
49M7061		Shaft K	ley	2 S	1.31	2.62	
					PARTS	2644.52	
					LABOR	1096.33	
	16001			SEGMENT	TOTAL==>	3740.85	
SEGMENT#13	C 670 NA	12/14/2	3 12/14/23				
	MMERS AND BUSHINGS			PALCE ALL	3.00	HRS	
HAMMERS AN	ID BUSHINGS.						
**** TECH	INICIANS COMMENTS **	******	* * * * * * * * * * * *	*****	* * *		
*					*		
*Lifted ch	opper and removed cl	hopper pa	nel to acces	s rotor.	*		
	all chopper hammers				*		
	ed all new chopper ha		-		*		
	hardware down and re		-		*		
*					*		
* * * * * * * * * *	****	*******	*****	*****	* * *		
HXE118760		Lock Nu	t 10M	30	1.78	53.40	
HXE15909		Spacer		44	16.01	704.44	
HXE59496		BUSHING	ł	44	13.75	605.00	
KXE10255		Knife K	it(L&R)	6	312.41	1874.46	
19M7935			M10X55MM	30	3.05	91.50	
					PARTS	3328.80	
					LABOR	450.64	
	16001			SEGMENT	TOTAL==>	3779.44	
SEGMENT#14	C 670 NA	12/14/2	3 12/14/23				
		. ,		CONT	INUED ON PA	GE 11	

Date

Х

Signature

• I hereby certify the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.

Terms: Full payment due immediately upon completion of work or service charge on overdue account at the rate of 1.5% per month (18% per annum)
It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.



Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

W	ww.agland.ca	780-645-4437 • 1-877-645-9933		780	0-853-5361 •	1-877-85	3-0922
[IN STORE PICKUP		Branch ST. PAUL				
Ë			Date	Time			Page
Ship			12/29/23	23:	32:12	(B)	11
o ا			Account No	Phone No		Inv	No
L			INTER01	780	8754471		95587
-			Ship Via		Purchase Or	der	
: ۲	INTERNAL CUSTOMER						
	Agland						
Invoice	Lloydminster AB T9	V 3A2					
Ĩ					-	Salespers	on
L			-			KG	ĸ

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

780-645-4437 • 1-877-645-9933

DESCRIPTION OF WORK & PARTS

STK#/FLEET	#	HRS	PIN/EIN	WARR	ANTY DATE	HRS	Fold
032842	S790 STS DJ HOG	1791	1H0S790SJJ0	800243	08/02/19		
	S790 STS	1310			08/01/21	1500	
RETHRESHE	R				6.00	HRS	
- CYLINDER	BEARINGS WORN AND CA	USING VI	BRATION.r0.5	hr			
-DRIVE CH	AIN WORN						
-IDLER SP	ROCKETS SEIZED ON HUB						
-TOP SPRO	CKET LOOSE ON SHAFT.						
-BOTH COV	ERS DAMAGED.						
**** TEC	HNICIANS COMMENTS ***	* * * * * * * *	*****	******	* * *		
*					*		
*Removed	chain guards and reth	resher d	rive chain		*		
*+Removed	threshing cylinder d	rive spr	ocket and		*		
*+elevato	r drive sprocket. Rem	oved loc	k collar and	bearing	*		
*+from RH	S of elevator top sha	ft. slid	l top sprocke	t and	*		
*+spacer	to the side enough to	replace	top shaft k	ey.	*		
*+Install	ed new Key and slid t	op sproc	ket and spac	er back	*		
*+into pl	ace. Reinstalled bear	ing, loc	k collar, an	d elevato	r *		
*+drive s	procket onto top shaf	t. Pulle	d return ele	vator	*		
*chain +b	ack into the elevator	. Instal	led end link	and	*		
*tensione	d +return elevator ch	ain.			*		
*+Removed	rethresher slip clut	ch to ac	cess cylinde	r bearing	*		
*+Removed	and replaced both cy	linder b	earings and	lock	*		
*+collars	. Reinstalled slip cl	utch and	rethresher	drive	*		
*+Replace	d damaged chain guard	S			*		
*					*		
******	* * * * * * * * * * * * * * * * * * * *	* * * * * * * *	*****	******	* * *		
AH133191		LOCKING	COLLAR	2	25.55	51.10	
AXE23133		Idler S	procket	2	68.94	137.88	
AXE54619		CHAIN 6	0X114L	1	265.04	265.04	
AZ10045		LOCK CC	LLAR-30M	2	15.13	30.26	
HXE103075		Shield		1 N	451.71	451.71	
HXE23793		Shield		1 N	205.34	205.34	
				CONT	INUED ON PA	GE 12	

• I hereby certify the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.

Terms: Full payment due immediately upon completion of work or service charge on overdue account at the rate of 1.5% per month (18% per annum)
It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.

Solutions from the Ground Up

Х

Signature



Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

W۷	vw.agland.ca	780-645-4437 • 1-877-645-9933		70	0-853-5361 • 1-8	5//-055-	0922
_			Branch				
	IN STORE PICKUP		ST. PAUL				
2			Date	Time			Page
			12/29/23	23:	32:12 (B)		12
'			Account No	Phone No		Inv N	lo
			INTER01	780	8754471	D9	5587
_			Ship Via	•	Purchase Order		
:	INTERNAL CUSTOMER						
	Agland						
	Lloydminster AB T9V	' 3A2					
					Sal	espersor	า
						KSK	

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

780-645-4437 • 1-877-645-9933

DESCRIPTION OF WORK & PARTS

STK#/FLEET#			PIN/EIN		ANTY DATE	HRS	Fold
032842	S790 STS DJ HOG	1791	1H0S790SJ	10800243	08/02/19		
	S790 STS	1310			08/01/21	1500	
H114395		SPACER		1 N	6.50	6.50	
H216427		SPACER		1 N	16.43	16.43	
JD10384		BEARING		2	74.82	149.64	
JD39104		BALL BE	ARING	2	64.94	129.88	
03M7191		BOLT-M1	0 X 25MM	4	1.45	5.80	
14M7296		NUT - 10M	M FLG HD	3	1.85	5.55	
26M4228		KEY-M8X	26MM	1	9.00	9.00	
					PARTS	1464.13	
					LABOR	1016.52	
	16001			SEGMENT	TOTAL==>	2480.65	
SEGMENT#15	C 670 NA	12/11/2	3 12/14/23				
WORN/CRACK		12/14/2	5 12/14/25		5 00	HRS	
	TOR BELT. (A)				5.00	IIIO	
- SECONDARY	. ,						
	C. (B)-LEAVE						
	OPPER BELT (A)						
	E BEATER (A)						
	EDER (B)-LEAVE						
	EDER (B)-LEAVE						
	INICIANS COMMENTS **	****	*******	*****			
*					*		
*Replace p	primary and accelera	tor belt	on RHS.		*		
*+Remove s	spreader pump and be	lt shroud	. Remove ch	narge pump.	*		
*+Remove a	aftertreatment belt	and shrou	d. Remove u	unloader	*		
*+belts ar	nd guide. Remove upp	er choppe	r belt. Ins	stall and	*		
*+tension	new belt. Re instal	l unloade	r belts and	d guide.	*		
*+Install	debris belt and shr	oud. Inst	all charge	pump	*		
*+and isol	lator. Mount spreade	r pump an	d shroud. H	Remove	*		
	nopper belts. Remove				*		
					INUED ON P	AGE 13	
					-		

• I hereby certify the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.

Terms: Full payment due immediately upon completion of work or service charge on overdue account at the rate of 1.5% per month (18% per annum)
It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.

Solutions from the Ground Up

Х

Signature



LLOYDMINSTER

Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

_		Branch			
	IN STORE PICKUP	ST. PAUL			
°Ľ		Date	Time		Page
Ship		12/29/23	23:32:12	(B)	13
N		Account No	Phone No	Inv No	þ
L		INTER01	7808754471	1 D95	587
_		Ship Via	Purchase Or	rder	
To:	INTERNAL CUSTOMER				
	Agland				
Invoice	Lloydminster AB T9V 3A2				
ΪĽ				Salesperson	
L				KSK	
		L			

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

780-645-4437 • 1-877-645-9933

DESCRIPTION OF WORK & PARTS

STK#/FLEET#	HRS PIN/EIN		RANTY DATE	HRS	Fold
032842 S790 STS DJ		0800243	08/02/19		
S790 STS	1310		08/01/21	1500	
	ter belt and tension. Re i	nstall	*		
*cover. Re install lowe	r chopper belts.		*		
*	* * * * * * * * * * * * * * * * * * * *				
				680.98	
HXE124868 HXE124870	BELT 3HC	1 1	680.98 433.00	433.00	
HXE54503	V-Belt 3B/NOTCHED/FEED	1	433.00 330.34	330.34	
HXE88564	V-Belt	1	377.04	377.04	
HXE95511	V-Belt	1	270.89	541.78	
HXE95511	V-Bert	2	270.89 PARTS	2363.14	
			LABOR	868.60	
16001		0 E CMENT	TOTAL==>	3231.74	
10001		SEGMENT		JZJI.74	
SEGMENT#16 C 670 NA	12/14/23 12/14/23				
	HAS DAMAGE FROM CHAIN JUN	IPING. LOWE	ER 2.50	HRS	
KEY WAY POUNDED. INSTAL	L NEW KEY IF POSSIBLE WITH	IOUT			
REPLACEING AUGER.					
**** TECHNICIANS COMME	NTS ************************************	* * * * * * * * * * *	* * * *		
*			*		
*Loosened clean grain e	levator chain tension and	removed	*		
*+chain end link. Remov	ed lock collar and bearing	g from auge	er *		
*+shaft. Slid lower spr	ocket to the side enough t	o access	*		
*+the key. Inspected ke	y way from damage from pou	unding.	*		
*+Key way has sight wea	r from pounding. (Advise i	nstalling	*		
*+longer key that spans	the entire length of the	key way)	*		
*+Installed a longer ke	y and slid lower sprocket	and spacer	*		
*+back into place. Inst	alled a new shaft bearing	and lock	*		
*+collar onto the auger	shaft. Replaced LHS shaft	bearing	*		
*+as well. Installed el	evator chain end link and	tensioned	*		
*+chain. Reinstalled be	aring cover.		*		
		CONT	INUED ON PA	AGE 14	

• I hereby certify the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.

Terms: Full payment due immediately upon completion of work or service charge on overdue account at the rate of 1.5% per month (18% per annum)
It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.

Solutions from the Ground Up

Х

Signature



Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

www.agland.ca	780-645-4437 • 1-877-645-9933		78	0-853-5361 • 1	L-877-853-	0922
[Branch				
IN STORE PICKU	P	ST. PAUL				
<u>o</u>		Date	Time			Page
		12/29/23	23	:32:12 (B	5)	14
א ע		Account No	Phone No		Inv N	lo
		INTER01	780	08754471	D9	5587
		Ship Via		Purchase Orde	r	
INTERNAL CUSTO	MER					
Lloydminster A	B T9V 3A2					
≒				S	alespersor	۱
					KSK	

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

DESCRIPTION OF WORK & PARTS

STK#/FLEET#		HRS PIN/H	EIN WARR	ANTY DATE	HRS	Fold
032842	S790 STS DJ HOG	1791 1H0S7	790SJJ0800243	08/02/19		
	S790 STS	1310		08/01/21	1500	
*				*		
*******	*****	*****	*****	* * *		
AH133191		LOCKING COLLA	AR 10	25.55	25.55	
JD39102		BEARING-25MM	1	33.48	33.48	
JD9275		BEARING	1	56.93	56.93	
11M7079		COTTER PIN	5	.22	1.10	
19M7774		FL/BOLT-M6X12	2MM 1	1.17	1.17	
49M6480		KEY-7X8X50MM	1	5.14	5.14	
				PARTS	123.37	
				LABOR	421.40	
	16001		SEGMENT	TOTAL==>	544.77	
 SEGMENT#17	C 670 NA	12/14/23 12/1	4/23			
LOWER RETU	RN ELEVATOR SPROCKE	T LOOSE ON SHAP	T. REPLACE KEY.	1.50	HRS	
**** TECH	NICIANS COMMENTS **	* * * * * * * * * * * * * * *	*****	* * *		
*				*		
*Loosened	return elevator cha	in and removed	tensioner plate	*		
	end link and remove		_	*		
*+elevator	. Removed lower bea	ring and slid k	ottom sprocket	*		
	ide enough to repla	-	-	*		
	and slid lower spr			*		
	stalled a new shaft			*		
P-2000, 111			-			

AZ10045	LOCK COLLAR-30M	1	15.13		
JD10384	BEARING	1	74.82		
49M6480	KEY-7X8X50MM	1	5.14		
		CONTI	INUED ON	PAGE	15
	to be done along with the use of necessary materials. You and your		х		
	machine for purposes of testing, inspection, or delivery at my risk. I	-	Signature		

X Signature Date

15.13 74.82 5.14

*

express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.Terms: Full payment due immediately upon completion of work or service charge on overdue account at the rate of 1.5% per month (18% per annum)It is understood that this company assumes no responsibility for loss or damage by theft or fire to

*auger shaft. Reinstalled tension plate onto elevator.

*elevator chain and installed bearing cover

*Reinstalled Tailings elevator chain and end link. Tensioned *

 It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.



Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

W	ww.agland.ca	780-645-4437 • 1-877-645-9933		78	0-853-5361 •	1-877-853	-0922
ſ	IN STORE PICKUP		Branch ST. PAUL				
ا ۲ ا			Date	Time			Page
Ship			12/29/23	23:	:32:12 (в)	15
S			Account No	Phone No		Inv	No
L			INTER01	780	08754471	D9	5587
-			Ship Via		Purchase Ord	ler	
:e	INTERNAL CUSTOMER						
	Agland						
Invoice	Lloydminster AB	C9V 3A2					
듭						Salesperso	n
L			-			KSK	2

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

780-645-4437 • 1-877-645-9933

DESCRIPTION OF WORK & PARTS

STK#/FLEET 032842	# S790 STS DJ HOG	HRS PIN/EIN 1791 1H0S790SJ		ANTY DATE 08/02/19	HRS	Fold
032042	S790 SIS D0 HOG S790 STS	1310	JU800245	08/02/19	1500	
	5790 515	1310		PARTS	95.09	
				LABOR	213.28	
	16001		<u>ຕະຕາທະານາ</u>	TOTAL==>	308.37	
	16001		SEGMENT	IUIAL>	300.37	
SEGMENT#18	C 670 NA	12/14/23 12/14/23				
LHS CLEAN	ING FAN BEARING FAILED	. REPLACE FAN BEAL	RINGS.	2.50	HRS	
**** TEC	HNICIANS COMMENTS ****	****	* * * * * * * * * * *	* * * *		
*				*		
*+Removed	LHS tone wheel and ou	ter bearing flange	е	*		
*+Removed	bearing and cleaned s	haft surface using	J	*		
*+wire wh	eel. Installed new bea	ring and reinstal	led	*		
	and tone wheel. Remov			7 *		
	of the cleaning fan.			*		
	aring flange. +Removed			*		
	the shaft surface usin	-		w *		
	and +reinstalled flang	-		*		
-	led drive pulley and d			*		
*				*		
******	****	****	*******	* * * *		
AH139297		BALL BEARING	1	82.81	82.81	
AH225510		BEARING	1	51.82	51.82	
AL14674		LOCKING COLLAR	1	29.10	29.10	
				PARTS	163.73	
				LABOR	397.32	
	16001		SEGMENT	TOTAL==>	561.05	
SEGMENT#19	C 662 NA	12/14/23 12/18/23				
CLEANING	FAN MOTOR BRACKET SNAP	PED OFF. RE WELD.		1.00	HRS	
**** TEC	CHNICIANS COMMENTS ****	* * * * * * * * * * * * * * * * * * * *	* * * * * * * * * * *	* * * *		
*				*		
			CONT	INUED ON PA	GE 16	
. I baraby carti		a use of passage motorials. You	and your	V		
employées ma	fy the above work to be done along with th ay operate above machine for purposes of	testing, inspection, or delivery at	my risk. I	Signature		Date
	cash on delivery of machine or on terms s anic's lien is acknowledged on above machi			Signature		Date
 Terms: Full pa 	ayment due immediately upon completion o 1 5% per month (18% per annum)					

It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.



LLOYDMINSTER

Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

_		Branch		
	IN STORE PICKUP	ST. PAUL		
₽ I		Date	Time	Page
Ship		12/29/23	23:32:12 (B	3) 16
s		Account No	Phone No	Inv No
L		INTER01	7808754471	D95587
_		Ship Via	Purchase Orde	r
۲ ۲	INTERNAL CUSTOMER			
	Agland			
Invoice	Lloydminster AB T9V 3A2			
Ĩ			S	alesperson
L				KSK

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

780-645-4437 • 1-877-645-9933

DESCRIPTION OF WORK & PARTS

STK#/FLEE	т#	HRS PIN/EIN	WARR	ANTY DATE	HRS	Fold
032842	S790 STS DJ HOG	1791 1H0S790SJJ	0800243	08/02/19		
	S790 STS	1310		08/01/21	1500	
*Disconne	ect batteries. Preppe	d area and reweld, c	onnect on	*		
*+batter:	ies.			*		
*				*		
******	* * * * * * * * * * * * * * * * * * * *	* * * * * * * * * * * * * * * * * * * *	******	* * *		
H113625		PRESSED FLANGE	1	15.49	15.49	
14M7296		NUT-10MM FLG HD	2	1.85	3.70	
19M7403		#8BOLT-M12X35MM	1	2.90	2.90	
				PARTS	22.09	
				LABOR	142.76	
	16001		SEGMENT	TOTAL==>	164.85	
	ATMENT BLOWER TENSION	12/14/23 12/14/23 ER BEARING DRY. REPA	LCE	1.00	HRS	
TENSIONE						
	CHNICIANS COMMENTS **	* * * * * * * * * * * * * * * * * * * *	* * * * * * * * * *			
*	.			*		
	aftertreatment blowe			*		
	Removed and replaced 1			*		
	alled and tensioned a:	ftertreatment blower	belt	*		
	alled belt cover.			*		
*				*		
	* * * * * * * * * * * * * * * * * * * *					
AXE64513		Belt Tensioner	1 N	303.14	303.14	
				PARTS	303.14	
				LABOR	132.44	
	16001		SEGMENT	TOTAL==>	435.58	
SEGMENT#2	1 C 670 NA	12/14/23 12/14/23				
VACCUUM	FAN BELT CRACKED. IDE	LR PULLEY BEARING DR	Y. REPLACE	1.25	HRS	

BELT AND BEARING.

CONTINUED ON PAGE 17

Signature

Х

• I hereby certify the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.

Terms: Full payment due immediately upon completion of work or service charge on overdue account at the rate of 1.5% per month (18% per annum)
It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.

Date



LLOYDMINSTER Box 10039 • Lloydminster, AB T9V 3A2

780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

		Branch				
	IN STORE PICKUP	ST. PAUL				
_ ₽		Date	Time			Page
Ship		12/29/23	23:	32:12 (в)	17
0		Account No	Phone No			Inv No
I		INTER01	780	8754471		D95587
		Ship Via		Purchase Ord	der	
To:	INTERNAL CUSTOMER					
	Agland					
Invoice	Lloydminster AB T9V 3A2					
ц					Salesp	person
I					1	KSK

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

780-645-4437 • 1-877-645-9933

DESCRIPTION OF WORK & PARTS

STK#/FLEET	#	HRS	PIN/EIN	WARR	ANTY DATE	HRS	Fold
032842	S790 STS DJ HOG	1791	1H0S790SJJ08	00243	08/02/19		
	S790 STS	1310			08/01/21	1500	
**** TEC	HNICIANS COMMENTS ****	* * * * * * *	* * * * * * * * * * * * *	*****	* * *		
*					*		
*+Removed	vacuum fan belt from	unit			*		
*+Removed	belt idler assembly an	nd remo	ved pulley.		*		
*+Pressed	old bearing out and no	ew bear	ing into pull	ey	*		
*+Reassem	bled idler assembly and	d reins	talled on uni	t	*		
*+Install	ed and tensioned new va	acuum f	an belt.		*		
*					*		
*******	* * * * * * * * * * * * * * * * * * * *	* * * * * * *	* * * * * * * * * * * * *	******	* * *		
HXE38073	•	VACUUM	FAN BELT	1	31.97	31.97	
JD8535	I	BEARING	ł	1	12.49	12.49	
					PARTS	44.46	
					LABOR	194.36	
	16001			SEGMENT	TOTAL==>	238.82	
SEGMENT#22	C 670 NA	12/14/2	3 12/14/23				
	ACK BLADE BEARINGS WOR ARINGS AND HUB.	N, PROP	ELLER CONTACT	'ING RAD.	1.25	HRS	
-	HNICIANS COMMENTS ****	* * * * * * *	*****	*****	* * *		
*					*		
*Remove a	ssembly, install new b	earings	and hub. Re		*		
	blade into cooling page	-			*		
*	5 1		-		*		
******	* * * * * * * * * * * * * * * * * * * *	******	*****	****	* * *		
HXE66282]	Hub		1	98.20	98.20	
JD8535	1	BEARING	ł	2	12.49	24.98	
					PARTS	123.18	
					LABOR	123.84	
	16001			SEGMENT	TOTAL==>	247.02	

CONTINUED ON PAGE 18

Date

Signature

Х

• I hereby certify the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.

Terms: Full payment due immediately upon completion of work or service charge on overdue account at the rate of 1.5% per month (18% per annum)
It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.



Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

	Branch			
	ST. PAUL			
	Date	Time		Page
	12/29/23	23:32:12	(B)	18
	Account No	Phone No		Inv No
	INTER01	78087544	71	D95587
	Ship Via	Purchase	Order	
ER				
T9V 3A2				
			Salespe	erson
			K	SK
	ER T9V 3A2	ER	ST. PAUL Date Time 12/29/23 23:32:12 Account No Phone No INTER01 780875447 Ship Via Purchase	ST. PAUL Date Time 12/29/23 23:32:12 (B) Account No Phone No I INTER01 7808754471 Ship Via Purchase Order T9V 3A2 Salespe

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

780-645-4437 • 1-877-645-9933

ESCRIPTION OF WORK & PARTS

STK#/FLEET#	HRS PIN/EIN	WARRA	NTY DATE	HRS	Fo
032842 S790 STS DJ HOG	1791 1H0S790SJJ0		08/02/19		FO
S790 STS	1310		08/01/21	1500	
SEGMENT#23 C 662 NA	12/14/23 12/14/23		,	2000	
COLD WEATHER STARTING SYSTEM		D SYSTEM	1.25	HRS	
IS PLUGGED WITH DIRT. GET SYS					
**** TECHNICIANS COMMENTS **		*****	* *		
*			*		
*+Cleaned system and lines. O	rdered new parts requ	ired.	*		
*Installed new parts and inst			*		
*Tested starting system. Syst	-		*		
*			*		
*****	*****	*****	* *		
RE556468	Starting Aid	2 0	16.04	32.08	
R73498	CONTAINER	1 M	35.66	35.66	
			PARTS	67.74	
			LABOR	141.04	
16001		SEGMENT	TOTAL==>	208.78	
SEGMENT#24 C 670 NA	12/14/23 12/14/23				
STATIONARY KNIVES POUNDED AND	CHANNEL POUNDED. FLI	P KNIVES	2.00	HRS	
AND WELD CHANNEL.					
***** TECHNICIANS COMMENTS **	* * * * * * * * * * * * * * * * * * * *	******	* *		
*			*		
*+Removed stationary knife ba	nk from chopper housi	ng	*		
*+Removed back of channel and	removed knives from	stationary	*		
*+channel. Cut flat bar to si	ze and drilled holes	to attach	*		
*+to channel. Reinstalled kn	ives and channel back	ing onto	*		
*+knife channel. Painted Flat	bar to match knife c	hannel.	*		
*+reinstalled stationary on c	hopper		*		
*			*		
******	* * * * * * * * * * * * * * * * * * * *	*******	* *		
NPN	KNIFE REINFORCE	1	40.00	40.00	
		CONTI	NUED ON PA	GE 19	
 I hereby certify the above work to be done along wit employees may operate above machine for purposes 			×		
agree to pay cash on delivery of machine or on term			Signature		Date

agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.

Terms: Full payment due immediately upon completion of work or service the another or overdue account at the rate of 1.5% per month (18% per annum)
It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.



LLOYDMINSTER

Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

		Branch			
	IN STORE PICKUP	ST. PAUL			
To:		Date	Time		Page
Ship		12/29/23	23:32:12	(B)	19
S		Account No	Phone No	Inv N	0
I		INTER01	780875447	1 D9!	5587
		Ship Via	Purchase C	rder	
To:	INTERNAL CUSTOMER				
	Agland				
Invoice	Lloydminster AB T9V 3A2				
In				Salesperson	
				KSK	

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

780-645-4437 • 1-877-645-9933

DESCRIPTION OF WORK & PARTS

STK#/FLEET‡	ŧ	HRS	PIN/EIN	WARR	ANTY DATE	HRS	Fold
032842	S790 STS DJ HOG	1791	1H0S790SJJ(0800243	08/02/19		
	S790 STS	1310			08/01/21	1500	
					PARTS	40.00	
					LABOR	366.36	
	16001			SEGMENT	TOTAL==>	406.36	
SEGMENT#25	C 670 NA	12/14/2	3 12/14/23				
	HAS BROKEN BOLTS. RE				1.50	HRS	
* * * * * * . 1. E.C.	HNICIANS COMMENTS ***	*****	******	* * * * * * * * * * *	* * *		
	r of unit up. Remove	hroken h	olts Instal	llnew	*		
	nd torque to spec. Lo				*		
*retorque				/	*		
*					*		
********	* * * * * * * * * * * * * * * * * * * *	******	****	******	* * *		
14M7300		NUT - 20M	IM FLG HD	2	5.96	11.92	
19M7921		M20X150	MM 10.9	2	20.37	40.74	
					PARTS	52.66	
					LABOR	184.04	
	16001			SEGMENT	TOTAL==>	236.70	
SEGMENT#26	C 670 NA	12/14/2	3 12/14/23				
	FILTER HOUSING CRACK				.25	HRS	
* * * * * * . 1. E.C.	HNICIANS COMMENTS ***	*****	******	* * * * * * * * * * *	* * *		
	d cabin air filter ho	uging			*		
*		Justing			*		
********	* * * * * * * * * * * * * * * * * * * *	******	******	******	* * *		
L201887		Box		1 N	134.57	134.57	
					PARTS	134.57	
					LABOR	41.28	
	16001			SEGMENT	TOTAL==>	175.85	
					INUED ON PA	AGE 20	

• I hereby certify the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.

Terms: Full payment due immediately upon completion of work or service charge on overdue account at the rate of 1.5% per month (18% per annum)
It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.

Solutions from the Ground Up

Х

Signature



LLOYDMINSTER

Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

W	ww.agland.ca	780-645-4437 • 1-877-645-9933		78	0-853-5361 •	1-877-8	53-0922
Г	IN STORE PICKUP		Branch ST. PAUL				
Ship To:			Date 12/29/23	Time 23 :	:32:12 ((B)	Page 20
σ			Account No	Phone No)8754471		v No 095587
Invoice To:	INTERNAL CUSTOME Agland Lloydminster AB		Ship Via		Purchase Or	der	
Invo	LIOYOMIIISter AB	TYV SAZ				Salesper KS	

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

DESCRIPTION OF WORK & PARTS

STK#/FLEET 032842	"# S790 STS DJ HOG S790 STS	HRS PIN/EIN 1791 1H0S790SJJ08002 1310	WARRANTY D. 243 08/02 08/01	/19	HRS 500	Folc
**** TEC *	CHAIN STRETCHED.REMOV CHNICIANS COMMENTS ***	*******	* * * * * * * * *	1.00 HRS		
*+reinsta *+checked *	lled on unit. tension adjustment (still ha		and * * *			
*****	16001	**************************************		BOR ==>	115.24 115.24	
ADVISE ON	CARINGS ORIGINAL. REMO	12/14/23 12/14/23 WE AND INSPECT.		2.00 HRS	5	
*			*			
*Remove d	lrive pulley and hub.	Remove arms off	*			
*+bearing	flanges. Remove pitm	an bearings. All 4 pitma	an *			
*+bearing	s were rough and dry.	Shaft bearings were tig	ght. *			
*+Removed	l bearing flange's fro	m bearings. Pressed old	*			
*+bearing	s off and new bearing	s onto hubs. Reinstalled	* E			
*+bearing	flanges, replaced da	maged set of flange's.	*			
		onto shaft. reinstalled	-			
*+arms on	to bearing flanges. R	einstalled drive pulley	hub *			
-	-	ed and torqued shaft bo	lts. *			
*+Reinsta	lled and tensioned sh	oe drive belt	*			
*			*			
*******	****	*****	* * * * * * * *			
			CONTINUED	ON PAGE	21	
		the use of necessary materials. You and your of testing, inspection, or delivery at my risk. I		-e		Date

agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.

Terms: Full payment due immediately upon completion of work or service the another or overdue account at the rate of 1.5% per month (18% per annum)
It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.



Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

www.agland.ca	780-645-4437 • 1-877-645-9933		/8	0-853-5361 • 1	-8//-853	-0922
		Branch				
IN STORE PICK	JP	ST. PAUL				
		Date	Time			Page
		12/29/23	23	:32:12 (B)	21
		Account No	Phone No		Invľ	No
		INTER01	780	08754471	D9	5587
		Ship Via		Purchase Order	-	
INTERNAL CUST	DMER					
Lloydminster	AB T9V 3A2					
i				S	alesperso	n
					KSK	2

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

780-645-4437 • 1-877-645-9933

DESCRIPTION OF WORK & PARTS

STK#/FLEET		HRS PIN/EIN		ANTY DATE	HRS	Fold
032842	S790 STS DJ HOG	1791 1H0S790SJJ 1310	0800243	08/02/19	1500	
AH125975	S790 STS	BALL BEARING	1	08/01/21 151.58	606.32	
H134118		BRG. HOLDER	4 2	35.88	71.76	
HI34110		BRG. HOLDER	2	PARTS	678.08	
				LABOR	665.64	
	16001		SEGMENT	TOTAL==>	1343.72	
SEGMENT#29	C 670 NA	12/14/23 12/14/23				
UNLOAD AUC	GER TENSIONER PULLEY	BEARINGS FAIL REPLA	CE PULLEY.	.50	HRS	
**** TECH	HNICIANS COMMENTS **	* * * * * * * * * * * * * * * * * * * *	******	* * *		
*				*		
*Removed ı	unload auger belt te	nsioner pulley. Insta	alled new	*		
*unload au	ger belt tensioner	pulley onto unit. To:	rqued bolt	• *		
*				*		
********	* * * * * * * * * * * * * * * * * * * *	* * * * * * * * * * * * * * * * * * * *	******	* * *		
AH204389		IDLER 8.5"	1	151.80	151.80	
				PARTS	151.80	
				LABOR	82.56	
	16001		SEGMENT	TOTAL==>	234.36	
SEGMENT#30	C 670 NA	12/14/23 12/14/23				
OVERHSOT E	BEARINGS HAVE PLAY.	REPLACE BEARINGS.		3.00	HRS	
**** TECH	HNICIANS COMMENTS **	****	******	* * *		
*				*		
*+Removed	vacuum fan tubing f	rom unit to gain		*		
*+access t	to the overshot beat	er. Removed overshot		*		
*+belt gua	ard and drive pulley	. Removed lock colla:	r	*		
*+and tone	e wheel from shaft.	Removed bearing flane	ges	*		
*+and bear	rings from the shaft	. RHS bearing is sei:	zed to the	*		
*+shaft. d	can not get puller o	n bearing. soaked dow	wn area	*		
*+and cut	inner race off of t	he shaft. Installed a	new	*		
			CONT	INUED ON PA	GE 22	

• I hereby certify the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.

Terms: Full payment due immediately upon completion of work or service charge on overdue account at the rate of 1.5% per month (18% per annum)
It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.

Solutions from the Ground Up

Х

Signature



Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

Branch ST. PAUL Date 12/29/23	Time			
Date	Time			
	Time			
12/20/22			Pag	ge
14/49/43	23:	32:12 (B)	22	2
Account No	Phone No		Inv No	
INTER01	780	8754471	D9558	87
Ship Via		Purchase Order		
		Sale	sperson	
			KSK	
	INTER01	INTER01 780	INTER01 7808754471 Ship Via Purchase Order	INTER01 7808754471 D9558 Ship Via Purchase Order Image: Salesperson Salesperson

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

780-645-4437 • 1-877-645-9933

DESCRIPTION OF WORK & PARTS

STK#/FLEE	т#	HRS PIN/EIN	WARRA	NTY DATE	HRS	Fold
032842	S790 STS DJ HOG	1791 1H0S790SJ3	J0800243	08/02/19		
	S790 STS	1310		08/01/21	1500	
bearing:	s and reinstalled bear	ing flanges. Instal	lled new loc	k		
*+lock co	ollar and tone wheel o	onto the shaft. Reir	nstalled	*		
*+oversh	ot drive pulley belt.	Reinstalled drive b	belt guard.	*		
*+Reinsta	alled vacuum fam tubir	ng onto unit		*		
*				*		
*******	* * * * * * * * * * * * * * * * * * * *	* * * * * * * * * * * * * * * * * * * *	* * * * * * * * * * * *	**		
AH133191		LOCKING COLLAR	1	25.55	25.55	
AH139296		BALL BEARING	2	61.90	123.80	
H135410		FLANGETTE	1	8.37	8.37	
26M7008		KEY 8MX28M	1	12.78	12.78	
				PARTS	170.50	
				LABOR	620.92	
	16001		SEGMENT	TOTAL==>	791.42	
SEGMENT#3	1 C 670 NA	12/14/23 12/14/23				
OVERSHOT	ISOLATOR POUNDED. REP	PACE ISOLATOR.		.50 H	IRS	
**** TE(CHNICIANS COMMENTS ***	****	* * * * * * * * * * * *			
*				*		
*loosened	d overshot beater driv	ve belt and removed	it from	*		
*+gearcas	se. Removed Overshot o	earcase isolator bo	olt.	*		
	led new isolator and h			*		
*		2		*		
* * * * * * * *	* * * * * * * * * * * * * * * * * * * *	****	* * * * * * * * * * * *	**		
GX21790		CAP SCREW	1	16.68	16.68	
Н81462		Spring	1	7.89	7.89	
T41770		Isolator	1	66.63	66.63	
				PARTS	91.20	
				LABOR	94.60	
	16001		SEGMENT	TOTAL==>	185.80	

CONTINUED ON PAGE 23

• I hereby certify the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.

Terms: Full payment due immediately upon completion of work or service charge on overdue account at the rate of 1.5% per month (18% per annum)
It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.

Х Signature Date



LLOYDMINSTER

Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

_		Branch				
	IN STORE PICKUP	ST. PAUL				
₽		Date	Time			Page
Ship		12/29/23	23:	32:12 (B)		23
S		Account No	Phone No		Inv No	I.
L		INTER01	780	8754471	D95	587
_		Ship Via		Purchase Order		
۲o: ۲	INTERNAL CUSTOMER					
	Agland					
Invoice	Lloydminster AB T9V 3A2					
ľ				Sal	esperson	
L					KSK	

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

780-645-4437 • 1-877-645-9933

DESCRIPTION OF WORK & PARTS

STK#/FLEET# 032842 S790 STS DJ HOG S790 STS	HRS PIN/EIN 1791 1H0S790SJJ 1310		ANTY DATE 08/02/19 08/01/21	HRS 1500	Fold
FEEDERHOUSE TOP DOOR BOWED. STR ROCK TRAP DOOR BENT. STRAIGHEN A ***** TECHNICIANS COMMENTS ****	AS REQURIED.		2.00	HRS	
<pre>* * *Removed bent lower section of : *+Brought section to the press a *+Reassembled panel to rest of a *+house. +Removed rock trap doo: *press to +straighten. Straighte *+reinstalled on combine.</pre>	and straightened c cover and test fit r from unit and br	out dent. t on feeder cought to	*		
*			*		
**************************************	**************************************	***************************************	.86	1.72	
	LOCK NUT 8MM	2	1.19	2.38	
	FL/BOLT-M8X25MM	2	1.54	3.08	
	,	_	PARTS LABOR	7.18 373.24	
16001		SEGMENT	TOTAL==>	380.42	
CONCAVES HAVE CRACKED FRAMES AND REPAIR OR REPLACE WITH USED SMAD FROM YARD AND INSTALL ***** TECHNICIANS COMMENTS ****	LL WIRE-FIND USED	CONCAVES		HRS	
*			*		
*Removed concaves from unit	From the		*		
*+Grabbed used set of concaves : *+Installed New Used concaves in	—		*		
*+Followed leveling procedure to		roncaveg	*		
	S TEVEL UND VELO (INUED ON PA	AGE 24	

• I hereby certify the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.

Terms: Full payment due immediately upon completion of work or service charge on overdue account at the rate of 1.5% per month (18% per annum)
It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.

Solutions from the Ground Up

Signature



LLOYDMINSTER

Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

		Branch				
	IN STORE PICKUP	ST. PAUL				
_ ₽		Date	Time			Page
Ship		12/29/23	23:	32:12 (B)	24
S		Account No	Phone No		Invi	No
I		 INTER01	780	8754471	D9	5587
		 Ship Via		Purchase Order		
To:	INTERNAL CUSTOMER					
	Agland					
Invoice	Lloydminster AB T9V 3A2					
Ľ				S	alesperso	n
					KSK	

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

780-645-4437 • 1-877-645-9933

DESCRIPTION OF WORK & PARTS

STK#/FLEE	Τ#	HRS PIN/EIN	WAR	RANTY DATE	HRS	Fold
032842	S790 STS DJ HOG	1791 1H0S790SJ3	J0800243	08/02/19		
	S790 STS	1310		08/01/21	1500	
*+Preform	med leveling and thr	reshing clearance cali	brations	*		
*				*		
* * * * * * * *	* * * * * * * * * * * * * * * * * * * *	* * * * * * * * * * * * * * * * * * * *	******	* * * *		
A103637		Pin Fastener	1	11.24	11.24	
				PARTS	11.24	
				LABOR	438.60	
	16001		SEGMEN	T TOTAL==>	449.84	
SEGMENT#34	4 C 670 NA	12/14/23 12/14/23				
MULTICOU	PLER MISSING SHEAR E	PIN AND EXTRA PIN. REP	PLACE PINS	25	HRS	
**** TE	CHNICIANS COMMENTS *	* * * * * * * * * * * * * * * * * * * *	******	* * * *		
*				*		
*+Replace	ed missing shear bol	ts in multicoupler.		*		
*				*		
******	* * * * * * * * * * * * * * * * * * * *	* * * * * * * * * * * * * * * * * * * *	******	* * * *		
14M7264		LOCK NUT	2	.46	.92	
19M9326		SHEARBOLT M4X30	2	1.89	3.78	
				PARTS	4.70	
				LABOR	15.48	
	16001		SEGMEN	T TOTAL==>	20.18	
SEGMENT#3	5 C 670 NA	12/14/23 12/14/23				
SERVICE.				11.00	HRS	
-ENIGNE (OIL AND FILTER.					
-MEG SER	VICE DUE.					
-ALL HYD	FILTERS.					
-FUEL FI	LTERS DUE.					
-CLEAN SI	EDIMENT BOWL.					
	RIS, ENGINE, AND CAE	BIN AIR				
-DEF FIL						
			CON	TINUED ON PA	GE 25	

CONTINUED ON PAGE 25

Signature

Х

• I hereby certify the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.

Terms: Full payment due immediately upon completion of work or service charge on overdue account at the rate of 1.5% per month (18% per annum)
It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.

Date



LLOYDMINSTER

Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

		Branch				
	IN STORE PICKUP	ST. PAUL				
To:		Date	Time			Page
Ship		12/29/23	23	:32:12 (B)	25
01		Account No	Phone No		Inv	' No
		INTER01	780	8754471	. D	95587
		Ship Via		Purchase Ord	der	
To: T	INTERNAL CUSTOMER					
	Agland					
Invoice	Lloydminster AB T9V 3A2					
In					Salespers	on
					KG	v

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

780-645-4437 • 1-877-645-9933

DESCRIPTION OF WORK & PARTS

STK#/FLEET#	HRS	PIN/EIN	WARR.	ANTY DATE	HRS	Fold
032842 S790 STS DJ HOG	1791	1H0S790SJJ	0800243	08/02/19		
S790 STS	1310			08/01/21	1500	
-BOTH FINAL DRIVES DARK AN	D DIRTY.					
ALL GEARCASES.						
-REVERSER (OTHER REPAIRS)						
-PRIMARY, ROTOR, OVERSHOT,	LOAD AUGER.					
-GREASE UNIT.						
-UPPER ENGINE LADDER PIN S	EIZED. REPLA	CE PIN OR FI	REE UP.			
-14 NEW SOFTWARE PAYLOADS						
**** TECHNICIANS COMMENTS	******	* * * * * * * * * * *	******	* * *		
*				*		
*+Drained engine oil and r	emoved engin	e oil filte:	r.	*		
*+Refilled engine oil and	installed ne	w engine oi	l filter.	*		
*+Drained MEG and transmis	sion oil. Re	placed		*		
*+pro drive lube and hydra	ulic oil cha	rge filters	•	*		
*+Refilled MEG with HY-Gar	d Hydraulic	oil		*		
*+Replaced both fuel filte	rs and clean	ed out sedin	ment	*		
*+and water separator bowl	s. Replaced	DEF dosing	unit	*		
*+and tank header filter.	Drained fina	l drives and	d refilled	*		
*+with GL-5 gear oil. Chan	ged Primary	countershaf	t gearcase	*		
*+oil. Changed rotor gearc	ase oil.			*		
*+Changed overshot gearcas	e oil.			*		
*+Changed load auger gearc	ase oil.			*		
*+Replaced primary and sec	ondary engin	e air filte:	rs	*		
*+Replaced primary and sec	ondary after	treatment a	ir filters	*		
*+Replaced cab intake and	recirculation	n air filte:	rs.	*		
*+Downloaded and installed	l all availab	le software	payloads	*		
*+onto unit. Discarded all	old oil and	filters and	d clean	*		
*drain pans				*		
*				*		
*****	*****	* * * * * * * * * * *	******	* * *		
AH128449	HYDRAUL	IC FILT	1	127.53	127.53	
			CONT	INUED ON PAG	E 26	

• I hereby certify the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.

Terms: Full payment due immediately upon completion of work or service charge on overdue account at the rate of 1.5% per month (18% per annum)
It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.

Solutions from the Ground Up

Х

Signature



Box 10039 • Lloydminster, AB T9V 3A2 780-875-4471 • 1-877-875-3445

VERMILION

4915 - 47 Avenue • Vermilion, AB T9X 1J4 780-853-5361 • 1-877-853-0922

www.agland.ca	780-645-4437 • 1-877-645-9933		780	-853-5361 • 1-8	77-853-0922
[Branch			
IN STORE PICKUP		ST. PAUL			
		Date	Time		Page
		12/29/23	23:	32:12 (B)	26
<u>מ</u>		Account No	Phone No		Inv No
		INTER01	780	8754471	D95587
		Ship Via		Purchase Order	•
INTERNAL CUSTOME	R				
1 Agland					
Lloydminster AB	T9V 3A2				
≒				Sale	esperson
L					KSK

ST PAUL

Box 1468 • St Paul, AB TOA 3A0

780-645-4437 • 1-877-645-9933

DESCRIPTION OF WORK & PARTS

STK#/FLEET#	HRS PIN/EIN	WARF	RANTY DATE	HRS	Fold
032842 S790 STS DJ HOG	1791 1H0S790SJJ08	300243	08/02/19		
S790 STS	1310		08/01/21	1500	
AN207368	PRODR. FILTER	1	168.77	168.77	
AR69444	HYGARD 18.9L	3	144.38	433.14	
AXE42065	DEBRIS FIL.#2	1	128.09	128.09	
AXE42066	DEBRIS FIL.#1	1	210.49	210.49	
DZ111004	Filter Kit	1	142.37	142.37	
DZ112918	SEC.FUEL FIL.	1	225.47	225.47	
DZ114640	FILTER KIT	1	219.47	219.47	
GL5	GL5 – 85W140	17	11.50	195.50	
HXE11090	AIR FILTER PRM.	1	399.97	399.97	
HXE11091	AIR FILTER SEC.	1	282.22	282.22	
JD8028	Label	1	43.59	43.59	
L214634	CAB REC. FILTER	1	46.14	46.14	
RE284091	CAB FILTER	1	111.77	111.77	
RE539465	FUEL FIL.PRIM.	1	162.57	162.57	
RE572785	ENG OIL FILTER	1	131.17	131.17	
TY26408	HD460 SYN.G.OIL	12	44.99	539.88	
TY26679	15W40+50II 19L	3	152.64	457.92	
			PARTS	4026.06	
			LABOR	1793.96	
16001		SEGMENI	TOTAL==>	5820.02	

***** WORK ORDER TOTALS *****

Date

	INTERNAL	CUSTOMER
PARTS	24385.39	
LABOR	19573.94	
SHOP SUPPLIES	250.00	
INTERNAL TOTAL	44209.33	

• I hereby certify the above work to be done along with the use of necessary materials. You and your employees may operate above machine for purposes of testing, inspection, or delivery at my risk. I agree to pay cash on delivery of machine or on terms satisfactory with you and until paid in full an express mechanic's lien is acknowledged on above machine to secure the amount of repairs thereto.

Terms: Full payment due immediately upon completion of work or service charge on overdue account at the rate of 1.5% per month (18% per annum)
It is understood that this company assumes no responsibility for loss or damage by theft or fire to machine placed with them for storage, sale, repair, or while field testing.

Solutions from the Ground Up

Signature		

X