Customer Name	Invoice#	RO#	Date	
Antone Ranch LLC	104570	14536	02/25/2020	

Misc.

Shipping & Handling

1.0000

25.00 0.00%

\$25.00

Subtotal \$729.95

					Repair Totals					
	ibtotal:	PreTax Su			Misc.:		Labor:		Parts:	Warranty
	ibtotal:	PreTax Su			Misc.:		Labor:		Parts:	Internal
\$12,451.39	ibtotal:	PreTax Su	5	\$629.3	Misc.:	\$2,935.50	Labor:	\$8,886.54	Parts:	Customer
	es Tax:	Sale		30.00					•	
\$12,451.39	tomer:	e from Cust	Total Du							
Other	Deposit	CIT	Mfg Credit	On Acct.	CC Type	CC		Check #	Check	Cash
\$0.00	\$0.00	\$0.00	\$0.00	\$12,451.39		\$0.00			\$0.00	\$0.00

DISCLAIMER OF WARRANTIES

Any warranties on their products sold hereby are those made by the manufacturers of those products. This dealership hereby expressly disclaims all warranties, either express or implied, including any implied warranties of merchantability or fitness for a particular purpose, and this dealership neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.

I hereby authorize the below repair work to be done along with necessary motorials. You and your employees may operate vehicle for purposes of testing, inspection, or delivery at my risk. Any express mechanic's lien is acknowledged on wehicle to secure the amount of repairs thereto. You are not responsible for loss or damage to the motor vehicle or its contents due to collision not due to your negligence; or due to fire, theft or other cassualty regardless of whether or not such fire, theft or other cassualty is due to your negligene; and you and your agents are hereby released from any and all claims for such loss and damage.

UPON BREACH OF FAILURE TO PAY THIS ACCOUNT WHEN DUE THE SELLER MAY DECLARE THIS ACCOUNT TO BE DELIQUENT AND PURCHASER SHALL BE LIABLE FOR ALL COST OF COLLECTION INCLUDING A REASONABLE ATTORNEYS FEE.

5	Summary	of Charges
	\$0.00	Taxable
\$1	2,451.39	Non-Taxable
\$1	2,451.39	Subtotal
	\$0.00	Sales Tax
\$1	2,451.39	PAY THIS AMOUNT
	\$0.00	Amount Tendered
	\$0.00	Change Due

Exempt Tax Cert #:	Date	Customer Signature
Expiration Date:		

Printed:2/25/2020 2:06 PM

Customer Name		Invoice# RO#			Date				
Antone Rane	ch LLC		104570	14536		02/25/2020			
	Misc.	Shipping & Handling	7		1.0000	39.36	0.00%	\$39.36	
	Item	68671-13610-620	WIRE		2.0000	10.92	0.00%	\$21.84	
	Item	RD411-78260-620	O RING		2.0000	41.22	0.00%	\$82.44	
	Item	04817-00240-620	O-RING		1.0000	1.41	0.00%	\$1.41	
	Item	04817-00140-620	O-RING		1.0000	1.41	0.00%	\$1.41	
	Item	04817-00110-620	O-RING		2.0000	1.41	0.00%	\$2.82	
	Item	04817-00110-620	O-RING		2.0000	1.41	0.00%	\$2.82	
	Item	04811-07530-620	O RING		1.0000	2.73	0.00%	\$2.73	
	Item	77700-00450-620	BATTERY, G	ROUP 24 WET *	1.0000	144.02	0.00%	\$144.02	
	Item	RD411-62210-620	FILTER, SUC	TION OIL	1.0000	80.94	0.00%	\$80.94	
	Item	RD431-62122-620	FILTER, RET	URN (OIL TANK)	1.0000	104.74	0.00%	\$104.74	
	Item	70000-10605-620	OIL,5 GAL H	YD 46 (SINGLE PAIL)	3.0000	92.68	0.00%	\$278.04	
	Item	70000-10602-620	OIL, 2.5 GAL	HYD 46 (CASE OF 2)	1.0000	56.11	0.00%	\$56.11	
	Item	RD411-62150-620	FILTER, BRE	ATHER (OIL)	1.0000	32.78	0.00%	\$32.78	
	Item	471TC-4-RL-MAN	Hose		2.0000	5.31	0.00%	\$10.62	
	Item	10343-4-4-MAN	1/4" crimp	male jic 37 deg	1.0000	10.49	0.00%	\$10.49	
	Item	19243-4-4-MAN	Hyd fitting		1.0000	16.00	0.00%	\$16.00	
	Item	70000-10001-620	OIL,1 GAL 1	5W-40 (CASE OF 3)	2.0000	25.63	0.00%	\$51.26	
	Item	77700-09664-620	OIL,46HD H GALLON CA	YD. EXCAVATOR, 6X1 SE	1.0000	26.59	0.00%	\$26.59	
	Misc.	Antifreeze			2.0000	15.99	0.00%	\$31.98	
	Misc.	Shipping & Handling			1.0000	37.18	0.00%	\$37.18	
	Item	RD411-63110-620	HOSE, SUCT	ION	1.0000	9.83	0.00%	\$9.83	
	Misc.	Shipping & Handling			1.0000	14.22	0.00%	\$14.22	

Customer Service Issue # 2

Com: THROTTLE ACTUATOR STUCK ON FULL.
Cause: ELECTRICAL CONNECTION CORRODED

Fix: FOUND THE BATTERY WAS BAD AND REPLACED WITH NEW, INSPECTED THE WIRING HARNESS AND FOUND A BAD GROUND CONNECTION, ALSO FOUND THE ACTUATOR MOTOR WIRING WAS NOT MAKING CONNECTION. CLEANED CONNECTIONS. THROTTLE

ACTUATOR WORKING NORMALLY AT THIS TIME.

Note:

Mech	Туре		Description		Total
6785	Labor	LABOR	LABOR	95.00 0.00%	\$95.00

Subtotal \$95.00

\$11,626.44

Subtotal

Customer Service Issue # 3

Com: A/C BELT MISSING, CUSTOMER WOULD LIKE A/C CHECKED OUT.

Cause: A/C BELT MISSING, COOLANT SHUTOFF VALVE STUCK PARTIALLY OPEN, RESISTOR HAD BROKEN SODER

WHEN INSTALLING ENGINE TO UNIT FOUND THE A/C BELT WAS MISSING, REPLACED BELT WHEN ENGINE INSTALLED, HAD AC RECHARGED, FOUND AC WAS STILL BLOWING WARM, FOUND THE COOLANT SHUT OFF VALVE WAS STICKING SLIGHTLY OPEN, REMOVED ACCESS PANEL, REPLACED THE VALVE, AC BLEW COLD AIR BUT FOUND IT WAS STUCK ON SPEED 3, REMOVED THE RESISTOR UNDER FLOOR PANELS AND FOUND THE SODER BROKE, REPLACED RESISTOR, AC OPERATES NORMALLY, NOTICED WHEN AC BUTTON PUSHED THE LIGHT DOES NOT TURN ON BUT EVERYTHING ENGAGES AS NORMAL.

Note:

Fix:

Mech	Type		Description				Total
2296	Labor	LABOR	LABOR		95.00	0.00%	\$142.50
6785	Labor	LABOR	LABOR		95.00	0.00%	\$190.00
	Misc.	Outside Charges NO	A/C RECHARGE	1.0000	225.00	0.00%	\$225.00
	Item	T1065-72180-620	RESISTOR, AIR CONDITIONING BLOWER***	1.0000	60.06	0.00%	\$60.06
	Item	T0270-67500-620	VALVE	1.0000	87.39	0.00%	\$87.39
					Printed	2/25/2020	2:06 PM

T THILDED EXPENSES EIGHT IN

Page 2 of 3 Pages



MIDSTATE POWER PRODUCTS

3290 S US HWY 97 REDMOND, OR 97756 Phone: (541) 548-6744 www.midstatekubota.com







REMIT TO: PO BOX 270 REDMOND, OR 97756

Invoice #	RED-104570
Date	2/25/2020
Time	14:40

PO#	
Terms	Net 30UE ON RECEIPT
Due Date	3/26/2020

Antone Ranch LLC 501 E Baybrook Ct

83706

Contact ZACK 541-314-3249 Service Invoice

Customer

Boise

RO#	RED-1	RED-14536				
RO Date	11/12	11/12/2019				
Miles	In	0.0	Out	0.0		
Hours	In	4492.0	Out	4492.0		
Service Writer	Allan	Gebhard				
Stock#		(14372)				
Serial#		31816				
Yr Make	Model	Kubota KX1613R4AS				
Descr	iption	KX1613R4AS				
L	icense	2				
Fleet#						
In Service	e Date	5/22/2006				
		- 1				

Customer Service Issue # 1

CUSTOMER STATES ENGINE BLOCK HAS A HOLE IN IT. Com:

Cause: HOLE IN ENGINE BLOCK

Fix:

Memo

TRACTOR WAS ON TRAILER HAD TO PULL DRIVE HUBS APART TO GET OFF TRAILER, PUSHED UNIT INTO STALL HAD TO BLEED HYDRAULIC LINS TO MOVE THE BOOM AND STEER UNITS CAB AROUND. DRAINED COOLANT, REMOVED THE UNITS REAR WEIGHT, THE BOLTYS WERE RUSTED AND STUCK, DISSASSEMBLED THE UNITS SIDE COVERS AND PANELS, REMOVED THE WINDSHIELD, REMOVED THE SEAT, REMOVED THE HEATER VENTS, REMOVED THE FLOOR MAT, REMOVED THE WIRING HARNESS, REMOVED THE CAB BOLTS AND LIFTED THE CAB FROM UNIT, HAD TO CLEAN GLASS, MUD AND DEBRIS FROM THE ACCESS PANEL BOLTS, PULLED UNIT OUT TO STEAM WASH DIRT FROM AREAS THAT NEEDED WORKED ON, PUSHED UNIT BACK INTO STALL, REMOVED THE ACCESS PANEL COVER, REMOVED THE HEATER LINES, REMOVED THE CABIN UNDER COVER, REMOVED THE MAIN FRAME AND FOUND THE BOLTS WERE RUSTED, FOUND THE AC AND HEATER CONTROLS WERE MISSING THE SCREWS, REMOVED THE FREON FROM AC, REMOVED ENGINE WIRE HARNESS, REMOVED ALL FUEL COMPONETS, REMOVED THE ENGINE FRAME, REMOVED THE RADIATOR COVERS, REMOVED THE RADIATOR, CLEANED OUT MULTIPLE RATS NESTS ON UNIT, REMOVED ALL LINES TO ENGINE, REMOVED THE AC PUMP, REMOVED ALL ENGINE MOUNT BOLTS, REMOVED THE HYDRAULIC PUMP, REMOVED THE ENGINE, CLEANED ALL DEBRIS FROM ENGINE AREA NOTED ALL THE LEAKS ON HYDRAULIC PUMP, LIFTED NEW ENGINE TO INSTALL PARTS, REMOVED NECCESSARY COMPONENTS FROM OLD ENGINE AND CLEANED, INSTALLED TO THE NEW ENGINE, INSTALLED THE MOTOR MOUNTS, REMOVED THE PUMP HOUSING FROM OLD MOTOR AND INSTALLED ON NEW, INSTALLED NEW HYDRAULIC DRIVE BUSHING, SET NEW MOTOR INTO UNIT AND INSTALLED THE MOUNTING BOLTS, INSTALLED THE AC PUMP AND LINES, REINSTALLED THE RADIATOR, REINSTALLED ALL LINES, REINSTALLED THE PUMP, FOUND THE PUMP HAD MULTIPLE LEAKS AND REPAIRED BY REPLACING O-RINGS ON THE HYDRAULIC FITTINGS, FOUND THE SUPPLY HOSE WAS LEAKING AND WOULD NOT TIGHTEN UP, REMOVED AND REPLACED THE LINE, PUT NEW HYDRAULIC OIL INTO UNIT, REINSTALLED THE FRAME AND WIRING, INSTALLED FUEL LINES AND ALL ANTIFREEZE LINES, REINSTALLED THE ACCESS PANEL AND MID PANEL, REINSTALLED CAB, REINSTALLED CABIN WIRE HARNESS, REINSTALLED THE OPERATOR SEAT, FILLED NEW ENGINE WITH OIL, TEST RAN UNIT FOUND A FUEL LINE WITH A CRACK AND REPLACED, RAN UNIT AND CHECKED ALL OPERATIONS, CHECKED FOR LEAKS ON UNIT, REINSTALLED ALL PANELS, ASSEMBLED HUB AND REFILLED WITH NEW OIL DROVE UNIT TO CHECK OPERATION, GREASED UNIT, ADJUSTED UNITS TRACKS, CHECKED HEATER OPERATION AND FOR LEAKS, REINSTALLED THE REAR WEIGHT, UNIT NEEDS A/C RECHARGED.

Note:

Mech	Туре		Description				Total
13	Labor	LABOR	LABOR		95.00	0.00%	\$323.00
6785 Labo	Labor	LABOR	LABOR		95.00	0.00%	\$2,185.00
	Item	1G868-10000-620	REPL ENG V2403E2BHQ TIER2 (KX161-3)	1.0000	7467.21	0.00%	\$7,467.21
	Misc.	Shipping & Handling		1.0000	256.61	0.00%	\$256.61
	Item	RD548-42630-620	COUPLING	1.0000	297.47	0.00%	\$297.47
	Item	RD118-49120-620	V BELT	1.0000	27.00	0.00%	\$27.00
	Item	RD538-42450-620	GASKET	1.0000	10.52	0.00%	\$10.52

Printed:2/25/2020 2:06 PM

Page 1 of 3 Pages