



25490 WCR 58
Greeley CO 80631

970-352-5220 x105

RECEIVED

NOV 15 2025

DURAN EXCAVATING, INC.

File Copy
Invoice

Date	Invoice #
3/11/2025	68187

Bill To
Duran Excavating Inc.

Terms
Net 30

Quantity	Description	Rate	Amount
1	Work on unit #18 per work order #12224 <i>Engine Replacement Rebuild</i> <i>1260</i> <i>Trk18</i> <i>Thank You!</i> <i>9/1/20</i>	26,724.63	26,724.63
		Payments/Credits	\$0.00
		Total	\$26,724.63

Balance Due

\$26,724.63

Excavation
County Road 58

Greeley

CO 80631

RECEIVED

MAR 13 2025

DURAN EXCAVATING, INC.

Invoice

Invoice #: 12224
Opened: 1/28/2025 9:48 AM
Closed: 3/11/2025 10:23 AM
PO Ref #:
Page: 1

Bill To:

Duran Excavating, Inc.

Vehicle #:
Year: 2000
Make: Freightliner
Model: FL70
License #: Q21-
VIN #:
Meter: Miles 404963 Hours 7754
Engine:

(SIGNATURE)

(DATE)

Services Performed

Service Code	Description	Taxable	Hours	Rate (hourly)	Total Price
1026	Engine- Diagnostic	Y	4.00	\$160.00	\$640.00
CUSTOMER COMPLAINT TRUCK WONT START AFTER RUNNING AWAY- CUSTOMER REQUEST INSPECT FUEL PUMP- DROVE TO CUSTOMER LOCATION- FOLLOWED TROUBLE SHOOTING- FOUND FUEL PRESENT IN LEFT AND RIGHT FUEL TANKS- INSPECTED FUEL BREATHERS- ALL OK- INSPECTED FUEL PRESSURE AT INJECTOR FUEL LINES- ALL OK- CUSTOMER ADVISED VALVE COVER WILL NEED REMOVED FOR FURTHER INSPECTION- CUSTOMER OK'D VALVE COVER REMOVAL- DISCONNECTED AND REMOVED VALVE COVER- REMOVED ROCKER ARMS OFF CYLINDER #1 AND #3- FOUND PUSH RODS BENT- CUSTOMER TOWED TRUCK TO SHOP FOR REPAIR- DROVE BACK TO SHOP					

MDW
E

Sub Total \$26,724.63
State 6.500% \$0.00
County 8.000% \$0.00
Grand Total \$26,724.63

vation

Invoice

County Road 58
Greeley CO 80631

Invoice #: 12224
Opened: 1/28/2025 9:48 AM
Closed: 3/11/2025 10:23 AM
PO Ref #:
Page: 2

Bill To:

Duran Excavating, Inc.

Vehicle #: 12224
Year: 2000
Make: Freightliner
Model: FL70
License #:
VIN #:
Meter: Miles 404963 Hours 7754
Engine:

(SIGNATURE)

(DATE)

1070

Engine- Overhaul Outframe

Y

61.50

\$160.00

\$9,840.00

DRAINED ENGINE COOLANT- DISCONNECTED AND REMOVED CHARGE AIR COOLER PLUMBING- DISCONNECTED AND REMOVED COOLANT LINES- DRAINED A/C SYSTEM- REMOVED FAN BELTS, FAN AND FAN HUB- DISCONNECTED AND REMOVED VALVE COVER- REMOVED ALL FUEL INJECTOR LINES, ROCKER ARMS, PUSH RODS, AND ALL INJECTORS- FOUND 3 INJECTORS WITH TIPS DAMAGED- DISCONNECTED AND REMOVED CYLINDER HEAD- DRAINED ENGINE OIL- DISCONNECTED AND REMOVED ENGINE OIL PAN- CLEANED AND INSPECTED ENGINE OIL PAN- FOUND SLUDGE AND PLASTIC REMAINS PRESENT IN OIL PAN- DISCONNECTED AND REMOVED SUCTION TUBE, PISTONS, AND ROD ASSYS- CLEANED AND INSPECTED ENGINE BLOCK AND HEAD BOLT HOLES- HONED AND INSPECTED CYLINDER WALLS- CLEANED AND INSPECTED CRANK SHAFT- FOUND PISTON COOLING JETS WORN- DUE TO COOLING JET REPLACEMENT BETWEEN UPPER MAIN BEARINGS AND BLOCK- ENGINE WILL NEED REMOVED FROM CHASSIS- CUSTOMER ADVISED- EVACUATED A/C SYSTEM- REMOVED AND INSPECTED A/C LINES AND A/C COMPRESSOR- DISCONNECTED AND REMOVED COOLING PACK- DISCONNECTED AND REMOVED ALL ELECTRICAL, FUEL LINES, COOLANT LINES AND P/S PUMP- SET TRANSMISSION ON JACK- DISCONNECTED AND REMOVED ENGINE FROM CHASSIS- SECURED BRACKET TO ENGINE- SECURED ENGINE TO STAND- REMOVED AND INSPECTED FLYWHEEL HOUSING, REAR MAIN HOUSING, FRONT COVER, FUEL PUMP, AIR COMPRESSOR, CAM SHAFT AND FRONT GEAR HOUSING- REMOVED CRANKSHAFT- REMOVED AND INSPECTED LIFTER TAPPETS- CLEANED ENGINE BLOCK INTERNALLY- REMOVED AND REPLACED COOLING JETS- CLEANED CRANKSHAFT- INSTALLED NEW MAIN BEARINGS- REINSTALLED CRANKSHAFT- APPLIED PLASTIGAGE ON CRANKSHAFT- INSTALLED CAPS- TORQUED- REMOVED CAPS AND MEASURED OIL CLEARANCE- ALL OK- REINSTALLED CAPS- TORQUED- MEASURED CYLINDER BORE DUE TO AFTERMARKET ENGINE BLOCK- FOUND CYLINDER BORES OVER STANDARD AT .020- CUSTOMER ADVISED- BUILT PISTON AND RADIATOR ASSYS- INSTALLED WITH NEW BEARINGS- TORQUED- TORQUED FRONT GEAR HOUSING TO SPEC- TORQUED FRONT GEAR HOUSING TO SPEC- REINSTALLED TAPPETS AND CAM SHAFT- TIMED ENGINE- TORQUED ALL REMOVED COMPONENTS- FOUND FUEL PUMP BRACE CRACKED- WELDED BRACE- INSTALLED NEW FRONT AND REAR MAIN SEALS- WHILE ENGINE WAS DISASSEMBLED- FOUND CLUTCH PRESSURE PLATE FAILED- SENT FLYWHEEL FOR TURN WITH NEW PILOT BEARING- INSTALLED FLYWHEEL- TORQUED- INSTALLED NEW CLUTCH- TORQUED- CLEANED CYLINDER HEAD- CLEANED HEAD BOLTS- INSTALLED NEW CYLINDER HEAD WITH NEW GASKET- TORQUED- FOUND 4 PUSH TUBES BENT- INSTALLED 4 NEW TUBES- INSTALLED ALL NEW INJECTORS- TORQUED- INSTALLED VALVE TRAIN- FOUND 1 ROCKER ARM WORN- INSTALLED 1 NEW ROCKER ARM- REINSTALLED ALL OTHER ROCKER ARMS- TORQUED- PERFORMED OVERHEAD- INSTALLED INTAKE MANIFOLD, GRID HEATER AND ALL FUEL LINES- TORQUED- INSTALLED NEW THERMOSTAT- REINSTALLED FAN HUB AND FAN- REINSTALLED ALTERNATOR BRACKET AND ALTERNATOR- REINSTALLED AIR COMPRESSOR, STARTER AND ECM- REINSTALLED ENGINE INTO CHASSIS- SECURED TRANSMISSION- SECURED CLUTCH LINKAGE- RESEALED OIL COOLER HOUSING WITH NEW FITTINGS- FOUND FLANGE ON DOWN PIPE DAMAGED- INSTALLED NEW FLANGE- REINSTALLED AND SECURED MANIFOLD AND TURBO WITH NEW GASKETS- TORQUED-

Sub Total \$26,724.63
State 6.500% \$0.00
County 8.000% \$0.00
Grand Total \$26,724.63

vation

Road 58

CO 80631

Invoice

Invoice #: 12224
 Opened: 1/28/2025 9:48 AM
 Closed: 3/11/2025 10:23 AM
 PO Ref #:
 Page: 3

Bill To:

Duran Excavating, Inc.

Vehicle #: 15 DL
 Year: 2000
 Make: Freightliner
 Model: FL70
 License #:
 VIN #:
 Meter: Miles 404963 Hours 7754
 Engine:

(SIGNATURE)

(DATE)

REINSTALLED AND SECURED COOLING PACK- SECURED ALL REMOVED COMPONENTS-
 FOUND LOWER ALTERNATOR BRACKET MISSING- FABRICATED LOWER BRACKET-
 SECURED ALTERNATOR TO BRACKET- FOUND OIL PRESSURE LINE RUBBING ON
 CLUTCH LINKAGE- REROUTED LINE TO PREVENT DAMAGE- INSTALLED NEW OIL, AIR
 AND FUEL FILTERS- FILLED SYSTEM WITH NEW OIL AND COOLANT- PRIMED ENGINE-
 INSPECTED FOR LEAKS- REINSTALLED INTAKE PIPING- PERFORMED A/C SERVICE-

1007	Engine- Air Comp	Y	1.75	\$160.00	\$280.00
------	------------------	---	------	----------	----------

FOUND OIL LEAK PRESENT UNDER LEFT DOOR STEP- INSPECTED- FOUND OIL LEAK AT
 AIR TANK- DRAINED AIR FROM TANK- FOUND OIL PRESENT IN AIR TANK- REMOVED AND
 INSPECTED CHARGE LINE FROM AIR COMPRESSOR- FOUND OIL PRESENT IN CHARGE
 LINE- DETERMINED AIR COMPRESSOR NEEDS REPLACED- DRAINED COOLANT-
 REMOVED AND INSPECTED ALL LINES AND P/S PUMP- DISCONNECTED AND REMOVED
 AIR COMPRESSOR- SWAPPED FITTINGS FROM OLD COMPRESSOR TO NEW
 COMPRESSOR- INSTALLED AND SECURE NEW COMPRESSOR WITH NEW GASKET-
 REFILLED SYSTEM WITH COOLANT- CHECKED FOR LEAKS- NONE FOUND- CLEANED OIL
 FROM AIR TANK-

1047	Engine- Fuel Leak	Y	0.50	\$160.00	\$80.00
------	-------------------	---	------	----------	---------

FOUND LEAKING DRAIN VALVE ON WATER SEPERATOR FILTER HOUSING- REMOVED
 AND REPLACED VALVE- CHECKED FOR LEAKS- NONE FOUND

0709	Drive Train- Clutch Adj.	Y	1.00	\$160.00	\$160.00
------	--------------------------	---	------	----------	----------

ADJUSTED CLUTCH AND CLEANED CLUTCH LINKAGE - FOUND CLUTCH LINKAGE
 SEIZED- GREASED LINKAGE- SET CLUTCH PEDAL FREE PLAY AND CHECKED
 OPERATION - ALL OK

Total Service \$11,000.00

Parts Used

Part Number	Description	ServiceCode	Taxable	Quantity	Price (each)	Total Price
02-12218-000	BEARING- PILOT		Y	1.00	\$26.27	\$26.27
04-19215-001	PIPE- EXHAUST		Y	1.00	\$222.60	\$222.60
10723710	CLUTCH		Y	1.00	\$952.97	\$952.97
15W40RT	ROTELLA T4		Y	4.50	\$15.42	\$69.39
236577BXW	GASKET- D2 GOV		Y	1.00	\$4.50	\$4.50
3103015CMN	SEAL-GROMMET		Y	4.00	\$3.42	\$13.68
3800323CMN	KIT- ENGINE PISTON		Y	6.00	\$319.52	\$1,917.12
3800326	KIT- ENGINE		Y	6.00	\$344.94	\$2,069.64
3800487CMN	KIT- LOWER ENGINE GASKET		Y	2.00	\$480.79	\$961.57
3802820CMN	KIT- SEAL		Y	1.00	\$196.85	\$196.85

Sub Total \$26,724.63
 State 6.500% \$0.00
 County 8.000% \$0.00
 Grand Total \$26,724.63

vation

oad 58

CO 80631

Invoice

Invoice #: 12224
 Opened: 1/28/2025 9:48 AM
 Closed: 3/11/2025 10:23 AM
 PO Ref #:
 Page: 4

Bill To:

Duran Excavating, Inc.

Vehicle #: 18 Duran
 Year: 2000
 Make: Freightliner
 Model: FL70
 License #:
 VIN #:
 Meter: Miles 404963 Hours 7754
 Engine:

(SIGNATURE)

(DATE)

3912473CMN	O RING	Y	1.00	\$5.76	\$5.76
3926126CMN	SEAL	Y	1.00	\$184.93	\$184.93
3929751CMN	GASKET- ACC	Y	1.00	\$20.04	\$20.04
3935032CMN	SEAL- RECTANGULAR, RING	Y	1.00	\$4.55	\$4.55
3937111CMN	SEAL- OIL	Y	1.00	\$64.84	\$64.84
3937220CMN	ROCKER- LEVER	Y	1.00	\$116.46	\$116.46
3938166CMN	GASKET- GEAR HOUSING	Y	1.00	\$43.91	\$43.91
3941253CMN	ROD- PUSH	Y	12.00	\$23.05	\$276.60
3944194CMN	INJECTOR	Y	6.00	\$317.32	\$1,903.92
3946168CMN	SCREW- ISOLATOR	Y	5.00	\$21.83	\$109.15
4090035CMN	SET- UPPER ENGINE GASKET	Y	1.00	\$429.64	\$429.64
4947667CMN	GASKET- REAR COVER	Y	1.00	\$14.52	\$14.52
4955853CMN	SET- MAIN BEARING STD	Y	1.00	\$223.86	\$223.86
4988280CMN	GASKET- P/S	Y	1.00	\$5.08	\$5.08
5286966RXCMN	COMPRESSOR- AIR 1 CYL	Y	1.00	\$1,773.20	\$1,773.20
5292742CMN	THERMOSTAT	Y	1.00	\$72.01	\$72.01
5361687RXCMN	HEAD- CYLINDER	Y	1.00	\$2,912.93	\$2,912.93
5405392CMN	SEAL- OIL	Y	1.00	\$48.26	\$48.26
5473238CMN	KIT- WATER	Y	1.00	\$343.52	\$343.52
5473331CMN	KIT- ROD, BEARING	Y	6.00	\$22.57	\$135.42
904-463	VALVE- WATER SEPERATOR	Y	1.00	\$70.82	\$70.82
B7177JAB	FILTER- OIL	Y	1.00	\$16.27	\$16.27
ELC5050RT	COOLANT- ROTELLA ELC	Y	7.50	\$9.16	\$68.70
FREIGHT- NDA	FREIGHT NEXT DAY AIR	Y	1.00	\$80.00	\$80.00
PF7777JAB	FILTER	Y	1.00	\$22.50	\$22.50
R134A	REFRIGERANT R134A	Y	3.00	\$14.79	\$44.37
RS3517JAB	FILTER	Y	1.00	\$58.09	\$58.09
SUBLET- FLYWHEEL MAC FLYWHEEL MACHINE CHARGE		Y	1.00	\$85.00	\$85.00

Total Parts \$15,568.94

Misc. Parts Fee \$155.69

Sub Total \$26,724.63
 State 6.500% \$0.00
 County 8.000% \$0.00
 Grand Total \$26,724.63