



CUSTOMER #: 369
 UNIT# B1348
 IBS - BARNEY TRUCKING
 IBS Cust:#569874
 235 SO SR24

SALINA, UT 84654
 HOME:315-800-2438 CONT:435-529-3701
 BUS: 435-529-3701 CELL:

24943SG

INVOICE

PAGE 3

JACKSON GROUP PETERBILT

ST. GEORGE

203 E. Playa Della Rosita
 Washington, UT 84780
 (435) 216-7800
 Fax: (435) 216-7801

Jackson Group
 PO Box 2208
 Decatur, AL 35609-2208
 Phone: (800) 332-9140

SERVICE ADVISOR: 1935 JOSH ALLAN

0001 1995 529 5791 CEE

SERVICE ADVISOR: 1995 529 5791

COLOR	YEAR	MAKE/MODEL		VIN	LICENSE	MILEAGE IN/ OUT		TAG
BLUE	22	PETERBILT 579		1XPBDP9X6ND796385		469213/469213		TB1348
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE	
25AUG21 DD			23:00 26AUG25	8-78872		IBS	04SEP25	
R.O. OPENED		READY		OPTIONS: STK:ND796385 DLR:P250 ENG:Y260591				
25AUG25		04SEP25						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

E** PCI - HOOD STRUT NOT FUNCTIONING PROPERLY

CAUSE: LOCKING HOOD STRUT

PCI-14 PCI - HOOD STRUT NOT FUNCTIONING PROPERLY

4445 WPET

(N/C)

1 L71-6043 STRUT-ASSIST, HOOD, LOCK, MECH DAMP

(N/C)

469213 LOCKING HOOD STRUT VERIFIED CUSTOMERS COMPLAINT OF HOOD

STRUT NOT FUNCTIONING PROPERLY. FOUND LOCKING MECHANISM ON HOOD STRUT

NOT FUNCTIONING PROPERLY. REMOVED HOOD STRUT. INSTALLED NEW HOOD STRUT.

VERIFIED HOOD OPERATION. COMPLETE

F** C/A COOLANT LEAK NEAR TRANS

CAUSE: COOLANT HOSES

WL WATER LEAKS

4445 WPET

(N/C)

1 F50-2339 HOSE-SILICONE, COOLANT

(N/C)

2 CT300LTRP CLAMP-CONST TORQUE HD SS #48

(N/C)

2 D1030-3833 HOSE-HEATER #12X300' J20R3-A ET

SIL VAL

(N/C)

2 9210TRP CLAMP-HOSE W/LINER #10

(N/C)

1 D1030-3628 HOSE-HEATER #10X50' J20R3

(N/C)

2 9208TRP CLAMP-HOSE W/LINER #8

(N/C)

1 ZXEDRU1 ZX HD EXTENDED LIFE 50/50 AFC 1GA

(N/C)

469213 COOLANT HOSES VERIFIED CUSTOMER COMPLAINT OF COOLANT LEAK

NEAR TRANSMISSION. PRESSURIZE COOLANT SYSTEM TO 15PSI. FOUND MULTIPLE

LEAKS. FOUND COOLANT HOSE TO WATER INLET TO ENGINE, HOSE TO THE HEATER

CORE, AND COOLANT HOSE FROM TRANSMISSION COOLER TO BACK OF ENGINE ARE

ALL LEAKING. TIGHTEN EACH HOSE CLAMP THAT WAS ABLE AND LEAKING STILL

OCCURRED. DRAIN COOLANT INTO CLEAN BUCKET. R&R SHIFTER COVER PANEL.

REMOVED TRANSMISSION COOLER COOLANT LINE. REMOVED HEATER CORE LINE.

REMOVED WATER INLET PIPE LINE. GET REPLACEMENTS FOR COOLANT LINES AND

NECESSARY CLAMPS. INSTALLED NEW WATER INLET HOSE WITH NEW CLAMPS.

INSTALLED NEW HEATER HOSE WITH NEW CLAMPS. TRANSFER HOSE GUARD ON TO

NEW TRANSMISSION COOLER HOSE AND INSTALLED WITH NEW CLAMPS. REFILLED

COOLANT SYSTEM. PRESSURIZE COOLANT SYSTEM WITH 15PSI AND HELD PRESSURE.

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE.

STATEMENT OF DISCLAIMER

The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)

CUSTOMER SIGNATURE

