



15294SL

JACKSON GROUP PETERBILT

- SALINA

385 E. 1620 S.
Salina, Utah 84654
Phone: (435) 562-7383

INVOICE

PAGE 1

Jackson Group
PO Box 2208
Decatur, AL 35609-2208
Phone: (800) 332-9140

SERVICE ADVISOR: 1948 Kasey Hansen

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
BLUE	22	PETERBILT 579	1XPBD49X1ND787172		490731/490731	D78717	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
07JUN21 DD			17:00 30APR25	7-352319	0.00	IBS	07APR25
R.O. OPENED	READY	OPTIONS: SOLD-STK:ND787172 DLR:P250 ENG:80336027					
25MAR25	07APR25						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
A							
Peterbilt Platinum Courtesy Inspection							
CAUSE: Peterbilt Platinum Courtesy Inspection							
PCCI Peterbilt Platinum Courtesy Inspection							
4488 CPCI							15.00 15.00
SCPN PACCAR SERVICE COUPON							-15.00 -15.00
490731							
Peterbilt Platinum Courtesy Inspection							
AUTHORIZATION CODE							
033125-PELAM							

B	LEAK @ EXHASUT MANIFOLD						
CAUSE: FOUND #6 EXHAUST MANIFOLD GASKET LEAKING.							
ENG ENGINE REPAIRS							
4488 WCUM (N/C)							
2	5486657CUM	GASKET,EXHAUST MANIFOLD					(N/C)
1	3104230CUM	GASKET,EXH GAS RCN VALVE					(N/C)
1	4966441CUM	GASKET,EXH OUT CONNECTION					(N/C)
2	3683940CUM	SEAL,EXHAUST MANIFOLD					(N/C)
1	3682940CUM	GASKET,EXHAUST MANIFOLD					(N/C)

490731 I INSPECTED FOUND EXHAUST LEAKS ON THE #6 EXHAUST MANIFOLD GASKET. I REMOVED THE BUMPER. I DRAINED COOLANT AND REMOVED INTAKE TUBE AND CHARGE AIR PIPE. I REMOVED TURBO OIL AND COOLANT LINES. I REMOVED TURBO AND EXHAUST MANIFOLD. I CLEANED AND INSPECTED MANIFOLD AND HEAD. BOTH OK. I INSTALLED MANIFOLD WITH NEW GASKETS. I INSTALLED TURBO WITH NEW SEALS AND GASKETS. I RECONNECTED OIL AND COOLANT LINES TO TURBO. I INSTALLED INTAKE TUBE AND CHARGE AIR PIPE. I REFILLED COOLANT. I INSTALLED BUMPER. I POWER WASHED ENGINE. I ROAD TESTED NO LEAKS.

C	C/S TRANSMISSION LEAKING OUT OF SHIFT TOWER						
CAUSE: LEAKING OUT OF THE BREATHER VENT.							
99-000-0001 C/S TRANSMISSION LEAKING OUT OF SHIFT TOWER							
4488CBRGM 0.00 0.00							

490731 INSPECTED TRANSMISSION FOUND OIL HAS BEEN LEAKING OUT OF THE

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE.

STATEMENT OF DISCLAIMER

The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)

CUSTOMER SIGNATURE



15294SL

JACKSON GROUP PETERBILT

- SALINA

385 E. 1620 S.
Salina, Utah 84654
Phone: (435) 562-7383

Jackson Group
PO Box 2208
Decatur, AL 35609-2208
Phone: (800) 332-9140

INVOICE

SERVICE ADVISOR: 1948 Kasey Hansen

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
BLUE	22	PETERBILT 579	1XPBD49X1ND787172		490731/490731	D78717	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
07JUN21 DD			17:00 30APR25	7-352319	0.00	IBS	07APR25
R.O. OPENED		READY	OPTIONS: SOLD-STK:ND787172 DLR:P250 ENG:80336027				
25MAR25		07APR25					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

BREATHER VENT. I CHECKED OIL LEVEL. IT IS GOOD AND OIL LOOKS GOOD. I PRESSURE WASHED THE TRANSMISSION. ROAD TESTED FOR 30 MIN AND INSPECTED FOR LEAKS. NO OIL LEAKING THAT I CAN SEE. POSSIBLY WAS OVERFILLED.

D** PCI- EXHASUT LEAK AT FLEX PIPE

CAUSE: LEAKING FLEX PIPE, FRETTE S PIPES

PCI-12 PCI- EXHASUT LEAK AT FLEX PIPE

4488 WPET

(N/C)

1 M66-7889-001 PIPE-EXHAUST

(N/C)

1 M74-1020-001 PIPE-NTSD,FLEX EXH INSUL

(N/C)

1 M66-8016-001 PIPE-EXHAUST

(N/C)

1 2866636CUM GASKET, AFM DEVICE

(N/C)

1 2880215CUM GASKET, AFM DEVICE

(N/C)

1 FREIGHT FREIGHT CHARGE

(N/C)

PACCAR FREIGHT FOR EXHAUST PIPE

1 FREIGHT FREIGHT CHARGE

(N/C)

FREIGHT FOR EXHAUST PIPE FROM OGDEN

490731 I INSPECTED AND FOUND FLEX PIPE LEAKING. I REMOVED EXHAUST DOWN PIPE. I REMOVED FLEX PIPE. INSPECTED FOUND FLANGES ON BOTH S-PIPES FRETTE. NEEDS PIPES REPLACED. I REMOVED BOTH S PIPES BEFORE AND AFTER FLEX PIPE. I PUT BACK TOGETHER WITH NEW GASKETS AND NEW FLEX PIPE AND S-PIPES AND CLAMPS.

E** C/S EXHAUST LEAK AT EGR VALVE HOSE

CAUSE: EGR HOSE

ENG ENGINE REPAIRS

4488 WCUM

(N/C)

1 3687223CUM HOSE,PLAIN

(N/C)

490731 I INSPECTED AND FOUND EGR HOSE CONNECTED TO EGR VALVE LEAKING EXHAUST. I TIRED TO TIGHTEN CLAMP. IT WOULD NOT TIGHTEN ANYMORE. I REMOVED THE CLAMPS, I REMOVED THE HOSE. I INSTALLED NEW HOSE. I TIGHTENED CLAMPS

F** EXHAUST LEAK @ MANIFOLD

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE.	STATEMENT OF DISCLAIMER	DESCRIPTION	TOTALS	
	The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.	LABOR AMOUNT		
		PARTS AMOUNT		
		GAS, OIL, LUBE		
		SUBLET AMOUNT		
		MISC. CHARGES		
		TOTAL CHARGES		
		LESS INSURANCE		
SALES TAX				
(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)	CUSTOMER SIGNATURE	PLEASE PAY THIS AMOUNT		



15294SL

JACKSON GROUP PETERBILT

- SALINA

385 E. 1620 S.
Salina, Utah 84654
Phone: (435) 562-7383

INVOICE

PAGE 3

Jackson Group
PO Box 2208
Decatur, AL 35609-2208
Phone: (800) 332-9140

SERVICE ADVISOR: 1948 Kasey Hansen

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
BLUE	22	PETERBILT 579	1XPBD49X1ND787172		490731/490731	D78717	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
07JUN21 DD			17:00 30APR25	7-352319	0.00	IBS	07APR25
R.O. OPENED		READY	OPTIONS: SOLD-STK:ND787172 DLR:P250 ENG:80336027				
25MAR25		07APR25					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
CAUSE: EXHASUT MANIFOLD LEAKING #6 CYLINDER							
ENG ENGINE REPAIRS							
				4488CBRGM		315.00	315.00
	SCPN			PACCAR SERVICE COUPON		-30.00	-30.00
	1	3695041CUM	GASKET,	TURBOCHARGER			15.43
	2	3963991CUM	WASHER,	SEALING			12.24
	1	5264570CUM	GASKET,	OIL DRAIN			3.64
	2	5658098CUM	SEAL,	O RING			4.60
	1	3104230CUM	GASKET,	EXH GAS RCN VALVE			35.26
	1	3683940CUM	SEAL,	EXHAUST MANIFOLD			47.03
	2	5486657CUM	GASKET,	EXHAUST MANIFOLD			33.22
	1	4966441CUM	GASKET,	EXH OUT CONNECTION			8.74
	1	3682940CUM	GASKET,	EXHAUST MANIFOLD			10.04

490731

I INSPECTED FOUND EXHAUST LEAKS ON THE #6 EXHAUST MANIFOLD GASKET.
I REMOVED THE BUMPER. I DRAINED COOLANT AND REMOVED INTAKE TUBE AND
CHARGE AIR PIPE. I REMOVED TURBO OIL AND COOLANT LINES. I REMOVED TURBO
AND EXHAUST MANIFOLD. I CLEANED AND INSPECTED MANIFOLD AND HEAD. BOTH
OK. I INSTALLED MANIFOLD WITH NEW GASKETS. I INSTALLED TURBO WITH NEW
SEALS AND GASKETS. I RECONNECTED OIL AND COOLANT LINES TO TURBO. I
INSTALLED INTAKE TUBE AND CHARGE AIR PIPE. I REFILLED COOLANT. I
INSTALLED BUMPER. I POWER WASHED ENGINE. I ROAD TESTED NO LEAKS.
**FILED FOR POLICY HELP DUE TO BEING OUT OF WARRANTY. CUMMINS
AGREED TO PAY ALMOST HALF**
AUTHORIZATION CODE COUPON
040725-YPMNW

ESTIMATE: 0.00 31MAR25 17:56 SA: 1948

CONTACT:

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE.	STATEMENT OF DISCLAIMER	DESCRIPTION	TOTALS	
	The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.	LABOR AMOUNT		
		PARTS AMOUNT		
		GAS, OIL, LUBE		
		SUBLET AMOUNT		
		MISC. CHARGES		
		TOTAL CHARGES		
		LESS INSURANCE		
		SALES TAX		
		(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)	CUSTOMER SIGNATURE	PLEASE PAY THIS AMOUNT

CUSTOMER COPY

