

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2024-12-17	924	vehicle			Miles Remove weibasto head and install new PCM board and temp sensors. Install all 6 new O/H blower motors on left side labor - 2 hrs/5 hrs 1- PCM M Series M80-24-2 00988 K 3 - R.H fan motors 3 - LH fan motors 3 - RH squirrel cages 3 LH squirrel cages		Jeanelle Hrechka	593687	14391
2024-12-04	924	vehicle	Oil Change	oil change	oil and filter change, fuel filter changed 1 X oil filter WL10107 1 X fuel filter WL10123 48 litres 10W30 oil		Jeanelle Hrechka	591642	14354
2024-11-28	924	vehicle	Oil Change	oil change	591.017 km oil and filter change fuel filter changed 1x filter WL10107 1x filter WL 10123 48 litres 10/30 oil		Jeanelle Hrechka	591017	14329
2024-11-28	924	vehicle			return fuel line found to be leaking fuel fuel drain tube, 289 7193CUM (from inl and) invoice 52463 BRP replace fuel line (one that bolts to the back of the head with a banjo bolt ) Parts purchased from Inland Brandon		Jeanelle Hrechka	591017	14329
2024-11-20	924	vehicle	Tires	Tire Inspection Required - steers	installed steer tires LH and RH - Michelin from denray tire (NEW) 2 X L 2470.65 EZ LRL (Michelin invoice 0367929NA 835935)		Jeanelle Hrechka	590847	14316
2024-10-08	924	vehicle			maintenance and repairs premier, trouble shoot proheat		Natalie Hrechka	582710	14134
2024-09-17	924	vehicle	Oil Change	oil change	Oil change, topped up coolant, install new air dryer filter cartridge. install new back up alarm, broke off mounting. 1-backup alarm #73040 1- Air dryer filter D6303 48 L 15/40 Oil 1-oil filter WL10107 Labor 3 hrs. 11 hr		Jeanelle Hrechka	575781	14023
2024-08-27	924	vehicle			replace hose clamps on intercooler 1 hour		Jeanelle Hrechka	572521	
2024-08-15	924	vehicle			install new air bag tensioner bag for a/c compressor belts. 2 hours 1 X M40.5011.B air bag		Jeanelle Hrechka	566569	
2024-07-30	924	vehicle			both license plate lights out Rear right service door latch not working properly		Natalie Hrechka	562959	
2024-07-25	924	vehicle			Install 2 new filter valves on coolant lines from rad to tank. Clean our coach air filters and vacuum rads. Change air temp sensor in coach. Parts -2-1166233 3 1 - air temp sensor (coach) 11259249		Shari Loshchyshyn (Deactivated)	565062	13849
2024-06-13	924	vehicle	Oil Change	oil change	Oil and filter change 1 X WIX WL10107 48 15/40 oil BH		Jeanelle Hrechka	554508	13649

2024-06-11	924	vehicle		Tight steering/high spot every 1/4 turn/ no return to center. Unit went to Freight liner to have limiting pressures checked on steering box. They were unable to as they did not have a metric fitting for their machine. Inspected king pins, moving rod and link ages, RH side pivot housing and upper King pin on the dry side. Greased - upper fitting would not take grease. R&R grease nipple greased. Problem seemed to be solved. Freightliner inv# 8800 1484	Shari Leshchyshyn (Deactivated)	554249	13642
2024-05-21	924	vehicle		Check operation of wheel chair lift. Wouldn't deploy. Found magnet on right side yellow safety arm broke off. Installed on the switch in lower platform Lube all mechanisms. Labor-3 hrs	Shari Leshchyshyn (Deactivated)	552960	13608
2024-04-25	924	vehicle		Check steering system binding every 180° in rotation. Removed steering to check bearings and u-joints. Greased front end Labor 8 hrs	Shari Leshchyshyn (Deactivated)	551939	13580
2024-04-12	924	vehicle		Lift on hoist and check over. Grease steering king pins and drive shaft. change out 2 compartment door lock mechanisms. Parts 2 12 5078 Locks Labor 4 hrs	Shari Leshchyshyn (Deactivated)	551939	13579
2024-01-03	924	vehicle	180 day inspection Mb Safety inspection	1- left tag brake caliper seized on slide pins. 2-Alternator belt starting to fray 1 Caliper-N50804659 8 1 Alt Belt - 25-08 0991 Labor-7hrs	Shari Leshchyshyn (Deactivated)	541410	13338

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2024-12-17	924	vehicle			Miles Remove weBasto head and install new PCM board and temp sensor. Install all 6 new O/H blower motors on left side labor - 2 hrs/5 hrs 1- PCM M Series M80-24-2 00988 K 3 - R,H fan motors 3 - LH fan motors 3 - RH squirrel cages 3 LH squirrel cages		Jeanette Hrechka	593687	14391
2024-12-04	924	vehicle	Oil Change	oil change	oil and filter change, fuel filter changed 1 X oil filter WL10107 1 X fuel filter WL10123 48 litres 10W30 oil		Jeanette Hrechka	591642	14354
2024-11-28	924	vehicle	Oil Change	oil change	591,017 km oil and filter change fuel filter changed 1x filter WL10107 1x filter WL 10123 48 litres 10/30 oil		Jeanette Hrechka	591017	14329
2024-11-28	924	vehicle			return fuel line found to be leaking fuel fuel drain tube, 289 7193CUM (from Inland and) invoice 52463 BRP replace fuel line (one that bolts to the back of the head with a banjo bolt ) Parts purchased from Inland Brandon		Jeanette Hrechka	591017	14329
2024-11-20	924	vehicle	Tires	Tire Inspection Required - steers	installed steer tires LH and RH - Michelin from denray tire (NEW) 2 X L 2470.65 EZ LRL (Michelin invoice 0367929NA 835935)		Jeanette Hrechka	590847	14316
2024-10-08	924	vehicle			maintenance and repairs premier, troubleshooting proheat	564.52	Natalie Hrechka	582710	14134
2024-09-17	924	vehicle	Oil Change	oil change	Oil change, topped up coolant. Installation new air dryer filter cartridge. install new back up alarm, broke off mounting. 1-backup alarm #73040 1- Air dryer filter D6303 48 L 15/40 Oil 1-oil filter WL10107 Labor 3 hrs. 11 hr		Jeanette Hrechka	575781	14023
2024-08-27	924	vehicle			replace hose clamps on intercooler 1 hour		Jeanette Hrechka	572521	
2024-08-15	924	vehicle			install new air bag tensioner bag for a/c compressor belts. 2 hours 1 X M40.5011.B air bag		Jeanette Hrechka	566569	
2024-07-30	924	vehicle			both license plate lights out Rear right service door latch not working properly		Natalie Hrechka	562959	
2024-07-25	924	vehicle			Install 2 new filter valves on coolant lines from rad to tank. Clean our coach air filters and vacuum rads. Change air temp sensor in coach. Parts - 2-1166233 3 1 - air temp sensor (coach) 11259249		Shari Leshchyshyn (Deactivated)	565062	13849
2024-06-13	924	vehicle	Oil Change	oil change	Oil and filter change 1 X WIX WL10107 48 15/40 oil BH		Jeanette Hrechka	554508	13649

2024-06-11	924	vehicle		Tight steering/high spot every 1/4 turn/ no return to center. Unit went to Freight liner to have limiting pressures checked on steering box. They were unable to as they did not have a metric fitting for their machine. I inspected king pins, moving rod and link ages. RH side pivot housing and upper King pin on the dry side. Greased - upper fitting would not take grease. R&R grease nipple greased. Problem seemed to be solved. Freightliner inv# 8800 1484	Shari Leshchyshyn (Deactivated)	554249	13642
2024-05-21	924	vehicle		Check operation of wheel chair lift. Would not deploy. Found magnet on right side yellow safety arm broke off. Installed on the switch in lower platform. Lube all mechanism. Labor-3 hrs	Shari Leshchyshyn (Deactivated)	552960	13608
2024-04-25	924	vehicle		Check steering system binding every 180° in rotation. Removed steering to check bearings and u-joints. Greased front end Labor 8 hrs	Shari Leshchyshyn (Deactivated)	551939	13580
2024-04-12	924	vehicle		Lift on hoist and check over. Grease steering king pins and driveshaft. change out 2 compartment door lock mechanisms. Parts 2 125078 Locks Labor 4 hrs	Shari Leshchyshyn (Deactivated)	551939	13579
2024-01-03	924	vehicle	180 day inspection Mb Safety inspection	1- left tag brake caliper seized on slide pins. 2-Alternator belt starting to fray 1 Caliper-N50804659 8 1 Alt Belt - 25-080991 Labor-7hrs	Shari Leshchyshyn (Deactivated)	541410	13338

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2025-02-04	924	vehicle	Tires,Tires,Tires	Tire Inspection - drives, Tire Inspection Required - steers, Tire Inspection - Tags	tire pressure check inner drives found to be low. re-inflated to 110 psi		Jeanelle Hrechka	599006	14595
2025-01-16	924	vehicle			595353 kms 14446 hrs Changed Lh& RH latches on engine door. Reset hinges to remove tension on latch rod. 8 litres Coolant added 1-RH latch 660170420 1- LH Latch 660170421 Labor - 4hrs		Jeanelle Hrechka	595353	14446

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2025-06-27	924	vehicle	Tires	Tire Inspection - Tags	Left tag tire blew at Regen Yard, Denray called to change tire, one nut could not be removed...Denray took cut off on site...stud damaged... Chained up axle and drove back to shop. Caliper found to be seized. Bearing seems ok. Rotor cracked, rusted onto bearing unit.... replaced rotor, caliper, tag tire, stud and nut 1 X N508046598KBC Caliper 1 X N508030040, rotor 1 X N455010187, stud 1 x 10516438. nut, short shank 1 x recap tire...Denray		Jeanette Hrechka	631206	15285
2025-06-05	924	vehicle	Oil Change	oil change	change oil and filter s change fuel filter 46 liters 15w40 oil 10107 oil filter 10123 fuel filter Jim		Jeanette Hrechka	625045	15150
2025-04-23	924	vehicle			Replace exhaust back pressure sensor unit derated, "engine warning" on no dash. Darren scanned to verify issue. 1 X 4928594 pressure sensor (Cummins) work completed by jim		Jeanette Hrechka	612650	14898
2025-04-11	924	vehicle	180 day inspection, Tires, Tires, 90 day inspection, Tires	Mb Safety inspection, Tire Inspection - drives, Tire Inspection - Tags, push out window log, Tire Inspection Required - steers	safety inspection performed by Exclusive bus lines in winnipeg - all wheels pulled for brake measurements. Repairs done prior to final inspection - fuel pump, transmission output seal replaced (muddy river), all drive tires replaced (Denray), RH tag shock replaced, 3 seatbelt buckles replaced, RH windsheild blind replaced, Retorque done on all wheels when unit was back at shop.		Jeanette Hrechka	609207	14807
2025-04-07	924	vehicle	Oil Change	oil change	oil and filter change R & R air regulator a/c for tensioner air bags R&R RH tag shock 1 X 5790 9 WIX oil filter 48L 15w40 oil 1 X 10880771 shock 1 X 637211400 valve, pressure limiting 4 hours		Jeanette Hrechka	608816	14799

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2025-09-16	924	vehicle			Miles Repair harness plug in rear of bus in over head for heating/AC. Clean up corrosion in plugs and re-arrange. Check side signal on right side. Install new air filter. Plug in webasto and now doesn't fire up. Remove head and clean up eye. Take to Denray for spin Balance on Steers. 1 - engine air filter - P785426 Labor 6 hrs		Susan Agland	640917	15486
2025-09-09	924	vehicle	Oil Change	oil change	401620 miles Oil change and filter Install new front left brake caliper and pads. Install new engine hatch right side latch and adjust both sides. Also re-enforce left lower doors top as it rusted off the body. Make up bracket with adjustment. Shim up front right side windows from squeaking. Repair radio change fuse and check breakers. Pull both steers and also have left one repaired. Try loosen up fuel tank door hinges. 1- oil filter wix WL10107 1- latch 660170421 44L - 15/40 oil Re-align steering wheel and repair right signal cancel. Remove fuel door and loosen up fuel fill door. Labor 8 hrs/8hrs/ 8hrs		Jeanelle Hrechka	640136	15473
2025-08-14	924	vehicle			Miles Test both batteries found outer one weak from over charging. Remove H/C alt and install on engine side. Install used alt on A/C side. Right tag tire blew causing damage to fender + need flap. Repair wires for both marker lights. Fibre glass fender and mounts. Remove front bumper for repairs. Tested all fuses on balancer. Ended up installing new battery balancer. Parts: 1 tag tire 1- balancer 11439656 1- harness 11079253 Labor 8 hrs/ 4 hrs		Jeanelle Hrechka	637371	15432
2025-07-23	924	vehicle	Tires	Tire Inspection Required - steers	LH steer tire at 70 lbs .... keep an eye on .... slow leak possibly refilled to 100 lbs		Jeanelle Hrechka	631434	15292
2025-07-11	924	vehicle	90 day inspection	push out window logs	check all e windows		Jeanelle Hrechka	629136	15241

2025-07-03

924

vehicle

try and find why out  
side batter  
continually draining  
. Both alternator le  
st ok. found CBZ07  
1 / CBZ010 (which  
ever is in position 1  
of the fuse box) to l  
et power through w  
hen shouldn't. Rest  
of the circuit seems  
to test ok. Change  
temperature sensor  
in middle of coach,  
as unit will not blow  
A/C or heat just out  
side air. (Make sur  
e to follow tech tip  
#1403 for correct w  
ire hookup) ! X 8A"  
fuse, from parts bu  
s 1 X 11175973 se  
nsor, AC temp. LH  
rear corner leaking,  
retaped with Eterna  
bond

Jeanette Hrechka 628822

15212

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2025-12-30	924	vehicle			bus broke down in swift current. they managed to get it started and brought it back to shop parked outside shop and no start again. dash was left apart from first attempt to fix it. found problem at rear of bus as both engine area light switch and on/off switch were broken. Install both new switches and put dash back together. test start and stop circuits. installed one switch from 919. tested good. top up coolant and engine oil. repair left rear hatch latch bracket. Install electrical panel cover back in place in washroom that was left off. 1 switch 82-2120 5   15/40 oil 3   coolant		Jeanette Hrechka	668311	15978
2025-12-03	924	vehicle			Top up power steering res. and bleed system. also changed out pressure hose off pump to front connecting house. repair left door on fuel bay. lower strap broke off. 38 hours. 1 hose 1096955 1 hose 11313106 1 fitting 637314820 1 coupler 11336632 10   power steering fluid		Jeanette Hrechka	666653	15933
2025-12-02	924	vehicle			M Install new steering hoses from pump to steering box in front. 3 hoses. Also change out tee fitting off steering box leaking		Susan Agland	666653	15933
2025-11-19	924	vehicle			Repair rear bumper on left side has a broken strap. Labor 1 hr		Susan Agland	665500	15897
2025-11-06	924	vehicle			M Install both new l o beam headlight assembly's check fused on webasto. Retorque steer tires. 2- Headlamps P/N 10876320 LED Labor 3 hrs		Susan Agland	658975	15793
2025-11-04	924	vehicle	Oil Change	oil change	M 658,763 Oil change and filter Change fuel filter 44L - 15/40 oil 1 oil filter-WL 10107 1-Fuel filter-SF10123 labor 5 hrs		Jeanette Hrechka	658763	15789
2025-10-30	924	vehicle	Tires	Tire Inspection Required - steers	replace both steer tires. michelin invoice da0010689046 LEZ LRL	2340.45	Jeanette Hrechka	657539	15755
2025-10-02	924	vehicle			645895 km Replaced both front (steer) shocks 2x 11154113 (ABC) shocks		Jeanette Hrechka	646097	15577

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2026-03-31	924	vehicle			remove crankcase breather box to check and repair fuel leak on supply tube to rail. Remove floor boards. Install new breather filter. Change rear start and stop switch. Get new key made up for luggage doors. Order all new fuel tubes and seals.		Jeanelle Hrechka	686779	
2026-03-26	924	vehicle			change fuel filters, check alt belt idlers for noise, ordered parts, change coolant filter, its leaking, drain all coolant, 1 coolant filter 4113 1 fuel filter sf 10123		Jeanelle Hrechka	686771	16478
2026-03-09	924	vehicle			replace high pressure fuel pump. Pin Point Diesel in Edmonton		Jeanelle Hrechka	685725	16457
2026-02-18	924	vehicle	Oil Change	oil change	oil and filter change 44 L 10W30 oil (Mardex) 1 X Wix10107 filter		Jeanelle Hrechka	681243	16316
2026-02-03	924	vehicle			installed new starter complete with solenoid. 1 starter 201-39221		Jeanelle Hrechka	674321	16178
2026-01-29	924	vehicle			bus outside/ no start, pull bus inside with tow truck, remove floor boards and panel in washroom wait to test R521 for start wire, removed panel on electrical in air filter compartment, lifted bus to test starter wiring, found broken wire on starter relay, installed new relay and cleaned up wiring. 1 relay 10511415.		Jeanelle Hrechka	674321	16178
2026-01-23	924	vehicle			replace proheat air filter, ignition module and electrodes. 2 00850k ignition module and electrode kit 200610k air filter 2 x 200122k bolt m 6 * 25 mm		Jeanelle Hrechka	673157	16120
2026-01-02	924	vehicle			left rear tv and top assembly loose on ceiling, also reading lights and vent assembly breaking loose, front step well modesty panel loosens on wall mounting, re-attach 2 reading lights on left side, used 2 angle metal straps to re-mount cabinet.		Jeanelle Hrechka	668469	15990

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2026-05-02	924	vehicle			change out right ta g air bag. Changeo ut front left tire and rim from 918. Insul ate A/C hose rubbi ng on air box. Top up A/C system. Inst all shut off valve for drivers defrost and wash out coach filter. top up all fluid s. Top up A/C syst em. Labor 5 hrs		Susan Agland	687039	16487
2026-04-21	924	vehicle			tighten and clean u p fittings on fuel se perator. change out fuel rail and fuel lin es. test and tighten fuel lines. cleaned drivers air filter. inst all 4 new tumbler d oor locks on luggag e doors. install 2 ne w door bumper slo ps on rear hatch. r emove tank pick up tube for inspection. 1 x fuel accumulato r 4307370 4 door latch tumblers 1072 2135		Jeanelle Hrechka	686788	16479
2026-04-20	924	vehicle	90 day inspection, 1 80 day inspection	push out window lo g, Mb Safety inspec tion	safety inspection. fi cense plate light ou t fuel door lower hing off step thresh old wore through c abinet push button latch no working ac compressor door la tch missing front la tch on battery box b roken top runner th reshold strip wore out.		Jeanelle Hrechka	686779	16479
2026-04-20	924	vehicle			Install new alt belt t ensioner, 2 idlers a nd belt. Install new door latch on right side rear of by. 1 b elt 11082486 1 idle r 11272930 1 tensi oner 10701420 abc 1 idler 11204418 1 door latch 6601718 07		Jeanelle Hrechka	686779	16479

Maintenance History Detail

921

2026

Date	Entity	Entity Type	Service Type	Service Name	Notes	Cost	Fleet Manager	Odometer	Engine Hours
2026-03-23	921	vehicle	180 day inspection	Mb Safety inspection	installed brake shoes and drums from 923 as they were new. checked on slack adjusters, both drive wheel seals leaking so change them, pulled both hubs, and changed all bearings, install new slack adjuster on left drive brakes. Torque drives and needs retore after test drive. 2 seal 48690 2 bearing 6632 bearing set 6580-20024 2 bearing 6+53 1 left slack adjuster		Jeanelle Hrechka	1146143	22375
2026-01-28	921	vehicle			check why no start, drove it in shop and no start in morning. testing all ignition wiring, relays and breakers. changed out oil temp and oil pressure sensors. changed trs and srs. removed alt, brakot to remove trs sensor. tested fuel supply at back of head. 2 oil sensors from old engine on stant. 1 trs sensor 1 srs sensor had to use either to start unit also change door valve, norgren V6001002US		Jeanelle Hrechka	1146143	22375
2026-01-19	921	vehicle					Susan Agland	1141943	22258