

# Alltrans Refrigeration Services, Inc.

PO Box 69  
Garwood NJ 07027  
Phone 908-964-0100  
Fax 908-964-0100

Accounting Ph: 908-931-0516  
Accounting Fax: 908-931-0516

## Invoice

Invoice Number

45310

P.O. No.

Bill To:	Invoice Date	Due Date	Terms
all Flavors Ice Cream	3/7/2025	3/7/2025	Due on receipt

Truck No.	Model #	Serial #	Service Date	Hours/Miles
Black hino	T-1080s Spectru	3000227491	3/7/2025	17261
ITEM	DESCRIPTION	QTY	COST	TOTAL
61-800	drier	1	57.76	57.76T
67-2971	condenser coil	1	3,692.03	3,692.03T
Silver Solder	Silver Solder	2	10.50	21.00T
rivits	blind rivets	24	1.95	46.80T
R404A	Refrigerant	15	50.00	750.00T
Nitrogen	Nitrogen( Pressure test/Leak check)	2	25.00	50.00T
used bottom panel	used bottom panel	1	225.00	225.00T
98-5099	support, grill/bellyband	1	45.19	45.19T
Shop supplies	remount control box	1	25.00	25.00T
Shop supplies	side door and bottom panel hardware.	1	45.00	45.00T
Shop supplies	Reseal discharge pressure transducer	1	10.00	10.00T
Anti-Freeze	Engine Coolant	2	6.99	13.98T
Labor	Labor, Shop Service	12	150.00	1,800.00T
		TOTAL		

# Alltrans Refrigeration Services, Inc.

PO Box 69  
Garwood NJ 07027  
Phone 908-964-0100  
Fax 908-964-0100

Accounting Ph: 908-931-0516  
Accounting Fax: 908-931-0516

## Invoice

Invoice Number

45310

P.O. No.

Bill To:	Invoice Date	Due Date	Terms
all Flavors Ice Cream	3/7/2025	3/7/2025	Due on receipt

Truck No.	Model #	Serial #	Service Date	Hours/Miles
Black hino	T-1080s Spectru	3000227491	3/7/2025	17261
ITEM	DESCRIPTION	QTY	COST	TOTAL
	Check unit -no start. Found battery wired incorrectly. correct battery cables. Start unit. no refrigerant leak check unit found leaks at discharge pressure transducer and discharge service port. Reseal as necessary. leak check to prove tight. Found additional leak at condenser tube sheet. - could not identify this leak to to size of leak at discharge pressure transducer. Remove all skins. Remove condenser coil. swap over shroud and orifice and install new condenser coil. . R&R drier leak check evacuate and recharge. remount resecure control box- no hardware holding it to frame. install new bolts and hardware for control panel door. Install used bottom panel. Repair/ fabricate mounting locations for bottom panel as necessary. Run and check operation. Found starter drive not retracting after startup. Remove starter and lube bendix drive. Reinstall and check operation. Sales Tax		6.625%	449.29
			<b>TOTAL</b>	\$7,231.05