



KENWORTH OF LOUISIANA

813 Veterans Dr. Carencro, LA 70520



INVOICE DATE:	12/31/2021 2 12:14PM
INVOICE NO.:	10039576
REPAIR ORDER:	9576
CUSTOMER:	12010
BRANCH:	Carencro

SOLD TO: Aucoin Transport
210 GUSTAVE
BROUSSARD, LA 70518

SHIP TO: Aucoin Transport
Richard Aucoin 337-319-859
LA 70507

Customer P/O: Invoiced by: rboquet / Orig R/O: 0 Completion Date: 12/31/2021

Unit Number: 154615 **Model Year:** 2017 **Make/Model:** KENWORTH T680 76" HIGH S
Type: Tractor **VIN:** 1XKYDP9X1HJ154615 **Meter:** 418289 Miles
In-Service Date: 07/01/2016 **ECM Reading:** 14631

Task: 1 TRIAGE TRIAGE - DOWNLOAD FAULT CODES, CHECK FOR CAMPAIGNS Department: Service

Complain: Check in unit
Hook up JPRO and upload ECM image
Check warranty and campaigns
Write up unit

QTY	SUPPLIER	PART NUMBER	DESCRIPTION / REF NUMBER	PRICE/PER	EXTENSION
1		PC FEE	COMPUTER FEE	\$25.00	\$25.00
** TASK 1 SUBTOTAL:				PARTS SUBTOTAL:	\$0.00
				LABOR SUBTOTAL:	\$62.00
				MISCELLANEOUS:	\$25.00
** TASK 1 SUBTOTAL:					\$87.00

Task: 2 099-107-000 DIAGNOSE Department: Service

Complain: Check engine light
Cause: Connected the service tool to the truck and read the faults. Found many pages of inactive faults. Checked the PCI software and it was up to date. Began troubleshooting with the NOX sensor faults P3867 heater element NOX sensor before catalyst performance malfunction. Removed the before catalyst NOX sensor from the exhaust and performed the evaluate the before catalyst NOX sensor test. The sensor failed the test. Removed the before catalyst NOX sensor from the exhaust and performed the after catalyst NOX sensor test. The sensor failed the test. The NOX sensors needs to be replaced.

QTY	SUPPLIER	PART NUMBER	DESCRIPTION / REF NUMBER	PRICE/PER	EXTENSION
** TASK 2 SUBTOTAL:				PARTS SUBTOTAL:	\$0.00
				LABOR SUBTOTAL:	\$341.00
** TASK 2 SUBTOTAL:					\$341.00

Task: 3 099-107-000 DIAGNOSE Department: Service

Complain: Truck makes a grinding noise when shifting gears--Not all the time--More when under a load
Cause: Drove the truck and did not hear any irregular noises. Drained a portion of the transmission fluid and metal was found in the oil.
Called EATON and the transmission is out of warranty by time.

QTY	SUPPLIER	PART NUMBER	DESCRIPTION / REF NUMBER	PRICE/PER	EXTENSION
** TASK 3 SUBTOTAL:				PARTS SUBTOTAL:	\$0.00
				LABOR SUBTOTAL:	\$155.00
** TASK 3 SUBTOTAL:					\$155.00

Task: 4 043-006-000 EXHAUST AFTERTREATMENT DEVICES Department: Service

Complain: Replace inlet and outlet NOX sensors
Correctio: Removed inlet NOX sensor and bushing. Installed new sensor and bushing. Removed passenger side steps. Removed outlet NOX sensor. Bolts broke during sensor removal. Drilled out bolts. Installed new Nox sensor with new bolts. Reinstalled steps. Verified repair.

QTY	SUPPLIER	PART NUMBER	DESCRIPTION / REF NUMBER	PRICE/PER	EXTENSION
-----	----------	-------------	--------------------------	-----------	-----------

CUSTOMER SIGNATURE	FREIGHT	SUBTOTAL	TAX STATUS/STATE	SALES TAX	PL EASE PAY
					CONTINUED

NO RETURNS OR REFUNDS ON ELECTRICAL PARTS
NO RETURNS OR REFUNDS ON SPECIAL ORDERED PARTS

Remit to: P.O. Box 1450
Gray, LA 70359

TERMS



KENWORTH OF LOUISIANA

813 Veterans Dr. Carencro, LA 70520



INVOICE DATE: 12/31/2021 2:12:14PM
 INVOICE NO.: 10039576
 REPAIR ORDER: 9576
 CUSTOMER: 12010
 BRANCH: Carencro

SHIP TO: Aucoin Transport
 210 GUSTAVE
 BROUSSARD, LA 70518

SHIP TO: Aucoin Transport
 Richard Aucoin 337-319-5859
 LA 70507

Customer P/O: Invoiced by: rboquet / Orig R/O: 0 Completion Date: 12/31/2021

QTY	PAC	PART NUMBER	DESCRIPTION	PRICE/PER	EXTENSION
1	PAC	1954664PRX	SENSOR-NOX	\$682.72EA	\$682.72
1	PAC	1954664PRX-C	SENSOR-NOX	\$170.00EA	\$170.00
1	PAC	2022708PE	BUSHING 20-29.9 OD	\$86.48EA	\$86.48
1	PAC	2236409PEX	NOX SENSOR FOWARD	\$739.38EA	\$739.38
1	PAC	2236409PEX-C	NOX SENSOR FOWARD -Core	\$50.00EA	\$50.00
(1)	PAC	1954664PRX-C	SENSOR-NOX	\$170.00EA	(\$170.00)
(1)	PAC	2236409PEX-C	NOX SENSOR FOWARD -Core	\$50.00EA	(\$50.00)
1		EPASVC	EPA RECOVERY FEE - SERVICE	\$0.00	\$0.00
** TASK 4 SUBTOTAL:				PARTS SUBTOTAL:	\$1,508.58
				CORE CHG:	\$220.00
				CORE RET:	(\$220.00)
				LABOR SUBTOTAL:	\$658.75
** TASK 4 SUBTOTAL:				** TASK 4 SUBTOTAL:	\$2,167.33

Department: Service

Task: 5 027-000-000 TRANSMISSION - MAIN, AUTOMATIC

Complaint: Replace transmission, clutch and rear main seal.
Correction: Removed driveline, Transmission, clutch, and flywheel. Noticed composite fitting leaking coolant on back of block. Replaced rear main seal. Removed bell housing and all other parts needed from old trans. Cleaned gasket areas. Installed bell housing onto new trans. Installed all parts removed from old trans to new trans. Installed new clutch fork, shaft, and bushings. Reinstalled flywheel. Installed new clutch. Installed new trans. Reinstalled driveline. Filled trans with oil. Test drove truck.

QTY	SUPPLIER	PART NUMBER	DESCRIPTION / REF NUMBER	PRICE/PER	EXTENSION
1	PAC	122002-35EX	INSTAL 2.000-14 SPLINE ECA EXCHANGE	\$2231.12EA	\$2,231.12
1	PAC	122002-35EX-C	INSTAL 2.000-14 SPLINE ECA EXCHANGE-Core	\$200.00EA	\$200.00
1	PAC	1876190PE	SEALRING-CRANKSHAFT FLYWHEEL	\$124.99EA	\$124.99
(1)	PAC	122002-35EX-C	INSTAL 2.000-14 SPLINE ECA EXCHANGE-Core	\$200.00EA	(\$200.00)
(1)	WEL	FAO16810SAMWEL-C	FAO16810S AUTOMATED MANUAL TRANSMISSI	\$5152.60EA	(\$5,152.60)
6	PEN	4520PAL	CLEANER -NON-CHLORINATED BRK HIGH V.O	\$2.69EA	\$16.14
1	FAS	606599	KIT	\$3.21EA	\$3.21
1	WEL	FAO16810SAMWEL	FAO16810S AUTOMATED MANUAL TRANSMISSI	\$9707.82EA	\$9,707.82
1	WEL	FAO16810SAMWEL-C	FAO16810S AUTOMATED MANUAL TRANSMISSI	\$5152.60EA	\$5,152.60
1	PAC	K4134FUL	KIT-BRAKE ASSY	\$498.53EA	\$498.53
1	PAC	K4145	KIT-CLUTCH INSTALLATION	\$912.00EA	\$912.00
1		EPASVC	EPA RECOVERY FEE - SERVICE	\$22.50	\$22.50
** TASK 5 SUBTOTAL:				PARTS SUBTOTAL:	\$13,493.81
				CORE CHG:	\$5,352.60
				CORE RET:	(\$5,352.60)
				LABOR SUBTOTAL:	\$2,790.00
				MISCELLANEOUS:	\$22.50
** TASK 5 SUBTOTAL:				** TASK 5 SUBTOTAL:	\$16,306.31

Department: Service

Task: 6 040-000-000 ENGINE/MOTOR SYSTEMS

Complaint: Need to replace leaking rear main seal.
Correction: Replaced rear main seal while trans and clutch was out the way.

CUSTOMER SIGNATURE	FREIGHT	SUBTOTAL	TAX STATUS/STATE	SALES TAX	PLEASE PAY
					CONTINUED

NO RETURNS OR REFUNDS ON ELECTRICAL PARTS
 NO RETURNS OR REFUNDS ON SPECIAL ORDERED PARTS

Remit to: P.O. Box 1450
 Gray, LA 70359

TERMS

TITLE MUST BE SURRENDERED BY DISM

KENWORTH OF LOUISIANA

813 Veterans Dr. Carencro, LA 70520



INVOICE DATE:	12/31/2021 2:12:14PM
INVOICE NO.:	10039576
REPAIR ORDER:	9576
CUSTOMER:	12010
BRANCH:	Carencro

LOUISIANA.COM
896 - 4997

GRAY | HARAHAH | PORT ALLEN | CARENCRO | MONROE | LAKE CHARLES | SHREVEPORT

LD TO: Aucoin Transport
210 GUSTAVE
BROUSSARD, LA 70518

SHIP TO: Aucoin Transport
Richard Aucoin 337-319-5859
LA 70507

Customer P/O: Invoiced by: rboquet / Orig R/O: 0 Completion Date: 12/31/2021

QTY	SUPPLIER	PART NUMBER	DESCRIPTION / REF NUMBER	PRICE/PER	EXTENSION
1		EPASVC	EPA RECOVERY FEE - SERVICE	\$1.25	\$1.25
			** TASK 6 SUBTOTAL:		\$0.00
			PARTS SUBTOTAL:		\$155.00
			LABOR SUBTOTAL:		\$1.25
			MISCELLANEOUS:		\$156.25
			** TASK 6 SUBTOTAL:		

Task: 7 040-000-000 ENGINE/MOTOR SYSTEMS

Department: Service

Complaint: Need to replace leaking coolant fitting on back of block.
Correction: Drained coolant. Removed leaking composite fitting on back of block. Installed new brass fitting. Refilled coolant. Verified repair.

QTY	SUPPLIER	PART NUMBER	DESCRIPTION / REF NUMBER	PRICE/PER	EXTENSION
1	DYN	V38-1018	FTG-STR 5/8" HOSE BEAD	\$15.23EA	\$15.23
1		EPASVC	EPA RECOVERY FEE - SERVICE	\$1.25	\$1.25
			** TASK 7 SUBTOTAL:		\$15.23
			PARTS SUBTOTAL:		\$155.00
			LABOR SUBTOTAL:		\$1.25
			MISCELLANEOUS:		\$171.48
			** TASK 7 SUBTOTAL:		

*TOTAL PARTS:	\$15,017.62
*TOTAL CORE CHARGE:	\$5,572.60
*TOTAL CORE RET:	(\$5,572.60)
*TOTAL LABOR:	\$4,316.75
*TOTAL MISCELLANEOUS:	\$50.00
*TOTAL SHOP SUPPLIES:	\$101.10

Paid With: Cash
Amount Due: \$21,519.10
Amount Received: \$21,519.10
Chg Due: \$0.00

DISCLAIMER OF WARRANTIES. Kenworth of Louisiana hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability of fitness for a particular purpose and neither assumes nor authorized any other person to assume for it any liability in connection with this sale. Buyer shall not be entitled to recover from Kenworth of Louisiana any consequential damages, damages to property, damages for loss of use, loss of time, loss of profit or income, or any other incidental damages. Parts not supplied by Kenworth do not carry the Kenworth warranty and/or product liability coverages. No parts returns after 90 days from invoice date. No returns or refunds on any electrical or special order parts. Restocking fee of 20% will be applied to all non-defective returned parts.

CUSTOMER SIGNATURE	FREIGHT	SUBTOTAL	TAX STATUS/STATE	SALES TAX	PLEASE PAY
		\$19485.47	TAXABLE	\$2,033.63	\$21,519.10

NO RETURNS OR REFUNDS ON ELECTRICAL PARTS
NO RETURNS OR REFUNDS ON SPECIAL ORDERED PARTS

Remit to: P.O. Box 1450
Gray, LA 70359

TERMS
DUE UPON RECEIPT



814 Saint Etienne Road
Broussard, LA 70518

337-252-7263
powerhouseserv@yahoo.com

Bill To

Aucoins Transport (Landstar)
203 Ave B
Broussard, La 70518

Invoice

Date	Invoice #
5/29/2025	4110

VIN Number	Terms	P.O. Number	Make	Mileage
1XKYDP9X1HJ154615	Due on receipt	LANDSTAR	2016 KW T680	641,531
Qty	Item	Description	Rate	Amount
10	ELC-100	Extended Life Coolant	12.03	120.30T
12	Labor	Labor	130.00	1,560.00T
1	MISC.	Shop Supplies	40.00	40.00T
		COMPLAINT: Water Pump, Inside belt, Drag link, Tie rod ends, King Pins, Radiator, Inverter		
		CAUSE: Worn front end parts, leaking radiator, old belt, water pump leak		
		CORRECTION: Removed and Replaced all parts, greased all ball joints and king pins, filled engine with coolant, recharged AC system with the amount of free-on that was recovered. Secured inverter and powered on to check system receiving 12v. Ran truck confirmed repairs and checked for leaks.		
		CUSTOMER FURNISHED ALL PARTS		
		90 DAY LABOR WARRANTY		
1	MISC.	CC charge	56.51	56.51
			Subtotal	\$1,776.81
			Sales Tax (9.5%)	\$163.43
			Total	\$1,940.24



814 Saint Etienne Road
Broussard, LA 70518

337-252-7263

powerhouserv@yahoo.com

Invoice

Date	Invoice #
10/13/2025	4381

Bill To

Accoins Transport (Landstar)
235 Ave B
Broussard, La 70518

VIN Number	Terms	P.O. Number	Make	Mileage
1XKYDP9X1HJ154615	Due on receipt		2016 KW	664,127

Item	Description	Rate	Amount
15 Labor	Labor COMPLAINT: Check Engine Light CAUSE: EGR Valve had all faults. system very dirty and clogged CORRECTION: Plugged autel and retrived fault codes. Ran test on system and did not respond as should. Pulled a couple of egr ports and sensor and seen how dirty. Customer approved a complete egr flush. Pulled cooler and cross over tube and cleaned. Customer furnished new egr valve and misc parts. Installed parts and ran truck. Needed OEM software for further installation and diags. Performed a stationary regen. system passed and no check engine lights came on.	130.00	1,950.00T

Subtotal	\$1,950.00
Sales Tax (9.5%)	\$185.25
Total	\$2,135.25



814 Saint Etienne Road
Broussard, LA 70518

337-252-7263
powerhouserv@yahoo.com

Invoice

Date	Invoice #
11/18/2025	4446

Bill To

Aucoins Transport (Landstar)
203 Ave B
Broussard, La 70518

VIN Number		Terms	P.O. Number	Make	Mileage
1axkydp9xfhj154615		Due on receipt		2016 K/W	664193
Qty	Item	Description		Rate	Amount
1	BC1044	Battery Cable		52.85	52.85T
2	BC152	Battery Cable		52.85	105.70T
4	BT31S93	Battery		118.91	475.64T
2	Labor	Labor		130.00	260.00T
<p>Check Batteries hard to start sometimes</p> <p>Diagnosed batteries found one battery bad and three marginal. Jumper cables had green corrosion coming from under insulation.</p> <p>Replaced batteries and bad jumper cables</p>					
Subtotal					\$894.19
Sales Tax (9.5%)					\$84.95
Total					\$979.14