



**DOBBS PETERBILT**



3707 Airport Way S.  
Seattle, Washington 98134  
TF: (800) 255-7383

**\*\* Reprint \*\***  
Invoice: 021R4874  
Date / Hour: 4/29/2024 7:27:18AM  
Repair Order: 4874  
Customer: 413689  
Branch: Seat  
Total Invoice: \$80,403.38  
\*\*\*Open Account - Charge\*\*\*  
Page 1 of 8

**Ship To:** HOS BROTHERS CONSTRUCTION

P. O. BOX 1788  
WOODINVILLE OUTSIDE, WA 98072

Office Phone: (206) 621-8573  
Email: ap@hosbro.com;  
titanc@hosbro.com

**Bill To:** Hos Brothers Construction

P. O. BOX 1788  
WOODINVILLE OUTSIDE, WA 98072

Work: (206) 621-8573

Shop: 425-236-3961

Customer P/O: 117634p

Open Date: 03/19/2024

Completion Date: 04/26/2024

Add User: Cass.Brehm

Salesperson: Eddie Cardines

**Unit Number: 1785**

**Model Year: 2013**

**Make/Model: Kenworth T800**

**Type: Truck**

**VIN: 1NKDX4EX1DR363689**

**Meter: 571193 Miles**

**In-Service Date: 06/05/2013**

**ECM Reading: 18251**

Unit Components:

Serial Number

79616010

S0981976

Manufacturer

Model

ISX15

RTLO-189188

Fuller

**Task: 1 99V Dobbs Courtesy Inspection**

**Department: Service**

**Complaint:** Perform Dobbs Courtesy Inspection

**Cause:** Recommendation:

-Replace springs and rear spring hanger with new pins  
-Replace passenger door down mirror  
-Replace rear diff tracking rod  
-Replace front diff torque rod  
-Replace 5th wheel pivot bushings  
-Replace exhaust band clamp  
-Replace shift isolator  
**Correction:** Performed Dobbs Courtesy Inspection and found the following:  
-Steer axle pins and bushings worn  
-Passenger door down mirror broken  
-Rear diff housing tracking rod bushings worn  
-Front diff housing torque rod bushing worn  
-5th wheel pivot bushing worn  
-Exhaust clamp #1 from SCR catalyst to left stack loose  
-Shifter isolator worn

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	CHECK	DOBBS COURTESY INSPECTION		-1.0	\$0.01	\$(0.01)

**Task 1 Subtotals**

Parts: \$0.00

Labor: \$0.01

Miscellaneous: \$(0.01)

Task 1 Subtotals: \$(0.01)

**Task: 2 521 Engine Assembly - Miscellaneous Repair**

**Department: Service**

**Complaint:** Customer requests: Quote swing engine.

\*\* See Last Page for Invoice Total \*\*



3707 Airport Way S.  
Seattle, Washington 98134  
TF: (800) 255-7383

**\*\* Reprint \*\***  
Invoice: 021R4874  
Date / Hour: 4/29/2024 7:27:18AM  
Repair Order: 4874  
Customer: 413689  
Branch: Seat  
Total Invoice: \$80,403.38  
\*\*\*Open Account - Charge\*\*\*  
Page 2 of 8

**Ship To:** HOS BROTHERS CONSTRUCTION  
P. O. BOX 1788  
WOODINVILLE OUTSIDE, WA 98072  
Office Phone: (206) 621-8573  
Email: ap@hosbro.com  
titanc@hosbro.com

**Bill To:** Hos Brothers Construction  
P. O. BOX 1788  
PO Box 1788  
WOODINVILLE OUTSIDE, WA 98072

Customer P/O: 117634p  
Add User: Cass Brehm  
Cause: Swing engine.

Work: (206) 621-8573  
Shop: 425-236-3961

Completion Date: 04/26/2024  
Open Date: 03/19/2024  
Salesperson: Eddie Cardines

New ESN: 60849837  
**Correction:** Drained engine oil, coolant, and power steering fluid. Recovered A/C system. Disconnected batteries, alternator wiring, block heater wiring, OEM engine harness, starter wiring, fuel lines, power steering lines, and air lines. Removed air inlet piping, CAC piping, A/C lines to condenser, compressor, receiver dryer, and belly bar under transmission. Supported transmission with transmission jack. Disconnected drive and shift linkage. Removed engine oil pan, engine fan, engine belts, and crankshaft pulley. Lined engine out overhead crane. Disconnected front and rear motor mounts. Removed crossmember for front motor mount. Raised engine out of vehicle and supported on jack stands. Disconnected decomposition tube, SCR outlet, and DOC inlet pipes. Removed entire aftertreatment assembly, step covers upper step bracket, and DOC/DPF assembly. Disassembled DOC/DPF and sent out for cleaning. During repairs, found surge tank and heater cord needs replaced.  
\*\*\*Recommend replace surge tank and heater cord.\*\*\*  
Assembled cleaned DOC/DPF. Reinstalled aftertreatment assembly with all new clamps and gaskets. Ensured all bolts and clamps torqued to spec. Installed turned flywheel with new pilot bearing and new clutch. Installed engine with new motor mounts on front and both rear. Installed front motor mount crossmember. Installed transmission into engine. Reconnected driveline and ensured all bolts torqued to spec. Installed new engine belts, engine fan, radiator pack, new radiator hoses, radiator pipes, and new surge tank. Connected coolant pipes to engine block. Installed exhaust pipe after turbocharger with new clamps and gaskets. Removed and replaced block heater harness. Connected, routed, and secured OEM engine harness and star/charge harness. Installed new block heater element and turbocharger intake piping from both air cleaner assemblies. Connected shift linkage. Removed EGR crossover pipe and valve cover for access to injector trim codes. Reinstalled valve cover and EGR crossover tube. Installed CAC piping. Filled cooling system and engine oil to proper levels. After filling coolant, found surge tank has hole in it and leaking. Drained coolant. Replaced leaking hose and refilled cooling system to proper levels. Installed new A/C receiver dryer with new O-rings. Installed new O-rings on A/C compressor and condenser. Connected batteries and installed battery cover. Connected to ECM. Reset all fault codes and trip recorder. Updated injector trim codes in ECM. Started engine and ensured coolant and oil levels topped off. Filled unit outside and pressure washed for road test. Cleaned bay. Performed break in road test and QC inspection. Found front lower radiator pipe to frame pipe leaking coolant. Recommend replacing hose and clamps. Charged A/C system to manufacturer specification. Drained coolant. Removed and replaced leaking coolant hose. Vacuum filled cooling system. Pressure tested cooling system to verify repairs. No issues found. Complete.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
CUM10	DR7960RXCUM-C	ENG ISX 15 10 B 400@1800 HPCR-Core	EA	-1.0	\$9,512.10	\$(9,512.10)
<b>Original Invoice: 021R4874</b>						
SEA21	18.	FLYWHEEL TURN	EA	1.0	\$126.69	\$126.69
SEA21	1D262	CONTACT CLEANER	EA	1.0	\$28.98	\$28.98
FNST	26-03483-001	ADAPTER-ISO 6149 PORT	EA	1.0	\$101.08	\$101.08
CUM10	2666337CUM	GASKET-CIRCULAR 5"	EA	3.0	\$38.94	\$38.94
CUM10	2666363CUM	GASKET-CIRCULAR 4"	EA	1.0	\$12.98	\$12.98
CUM10	2666363CUM	GASKET-CIRCULAR 4"	EA	1.0	\$12.98	\$12.98
CUM10	2871453CUM	GASKET-DPF ASSY	EA	2.0	\$34.68	\$69.36

\*\* See Last Page for Invoice Total \*\*



3707 Airport Way S.  
Seattle, Washington 98134  
TF: (800) 255-7383

**\*\* Reprint \*\***  
Invoice: 021R4874  
Date / Hour: 4/29/2024 7:27:18AM  
Repair Order: 4874  
Customer: 413689  
Branch: Seat  
Total Invoice: \$80,403.38  
\*\*\*Open Account - Charge\*\*\*  
Page 3 of 8

**Ship To: HOS BROTHERS CONSTRUCTION**  
P. O. BOX 1788  
WOODINVILLE OUTSIDE, WA 98072  
Office Phone: (206) 621-8573  
Email: ap@hosbros.com;  
titanc@hosbros.com

**Bill To:** Hos Brothers Construction  
P. O. BOX 1788  
PO Box 1788  
WOODINVILLE OUTSIDE, WA 98072

Work: (206) 621-8573 Shop: 425-236-3961

Customer P/O: 117634p Open Date: 03/19/2024 Completion Date: 04/26/2024  
Add User: Cass Brehm Salesperson: Eddie Cardines

QTY	UNIT	DESCRIPTION	ITEM #	PRICE	TOTAL
2.0	EA	CLAMP-V BAND	2871863CUM	\$87.69	\$175.38
1.0	EA	GASKET-AFM DEVICE	2880215CUM	\$17.18	\$17.18
1.0	EA	WATER OUTLET O-RING SEAL	3081695CUM	\$4.84	\$4.84
1.0	EA	APEX RED (ISX) PAINT	3163075	\$25.36	\$25.36
1.0	EA	HEATER-BLOCK PACCAR ISX AND MX	351-0474	\$29.48	\$29.48
1.0	EA	HARNESSE-ETR CNT MDL WRG	4312327CUM	\$1,260.69	\$1,260.69
1.0	EA	GASKET-PUMP HYDRAULIC	4988280CUM	\$4.58	\$4.58
15.0	EA	OIL-ROTELLA TRI P 15W40	500010048	\$19.14	\$287.10
1.0	EA	CLAMP-V BAND	5304600CUM	\$60.36	\$60.36
1.0	EA	BEARING	6306LLUA1C3/ZE	\$15.98	\$15.98
1.0	EA	CLAMP-V BAND 4"	90-0012	\$14.36	\$14.36
1.0	EA	CLAMP-V BAND 4"	90-0012	\$14.36	\$14.36
1.0	EA	CLAMP-V BAND 4"	90-0012	\$14.36	\$14.36
1.0	EA	CLAMP-V BAND 5"	90-0013	\$14.98	\$14.98
1.0	EA	CLAMP-HOSE W/LINER #10	9210TRP	\$2.41	\$2.41
2.0	EA	CLAMP-HOSE W/LINER #12	9212TRP	\$2.41	\$4.82
2.0	EA	CLAMP-HOSE W/LINER #16	9216TRP	\$1.95	\$3.90
2.0	EA	ZEP N/C BRAKE CLNR 12/14OZ	AMRPAZAA734	\$6.58	\$13.16
4.0	EA	CHEVRON MD-3 ATF 1QT	CHEVATF	\$6.22	\$24.88
1.0	TRP	CLAMP-CONST TORQUE HD SS	CT300LTRP	\$10.69	\$10.69
8.0	TRP	CLAMP-CONSTANT TORQUE #44	CT9444TRP	\$6.60	\$52.80
1.0	EA	HOSE-RADIATOR #40 J20R1-A	D1030-2650	\$25.95	\$25.95
3.0	EA	HOSE-HEATER 1"X25"	D1030-3950	\$11.18	\$33.54
1.0	EA	BELT-POLY 6 RIBS X 1620 E	D84-1000-6061620	\$41.69	\$41.69
1.0	EA	BELT-POLY 12 RIBS X 2180	D84-1000-6122180	\$75.71	\$75.71
1.0	EA	ENG ISX 15 10 B 400@1800 HPCR	DR7960RXCUM	\$48,660.99	\$48,660.99
1.0	EA	ENG ISX 15 10 B 400@1800 HPCR-Core	DR7960RXCUM-C	\$9,512.10	\$9,512.10
16.0	JG	COOLANT-TRP ELC 50/50 JUG	EC3501	\$9.00	\$144.00
1.0	EA	ELBOW-RUBBER SILICONE 90D	F04-6006	\$99.61	\$99.61
1.0	EA	HOSE-SILICONE 2.5"	F50-1548	\$34.18	\$34.18
1.0	EA	EPA/HOSE-COOL 2-1/2" SIL BLUE	F50-6308	\$69.01	\$69.01
1.0	EA	DRYER-RECEIVER O RING 3"X	GD11350	\$29.48	\$29.48
1.0	EA	HARNESSE-HEATER ENGINE	K068-5616-22-9	\$263.69	\$263.69

\*\* See Last Page for Invoice Total \*\*



**DOBBS PETERBILT**



3707 Airport Way S.  
Seattle, Washington 98134  
TF: (800) 255-7383

**Ship To: HOS BROTHERS CONSTRUCTION**

**Bill To: Hos Brothers Construction**

P. O. BOX 1788  
WOODINVILLE OUTSIDE, WA 98072  
Office Phone: (206) 621-8573  
Email: ap@hosbro.com  
titanc@hosbro.com

P. O. BOX 1788  
WOODINVILLE OUTSIDE, WA 98072

Work: (206) 621-8573 Shop: 425-236-3961

Customer P/O: 117634p Add User: Cass Brehm Salesperson: Eddie Cardines  
Open Date: 03/19/2024 Completion Date: 04/26/2024

**Correction:** Lifted frame rails with A-frame. Tightened brakes down to prevent tires from rolling and spinning axle. Removed front spring pin hold-down straps, shock absorbers, and rear shackles. Cut U-bolts out and removed leaf springs. Removed aftertreatment assembly mounting bracket for access to passenger side rear spring hanger. Removed both rear spring hangers. Installed new spring hangers, aftertreatment mounting bracket, new spring hanger pins, new leaf springs on both sides, new front spring pins, front spring pin straps, and new U-bolts and nuts. Torqued all bolts down to spec. Installed new rear spring pin shackles, had to loosen U-bolts to align rear shackles. Re-torqued all bolts to spec. Verified repairs, no issues found with work performed. Complete.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
Dayton15	327-540	SPRING PIN	EA	2.0	\$24.69	\$49.38
Dayton15	327-544	SPRING PIN	EA	4.0	\$25.18	\$100.72
Dayton15	338-2172-01	Hanger	EA	2.0	\$145.39	\$290.78
Dayton15	59-576	spring	EA	1.0	\$889.81	\$889.81
Dayton15	59-576	spring	EA	1.0	\$732.98	\$732.98
PACPR	B20-6006	SHACKLE-FRONT AXLE	EA	4.0	\$69.18	\$276.72
PACPR	B22-6000	CAP-SPRING PIN	EA	4.0	\$20.18	\$80.72
PTBPR	B71-1001	ABSORBER-SHOCK OE	EA	2.0	\$86.00	\$172.00
SEA21	HRWR	NUTS-WASHERS	EA	1.0	\$7.69	\$7.69
PACPR	K241-570-296	U BOLT-FRONT SPRG 3/4-16N	EA	2.0	\$60.48	\$120.96
PACPR	K241-570-309	U BOLT-FRONT SPRG 3/4-16N	EA	2.0	\$49.98	\$99.96
<b>Task 3 Subtotals</b>						
Parts:					\$2,821.72	
Labor:					\$2,784.00	
Task 3 Subtotals					\$5,605.72	

**Task: 4 506 Rear Axle - Miscellaneous Repair**

Department: Service

**Complaint:** Rear diff housing tracking rod bushings worn

**Cause:** Replaced rear diff tracking rod.

**Correction:** Removed rear drive axle tracking rod. Cleaned hardware and installed new tracking rod. Torqued all bolts to specification. Verified repairs, no issues found with work performed. Complete.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
TRP	TORAB1-610	TORQUE ROD-1-1/4" F2S BP/TP BOND & CURL	EA	1.0	\$175.98	\$175.98
<b>Task 4 Subtotals</b>						
Parts:					\$175.98	
Labor:					\$139.20	
Task 4 Subtotals					\$315.18	

**Task: 5 505 Front Axle - Miscellaneous Repair**

Department: Service

**Complaint:** Front diff housing torque rod bushing worn

**Cause:** Replaced front diff torque rod.

**Correction:** Removed front differential torque rod. Cleaned threads on hardware. Installed new torque rod, torqued all bolts to spec, and painted. Verified repairs, no issues found with work performed. Complete.

\*\* See Last Page for Invoice Total \*\*

**\*\* Reprint \*\***  
Invoice: 021R4874  
Date / Hour: 4/29/2024 7:27:18AM  
Repair Order: 4874  
Customer: 413689  
Branch: Seat  
Total Invoice: \$80,403.38  
\*\*\*Open Account - Charge\*\*\*  
Page 5 of 8



**DOBBS PETERBILT**



3707 Airport Way S.  
Seattle, Washington 98134  
TF: (800) 255-7383

**\*\* Reprint \*\***

Invoice: 021R4874  
Date / Hour: 4/29/2024 7:27:18AM  
Repair Order: 4874  
Customer: 413689  
Branch: Seat  
Total Invoice: \$80,403.38  
\*\*\*Open Account - Charge\*\*\*  
Page 6 of 8

**Ship To: HOS BROTHERS CONSTRUCTION**

P. O. BOX 1788  
WOODINVILLE OUTSIDE, WA 98072  
Office Phone: (206) 621-8573  
Email: ap@hosbro.com  
titanc@hosbro.com

**Bill To:**

Hos Brothers Construction  
P. O. BOX 1788  
PO Box 1788  
WOODINVILLE OUTSIDE, WA 98072

Work: (206) 621-8573

Shop: 425-236-3961

Customer P/O: 117634p

Open Date: 03/19/2024

Completion Date: 04/26/2024

Add User: Cass.Brehm

Salesperson: Eddie.Cardines

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
HDR10	62000-595	ROD-TORQUE HENDRICKSON UL	EA	1.0	\$111.18	\$111.18
	Freight					\$40.00
<b>Task 5 Subtotals</b>						
	Parts:				\$111.18	\$111.18
	Labor:				\$162.40	\$162.40
	Miscellaneous:				\$40.00	\$40.00
	Task 5 Subtotals				\$313.58	\$313.58

Detail Tax Info:

Sales Tax

Total: \$7,599.37

Total Parts:	\$57,358.41
Total Core Charge:	\$9,512.10
Total Core Ret:	\$(9,512.10)
Total Labor:	\$14,685.61
Total Miscellaneous:	\$(440.01)
Total Environmental Fee:	\$200.00
Total Shop Supplies:	\$1,000.00
Invoice Subtotal:	\$72,804.01
Total Tax:	\$7,599.37
<b>Total Invoice:</b>	<b>\$80,403.38</b>

Payment Method

Terms

Due Date

\*\*\*Open Account - Charge\*\*\*

Net 30 Days

5/29/2024

Remit To

Dobbs Peterbilt - Seattle, WA  
P. O. Box 35144 #1022

Seattle, WA 98124-5144



**DOBBS PETERBILT**



3707 Airport Way S.  
Seattle, Washington 98134  
TF: (800) 255-7383

**\*\* Reprint \*\***

Invoice: 021R4874  
Date / Hour: 4/29/2024 7:27:18AM  
Repair Order: 4874  
Customer: 413689  
Branch: Seat  
Total Invoice: \$80,403.38  
\*\*\*Open Account - Charge\*\*\*  
Page 7 of 8

**Ship To: HOS BROTHERS CONSTRUCTION**

P. O. BOX 1788  
WOODINVILLE OUTSIDE, WA 98072  
Office Phone: (206) 621-8573  
Email: ap@hosbros.com  
titanc@hosbros.com

**Bill To: Hos Brothers Construction**

P. O. BOX 1788  
PO Box 1788

WOODINVILLE OUTSIDE, WA 98072

Work: (206) 621-8573 Shop: 425-236-3961

Customer P/O: 117634p Open Date: 03/19/2024 Completion Date: 04/26/2024  
Add User: Cass Brehm Salesperson: Eddie Cardines  
**LIMITED WARRANTY**

**THIS LIMITED WARRANTY GIVES YOU SPECIFIC LEGAL RIGHTS AND YOU MAY ALSO HAVE OTHER RIGHTS, WHICH VARY FROM STATE TO STATE. WHO IS COVERED:** The Dealer is issuing this invoice (the "Dealer") offers this limited warranty to only you, the customer listed on this repair order/invoice. It does not extend to any subsequent owner. It cannot be transferred to any other person.

**WHAT IS COVERED:** The Dealer warrants the workmanship of our labor performed in conjunction with repairs for 90 days (the "Warranty Period"). Said Warranty Period commences on the date ("Invoice Date") that the repairs are completed. The following items will void this Limited Warranty, if the failure was caused by misuse, abuse, lack of or improper maintenance, accident, alterations, overheating, and/or lack of lubrication or coolant. For any failure caused by the Dealer's workmanship (labor) covered by this Limited Warranty, the Dealer will either repair or replace such failure, at its option, in the Dealer's facility.

**YOUR RESPONSIBILITIES:** All items must be returned to our shop with transportation charges prepaid for our inspection and determination within 60 days from the date of the sales invoice covering said items. The customer is required to return the vehicle to the Dealer or authorized repair facility at the customer's expense. You must retain copies of your Repair Orders/Invoices, and, upon request, be able to present them to us when requesting coverage under this Limited Warranty. Upon return of the vehicle to you, you must pay for any parts, labor, products, expenses, freight and taxes that the Dealer is not obligated to provide or pay for under this Limited Warranty.

**WHAT IS NOT COVERED:** Repairs which are still covered by a manufacturer's warranty or recall or other third party warranty/service contract. The Dealer's Limited Warranty shall be secondary to any such warranty or service contract that provides coverage for repair claims covered hereunder. Damage caused by your failure to use manufacturer approved fluids, or the lack thereof, including but not limited to oil, antifreeze, and DEF. Any failure or damage resulting from your failure to perform maintenance in accordance with the manufacturer's recommendations; your failure to maintain appropriate fluid levels (e.g. oil, water, DEF, transmission fluid); your continued operation of the vehicle after warning light notification; modification or operation of the vehicle in a manner that is not in conformance with the manufacturer's specifications or intended use; an accident or collision; your use of improper or contaminated fluids including fuel, and/or misuse, abuse, tampering, negligence, theft, vandalism, or acts of nature or God. Parts installed and/or repairs performed on vehicles used primarily for off road competition or engaging in a contest of speed or endurance of any type.

**INSPECTION RIGHTS:** The Dealer reserves the right to inspect the vehicle and any parts removed from or installed in the vehicle both prior to and after a repair is performed pursuant to a claim made under this Limited Warranty.

**EXCLUSIVE REMEDY:** The performance of labor to effect repairs is the exclusive remedy available under this written Limited Warranty. THE PERFORMANCE OF LABOR TO EFFECT REPAIRS IS YOUR SOLE AND EXCLUSIVE REMEDY AND OUR ENTIRE LIABILITY FOR ANY BREACH OF THIS LIMITED WARRANTY. OUR LIABILITY SHALL UNDER NO CIRCUMSTANCES EXCEED THE ACTUAL AMOUNT PAID BY YOU FOR THE LABOR WE SUPPLIED, NOR SHALL WE UNDER ANY CIRCUMSTANCES BE LIABLE FOR ANY CONSEQUENTIAL, INCIDENTAL, SPECIAL OR PUNITIVE DAMAGES OR LOSSES, WHETHER DIRECT OR INDIRECT. SOME STATES DO NOT ALLOW THE EXCLUSION OR LIMITATION OF INCIDENTAL OR CONSEQUENTIAL DAMAGES, SO THE ABOVE LIMITATION OR EXCLUSION MAY NOT APPLY TO YOU.

**IMPLIED WARRANTY DISCLAIMER:** The only warranty on parts and products sold in conjunction with repairs performed by the manufacturer or supplier of said parts or products. Except for the limited warranty on the workmanship of our labor, the Dealer expressly disclaims all implied warranties including any implied warranties of the merchantability and fitness for a particular purpose for any period beyond the Warranty Period. WE LIMIT THE DURATION AND PURPOSE TO THE DURATION OF WARRANTY PERIOD.

**SOME STATES DO NOT ALLOW LIMITATIONS ON HOW LONG AN IMPLIED WARRANTY LASTS, SO THE ABOVE LIMITATION MAY NOT APPLY TO YOU. NO ASSUMPTION OF LIABILITY:** The Dealer does not authorize any other person to assume for it any liability in connection with the sales of any parts or products of this repair.

**THE FOLLOWING APPLIES TO ALL OF OUR CUSTOMERS**

**STORAGE CHARGES:** I understand and agree that a daily storage charge may be assessed if I fail to pick up the vehicle after being notified that the repairs have been completed. Storage charges will accrue at the rate of \$45.00 per day beginning 15 days after the repair has been completed. Storage fees will also accrue at the same charge if I fail to authorize repairs to be performed within three days after the data or communication from the Dealer. **DISASSEMBLY/REASSEMBLY CHARGES:** If you authorize disassembly of the vehicle or a vehicle component to provide an estimate or commencement of



**DOBBS PETERBILT**



3707 Airport Way S.  
Seattle, Washington 98134  
TF: (800) 255-7383

**\*\* Reprint \*\***

Invoice: **021R4874**

Date / Hour: 4/29/2024 7:27:18AM

Repair Order: 4874

Customer: 413689

Branch: Seat

Total Invoice: \$80,403.38

\*\*\*Open Account - Charge\*\*\*

Page 8 of 8

**Bill To:**

Hos Brothers Construction

P. O. BOX 1788

PO Box 1788

WOODINVILLE OUTSIDE, WA 98072

**Ship To:** HOS BROTHERS CONSTRUCTION

P. O. BOX 1788

WOODINVILLE OUTSIDE, WA 98072

Office Phone: (206) 621-8573

Email: ap@hosbros.com;

titanc@hosbros.com

Work: (206) 621-8573

Shop: 425-236-3961

Add User: Cass.Brehm

Salesperson: Eddie.Cardines

Customer P/O: 117634p

Open Date: 03/19/2024

Completion Date: 04/26/2024

repairs and do not authorize completion of a repair or service, a charge will be imposed for disassembly, reassembly or partially completed work and you

agree to pay the same. Such charges will be directly related to the actual amount of labor and parts involved in the inspection, repair or service. I have been

advised that disassembly of the vehicle may prevent restoration of the vehicle to its prior condition.

DELAYS AND LEGAL LIABILITY: I understand and agree that the Dealership is not responsible for any delays caused by unavailability of parts or shipping by

the supplier or transporter or any losses or downtime relating to such delays, nor is it responsible for loss or damage to the vehicle or articles left in the vehicle

in the event of fire, theft, or any other cause beyond its control. The Dealership will not be responsible for personal property. You and your representative

agree to hold the Dealership harmless and not liable for any missing or damaged property.

WARNING: Products being sold to you can expose you to chemicals which are known to the State of California to cause cancer, birth defects or other

reproductive harm. For more information go to www.P65Warnings.ca.gov.

Customer Signature: \_\_\_\_\_ Date: \_\_\_\_\_