

**Bill To:**

Hos Brothers Construction

7733 W Bostian Rd

PO Box 1788

Woodinville Outside, WA 98072

**Ship To:** Internal Lease/Rental

3701 Airport Way S

Seattle, WA 98108

Shop:425-236-3961

Customer P/O: 1162956

Open Date: 01/06/2023

Completion Date: 01/26/2023

Add User: matthew.austin

Salesperson: ataylor

Unit Number: 1850

Model Year: 2017

Make/Model: Peterbilt 367

Type: Truck

VIN: 1NPTX4EX1HD412687

Meter: 287846 Miles

In-Service Date: 08/08/2016

ECM Reading: 12599

Task: 3 99V

Dobbs Courtesy Inspection

Department: Service

Complaint: Perform Dobbs Courtesy Inspection

Cause: Perform Dobbs Courtesy Inspection

Correction: Performed Dobbs Courtesy Inspection. Found exhaust flex pipe is cracked and leaking, EGR cooler to exhaust manifold slip joint is leaking.

Supp. Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
<b>Task 3 Subtotals</b>					
Parts:				\$0.00	\$0.00
Labor:				\$0.00	\$0.00
Task 3 Subtotals				\$0.00	\$0.00

Task: 4 521

Engine Assembly - Miscellaneous Repair

Department: Service

Complaint: Coolant over-pressurizing - Check and Advise

Cause: EDS# DSCBT0513

Found cylinder 2 liner has dropped due to counter bore ledge, flex pipe after turbo is cracked, exhaust manifold slip joint to EGR cooler worn and leaking, EGR cooler inlet clamp broke upon removal, front main seal is leaking, both belts are starting to crack, overhead internal harness is wicking, rocker arms have a large amount of corrosion and rocker shaft detents are worn, #5 high pressure fuel line has heavy corrosion on injector side, 9 short head bolts are damaged, and air compressor hard discharge line is not secure 2 p-clamps are damaged, and oil pressure sensor is weeping oil.



**DOBBS PETERBILT**



3707 Airport Way S.  
 Seattle, Washington 98134  
 TF: (800) 255-7383

**\*\* Reprint \*\***  
 Invoice: 021R2757  
 Date / Hour: 1/28/2023 8:45:04AM  
 Repair Order: 2757  
 Customer: 413689  
 Branch: Seat  
 Total Invoice: \$37,436.93  
 \*\*\*Open Account - Charge\*\*\*  
 Page 1 of 6



DOBBS PETERBILT



3707 Airport Way S.  
Seattle, Washington 98134  
TF: (800) 255-7383

**\*\* Reprint \*\***  
Invoice: 021R2757  
Date / Hour: 1/28/2023 8:45:04AM  
Repair Order: 2757  
Customer: 413689  
Branch: Seat  
Total Invoice: \$37,436.93  
\*\*\*Open Account - Charge\*\*\*  
Page 2 of 6

Ship To: Internal Lease/Rental

3701 Airport Way S  
Seattle, WA 98108

Bill To: Hos Brothers Construction

7733 W Boston Rd  
PO Box 1788

Woodinville Outside, WA 98072

Shop: 425-236-3961

Customer P/O: 116295p

Open Date: 01/06/2023

Completion Date: 01/26/2023

Add User: matthew.austln

Salesperson: ataylor

**Correction:** Steam cleaned mud off of engine compartment and aftertreatment area. Started stationary regeneration to raise operating temperature. During regeneration, noticed exhaust flex pipe after turbo is cracked and leaking. Slip joint between exhaust manifold and EGR cooler is leaking. Fault code 3225 aftertreatment purge air actuator not responding came active. Performed block test and found results are positive for combustion gases in cooling system. Uploaded photos of block test results to TruVideo. Opened EDS session DSCBT0513, uploaded ECM image to EDS and started troubleshooting coolant coming from overflow. Verified coolant temperature sensor is accurate. Removed EGR cooler outlet elbow and tested soot with strip. No evidence of coolant in EGR cooler outlet elbow. Removed clean air intake, EGR crossover tube, and valve cover. Removed high pressure fuel lines, high pressure fuel connectors, and fuel injectors. Found no visual damage to fuel injectors, O-rings, or injector cups. Evacuated refrigerant. Removed hood, charge air pipes, coolant hoses, washer reservoir, radiator braces, fuel cooler lines, coolant vent lines, power steering cooler lines, and A/C lines. Removed cooling package assembly, alternator, A/C compressor, mega bracket, thermostat housing, turbocharger, exhaust outlet connection, fuel doser fuel line, EGR valve, EGR mass measurement assembly, exhaust manifold, engine harness, intake manifold, high pressure fuel lines, fuel rail, rocker lever assemblies, front cover, adjustable idler, camshaft gear, and camshaft. Removed head bolts and cylinder head. Found evidence of combustion gas trailing to coolant jacket on cylinder #2. Cleaned block and cylinder head decks. Checked liner protrusion, found liner below spec at .006" on exhaust side and .009" on the intake side. Cleaned and inspected parts. Found flex pipe after turbo is cracked, exhaust manifold slip joint to EGR cooler worn and leaking, EGR cooler inlet clamp broke upon removal, front main seal is leaking, both belts are starting to crack, overhead internal harness is wicking, rocker arms have a large amount of corrosion and rocker shaft detents are worn, #5 high pressure fuel line has heavy corrosion on injector side, nine short head bolts are damaged, and air compressor hard discharge line is not secure - two p-clamps are damaged.

\*\*\*\*Recommend counter-bore machine, cylinder liners, rocker shafts, cylinder liners, and Exhaust manifold front piece update\*\*\*\*\*  
Drained engine oil. Removed oil pan, suction tube, block stiffener, oil pump, oil pan, cylinder head, and camshaft. Timed engine and parts. Found wear in engine brake detents on rocker shafts.  
Machined counter bore ledges and installed new liners with shims. Checked liner protrusion all liners are within .0005" of .011".  
Removed and replaced all crankshaft main bearings and thrust washers. Found no damage in crankshaft journals. Removed engine harness. Found oil PSI sensor is wicking. Replaced oil PSI sensor. Removed after treatment cover and step. Removed DPF and DOC. Sent DOC out for cleaning. Found no visual damage in DOC. Found DPF differential pressure sensor tube collar is seized.  
Attempted to free up collar and was unsuccessful. Ordered new DPF differential pressure sensor tube. Replaced engine brake piston kits.  
Installed piston assemblies, piston cooling nozzles, block stiffener, oil pump, oil pan, cylinder head, and camshaft. Timed engine and installed front gears. Installed front cover, injectors, rockers, valve cover, intake manifold, exhaust manifold, t-stat housing, turbo, aftertreatment system, alternator, A/C Compressor, radiator assembly, coolant pipes, CAC Pipes, intake pipes, A/C line, and air filters. Filled oil and coolant. Pressure checked cooling system with no leaks. Charged A/C system. Started and ran vehicle with no leaks. Performed break in road test. Performed QC with no issues found.

Supp. Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
PTBPR 105FBC	LUBRILATE	EA	1.0	\$11.29	\$11.29
20WW15 1D262	contact cleaner	EA	3.0	\$25.76	\$77.28
Tac Scr15 222-630-1	M6X30 BOLT	C	6.0	\$0.08	\$0.48
Tac Scr15 222-640-1	M6X40 BOLT	C	2.0	\$0.11	\$0.22
Tac Scr15 234-306-1	STEEL FULL NYLOC NUT METRIC M6-1.0 ZINC CLASSC		2.0	\$0.04	\$0.08
Tac Scr15 236-006-2	M6 WASHER	C	8.0	\$0.01	\$0.08
CUM10 2866373CUM	GASKET-CIRCULAR 5"	EA	1.0	\$12.83	\$12.83
CUM10 2866636CUM	GASKET-CIRCULAR 4"	EA	1.0	\$12.83	\$12.83

\*\* See Last Page for Invoice Total \*\*



**DOBBS PETERBILT**

3707 Airport Way S.  
Seattle, Washington 98134  
TF: (800) 255-7383



LEASE CARRIER COMPANY

**\*\* Reprint \*\***  
Invoice: 021R2757  
Date / Hour: 1/28/2023 8:45:04AM  
Repair Order: 2757  
Customer: 413689  
Branch: Seat  
Total Invoice: \$37,436.93  
\*\*\*Open Account - Charge\*\*\*  
Page 3 of 6

**Ship To: Internal Lease/Rental**  
3701 Airport Way S  
Seattle, WA 98108

**Bill To:**  
Hos Brothers Construction  
7733 W Boston Rd  
PO Box 1788  
Woodinville Outside, WA 98072

Shop: 425-236-3961

Customer P/O: 116295p      Open Date: 01/06/2023      Completion Date: 01/26/2023  
Add User: matthew.austin      Salesperson: ataylor

QTY	UNIT	DESCRIPTION	PRICE	TOTAL
2.0	EA	GASKET-DPF ASSY	\$33.08	\$66.16
2.0	EA	CLAMP-V BAND	\$83.46	\$166.92
1.0	EA	KITENGINE BRAKE OVERHAUL	\$426.92	\$426.92
1.0	EA	SHAFT-LEVER ROCKER	\$227.90	\$227.90
1.0	EA	SHAFT-LEVER ROCKER	\$228.67	\$228.67
1.0	EA	TUBE-FORMED	\$129.35	\$129.35
6.0	EA	CONNECTOR-FUEL INJECTOR	\$86.30	\$517.80
2.0	EA	APEX RED (ISX) PAINT	\$22.88	\$45.76
9.0	EA	SCREWHX FLANGE HEAD CAP	\$20.54	\$184.86
2.0	EA	CLAMP-V BAND	\$50.29	\$100.58
1.0	EA	SEAL-OIL	\$61.48	\$61.48
1.0	EA	TUBE-INJECTOR FUEL SUPPLY	\$115.51	\$115.51
1.0	EA	MANIFOLD-EXHAUST	\$421.20	\$421.20
1.0	EA	HARNSS-WIRING	\$214.24	\$214.24
1.0	EA	CLEANSOLVENT (JUG)	\$36.21	\$36.21
1.0	EA	HARNSS-ETR CNT MDL WRG	\$1,219.79	\$1,219.79
1.0	EA	SENSOR-PRESSURE	\$83.89	\$83.89
6.0	EA	SHIM	\$50.86	\$305.16
1.0	EA	FIGTAIL	\$24.63	\$24.63
1.0	EA	KIT,EXHAUST OUTLET	\$225.56	\$225.56
1.0	EA	HEAD, CYLINDER	\$5,744.10	\$5,744.10
1.0	EA	HEAD, CYLINDER-Core	\$635.94	\$635.94
1.0	EA	KIT, CLASSIC OVERHAUL	\$6,857.05	\$6,857.05
2.0	EA	3M SCOTCH-BRITE	\$1.63	\$3.26
50.0	EA	CABLE TIE-11"BLK NYL 50#	\$0.05	\$2.50
50.0	EA	CABLE TIE-14"BLK NYL 120#	\$0.12	\$6.00
3.0	EA	CLAMP-V BAND 4"	\$10.46	\$31.38
1.0	EA	CLAMP-V BAND 5"	\$12.84	\$12.84
-1.0	EA	HEAD, CYLINDER-Core	\$635.94	\$(635.94)
1.0	EA	DPF FLTR (579295)5295609, 3989618C91, 5295609N)EA	\$1,525.65	\$1,525.65
1.0	EA	MISC CLEAN	\$297.62	\$297.62
1.0	EA	DPF/DOC CLEAN	\$297.62	\$297.62
1.0	EA	BELT-POLY 6 RIBS X 1620 E	\$52.75	\$52.75
1.0	EA	BELT-POLY 12 RIBS X 2180	\$100.99	\$100.99
1.0	EA	BELLOW-EXHAUST PETERBILT	\$294.18	\$294.18

Original Invoice: 021R2757021R2757

\*\* See Last Page for Invoice Total \*\*



**DOBBS PETERBILT**

3707 Airport Way S.  
Seattle, Washington 98134  
TF: (800) 255-7383



CRANE CABINET COMPANY

**Ship To:** Internal Lease/Rental

3701 Airport Way S  
Seattle, WA 98108

**Bill To:** Hos Brothers Construction

7733 W Bostian Rd  
PO Box 1788  
Woodinville Outside, WA 98072

Shop: 425-236-3961

Customer P/O: 116295p

Add User: mathew.austin

Salesperson: ataylor

Open Date: 01/06/2023

Completion Date: 01/26/2023

TRPCT	EC9501	COOLANT-TRP ELC 50/50 JUG	JG	13.0	\$11.06	\$143.78
PACPR	K37-1029	FILTER-ELEMENT FUEL 10	EA	1.0	\$50.47	\$50.47
DON10	P625128	AIR FILTER RADIALSEAL	EA	2.0	\$111.02	\$222.04
TRPWS	TWS0013	FLUID-WINDSHIELD WASH -20	EA	1.0	\$3.09	\$3.09
	Loyalty	Paccar Loyalty Coupon		-11.0	\$1.00	\$(11.00)
	Loyalty	30REWARDD2023Q1		-1.0	\$30.00	\$(30.00)
	Loyalty	Y234360		-13.0	\$1.00	\$(13.00)
<b>Task 4 Subtotals</b>						
Parts:					\$20,265.38	
Core Chg:					\$635.94	
Core Ret:					(\$635.94)	
Labor:					\$12,540.00	
Miscellaneous:					(\$54.00)	
Total Tax:					\$3,485.55	
Total Invoice:					\$37,436.93	

Detail Tax Info:

Sales Tax

\$3,485.55

Total:

\$3,485.55

Total Parts:	\$20,265.38
Total Core Charge:	\$635.94
Total Core Ret:	(\$635.94)
Total Labor:	\$12,540.00
Total Miscellaneous:	(\$54.00)
Total Environmental Fee:	\$200.00
Total Shop Supplies:	\$1,000.00
Invoice Subtotal:	\$33,951.38
Total Tax:	\$3,485.55
<b>Total Invoice:</b>	<b>\$37,436.93</b>

Payment Method

Terms

\*\*\*Open Account - Charge\*\*\*

Net 45 Days

Due Date

3/14/2023

Remit To:

Dobbs Peterbilt - Seattle, WA  
P.O. Box 35144 #1022

Seattle, WA 98124-5144

**\*\* Reprint \*\***

Invoice: 021R2757  
Date / Hour: 1/28/2023 8:45:04AM  
Repair Order: 2757  
Customer: 413689  
Branch: Seat  
Total Invoice: \$37,436.93  
\*\*\*Open Account - Charge\*\*\*

Page 4 of 6



**DOBBS PETERBILT**



3707 Airport Way S.  
Seattle, Washington 98134  
TF: (800) 255-7383

**\*\* Reprint \*\***  
Invoice: 021R2757  
Date / Hour: 1/28/2023 8:45:04AM  
Repair Order: 2757  
Customer: 413689  
Branch: Seat  
Total Invoice: \$37,436.93  
\*\*\*Open Account - Charge\*\*\*  
Page 5 of 6

**Ship To:** Internal Lease/Rental  
3701 Airport Way S  
Seattle, WA 98108

**Bill To:** Hos Brothers Construction  
7733 W Bostan Rd  
PO Box 1788  
Woodinville Outside, WA 98072

Shop: 425-236-3961

Customer P/O: 116295p      Open Date: 01/06/2023      Completion Date: 01/26/2023  
Add User: mathew.austin      Salesperson: ataylor

**LIMITED WARRANTY**

THIS LIMITED WARRANTY GIVES YOU SPECIFIC LEGAL RIGHTS AND YOU MAY ALSO HAVE OTHER RIGHTS, WHICH VARY FROM STATE TO STATE. WHO IS COVERED: The Dealership issuing this invoice (the "Dealership") offers this limited warranty to only you, the customer listed on this repair order/invoice. It does not extend to any subsequent owner. It cannot be transferred to any other person.

WHAT IS COVERED: The Dealership warrants the workmanship of our labor performed in conjunction with repairs for 90 days (the "Warranty Period"). Said Warranty Period commences on the date ("Invoice Date") that the repairs are completed. The following items will void this Limited Warranty: if the failure was caused by misuse, abuse, lack of or improper maintenance, accident, alterations, overheating, and/or lack of lubrication or coolant. For any failure caused by the Dealership's workmanship (labor) covered by this Limited Warranty, the Dealership will either repair or replace such failure, at its option, in the Dealership facility.

YOUR RESPONSIBILITIES: All items must be returned to our shop with transportation charges prepaid for our inspection and determination within 60 days from the date of the sales invoice covering said items. The customer is required to return the vehicle to the Dealership or authorized repair facility at the customer's expense. You must retain copies of your Repair Order/Invoices, and, upon request, be able to present them to us when requesting coverage under this Limited Warranty. Upon return of the vehicle to you, you must pay for any parts, labor, products, expenses, freight and taxes that the Dealership is not obligated to provide or pay for under this Limited Warranty.

WHAT IS NOT COVERED: Repairs which are still covered by a manufacturer's warranty or recall or other third party warranty/service contract. The Dealership's Limited Warranty shall be secondary to any such warranty or service contract that provides coverage for repair claims covered hereunder. Damage caused by you for failure to use manufacturer approved fluids, or the lack thereof, including but not limited to oil, antifreeze, and DEF. Any failure or damage resulting from your failure to perform maintenance in accordance with the manufacturer's recommendations; your failure to maintain appropriate fluid levels (e.g. oil, water, DEF, transmission fluid); your continued operation of the vehicle after warning light notification; modification or operation of the vehicle in a manner that is not in conformance with the manufacturer's specifications or intended use; an accident or collision; your use of improper or contaminated fluids including fuel, and/or misuse, abuse, tampering, negligence, theft, vandalism, or acts of nature or God. Parts installed and/or repairs performed on vehicles used primarily for off road competition or engaging in a contest of speed or endurance of any type.

EXCLUSIVE REMEDY: The performance of labor to effect repairs is the exclusive remedy available under this written Limited Warranty. THE PERFORMANCE OF LABOR TO EFFECT REPAIRS IS YOUR SOLE AND EXCLUSIVE REMEDY AND OUR ENTIRE LIABILITY FOR ANY BREACH OF THIS LIMITED WARRANTY. OUR LIABILITY SHALL UNDER NO CIRCUMSTANCES EXCEED THE ACTUAL AMOUNT PAID BY YOU FOR THE LABOR WE SUPPLIED, NOR SHALL WE UNDER ANY CIRCUMSTANCES BE LIABLE FOR ANY CONSEQUENTIAL, INCIDENTAL, SPECIAL OR PUNITIVE DAMAGES OR LOSSES, WHETHER DIRECT OR INDIRECT. SOME STATES DO NOT ALLOW THE EXCLUSION OR LIMITATION OF INCIDENTAL OR CONSEQUENTIAL DAMAGES, SO THE ABOVE LIMITATION OR EXCLUSION MAY NOT APPLY TO YOU.

IMPLIED WARRANTY DISCLAIMER: The only warranty on parts and products sold in conjunction with repairs performed by the manufacturer or supplier of said parts or products. Except for the limited warranty on the workmanship of our labor, the Dealership expressly disclaims all implied warranties including any implied warranties of the merchantability and fitness for a particular purpose for any period beyond the Warranty Period. WE LIMIT THE DURATION AND REMEDIES OF ALL IMPLIED WARRANTIES, INCLUDING WITHOUT LIMITATION THE WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE TO THE DURATION OF WARRANTY PERIOD. SOME STATES DO NOT ALLOW LIMITATIONS ON HOW LONG AN IMPLIED WARRANTY LASTS, SO THE ABOVE LIMITATION MAY NOT APPLY TO YOU. NON ASSUMPTION OF LIABILITY: The Dealership does not authorize any other person to assume for it any liability in connection with the sales of any parts or products of this repair.

THE FOLLOWING APPLIES TO ALL OF OUR CUSTOMERS  
STORAGE CHARGES: I understand and agree that a daily storage charge may be assessed if I fail to pick up the vehicle after being notified that the repairs have been completed. Storage charges will accrue at the rate of \$45.00 per day beginning 15 days after the repair has been completed. Storage fees will also accrue at the same charge if I fail to authorize repairs to be performed within three days after the date of communication from the Dealership.  
DISASSEMBLY/REASSEMBLY CHARGES: If you authorize disassembly of the vehicle or a vehicle component to provide an estimate or commencement of repairs and do not authorize completion of a repair or service, a charge will be imposed for disassembly, reassembly or partially completed work and you agree to pay the same. Such charges will be directly related to the actual amount of labor and parts involved in the inspection, repair or service. I have been



**DOBBS PETERBILT**



3707 Airport Way S.  
Seattle, Washington 98134  
TF: (800) 255-7383

**Ship To:** Internal Lease/Rental

3701 Airport Way S  
Seattle, WA 98108

**Bill To:** Hos Brothers Construction

7733 W-Boston Rd  
PO Box 1788  
Woodinville Outside, WA 98072

Shop: 425-236-3961

Customer P/O: 116295p      Open Date: 01/06/2023      Completion Date: 01/26/2023

Add User: mathew.austin

Salesperson: ataylor

advised that disassembly of the vehicle may prevent restoration of the vehicle to its prior condition.  
DELAYS AND LEGAL LIABILITY: I understand and agree that the Dealership is not responsible for any delays caused by unavailability of parts or shipping by the supplier or transporter or any losses or downtime relating to such delays, nor is it responsible for loss or damage to the vehicle or articles left in the vehicle in the event of fire, theft, or any other cause beyond its control. The Dealership will not be responsible for personal property. You and your representative agree to hold the Dealership harmless and not liable for any missing or damaged property.  
WARNING: Products being sold to you can expose you to chemicals which are known to the State of California to cause cancer, birth defects or other reproductive harm. For more information go to www.P65Warnings.ca.gov.

Customer Signature: \_\_\_\_\_ Date: \_\_\_\_\_

**\*\* Reprint \*\***  
Invoice: 021R2757      Date / Hour: 1/28/2023 8:45:04AM  
Repair Order: 2757      Customer: 413689  
Branch: Seat      Total Invoice: \$37,436.93  
\*\*\*Open Account - Charge\*\*\*  
Page 6 of 6