

midland GLASS

LTD.

520 - 10th Street
Box 1387
Humboldt, SK
S0K 2A0

Tel. 306-682-5288
Email. midlandglass@sasktel.net
www.midlandglass.ca

Invoice #
59783

GST # R103682753
PST # 2345502

SOLD TO	SHIP TO		
DATE ORDERED	ORDER NUMBER	DATE SHIPPED	LABOUR TIME
Jan. 6/26		Jan. 21/26	
QTY	DESCRIPTION	UNIT	TOTAL
1	DW1384		
1	DW1385		
Installed			
2005 International New Windshield			
		SUBTOTAL	470 00
		G.S.T.	23 50
		P.S.T.	28 20
		DEDUCTIBLE	-
		TOTAL	\$ 521 70

TERMS: Net 30 days. 2% interest (24% per annum) will be charged on overdue accounts.

Signature _____

Thank You!

Prairie Diesel Inc

BOX 177 ANNAHEIM SK S0K 0G0
 210 8TH HUMBOLDT SK, S0K 2A0. Humboldt
 Phone: 306-682-2900 Fax: 306-682-2970
 Diesel be the people you want to know!

INVOICE

13214

817904600RT0001

2005 International Safety

INVOICE

Printed Date: 02/03/2026

Work Completed: 02/03/2026

2005 International - 9000 Series - 9200 - Cummins ISX CM870 6 CYL

Lic #:

Odometer In: 1052712

VIN #: 2HSCEAPR5 5C158107

Part Description	I Number	Qty	Sale	Ext	Labor Description	Ext
Safety Decal <i>Decal</i>		1.00	45.00	45.00	1. Safety Inspection Performed Safety	n/c
Prestone Yellow Coolant (Per Jug) ENV96 74097		1.00	17.08	17.08	2. Both glad hands have corrosion expansion behind slipper Both the glad hands was not in good shape. R and R both of them with new ones and used pipe dope.	n/c
ENV96 <i>ENV96</i>		1.00	0.96	0.96	3. Passenger tie rod end has 1/8" play	n/c
WINDSHIELD WASHER FLUID -40 NEMCO 3.78ML Size: 3.78L <i>WWWFZ0003</i>		2.00	6.12	12.24	Cut and removed the cotter pin, then removed the nut from the tie rod. Unscrewed the tie rod end and cleaned the threads. Installed the new tie rod end, matching the original alignment, tightened it to specification, and installed a new cotter pin.	n/c
GLADHAND SERVICE BLUE STEEL 81-0001-B		1.00	7.65	7.65	4. Fan stat wires are mouse chewed Spliced the bad parts of both wires out and hard wired them	n/c
GLADHAND EMERGENCY RED STEEL 81-0001-R		1.00	7.24	7.24	5. Steer axle passenger side brake shoes are cracking apart Removed wheels and drum. Removed old brake shoes. Replaced anker pins and bushings. Installed new brake shoes. Put drum back and wheel lubed all lug nuts and torqued them to spec. Put covers back and adjusted the brakes.	n/c
BRAKE SHOES MERITOR Q PLUS Size: 15" X 4" <i>XSS504702QPK</i>		1.00	104.30	104.30	6. Air leaks Diagnosed and found 4 air leaks. One at air tank, two at junction close to steering rod and one at governor. Fixed all of them.	n/c
MALE PIPE CONNECTOR Air Brake Fit for Nylon Tube Size: 1/4 X 1/8 PIPE DOT 1468-4A		1.00	4.88	4.88	7. Passenger side front drive axle service line hanging down between axles. Needs P clamps because of rubbing Used P clamps to secure all the lines	n/c
BRASS SLEEVE- Air Brake Fitting for Nylon Tube Size: 3/8 TUBE DOT 1460-6		1.00	1.00	1.00	8. 5th wheel needs adjustment Cleaned the adjusting nut and the threads and Adjusted the fifth wheel	n/c
INSERT FOR J844D- Air Brake Fitting for Nylon Tube Size: 3/8 TUBE DOT 1481-6		1.00	1.00	1.00	9. Windshields (direct billed to customer from midland glass) Windshield was replaced	n/c
UNC HEX BOLT GR8 YZ Size: 5/16-18X1-1/4 <i>074.516.114</i>		1.00	1.23	1.23	10. Washer fluid not making it to window can hear pump. Had to fill tank. Check functionality Washer fluid lines were clogged, blew out the dirt. tested. Still Doesn't function properly. R and R nozzles. Tested. Works as it should	n/c
LOCK NUT 335.516		1.00	0.58	0.58	11. Air lines and wiring from cab back secured loosely needs more zip ties Secured all the loose wires and air lines with heavy duty zip ties	n/c
SAE FLT WASHER F436 YZ 5/16 422.516		2.00	0.18	0.36	12. Reverse lights on back of bunk. R and R Drilled out the reverse lights. Removed old rivets, installed new lights and rivet in tight with seal. Hooked up and tested wires.	n/c
SAE FLT WASHER F436 YZ 1/4 422.14		6.00	0.15	0.90	Works as it should	
LOOM 3/8 773.38		6.00	1.63	9.78	13. Grill missing bolt Put new nut, bolts and washer to secure Grill.	n/c
ZINC PLTD CLAMP W/RUBBER INSERT Size: 1" 3/8"H D16-16 545.1		3.00	2.75	8.25		
bolt <i>074.14.1</i>		1.00	1.10	1.10		

Visit us on the web: www.prairiediesel.ca

Service Advisor: Boucher, Jennae, Tech:

Page 1 of 3

Copyright (c) 2006 Mitchell Repair Information Company, LLC invhrs 5.12.21kr

Prairie Diesel Inc

BOX 177 ANNAHEIM SK S0K 0G0
 210 8TH HUMBOLDT SK, S0K 2A0. Humboldt
 Phone: 306-682-2900 Fax: 306-682-2970
 Diesel be the people you want to know!

INVOICE

13214

817904600RT0001

INVOICE

Printed Date: 02/03/2026

Work Completed: 02/03/2026

2005 International - 9000 Series - 9200 - Cummins ISX CM870 6 CYL

Lic #:

Odometer In : 1052712

VIN #: 2HSCEAPR5 5C158107

Part Description	I Number	Qty	Sale	Ext	Labor Description	Ext
UNC NYLON LOCKNUT GR8 YZN		1.00	1.83	1.83	14. Coolant below add Mark Topped up coolant	n/c
Size: 1/4-20 373.014						
WIRE TIE PLST PREMIUM BLACK		16.00	1.33	21.28	15 Drive axle Fender missing bolts Added nuts and bolts	n/c
Size: 0.30"X14.3" 553.59001P						
BACK UP LIGHT 1693499c91		2.00	69.21	138.42	16. Noticed engine light on after it was brought into shop For final repairs found check engine light on. Scanned Found OEM Code 343 wont clear. Power supply lost with ignition on. Fired truck up, tested alternator output. alternator has adequate output. batteries are weak. Once truck was running for 5 min. Check engine light went out.	n/c
WINDSHEILD NOZZLE 2588068C1		2.00	34.23	68.46		
COTTER PIN ZN 1/8x1-1/2 471.18.112		1.00	0.23	0.23	Work Performed	2,465.00
RIV FLANGE AL/AL (0.251-0.375)		6.00	0.35	2.10		
Size: 3/16X0.575 940.316.38						
3/8-16 UNC NYLON LOCKNUT GR8 YZN 373.038		1.00	1.85	1.85		
Flat washer 422.38		1.00	0.20	0.20		
TIE ROD END R.H. R230069		1.00	79.70	79.70		
PARTS CLEANER 890.108716		3.00	12.92	38.76		
SHOP SUPPLIES				123.25		
HAZ MAT				15.00		
					Taxes	
					pst	190.72
					gst	158.93

Prairie Diesel Inc
 BOX 177 ANNAHEIM SK S0K 0G0
 210 8TH HUMBOLDT SK, S0K 2A0. Humboldt
 Phone: 306-682-2900 Fax: 306-682-2970
 Diesel be the people you want to know!

INVOICE

13214

817904600RT0001

Printed Date: 02/03/2026

Work Completed: 02/03/2026

2005 International - 9000 Series - 9200 - Cummins ISX CM870 6 CYL
 Lic #: Odometer In : 1052712

VIN #: 2HSCEAPR5 5C158107

Ext



Part Description I Number Qty Sale Ext Labor Description

Org. Estimate 0.00 Revisions 0.00 Current Estimate 0.00

Labor:	2,465.00
Parts:	699.63
HazMat:	15.00
SubTotal:	3,179.63
Tax:	349.65
Total:	3,529.28
Bal Due:	\$3,529.28

[Payments -]

Monday to Friday 8am to 5pm

Customer Number : 180

Vehicle Received: 12/23/2025

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the vehicle described for testing and/or inspection. Express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. All Parts removed will be discarded unless instructed otherwise: Save all Parts _____. NOT RESPONSIBLE FOR LOSS OR DAMAGE TO CARS OR ARTICLES LEFT IN CARS IN CASE OF FIRE, THEFT OR ANY OTHER CAUSE. Parts warranty is 6 months on all parts installed and 90 days labour warranty. Parts warranty is 6 months on over the counter parts. If wheels have been removed please return to the shop for re-torquing after 100kms

Returned goods must be accompanied by original invoice. Special order goods subject to 20% restocking charge. Good returned after 30 days subject to 20% restocking charge. Electrical parts are non-returnable. Open kits are not returnable. Cores returned after 90 days will not be accepted for credit.

Payment can be mailed to Prairie Diesel Inc Box 177 Annaheim, SK S0K0G0

Signature _____ Date _____

Visit us on the web: www.prairiediesel.ca

Email Address: admin@prairiediesel.ca

Service Advisor: Boucher, Jennae Tech:

Page 3 of 3

Copyright (c) 2026 Mitchell Repair Information Company, LLC invhrs 5.12.21r