



Vehicle History Summary

Fleet #	
Registration	
Make	Kenworth
Model	K200
VIN / Chassis #	6F5000000HA459334
Build Date	2017

Date	Reading / Units	Type / Repairer Notes	Repairer
13/08/2026		Window Inop R-4143 remove and replaced faulty window module in driverside door	
07/07/2026	828,454 kms	clearance lights, Coolant System, Coolant Top Up, Power Steering, Radiator, wiring R-4232 attended breakdown removed + replaced hose + topped up with coolant ran engine to operating temp - let thermostat open re-filled coolant inspected shorted clearance lights on P/S truck ran new wiring from front bar + installed inline fuse + removed + replaced power steer pump bled system	Internal Workshop
02/07/2026	826,665 kms	Power Steering R-4227 inspect/ bleed power steer circuit	Internal Workshop
29/06/2026	825,033 kms	Washers & Wipers R-4223 Removed + replaced wiper blades Ordered windshield squirt assemblies + hoses	Internal Workshop
25/06/2026	823,978 kms	shock absorber, tyres R-4221 removed + replaced 8x new drive tyres removed + replaced all lower shock rubbers replaced on 1st, 2nd drive D/S & P/S	Internal Workshop
20/06/2026	821,969 kms	clearance lights, CLUTCH R-4218 removed + replaced dim clearance light D/S Adjusted clutch + clutch freeplay tightened guard bracket removed + replaced X/Y pin + actuator arm	Internal Workshop
17/06/2026		Fault R-3969 Replace maxi alarm	Internal Workshop
06/05/2026	806,198 kms	trailer plug R-4188 Replaced faulty trailer plug	Internal Workshop
05/05/2026	805,998 kms	batteries R-4181 Jumpstart and load test batteries and reset fuse	Internal Workshop
25/03/2026	791,024 kms	Steering R-3601 Replaced two mud flaps on trailer in front of third axle and fitted two anti-sail brackets Adjusted steering wheel Checked for fire extinguisher, safety triangles, first aid kit, and wheel chocks Fitted 2 wheel chocks Tightened fire extinguisher bracket on chassis	Internal Workshop
16/03/2026	788,367 kms	bar, Brakes, Bushes, Cab, gearstick, reflectors, RIM, seat, slack adjusters, Tail shaft, tyres, WHEEL BEARING, wiring R-3705 driver's seat replaced cab steps replaced 2x trailer tyres 2nd axle brakes & discs replaced control arm bushes replaced wheel bearing replaced L/H 3rd axle correct rim fitted tidied wiring in trailer reflectors fitted slack adjustors faulty drive brakes replaced gearstick boot replaced air leak @ front of trailer repaired tail shaft replaced sway bar bolts tightened	Internal Workshop
12/02/2026		windscreen R-3224	

Date	Reading / Units	Type / Repairer Notes	Repairer
12/02/2026		windscreen washers R-3225	
11/02/2026		Tarp R-3219	
11/02/2026		welding R-3218	
10/02/2026		Tarp R-3212	
04/02/2026		book R-3152	Internal Workshop
04/02/2026		window R-3151	
08/01/2026	774,053 kms	Chassis R-3112 Replaced 2x Ad blue tank straps Got ad blue tank straps from Gilbert and roach	
26/09/2025	749,892 kms	Brakes, diff, hub seal R-3005 Remove + replace hub bearings LH + RH Replaced sheared RH axle with new Refill diff oils with new (C service) Remove + replace RH brake shoes with new Refit + tension tyres Adjust brakes	
26/09/2025	749,892 kms	C - 100k S-1581	
23/01/2025	734,364 kms	TYRE R-1676 put 4 new drive tyres on 2nd axle drive axle put 3 new drive tyres on 1st drive axle	Internal Workshop
23/01/2025	734,364 kms	TYRE R-1639 Put 4 new Drive Tyres on 2nd drive axle Put 3 new Drive Tyres on 1st drive axle	Internal Workshop
20/01/2025	732,398 kms	service R-1595	
14/01/2025	729,921 kms	dash R-1542	
08/01/2025	128,000 kms	mudflap R-1475	
07/01/2025	727,718 kms	Air System R-1441	
18/12/2024	725,484 kms	C - 100k S-1288 C service completed yearly inspection completed	Internal Workshop
02/12/2024	719,679 kms	Air Conditioner R-1061 had unique auto electrical check A/C and engine brakes/cruise INOP from steering wheel, found clock spring broken under steering wheel, replaced test okay also found faulty replay for A/C replaced test okay.	Internal Workshop
08/11/2024	745,000 kms	B - 50k S-1053	Internal Workshop
08/11/2024	720,000 kms	A - 10k S-1052	Internal Workshop
04/11/2024		OIL LEAKS R-1017 -checked vehicle for oil leaks -found and replaced faulty PTO Pump -fitted new hose -topped with oil -Replaced worn engine mounts	Internal Workshop
04/11/2024	710,505 kms	A - 10k S-1198	Internal Workshop
30/10/2024		ELECTRICAL R-1060 found faulty relay ,replaced test ok	
30/10/2024		OIL LEAKS R-1059 replaced pto and pump	
12/10/2024	703,613 kms	Mudflaps, Tarp R-866 8M Tarp cable 2x 24x24 Mudflaps	Internal Workshop

Date	Reading / Units	Type / Repairer Notes	Repairer
12/10/2024	703,613 kms	B - 50k S-788 B Service Carried out B Service Changed Oil Filter Oil Coolant All Ok	Internal Workshop
27/09/2024	688,169 kms	LEAK R-651	Internal Workshop
13/08/2024	682,946 kms	A - 10k S-587 A Service Carried out A Service Checked all Levels. All ok 2 steering Tyres	Internal Workshop
02/07/2024	673,717 kms	A - 10k S-619 A Service Carried out A Service Checked all Levels. All ok	Internal Workshop

Signed: _____

Name: _____

Date: _____