



Vehicle History Summary

Fleet #	
Registration	
Make	KENWORTH
Model	K200
VIN / Chassis #	6F5000000PA483814
Build Date	2023

Date	Reading / Units	Type / Repairer Notes	Repairer
12/05/2026	485,783 kms	A - 10k S-2082 Completed A Service Checked all fluid levels and topped up Check tires and Brakes and adjusted as needed Check all electrics working All Ok	Internal Workshop
08/04/2026	481,682 kms	trailer plug, windscreen wipers R-3695 replaced wiper blades replaced 7 pin trailer plug	Internal Workshop
23/03/2026	477,847 kms	clutch brake R-3611 install clutch Freeplay adjuster arm, carry out clutch adjustment as per OEM, install circlip on to turbo waste gate pin, install walkplate	Blue Collar Diesel
19/03/2026	477,847 kms	CLUTCH R-3608 moved vehicle into workshop and jacked chassis and placed onto stands, removed air intake, gearbox support, rear crossmember, wiring loom, hydraulic pump, tail shaft, air tanks, gear levers. Attached lifting point and removed gearbox from vehicle, removed failed clutch and worn flywheel assembly for machining. Clean gearbox and replaced input shaft and bearing kit, replaced fork and bush assembly. Installed flywheel into vehicle and tensioned to Oem spec, fit new clutch and tensioned, installed gearbox back into vehicle and reassembled all components. Adjusted clutch to Eaton specification.	Moore Diesel Services
06/03/2026	478,013 kms	B - 50k S-2072 Carried out B Service	Internal Workshop
06/03/2026		windscreen wipers R-3455 Mechanic notified and will be repairing them today	Internal Workshop
06/03/2026		Brake Air Feed R-3456 Spoken to mechanic and getting sorted ASAP as I was unaware of problem	Internal Workshop
06/03/2026		Brake Air Feed R-3457 Spoken to mechanic and problem is going to get sorted ASAP as I was unaware of problem	Internal Workshop
05/03/2026	477,799 kms	couplings R-3485 Work Completed: Travelled to the Hallet site to investigate brake issues. Found that the self-sealing couplings had failed. Collected necessary parts and returned to the site, where I switched to manually swapped taps and couplings. Replaced the airline on the emergency brake side of the dolly A-frame due to a rupture. Conducted a thorough check for any additional air leaks	Moore Diesel Services
26/02/2026	476,671 kms	bearings, diff leak, Engine mounts R-3481	Moore Diesel Services

Date	Reading / Units	Type / Repairer Notes	Repairer
		Replace engine mounts - Loosen front engine mount bolts and Removed engine fan. Lifted engine and removed worn engine mount bushes, pressed out steel inserts and installed new mountings. Lowered engine and torque engine mount boots. Installed engine fan and tightened to OEM spec. Reseal rear diff - Removed axle shafts from rear axle and loosened housing fasteners, removed jack shaft and pulled diff out of housing. Cleaned up sealing surfaces and installed high temp gasket maker and reinstalled diff into housing and tightened all mounting points. Installed jack shaft and cleaned up sealing surfaces on axle shafts, install and tensioned. Filled diff with oil to correct level and fitted fill plug. Replace gearbox bearings - Removed tail shaft from vehicle and loosened yoke, removed seal housing from rear of gearbox and pulled out output shaft bearing, clean and inspected components for serviceability. Installed new inner bearing, bearing housing with spacer and outer bearing. Replaced output shaft seal and installed Yoke and tensioned to Eaton specs. Refit tail shaft and filled gearbox with oil, completed road test and check for any oil leaks.	
21/02/2026	476,641 kms	adblue R-3616	Blue Collar Diesel
		Diagnosed and repaired ad blue leak coming from exhaust elbow, replaced worn filters x 2,remove injector, clean, check for damage, found to be okay, removed exhaust piece found broken gasket, remove and install new gasket re install clamps, retest for leak. carry out Horton fan rebuild as per procedure test prior to reinstalling clean oil filler to engine block to correctly diagnose found block end leaking removed cleaned block and spout retestion hose clamps on joining piece, install new seal/sealant tension mounting bolts to spec replace Ryco fittings carry out air drier rebuild as per procedure replace battery's load tested battery's and found to be low/weak carry out 5th wheel adjustment as per jost procedure note.	
05/12/2025	468,878 kms	A - 10k S-1721	Internal Workshop
		Completed A service Fitted 8 drive and 2 steer tyres Got windscreens replaced Fitted new wiper blades Ordered hydraulic tank Ordered tarp poles	
01/12/2025	468,878 kms	windscreen R-3047	Internal Workshop
		Both left and right windscreens replaced	
01/12/2025	468,878 kms	Washers & Wipers R-3048	Internal Workshop
		Fitted new wiper blades	
01/12/2025	468,878 kms	windscreen washers R-3046	Internal Workshop
		Got new windscreen	
22/11/2025	460,138 kms	A - 10k S-2080	Internal Workshop
		Completed A Service Checked all fluid levels and topped up Check tires and Brakes and adjusted as needed Check all electrics working All Ok	
11/11/2025	454,372 kms	GREASE, height valve R-3548	Internal Workshop
		replaced height control valve, greased up b trailer tailgate hinge	
28/10/2025	450,850 kms	A - 10k S-2079	Internal Workshop
		Completed A Service Checked all fluid levels and topped up Check tires and Brakes and adjusted as needed Check all electrics working All Ok	
28/10/2025	450,850 kms	Brakes R-3546	Internal Workshop
		pulled apart brakes replaced drum adjusted brakes	
24/10/2025	450,385 kms	Air System R-3501	Internal Workshop
		Removed and replaced faulty air fitting, tested components for serviceability - all in working condition.	
17/10/2025	447,257 kms	flushing, Hydraulics, Intercooler R-3527	Internal Workshop
		fitted new hydraulic coupling, repaired hinge on tool box, repaired leaking steer hub cap, flushed and replaced intercooler	
10/10/2025	443,576 kms	A - 10k S-2078	Internal Workshop
		Completed A Service Checked all fluid levels and topped up Check tires and Brakes and adjusted as needed Check all electrics working All Ok	
10/10/2025	443,576 kms	air filter, hydraulic oil R-3535	Internal Workshop
		replaced air filter, topped up hydraulic oil	
02/09/2025	429,013 kms 1 hrs	B - 50k S-1576	

Date	Reading / Units	Type / Repairer Notes	Repairer
		Completed B service on truck and trailers Fitted new air filter Fitted new brake shoes and drums on 2nd axle A trailer (from truck line marulan PO 6133) Tightened hydraulic coupler on back of A trailer Fitted new brake shoes and drums on 1st axle LH side & 2nd axle trailer (from truck line marulan PO 6130) Fitted new brake shoes and drums on 2nd & 3rd axle LH side (from truck line marulan PO 6128)	
13/08/2025		windscreen wipers R-2967	
13/08/2025		general checkover R-2968	
13/08/2025		general checkover R-2966	
11/08/2025		tyres R-2948	
11/08/2025	418,146 kms	A - 10k S-2077 Completed A Service Checked all fluid levels and topped up Check tires and Brakes and adjusted as needed Check all electrics working All Ok	Internal Workshop
05/08/2025		windscreen R-2916 Booked in for replacement	
05/08/2025		General R-2917 cleaned down and checked - will monitor	
28/07/2025	411,214 kms	A - 10k S-2076 Completed A Service Checked all fluid levels and topped up Check tires and Brakes and adjusted as needed Check all electrics working All Ok	Internal Workshop
16/07/2025	405,474 kms	A - 10k S-2075 Completed A Service Checked all fluid levels and topped up Check tires and Brakes and adjusted as needed Check all electrics working All Ok	Internal Workshop
04/07/2025	396,398 kms	air filter, HEADLIGHTS R-3530 replaced air filter, fixed broken wires for spotlights	Internal Workshop
04/07/2025	396,398 kms	A - 10k S-2074 Completed A Service Checked all fluid levels and topped up Check tires and Brakes and adjusted as needed Check all electrics working All Ok	Internal Workshop
30/06/2025	393,443 kms	Ring Feeder R-3505 Removed and replaced faulty ring feder with new parts, removed and replaced tow eye bush. Checked all components for serviceability - all in working condition.	Internal Workshop
20/06/2025	390,590 kms	Instrument Cluster R-3506 Removed and replaced gauge, checked for serviceability - all in working condition.	Internal Workshop
13/06/2025	387,272 kms	B - 50k S-2073 Completed B Service Checked and replaced Oil and Filter Checked and replaced Air Filter Checked All Brakes and Drums - Adjusted as needed Checked all belts, hoses and clamps Checked Bearings and King Pins	Internal Workshop
13/06/2025	387,272 kms	adblue, air dryer, Filter/Oil Change R-3567 replaced adblue filter, new air dryer filter, new oil separator filter	Internal Workshop
12/06/2025	387,248 kms	indicators R-3554 bypassed circuit with suzie coil rewired plug at both ends	Internal Workshop
12/06/2025	387,248 kms	ELECTRICAL R-3025 Bypassed existing blinker circuit with new Suzi coil, rewired plug at both ends to accommodate existing plug. Tested for correct operation - all in working condition.	Internal Workshop

Signed: _____

Name: _____

Date: _____