 


Wilson Ag Repair Ltd.

NW22-10-2-W3rd
 PO Box 307
 Gravelbourg, SK
 S0H 1X0

Date	Invoice #
7/15/2024	12027

Invoice To



Make/Model	Serial Number	Hourmeter	Terms
9670	H09670S726600	3167/2306	Due on receipt

Description	Amount
1-Inspect combine for repairs. After repairs grease, run combine and make final adjustments. Install shields.	1,900.00
2-Install a John Deere AutoSteer. (Hydrostatic Integrated). Also had Deere come out and program the controller after installation. Ran and tested and calibrated.	1,200.00
H134624 ISOLATOR	21.60
1/4 Washer	0.90
19M7775 M6X16 FLANGE	10.56
5-Replace the hydro cable.	420.00
AH208684 - BALL JOINT	59.76
6-Install a steering column foot rest.	90.00
LANJDFR120 - JD COMBINE FOOTREST	204.30
7-Replace the grain tank window seal.	60.00
AH80335 Weatherstrip	141.53
8-Replace 7 damaged feed accelerator fins. When fins were off we found the 3 wheels were damaged and also had to be replaced. Disassembled the shaft and replaced the wheels as required.	720.00
AXE60582 BEARING	459.32
19M7786 M10 X 30 FLANGE BOLT	2.35
19M7788 M12 X 25 FLANGE BOLT	2.79
9-Install an extended stone trap kit.	1,200.00
19M7787 M12 X 20 FLANGE BOLT	5.28
14M7299 M12 FLANGE NUT	5.48
H160905 BOLT	18.96

Phone #	E-mail	GST/HST No.
306-354-2285	wilsonagrepair@hotmail.com	856640008

Subtotal
Sales Tax Total
Total
Balance Due

Paid July 18/24

100%
 # 51,125.82

Wilson Ag Repair Ltd.

NW22-10-2-W3rd
 PO Box 307
 Gravelbourg, SK
 S0H 1X0

Date	Invoice #
7/15/2024	12027

Invoice To



Make/Model	Serial Number	Hourmeter	Terms
9670	H09670S726600	3167/2306	Due on receipt

Description	Amount
Cotter Pin 3/16 x 1-1/2	0.54
10-Replace the front feeder house belt tensioner rod. Replace the front tensioner pulley.	90.00
11-Replace the damaged feeder house drum. Update to a Posi Feed drum.	360.00
A-AH220242-PF POSI-FEED FEED ROLL DRUM	1,456.61
14M7291 16MFLANGE NUT	5.07
Cotter Pin 3/16 x 2	1.54
Cotter Pin 1/8 x 7/8	0.30
A15146 Hair Pin	1.19
12-Replace one damaged feeder chain slat. Replace worn cotter pins as required. Needs a set in the middle of chain no where close to connector links.	120.00
A-HXE24328 Feederchain Slat	74.85
H84026 PIN	16.50
13-Replace the right hand front feeder house shaft bearing.	210.00
JD9202 BEARING	100.29
14-Replace all the roller chains.	180.00
AH206701 Feederhouse Roller Chain	284.97
AXE53952 Unloading Auger roller Chain	458.72
50-70 STS Series Tailings Upper Drive Roller Chain	82.99
15-Replace the cracked out front shoe auger bearing support. Has been welded and cracked out again.	1,290.00
AH129451 BEARING	69.63
AH129452 ECCENTRIC LOCKING COLLAR	22.48
JD8665 BEARING	131.55

Phone #	E-mail	GST/HST No.
306-354-2285	wilsonagrepair@hotmail.com	856640008


Subtotal
Sales Tax Total
Total
Balance Due

Wilson Ag Repair Ltd.

NW22-10-2-W3rd
 PO Box 307
 Gravelbourg, SK
 S0H 1X0

Date	Invoice #
7/15/2024	12027

 Invoice To



Make/Model	Serial Number	Hourmeter	Terms
9670	H09670S726600	3167/2306	Due on receipt

Description	Amount
AXE13435 LOCKING COLLAR	64.14
14M7298 M8 FL NUT	3.58
19M7866 M8X20 FLANGE	3.50
16-Replace the worn and damaged plastic feeder chain wearstrips.	120.00
A-H171960 WEAR STRIP	123.00
17-Replace the middle worn feeder chain top sprockets.	960.00
A-H159616 Sprocket, Feeder House Center, Upper	117.02
JD10020 BEARING	123.77
JD9373 BEARING	112.79
18-Replace all 3 rotor hoods.	2,400.00
H154379 GREEN SILICONE	105.80
H81330 ISOLATOR	121.20
H174755 BOLT	18.90
19-Replace all 4 rear shoe auger bearings.	240.00
AH163056 BEARING	364.40
JD8554 COLLAR	48.40
20-Replace the worn front rotor throat carriage bolts as required.	90.00
H174755 BOLT	12.60
21-Replace all the damaged threshing elements.	360.00
A-AH216674 - THRESHING ELEMENTS	898.02
H160905 BOLT	18.96
A-AH216675 - THRESHING ELEMENT	705.97
A-AH216678 THRESHING ELEMENT	1,447.17


Phone #	E-mail	GST/HST No.	Subtotal
306-354-2285	wilsonagrepair@hotmail.com	856640008	Sales Tax Total
			Total
			Balance Due

Wilson Ag Repair Ltd.

NW22-10-2-W3rd
 PO Box 307
 Gravelbourg, SK
 S0H 1X0

Date	Invoice #
7/15/2024	12027

 Invoice To



Make/Model	Serial Number	Hourmeter	Terms
9670	H09670S726600	3167/2306	Due on receipt

Description	Amount
22-Repair concaves. Replace the worn Z bar and front concave nose plate. Replace all the boronized inserts, flip all the max thrash inserts. Replace bent #6 frame. Replace one round bar insert., Install, level and calibrate. We installed a complete new boronized front concave and used that frame for the #6 concave position.	480.00
A-AH215091 - Plate, Concave Support	569.14
SBJ0700 - STS Front Lip	236.25
SBJ0742B - STS C.A. CONCAVE HELICAL (7 ANGLE INSERT max thr) BORON	1,155.00
SBJ0740D STS RND BAR INSERT SGLE BL	89.25
3/8 X 1-1/4 FLANGED SERRATED BOLT	40.56
3/8 FLANGED SERRATED NUT	13.00
23-Replace a damaged tine. Come in sets of 3.	240.00
A-AH209123 - Tines; Chrome Kit, (Set of 3)	282.80
25-Repair burnt out left rear marker light.	30.00
1156 BULB	3.63
26-Replace the failed rotor grain loss sensor. Retest left shoe sensor. It was good.	90.00
27-Replace the worn shoe and chaffer frame shaker arms. When the chaffer frame was removed we inspected and found cracks that were repairable. Welded as required.	2,040.00
19M7820 M12 X 100 FLANGE BOLT	17.86
28-Replace the rear grain tank cross auger bearings.	360.00
JD39104 BEARING	124.34
29-Wash out grain tank.	210.00
30-Recondition the failed unloading auger lower gearbox. Replace the worn vertical auger. Inspect the 90° horizontal gearcase. The horizontal gear case was good.	840.00

Phone #	E-mail	GST/HST No.	Subtotal
306-354-2285	wilsonagrepair@hotmail.com	856640008	Sales Tax Total
			Total
			Balance Due

Wilson Ag Repair Ltd.

NW22-10-2-W3rd
 PO Box 307
 Gravelbourg, SK
 S0H 1X0

Date	Invoice #
7/15/2024	12027

Invoice To



Make/Model	Serial Number	Hourmeter	Terms
9670	H09670S726600	3167/2306	Due on receipt

Description	Amount
A-AXE12921 - Auger, HUR Vertical Unloading	1,783.96
H215085 Shaft, Auger, Lower, Vertical Gear Case	281.29
H64376 KEYSTOCK	43.30
AH90963 SEAL	118.80
JD8524 BEARING	83.08
AH96585 BEARING	98.82
31-Adjust the rotor belt sheave gap.	90.00
32-Replace the worn inner and outer tie rods.	480.00
Cotter Pin 5/32 x 2-1/2	0.48
33-Replace the missing pin for the left rear gullwing.	0.00
M164120 Spring Pin	2.56
34-Replace one set of hydro hose clamps. Below gearcase.	30.00
35-Replace the worn out chopper floor.	480.00
A-AH218187 STRAW CHOPPER FLOOR	989.96
36-Replace chopper hammers. Convert to Redekop. Replace the stationary knives.	330.00
390-205 Kit Blade Conversion STS 70S Fine Cut (44 Ser Carb) 390-200 discontinued	1,770.00
Freight	49.00
H215004 - STRAW CHOPPER BLADES	627.12
37-Flip the discharge beater teeth.	360.00
38-Replace the missing pin in 2 speed lever.	30.00
24H1290 WASHER	1.36
Cotter Pin 1/8 x 3/4	0.20
40-Replace the engine side rotary screen belt and tensioner pulley.	90.00

Phone #	E-mail	GST/HST No.	Subtotal
306-354-2285	wilsonagrepair@hotmail.com	856640008	Sales Tax Total
			Total
			Balance Due

Wilson Ag Repair Ltd.

NW22-10-2-W3rd
 PO Box 307
 Gravelbourg, SK
 S0H 1X0

Date	Invoice #
7/15/2024	12027

Invoice To



Make/Model	Serial Number	Hourmeter	Terms
9670	H09670S726600	3167/2306	Due on receipt

Description	Amount
41-Replace the shoe belt front idler pulley,	60.00
42-Replace the feed accelerator outside tensioner pulley,	60.00
43-Replace the lower clean grain cross auger and sprocket. Key almost sheared off.	360.00
A-AH162154 - Auger, Lower, Clean Grain	989.03
H150269 KEYSTOCK	27.31
A-H133143 Sprocket, Clean Grain Elevator, Lower	75.21
JD10384 BEARING	70.11
JD39102 BALL BEARING	46.20
H84026 PIN	2.20
H141123 M10 PUSH NUT	6.75
44-Repair oil leak on engine. Diagnose oil pan leaking at rear. Timing cover leaking. Reconditioned with all new gaskets. Also replaced the waterpump and thermostats. Had the oil pan machined.	3,480.00
Have oil pan machined for flatness where gasket seals to block.	489.80
R532464 GASKET	120.27
19M8306 M12 X 50 FLANGE BOLT	87.30
19M7805 M10 X 45 FLANGE BOLT	29.68
R504810 O RING	12.72
R502011 GASKET	17.85
DZ116420 GASKET	97.88
RE543639 SEAL	64.46
Antifreeze	222.18
SAE 15W-40 CK-4 Advanced Formula	186.76


Phone #	E-mail	GST/HST No.	Subtotal
306-354-2285	wilsonagrepair@hotmail.com	856640008	Sales Tax Total
			Total
			Balance Due

Wilson Ag Repair Ltd.

NW22-10-2-W3rd
 PO Box 307
 Gravelbourg, SK
 S0H 1X0

Date	Invoice #
7/15/2024	12027

Invoice To

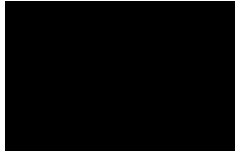

Make/Model	Serial Number	Hourmeter	Terms
9670	H09670S726600	3167/2306	Due on receipt

Description	Amount
Hydraulic Oil Synthetic Blend	22.10
AT13740 DRAIN VALVE	6.85
45-Clean the radiator and coolers.	90.00
46-Install an exhaust elbow.	60.00
EE500SS 5" Stainless Steel Exhaust Extension	190.02
48-Replace the turbo actuator coolant supply line. Rubbed.	120.00
T77613 O RING	7.76
49-Replace the failing alternator and oil soaked belt.	120.00
A-AXE17691 Alternator	657.34
50-Replace the worn grain tank loading auger and bearing. Straighten the tube.	240.00
A-AH218485 - Auger, Loading, Tank	988.54
JD10384 BEARING	70.11
03M7194 M10 x 40	10.36
51-Replace the worn mass flow sensor pad.	60.00
52-Repair moisture sensor. Motor growling and lower cell worn. Also had to extract broken bolts.	480.00
HXE16669 STRAP	22.20
53-Replace nut on bolt by unloading auger covers. At turret.	30.00
14M7298 M8 FL NUT	1.79
54-Install the sieve element. Replace the failed chaffer element. Also remove side agitator flaps. Calibrate.	240.00
19M7866 M8X20 FLANGE	7.00
A58549 WASHER	6.06

Phone #	E-mail	GST/HST No.	Subtotal
306-354-2285	wilsonagrepair@hotmail.com	856640008	Sales Tax Total
			Total
			Balance Due

Wilson Ag Repair Ltd.

NW22-10-2-W3rd
 PO Box 307
 Gravelbourg, SK
 S0H 1X0

Date	Invoice #
7/15/2024	12027

Invoice To



Make/Model	Serial Number	Hourmeter	Terms
9670	H09670S726600	3167/2306	Due on receipt

Description	Amount
55-Recondition the loose loading auger gearcase.	720.00
CE21674 Shaft, Input, Clean Grain Elevator Gearcase	318.42
AH21815 SEAL	20.63
H170967 Shaft, Clean Grain Elevator Gearcase	262.18
75W140 Synthetic Oil	97.80
56-Weld the cracked support under the engine/main gearcase support.	180.00
57-Replace the discharge beater belt. Discharge drive was vibrating. This repaired it. Also replaced the bushing on the countershaft drive tensioner.	90.00
H170141 PIVOT	36.60
14M7275 NUT	2.16
58-Adjust the cab door latch.	30.00
59-Install a new connector at the A/C compressor power supply. Also top up the A/C. After topping up John mentioned it has a leak. Checked with soapy water and could not isolate a leak. Added A/C dye and ran the combine and rechecked. and still could not isolate. Will have to run the combine and see how system holds.	330.00
Nitrogen	8.50
A-B714008 Universal Stay Bright A/C Dye, 8 OZ Bottle,	54.84
R-134a Freon	280.00
Shop Supplies	1,496.10
Freight	100.00
Freight	15.00
Freight	25.33
Freight	25.33

Phone #	E-mail	GST/HST No.	Subtotal
306-354-2285	wilsonagrepair@hotmail.com	856640008	Sales Tax Total
			Total
			Balance Due

Wilson Ag Repair Ltd.

NW22-10-2-W3rd
 PO Box 307
 Gravelbourg, SK
 S0H 1X0

Date	Invoice #
7/15/2024	12027

Invoice To



Make/Model	Serial Number	Hourmeter	Terms
9670	H09670S726600	3167/2306	Due on receipt

Description	Amount
Freight	25.33
Freight	25.33
Freight	25.33
GST on sales	2,430.29
PST (SK) on sales	89.77

Phone #	E-mail	GST/HST No.
306-354-2285	wilsonagrepair@hotmail.com	856640008

Subtotal	\$48,605.76
Sales Tax Total	\$2,520.06
Total	\$51,125.82
Balance Due	\$51,125.82