

# Highway 99 Diesel and Auto Repair

18344 B OLD Hwy 99  
 Rochester, WA. 98579  
 Phone: 360-858-4952

## INVOICE

191

Org. Est. # 000710

## INVOICE

Printed Date: 09/21/2023

**Gulley logging**

2007 Ford - F550 Super Duty - 6L, V8 (363CI) VIN(P)

Lic # : C42269Z

Odometer In : 242703

VIN # : 1FDAF56P3 7EB26348

Part Description	Qty	Sale	Ext	Labor Description	Ext
Fuel Tank	1.00	930.00	930.00	FUEL TANK - Remove & Replace - Rear,Mount -	675.00
Hose - Overflow	1.00	107.59	107.59	[Includes: Drain and fill.]	
Air Filter	1.00	98.80	98.80	Truck had a full tank of fuel that was contaminated with rust.	
Antifreeze/Coolant	1.00	19.54	19.54	Technician Removed and Replaced Fuel Tank	
Oil/Fuel Filter Cap	1.00	32.23	32.23	Perform Inspection. Vehicle arrived as a NO START.	120.00
Oil Filter	1.00	31.01	31.01	Technician checked Fuel Pressure, noticed low pressure, inspected	
Ficm harness plug	1.00	55.00	55.00	Fuel Filters and Fuel Tank. Technician noticed Fuel Filters both dirty	
Used Ficm	1.00	185.00	185.00	and Fuel Tank filled with rust. Removed and Replaced Rear Fuel	
Stand Pipe	2.00	154.80	309.60	Tank. Technician went on a test drive and truck died.	
Fuel Filter	1.00	92.85	92.85	Vehicle died on test drive after replacing fuel tank.	120.00
Fuel Pump	1.00	360.60	360.60	Technician found the FICM was not getting signal.	
Job Supplies			12.95	Performed inspection of FICM and found the wires were burnt on	
				the engine harness plug. Technician Removed and Replaced both	
				the FICM Plug and FICM, then performed and test drive. Vehicle	
				would not start up when warm.	
				Vehicle would not start when warm after replacing	120.00
				FICM and fuel tank. Perform Inspection.	
				Technician Performed Inspection. Found vehicle was did not build	
				proper oil pressure when hot (Stand Pipes bad).	
				FUEL INJECTION POWER MODULE - Remove &	351.00
				Replace - 6.0L Eng FICM - [Includes: Programming.]	
				Technician Removed and Replaced FICM as well as Wired a new	
				FICM Plug into the wiring harness.	
				HIGH PRESSURE OIL PIPE - Remove & Replace -	824.85
				6.0L Eng Both,Standpipe	
				Technician Removed and Replaced Standpipes on both sides of the	
				engine	
				During Inspection, Technician noticed 5 bolts that are stripped on	
				the rocker box causing it to leaking oil.	
				To service the rocker boxes you have to remove the cylinder head.	
				2 broken bolts and 2 stripped on drivers side	
				1 stripped on passenger side and one broken bolt	
				FUEL PUMP - Remove & Replace - Diesel Electric	161.20
				Pump - [DOES NOT include test.]	
				Environmental Fees	3.78

**Highway 99 Diesel and Auto Repair**

18344 B OLD Hwy 99  
Rochester, WA. 98579  
Phone: 360-858-4952

**INVOICE**

191

Org. Est. # 000710

**INVOICE**

Printed Date: 09/21/2023

**Gulley logging**

2007 Ford - F550 Super Duty - 6L, V8 (363CI) VIN(P)

Lic # : C42269Z

Odometer In : 242703

VIN # : 1FDAF56P3 7EB26348

Part Description	Qty	Sale	Ext	Labor Description	Ext
------------------	-----	------	-----	-------------------	-----

[ Payments - ]

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Labor:	2,372.05
Parts:	2,235.17
HazMat:	3.78
Sub:	4,611.00
Tax:	373.49
Total:	\$4,984.49
Bal Due:	\$4,984.49

Vehicle Received: 9/11/2023

Customer Number : 217

Signature \_\_\_\_\_ Date \_\_\_\_\_