

P.O Box 5287

Victoria Point Queensland 4165

ABN: 75687910704

Licence:

AIRCON LICENCE AU57719

APPROVED INSPECTION STATION

13303

Tel:0448929128

Email: admin@seqtruckrepairs.com.au

Website: www.seqtruckrepairs.com.au



TAX INVOICE

Tax Invoice Number:7507

Date: 04/08/2026

Due Date:21/08/2026

Payment Term:COD

FOR:

diff leak

Model:KENWORTH K200

Reg No:ABMC

Next Service Date:26/10/2026

Next Service Odometer:821,412 Kms

VIN: 6F5000000NA473480

Body Type:PRIME MOVER

Year: 2022

Description	Qty.	Unit Price	Amount
REPAIRS			
Labour	9.0	\$150.00	\$1,350.00
Repair 1 – Differential Reseal			
Raised vehicle and removed the relevant CV axle, differential air line and tailshaft to gain access to the differential assembly. Removed the differential centre from the housing and thoroughly cleaned all mating surfaces, housing and differential centre in preparation for reassembly. Resealed and refitted the differential centre using the correct sealing procedure and torque specifications. Reinstalled the tailshaft, CV axles and differential air lines, replacing the rear cab air lines where required. Refilled both differentials with the correct grade and quantity of oil. Checked the system for leaks and verified correct operation. Replaced the damaged ABS cable and confirmed secure routing and connections. Performed a final differential oil level check and cleaned the work area before returning the vehicle to service.			
Repair 2 – Right-Hand Steer Hub Seal Replacement			
Raised and safely supported the steer axle. Removed the right-hand front wheel, brake drum, wheel hub and brake shoes. Cleaned all reusable components in the parts washer and thoroughly cleaned the backing plate. Installed new brake shoes and fitted a new steer hub seal. Reassembled the wheel hub and brake drum, ensuring correct bearing adjustment and hub installation. Reinstalled the front wheel, applying anti-seize compound to the wheel studs before installation. Torqued wheel nuts to 600 Nm in accordance with manufacturer specifications. Rechecked differential oil levels following repairs. Completed a final inspection, cleaned the work area and packed away all tools.			

P A R T S			
Diff oil filter - meritor	1.0	\$46.89	\$46.89
Dynatrans DA 85w140	35.0	\$9.95	\$348.25
DEGREASER	1.0	\$24.90	\$24.90
SUZI COIL 1 LONG/1 SHORT TAIL ABS/EBS	1.0	\$306.32	\$306.32
CR SCOTSEAL CLASSIC	1.0	\$73.52	\$73.52
ADAPTOR - NON SEALING 1/2" FEMALE	1.0	\$9.94	\$9.94
CLIPLOCK COUPLING NON SEAL FEMALE 1/2"	1.0	\$36.94	\$36.94
SUZI COIL SET - LONG TAIL RED & BLUE	1.0	\$90.45	\$90.45
WORKSHOP CHARGES			
SUNDRIES	8.0	\$12.50	\$100.00



Subtotal	\$2,387.21
GST	\$238.72
Total	\$2,625.93
Paid	\$0.00
Balance Due	\$2,625.93

THANKS FOR YOUR BUSINESS!

We are now an approved inspection station, also offering Brake roller testing!

SEQ TRUCK & TRAILER REPAIRS PTY LTD
BSB 013265
ACC 162012661

PLEASE REMEMBER TO CHECK YOUR TRUCK SERVICE INTERVAL REGULARLY AND BOOK IN WHEN YOU ESTIMATE YOU ARE 3 WEEKS OUT TO AVOID DISAPPOINTMENT.

ALL CARD PAYMENTS WILL INCUR A 1.18% SURCHARGE

Terms of trade are available on request.