

Vehicle History

Search terms:

Number	Type	Date Open	Date Closed	Kilometres Closed	HoursClosed	Fuel Usage Closed	Fault	Repairer / Notes	Cost / Invoice
R-3105	hub seal	15/01/2026	15/01/2026	764,865	0	0		replaced l/h 1st drive hub seal, brakes and drum also replaced s cam bushes	\$0.00
S-1733	B - 50k	15/01/2026	15/01/2026	764,865 31,472	11,336	0		carried out b service replaced l/h 1st drive hub seal	\$0.00
R-3404	Starting and Charging system	04/12/2025	04/12/2025	770,695	0	0		Blue Collar Diesel Attended vehicle, inspected and diagnosed vehicle as starter motor. Throw-out gear not engaging correctly, attempted jump-start to move vehicle from depot - unsuccessful. Removed starter motor and installed new parts the following morning.	\$217.50 1870

Number	Type	Date Open	Date Closed	Kilometres Closed	HoursClosed	Fuel Usage Closed	Fault	Repairer / Notes	Cost / Invoice
R-3347	Tarp	17/11/2025	17/11/2025	771,735	0	0		Internal Workshop Inspected tarp wiring loom and motor, found faulty wiring and failed solenoid. Rewired loom and replaced faulty solenoid, checked all components for serviceability - all in working condition.	\$0.00

Number	Type	Date Open	Date Closed	Kilometres Closed	HoursClosed	Fuel Usage Closed	Fault	Repairer / Notes	Cost / Invoice
R-3362	Starting and Charging system	07/11/2025	07/11/2025	77,471	0	0		Internal Workshop Inspected truck, confirmed diagnosis as faulty starter motor. Disconnected and isolated batteries, disconnected starter leads, removed starter motor and inspected fly wheel teeth and throw-out bearings - all serviceable. Installed new starter motor, connected leads and un-isolated batteries. Checked all components for serviceability - all in working condition.	\$0.00

Number	Type	Date Open	Date Closed	Kilometres Closed	HoursClosed	Fuel Usage Closed	Fault	Repairer / Notes	Cost / Invoice
R-3364	Coolant System	24/10/2025	24/10/2025	767,486	0	0		Blue Collar Diesel Travel to side road outside of pt Wakefield to attend breakdown for vehicle over heating as stated by driver, once arrived flipped over cab, noticed drive belt had snapped causing vehicle to over heating fault, no drive belt on board breakdown vehicle due to time of day unable to access parts within time, check over all belt tensioners, pulleys and check for any further damage, on inspection it was found engine oil to be excessively low taking 8L of 15W 40 engine oil, when inspecting the coolant, no coolant was seen in header tank, refilled radiator with 12L of Paccar coolant run vehicle,	\$0.00

Number	Type	Date Open	Date Closed	Kilometres Closed	HoursClosed	Fuel Usage Closed	Fault	Repairer / Notes	Cost / Invoice
								reinspected for leaks, no leaks found inform workshop manager of findings, lock vehicle up and return to workshop. Re-attend breakdown first thing Saturday morning, travel back to pt Wakefield with the required belt, install drive belt as per Cummins diagram, run vehicle for a while inspect all belts running true, pack up vehicle, lock vehicle and contacted Adelaide workshop manager, inform where keys are left on vehicle and return to workshop.	
R-3092	lights	15/10/2025	15/10/2025	7,651,507	0	0	2183		\$0.00
R-3091	lights	15/10/2025	15/10/2025	7,651,507	0	0	2183	repaired broken wiring at drawbar	\$0.00
R-3090	lights	15/10/2025	15/10/2025	7,651,507	0	0	2183	repaired damaged wiring at draw bar	\$0.00
R-3074	wheel nut indicators	14/10/2025	14/10/2025	7,649,835	0	0	2174	fitted wheel nut indicators	\$0.00

Number	Type	Date Open	Date Closed	Kilometres Closed	HoursClosed	Fuel Usage Closed	Fault	Repairer / Notes	Cost / Invoice
T-439	Fault, Puncture	14/10/2025	14/10/2025	7,649,835	0	0	2173	adam checked all tyre pressures and adjusted	\$0.00
R-3073	airhose	13/10/2025	13/10/2025	45,268	0	0	2165	re secured air lines as required	\$0.00
R-3072	Mudflaps	13/10/2025	13/10/2025	45,268	0	0	2163	fitted new mud flaps as required	\$0.00

Number	Type	Date Open	Date Closed	Kilometres Closed	HoursClosed	Fuel Usage Closed	Fault	Repairer / Notes	Cost / Invoice
R-3305	hubseal	03/10/2025	03/10/2025	764,865	0	0		Internal Workshop Removed wheels, removed axle and hub, inspected bearings and bearing cones - serviceable. Removed failed hub-seal and cleaned hub, cleaned bearings, lubricated and installed, installed new hub-seal. Removed contaminated braking hardware and installed new s-cam bushes and grease seals, installed new brake shoes and brake drums, installed hub and axle, re-fit wheels and adjusted wheel bearing to specification. Torqued wheel nuts and lowered truck, tested all components - all in working condition.	\$0.00
S-1554	A - 10k	01/08/2025	01/08/2025	765,437 9,763	0	0		Internal Workshop	\$0.00
S-1553	A - 10k	02/06/2025	02/06/2025	755,674 9,880	0	0		Internal Workshop	\$0.00

Number	Type	Date Open	Date Closed	Kilometres Closed	HoursClosed	Fuel Usage Closed	Fault	Repairer / Notes	Cost / Invoice
R-2274	grainlock	23/05/2025	23/05/2025			0	1389	tightened grain locks. Test ok	\$0.00
S-1361	A - 10k	20/01/2025	15/01/2025	745,794 12,401	0	0		Internal Workshop -A service Completed.	\$0.00
R-1466	TYRE	06/01/2025	06/01/2025	742,613	0	0		Internal Workshop plug tyre L/H/R inner axle 2	\$0.00
R-1281	tailgate, TYRE	06/12/2024	06/12/2024	736,196	0	0		Internal Workshop Rear tailgate not closing due to bent tailgate from grain lock being left on. straighten rear tailgate with forklift, and heat up with OXY grain lock and restraighten L/R/O drive Tyre plugged.	\$0.00

Generated at: 29/05/2026, 2:24:28 pm