

Vehicle History

Search terms:

Number	Type	Date Open	Date Closed	Kilometres Closed	HoursClosed	Fuel Usage Closed	Fault	Repairer / Notes	Cost / Invoice
R-3124	Brakes	04/02/2026	04/02/2026	0	0	0		Blue Collar Diesel	\$0.00
R-3403	Air Conditioning	24/12/2025	24/12/2025	976,294	0	0		Blue Collar Diesel Inspected vehicle HVAC system to check for leaks using nitrogen, no evidence of any leaks present, ran vehicle ensured air-con was reaching desired temperature and correctly cycling - found air-con gas to be low and filled per requirement. Applied air-con leak sealant as a precaution, re-inspect leaks using vacuum test, re-gas air-con per requirement, ran system to ensure air-con is reaching desired temperature and cycling correctly - all successful.	\$553.40 1872

Number	Type	Date Open	Date Closed	Kilometres Closed	HoursClosed	Fuel Usage Closed	Fault	Repairer / Notes	Cost / Invoice
R-3336	Tarps	04/12/2025	04/12/2025	971,978	0	0		Internal Workshop Inspected tarp motor wiring harness, found wire rubbed through and shorting, found seized wiring terminals, found faulty tarp solenoid. Repaired faulty wiring joints and terminals, removed and replaced failed tarp solenoid. Tested all components - all in working condition.	\$0.00
R-3338	Tarps	02/12/2025	02/12/2025	971,056	0	0		Internal Workshop Inspected tarp motor and wiring harness, found power at tarp motor but no function. Installed new tarp motor to confirm diagnosis - successful. Tested all components - all in working condition.	\$0.00
R-3057	ELECTRICAL	02/12/2025	02/12/2025	970,557	0	0	2405	had speedo repaired by blue collar diesel	\$0.00

Number	Type	Date Open	Date Closed	Kilometres Closed	HoursClosed	Fuel Usage Closed	Fault	Repairer / Notes	Cost / Invoice
R-3402	Aftertreatment, Engine	21/11/2025	21/11/2025	967,905	0	0		<p>Blue Collar Diesel Attended yard for breakdown, inspected vehicle fault codes - non active that would cause de-rating issues. Inspected ad-blue aftertreatment system, removed ad-blue dosing injector from exhaust and inspected - air was not able to pass through. Cleaned injector with hot water and re-tested successful. Re-installed ad-blue injector and ran pump dosage test, all components met requirements. Checked over engine bay for any other possible faults, found engine oil level to be excessively low - took 5 liters to reach full mark on dipstick. Suggested to road test vehicle to see if fault persists.</p>	\$553.40 1872

Number	Type	Date Open	Date Closed	Kilometres Closed	HoursClosed	Fuel Usage Closed	Fault	Repairer / Notes	Cost / Invoice
R-3345	Shifter	17/11/2025	17/11/2025	966,717	0	0		Internal Workshop Inspected air leak on shifter knob, found internal leak. Removed and replaced internal shifter knob, tested all components for serviceability - all in working condition.	\$0.00
R-3334	Brakes, hubseal	10/11/2025	10/11/2025	946,489	0	0		Internal Workshop Removed steer wheels, removed and replaced foundation braking components on steer axle, removed failed hub-seal, cleaned and inspected bearings - all serviceable, installed and lubricated bearings and new hub-seal. Re-fit wheels and torqued wheel nuts to spec, adjusted brakes and greased axle. Tested all components - all in working condition.	\$0.00
S-1800	C - 100k	10/11/2025	10/11/2025	964,489 39,293	0	0		Internal Workshop Completed "C" service.	\$0.00

Number	Type	Date Open	Date Closed	Kilometres Closed	HoursClosed	Fuel Usage Closed	Fault	Repairer / Notes	Cost / Invoice
R-3058	airbag	28/10/2025	28/10/2025	962,800	0	0	2162, 2244	adam replaced both 1st axle airbags	\$0.00
R-3058	Tarp	28/10/2025	28/10/2025	962,800	0	0	2162, 2244	replaced tarp motor retest all ok	\$0.00

Number	Type	Date Open	Date Closed	Kilometres Closed	HoursClosed	Fuel Usage Closed	Fault	Repairer / Notes	Cost / Invoice
R-3370	CLUTCH	20/10/2025	20/10/2025	961,440	0	0		<p>Blue Collar Diesel Attended site to carry out clutch adjustment; however, inspection found the clutch was beyond adjustment limits due to a seized release bearing on the input shaft preventing full pedal stroke. The transmission was removed, and the clutch assembly showed excessive wear and heat spotting, so a new clutch was fitted. The flywheel was removed and sent for machining, and a new genuine Cummins rear main oil seal was installed using the correct tools. A genuine Eaton 10-spline input shaft rebuild kit was also fitted, endplay set to specification, and all components reassembled and torqued to manufacturer</p>	\$0.00

Number	Type	Date Open	Date Closed	Kilometres Closed	HoursClosed	Fuel Usage Closed	Fault	Repairer / Notes	Cost / Invoice
								specifications, with final checks confirming smooth operation and correct gear engagement.	
S-1640	A - 10k	03/10/2025	03/10/2025	956,196 21,000	0	0		Internal Workshop A SERVICE	\$0.00
R-2924	heater	12/08/2025	12/08/2025			0	1818	Heater tap seal replaced	\$0.00
R-1636	diff bush	23/01/2025	23/01/2025			0	843		\$0.00
R-1643	wheel alignment	22/01/2025	22/01/2025			0	833		\$0.00
R-1642	guages	22/01/2025	22/01/2025			0	832		\$0.00
R-1640	speed o	22/01/2025	22/01/2025			0	834		\$0.00
R-1638	ELECTRICAL	22/01/2025	22/01/2025			0	831		\$0.00
R-1637	vibration	22/01/2025	22/01/2025			0	830		\$0.00

Generated at: 29/05/2026, 2:04:01 pm