



## Vehicle History Summary

Fleet #	XB83GS
Registration	XB83GS
Make	Kenworth
Model	T909
VIN / Chassis #	6F5000000KA465900
Build Date	2019

Date	Reading / Units	Type / Repairer Notes	Repairer
		<b>Oil Leak R-1883</b>	
		T-10	
31/07/2025		<b>External Vehicle wash O-380</b> This is prior to the equipment going to auction.	Singh Truck Wash
24/06/2025	1,075,272 kms	<b>Sensor fault R-1825</b> CHECKED FAULT CODE SCR FAULT AND NOX FAULT. FLUSH THE SYTEM AND RECHECKED FAULT CODE. SCR FAULT BECOME INACTIVE. AND TEST DROVE TO NOX RESET. TEST DROVE AROUND 30 MIN BEFORE NOX RESET. ERASED FAULT CODEJOB COMPLETED. FAULT CODE 2727,2773 AND 3575	BHTC (Broken Hill Truck Centre)
24/06/2025		<b>Steering shaft R-1791</b>	M K Equipment
12/06/2025	1,037,016 kms	<b>New T-517</b> 11003587 11R22.5 148/145L FS FD664 4 Positions: 5,6,7,8 33000084 FIT TBR TYRE 4 Positions: 5,6,7,8 33000241 SCRAP TYRES TBR 4 Positions: 5,6,7,8 33000529 REMOVAL:END OF TYRE LIFE	Bridgestone Albury
12/06/2025	1,049,622 kms	<b>B S-890</b> Tyre wrapped around 1st drive axle LHS- Done Defects list: 1. Top steer UJ u/s 2. Pto leaking 3. 1st diff head leaking 4. 1st diff input leaking 5. shaft leaking 6. Dust cap missing from RHS Air cleaner lid 7.Guard mounts loose	Brown and Hurley Darra
11/06/2025		<b>Diff R-1790</b>	Brisbane Diff and Gearbox Services (P)
27/05/2025	1,049,622 kms	<b>Adblue, AIR LEAK R-1764</b> -Attached to laptop and carried out fault code inspection, Code 3575 active, Carried out diagnostics and carried out both wet and air side ad-blue flush, carried out adblue test via laptop and code went inactive, cleared all fault codes and road tested all OK -No time to inspect this concern, will need to rebook -Found 1st diff head weeping and 1st diff input leaking, will need to rebook for repairs -Did road test, didn't feel excessive vibrations. Could be caused by k051-1, suggest replacing gas stroke first and monitor - Completed B Service: Completed B Service Sheet as per provided sheets. Change oil, oil filters and fuel filters, lube chassis, check cab and electrical components and operation, check engine and cooling systems and operation, check steering and brakes for condition and operation, check drive line and chassis, general complete check over. Carried out icepack service as per service sheet. Carried out fianl road test all Ok. Removed panels from steering column, found cable disconnected from gas stroke because it's not pushing rod out, needs new stroke and re-inspect after repairs for steering shake	Brown and Hurley Darra
14/05/2025		<b>New T-531</b> Rego:XB83GS Odo:455,321 385/65R22.5 160K BS R249	Bridgestone (Main Account)
30/04/2025	1,022,090 kms 7,864 hrs	<b>Engine R-1716</b>	Cummins Laverton

Date	Reading / Units	Type / Repairer Notes	Repairer
		<p>Complaint: Excessive Noise In Front Of Engine Cause: Spun bush in lower concept gear Correction: Guidanz SO Number: 1298129 Coverage:Retail ( Account # ) Speedo: 1 022 090 kms ECM Engine Distance: 906333 Kms ECM Engine Run Time: 15283 Hrs ECM Fuel Burn: 511677 Ltr Correction: Truck presented with complaint of Excessive noise in front of engine Moved truck into workshop, carried out JSA &amp; download. Connect to insite, checked fault codes, found - No relevant data found - Diagnosed noise coming from front of Engine - Removed oil filter &amp; cut open oil filter - Found metal in filter - Pushed fan hub forward &amp; removed front cover - Bar engine around Found lower scissor gear moving more than normal - Remove all gears - Found lower scissor gear with a spun Bush and cracked shaft - Removed and inspected oil filter bypass valve, didnt appear to be opened - Cleaned, inspected and measured all gears, filled out gear measurement form - Inspected camshaft, all okay - Drained oil &amp; remove sump - Remove the stiffener plate - Remove oil pump - Pulled apart oil pump found scoring on housing - Removed 1&amp;4&amp;6 main cap &amp; removed big ends bearing bearing look good for the age of the engine - Clean all parts - Refitted removed big end and main bearing cap with new - Installed new oil pump due to scoring housing, - Installed stiffener plate with new 10 new bolts - Installed new lower idler gear with new shaft and bolt/washer, due to span bearing. - Installed upper idler gear with new shaft, refitted the rest of the gear - Perform engine base timing, -Refitted front cover, damper, fan hub, - Carry out tune up as per check list - Removed and replaced fuel pump gear pump, - Refitted oil pick up and sump, - Fill up coolant and new oil, fitted new oil filter, - Pressured tested found radiator hose leaking on thermostat housing side due wrong clamp fitted and coolant transfer tube leaking from middle oring, started truck -ok, - Drain coolant, removed rear side coolant transfer tube. - Remove front half of transfer tube - Replace Oring on transfer tube - Reinstall transfer Tube -Refill coolant -Pressure test cooling system, no leaks - Steam wash engine - Road test vehicle, found thermostat not holding temperature on road test and Oil leak coming around fuel pump - Drain coolant - Replace thermostat and thermostat seal - Remove power steering pump - Remove air compressor - Removed fuel pump Lines - Removed fuel pump - Cleaned sealing surfaces - Reinstalled fuel pump - Installed new oring on gear pump - Installed air compressor -Fill vehicle with coolant - Wash and road test, All good - Return vehicle back to service</p>	
04/04/2025		<b>Steering R-1684</b>	AJT Truck Repairs (P)
		Model: Kenworth T909 Reg No: XB83GS Body Type: Conventional 28/3/2025 *Check for reported power steering oil leak, found to be high pressure fuel pump leaking, also found engine knock, possible gear train failure, truck to go to cummins.	
04/04/2025		<b>Adblue R-1691</b>	Brown and Hurley Kyogle
		Brought the vehicle into the workshop, connected the computer and checked for logged codes, found active code for ad-blue pressure. Carried out troubleshooting and found the injector blocked. Carried out airside and wet side flushes and found the code to go inactive. Checked the Calibration file and found newer version available. Carried out Cal file update, road tested the vehicle and checked operation. Secured the loose mudguard bolt	
27/03/2025		<b>Puncture T-364</b>	Bridgestone Albury
		Repaired	
14/03/2025	11,872 kms	<b>Bearings, Brakes, Diff Seal R-1664</b>	On Point Mechanical
		Job date: 14/03/2025 Rego# XB83GS 1150528Kms 2019 KENWORTH T909 PRIME MOVER PO# R1664 Carry out repairs as identified during servicing Faults identified: - 1st diff output leaking - 1st diff input weeping - 1st diff right side brakes low - 1st diff brakes low - Clutch out of adjustment Faults repaired: - Jacked up 1st diff and pull wheels and drums off - Found left hub seal leaking - Pulled hub off and cleaned to inspect - Found hub to be damaged - Removed and replaced hub - Removed and replaced brake shoes and drums - Adjusted and tensioned brakes and all bearings - Changed diff oil - Replaced diff filter - Carried out adjustment on clutch - Tested rove - OK Labour	
05/03/2025	997,420 kms	<b>B S-750</b>	On Point Mechanical
		Job date: 17/02/2025 Rego# XB83GS 997020Kms 2019 KENWORTH T909 PRIME MOVER PO: S750 Carry out B service as per service sheet. Carry out Icepack service as per service sheet. Grease all points including suspension component and chassis. Check king pins and wheel bearings. Check brakes and all associated components. Check air system for leaks and drain tanks. Change engine oil and filters. Remove and replace fuel filter/s Check oil levels in transmission and diffs. Check condition of all hoses, check cooling system and fluid level. Check air filters. Check condition of belts and pulleys. Check all lights and electrical components including batteries. Check windscreen, wipers and washer fluid. Check mud flaps, guards and brackets. Found coolant filter to be leaking, inspect and tighten coolant filter. Test - OK Test drive vehicle - OK Faults identified: - Loading light not working - Left rear mudguard small tear - Beacon not working - Power steering reservoir leaking - Power steering pump leaking - 1st diff output leaking - 1st diff input weeping - 2nd drive shockies leaking - 1st diff right side brakes low - Drain cock leaking air - PTO leaking - Coolant filter leaking- Replaced - Battery u/s need replacing - Isolator mount broken - Holes in exhaust before dpf Labour	
24/02/2025		<b>Governor Valve R-1632</b>	On Point Mechanical
		Job date: 19/02/2025 Rego# XB83GS 2019 KENWORTH T909 PRIME MOVER Carry out valve replacement for air leak Faults identified: - Governor valve leaking Faults repaired: - Inspected air leak and found that the governor valve has been damaged causing an air leak - Removed and replaced valve - Tested - OK Labour	
18/02/2025		<b>Internal Tanker wash O-179</b>	Acacia Ridge Container Park
		Washout YB67AQ Product - Condensate (black) Rego# XB83GS Docket# 42075	

Date	Reading / Units	Type / Repairer Notes	Repairer
13/02/2025		<b>Coolant Leak R-1611</b>  Job date: 31/01/2025 Rego# XB83GS 985230Kms 2019 KENWORTH T909 PRIME MOVER PO# R1611 Carry out filter replacement Faults identified: - Coolant leak around coolant filter Faults repaired: - Removed and replaced the leaking coolant filter - Topped up coolant - Test drove and drop truck back to yard	On Point Mechanical
03/02/2025		<b>Coolant Leak R-1592</b>  Job date: 29/01/2025 Rego# Xb83GS 2019 KENWORTH T909 PRIME MOVER Carry out inspection and repair of coolant leak Faults identified: - Loose clamps and fittings Faults repaired: - Inspected the truck and found that the coolant leak has been caused by loose hose clamps and fittings - Secured and tensioned all clamps and hose fittings - Tested engine - OK	On Point Mechanical
21/01/2025		<b>External Vehicle wash O-140</b>	Singh Truck Wash
06/01/2025		<b>Electrical R-1557</b>  CONTRACT AUTO ELECTRICAL LABOUR: 9.1.25 MODEL: Kenworth UNIT / REGO: XB83GS Loose connection to steering module. Inspected cruise control, engine brake and horn inoperable. Checked cruise control switch and wirings, ok. Checked cruise control on and off signal to steering module, good. Checked engine brake switch and signal to steering wheel module, ok. Found loose terminals to steering wheel module, tighten terminals. Replaced horn fuse and relay. Rechecked cruise control engine brake and horn operation, all good Contract Services - Services Provided - 6hrs @ \$125/hr	Pro Truck Electrical
04/12/2024		<b>External Vehicle wash O-118</b>	Singh Truck Wash
04/12/2024		<b>Air Conditioner R-1507</b>  Rego# XB83GS 2019 KENWORTH T909 PRIME MOVER PO# R1507 Test and repair AC blower fan circuit. Found fuse blown and relay holder burnt out. Replace C/B, relay and repair wiring, test - OK Labour	On Point Mechanical
03/12/2024	954,410 kms	<b>B S-645</b>	Sustar Engineering
29/10/2024		<b>Alternator R-1451</b>  Breakdown-: Organize parts and travel to truck at Kynuna. Replace failed alternator, pulley and fan belt. Connect sensor wire to new alternator so voltage regulated at13.4V. Connect insite and clear all fault codes set by low voltage issue. Pack up and return to Mount Isa. ( Labour @ Sunday rates) 935022 k.m. / 13911 hrs. Travel \$1.30/km	Murphys trailer repairs
22/10/2024		<b>Windscreen R-1426</b>  Replaced PO/RO/Stock Number - R1426 Email Address - acc.payable@defgroup.com.au Supply & Fit - XB83GS - KENWORTH T900-Series T909 2019 - TRUCK N/C Part Used - KW1648 Guarantee - 12 month warranty on workmanship Time to Drive - Drying Time - Not Required Window Down 48hrs - No ADAS Required - No	Economy Windscreens
22/10/2024	928,120 kms	<b>hose clamp R-1425</b>  Replaced top and bottom hoses and clamps	Brisbane Workshop
21/10/2024		<b>Air Conditioner R-1412</b>  Replace fan	Murphys trailer repairs
17/10/2024	927,791 kms	<b>B S-619</b>  b service air leaks behind seat and under cab pto hose leak pump fan bracketery broken wiper blades check codes heater taps x 2	Brisbane Workshop
11/10/2024		<b>External Vehicle wash O-133</b>	Singh Truck Wash
10/10/2024	921,347 kms	<b>Coolant Leak R-1400</b>  Replace hose and top up coolant ,( call out ) Karratha , WA	STS
01/10/2024	906,501 kms	<b>Coolant Leak R-1376</b>	Brisbane Workshop
13/09/2024	906,501 kms	<b>C S-946</b>	Brisbane Workshop
05/09/2024	898,911 kms	<b>B S-536</b>  b service 2 x steer tyres a/c not cold - sublet pro truck inverter keeps blowing fuse - pro truck to fix - inverter supplied esc - atc - abs light on - sublet pro truck starting issues - sublet protruck oil pressure light	Brisbane Workshop
02/09/2024	886,494 kms	<b>New T-290</b>	Brisbane Workshop

Date	Reading / Units	Type / Repairer Notes	Repairer
02/09/2024	898,911 kms	<b>New</b> T-301	Brisbane Workshop
14/08/2024	882,743 kms	<b>Adblue</b> R-1332	EDGE DIESEL AUSTRALIA PTY LTD
13/08/2024	886,494 kms	<b>Sensor fault, Wheel Seal</b> R-1335	Brisbane Workshop
06/08/2024	854,594 kms	<b>Clutch, Horton fault, Turntable, Tyre</b> R-1295	Brisbane Workshop
06/08/2024	864,573 kms	<b>Wheel bearings</b> R-1312	Steel Earthmoving Repairs
02/08/2024	875,078 kms	<b>B</b> S-489 b service check tyres check shocks heater core leaking air leaks. cab hcv leaking 4 x airbags leaking cab mounts - next service service icepack- 5287 hrs next due 6287hrs	Brisbane Workshop
30/07/2024		<b>External Vehicle wash</b> O-80	Singh Truck Wash
11/06/2024	842,891 kms	<b>B</b> S-419 carry out b service repair lights.. check icepack - top up oil and replaced air cleaner refit drive brake backing plates	Brisbane Workshop
28/05/2024	831,735 kms	<b>Hydraulics</b> R-1254	Brisbane Workshop
10/05/2024	821,914 kms	<b>Lights</b> R-1247	Brisbane Workshop
09/05/2024		T-168	
03/05/2024	754,960 kms	<b>New</b> T-168	Goodyear Autocare Leongatha
26/04/2024	796,202 kms	<b>Hydraulics</b> R-1241 Repair damaged hyd cooler	Brisbane Workshop
19/04/2024	813,480 kms	<b>B</b> S-352 Replaced exhaust flex pipe Replaced 4 exhaust gaskets Replaced 2 exhaust clamps Replaced pressure protection valve Adjusted front wheel bearings Adjusted all tire pressures	Brisbane Workshop
18/04/2024	801,662 kms	<b>Clutch</b> R-1224 Replaced clutch linkage	Brisbane Workshop
28/03/2024	803,237 kms	<b>Fan Belt</b> R-1227 Replace both belts and tensioners	Brisbane Workshop
28/03/2024	801,662 kms	<b>wipers</b> R-1224 Replaced wipers	Brisbane Workshop
28/03/2024	803,237 kms	<b>Belt Tensioner</b> R-1228 replace ac and fan belt and tensioners	Brisbane Workshop
21/02/2024	779,172 kms	<b>B</b> S-259 carry out B service. replace exhaust manifold and turbo gaskets. remove muffler and send to exhaust repaired at intake flange. replaced rear drive brake shoes. removed and replaced Scams bushes and Cam shafts. replaced rear drive shockers. repair oil leak at filler neck on passenger side. aftertreatment light on dash crystallization of DEF system code 3575. cleaned out air system of Ad blue system, cleaned out fitting in pump to injector. replaced missing sump bolts tensioned to Specs.	Brisbane Workshop
14/02/2024		<b>Ice pack</b> R-1180	Pro Truck Electrical
11/12/2023	754,960 kms	<b>Balance, Puncture</b> T-167	Goodyear Autocare Leongatha
05/12/2023		<b>pressure switch</b> R-1129	EDGE DIESEL AUSTRALIA PTY LTD
01/12/2023	736,087 kms	<b>B</b> S-185	Murphys trailer repairs

Date	Reading / Units	Type / Repairer Notes	Repairer
22/11/2023	749,518 kms 10,134 hrs	<b>B S-206</b>  'B' Service. Service ice pack. Price includes service (A) for YQ27BX, YQ56UY, YN46HD, YN47HD	Murphys trailer repairs
09/11/2023	735,778 kms 10,134 hrs	<b>Tanker washout R-1083</b>  Washout YQ93RC Product - Petroleum Crude Oil Rego# XB83GS Docket# 38706	Acacia Ridge Container Park
25/10/2023	693,505 kms 10,134 hrs	<b>B S-91</b>	Murphys trailer repairs
25/10/2023	658,594 kms 9,598 hrs	<b>B S-66</b>  Removed windscreen tint Tightened all engine mounts Secured hotline Tightened hydraulic tank brackets Tightened undercab brace Pressure test and replace radiator cap Front diff pinion seal leak Turntable has no adjustment but also has no jaw movement- will need rebuild in coming months	Brisbane Workshop
19/10/2023		<b>Lights, Wheel bearings R-930</b>	Brisbane Workshop
19/10/2023		<b>MUDGUARD R-926</b>  Replaced p4 mudguard and snails with 2nd hand guard Replaced p3 mudguard snails	Brisbane Workshop
19/10/2023	713,027 kms	<b>bullbar, Wheel bearings R-945</b>  Replaced P3 wheel bearings, inspected p4 bearings found to be worn as well Replaced contaminated brake shoes on P3 Replaced diff oil and filter Replaced bullbar spring and bolt, tensioned he spring as well INV-860365	Brisbane Workshop
10/10/2023		<b>Tanker washout R-971</b>  Washout YQ94RC Product - Petroleum Crude Oil Rego# XB83GS Docket# 38539	Acacia Ridge Container Park
09/10/2023	703,595 kms	<b>Ice pack R-1045</b>  Check oil leak on icepack motor. Change filter and top up engine oil.	Murphys trailer repairs
08/09/2023	702,253 kms	<b>New T-115</b>  11R22.5 148/145L KMAX G667+ 16PR x 8	Goodyear Autocare Leongatha
04/09/2023	693,505 kms 10,134 hrs	<b>B S-174</b>  'B' Service. Replace 1 mud guard bracket5	Murphys trailer repairs
04/09/2023	693,505 kms 10,134 hrs	<b>B S-166</b>  B' Service. Replace 1 mud guard bracket5 Trailers and Dolly's 'A' Service. Replace 2 shock absorbers.	Murphys trailer repairs
30/08/2023		<b>Electrical R-703</b>  Relocated estop mount and fit new estop	Brisbane Workshop
30/08/2023		<b>Adblue R-686</b>  Repair air leak Test adblue pump operation Test for fault codes Can't fault	Brisbane Workshop
28/08/2023	6,607,863 kms	<b>Turntable R-731</b>  Turntable unserviceable Swap turntables with red A trailer	Brisbane Workshop
17/08/2023	6,607,863 kms	<b>Hydraulics R-593</b>  Diagnose fault Faulty control solenoid Replace valve and tested ok	Brisbane Workshop
26/07/2023	673,689 kms	<b>E-Stop R-663</b>  Replaced smashed E-Stop as required. Removed I-ROJ bx as required. Test USB socket, found socket powered off of accessories	Pro Truck Electrical
18/07/2023		<b>signs R-743</b>  replace signs	Brisbane Workshop
14/07/2023		<b>Tanker washout R-610</b>	Acacia Ridge Container Park

Date	Reading / Units	Type / Repairer Notes	Repairer
Washout YQ73PD Product - Fuel Oil Rego# XB83GS Docket# 38038			
11/07/2023	658,594 kms	<b>Coolant Leak</b> R-459 Replaced faulty radiator cap	Brisbane Workshop
11/07/2023	653,637 kms	<b>Air dryer assembly</b> R-473 Replace air dryer assembly	Brisbane Workshop
11/07/2023		<b>Suspension</b> R-539 Replaced shockers , and air bag	Brisbane Workshop
11/07/2023	657,138 kms	<b>Chassis</b> R-545 repair pump mounts , cross member , light brackets	Brisbane Workshop
11/07/2023	658,594 kms	<b>Ice pack</b> R-555 Replace top engine mount Replace air filter housing	Brisbane Workshop
03/07/2023		<b>FUEL FILTER, oil filter</b> R-583 Supply oil and fuel filters for T909	Pro Truck Electrical
15/06/2023	643,699 kms	<b>AIR LEAK</b> R-366 Replace pressure limiting valve on air tank under cab	Brisbane Workshop
15/06/2023	653,637 kms	<b>Air Compressor</b> R-562 AIR DRYER KIT	Brown and Hurley Darra
13/06/2023		<b>Driveline</b> R-458 Clean Diff and top up oil	Brisbane Workshop
22/05/2023	637,480 kms	<b>mirror</b> R-321 Remove interior panels to gain access to be able to replace and remount bracket with bolts instead of rivets Remove and replace bracket Refit interior panels/ visor/ door rubber	Brisbane Workshop
22/05/2023	637,480 kms	<b>guard</b> R-322 Remove and replace rhf drive guard/ suppression flap/ stay Tighten all guard posts	Brisbane Workshop
18/05/2023	633,874 kms	<b>ISO Switch</b> R-314 Test operation of Isolator, found isolator operational at time of inspection. Inspect E-Stop wiring, found E-stop connections failed. Reconnect e-stop. Retest isolator. Isolator restored	Pro Truck Electrical
16/05/2023	692,083 kms 9,150 hrs	<b>service</b> R-311 Carry out B service as per service sheet. Remove and replace leaking hub seal RHF steer	Torquing Diesels Pty Ltd ATF The McKee Trust
19/04/2023	618,299 kms	<b>Road Worthy Inspection</b> R-253 Brake Roller Test Per Axle HVRAS Rego Assessment Certificate of Inspection (HV-31207402-6)	ALL MAINTENANCE TRUCK SPECIALISTS
22/03/2023		<b>Pressure Maintenance</b> T-10 PRESSURE MAINT 900R20 & ABOVE	Goodyear Autocare Leongatha
22/03/2023	600,728 kms	<b>Blinker Stalk, Ice pack</b> R-109 Bring the vehicle into the workshop and removed the dash panel and steering column covers and cut all the cable ties holding the blinker stalk wiring harness. Unplugged all the plugs, removed and replaced the blinker stalk assembly with a new one supplied by the customer. cable tied up all of the wiring harness, tested all the blinker stalk functions , all okay and refitted the dash panels and steering column cover. Loosened the top of the left hand mirror bracket stay arms off the mirror bracket, fitted the new rivets into the bracket and tightened the stay arm bolts. tested to see if the vibration was still present, all okay. Removed the ice pack cover and inspected and topped up the engine oil in the ice pack, using the supplied oil and refitted the cover of the ice pack.	Heavy Haulage Maintenance
28/02/2023	590,514 kms	<b>B S-7</b>	Heavy Haulage Maintenance

Bring the vehicle into the workshop and carry out the B service in accordance to the service sheet, inspected the operation and condition of all the lights, reflectors, decals, wiper blades and washer bottles. Drained the engine oil and removed and replaced the oil and fuel filters, removed and blow out the air filters and refit. Filled the sump with new oil, bleed the fuel system, started the motor and re inspected the oil level. Inspected the remaining oil, fluid and coolant levels, topped up the coolant, adjusted the clutch and blew out the radiator. jacked up the axles and inspected the wheel bearing play, bearing and braking components. Adjusted the brakes and completed a full grease over the vehicle, inspected all drive line, chassis and suspension components, found the right hand second axle front mudguard snails to be broken. Removed the snails, drilled the holes in the mudguard to fit the new snails . Fit the new snails, removed the e stop , removed the bracket and bent the bracket back into the correct position. Fit the bracket and the new e stop and inspected the operation , all okay. Inspected all hoses, belts and the batteries, washed down the engine, finished off the service and performed a brake roll test.

Signed: \_\_\_\_\_  
Name: \_\_\_\_\_  
Date: \_\_\_\_\_