

TEL: (306) 693-7253 FAX: (306) 692-9253

TOLL FREE: (877) 302-0253 (IN SASKATCHEWAN)

Formerly Known as Warner Fire & Rescue G.S.T. Registration Number 881742126 P.S.T. Registration Number 1828656

SERVICE INVOICE: R200014656:01





				ENGINE HOU	C)	U		
DATE	PROMISED	DATE INVOICE	SALES TYPE	ADVISO	R	TERMS	CUSTOMER	REFERENCE
3/17/2025	7:53:54AM	3/31/2025	SC	DWAY	NE	VISA	N. Singilia	
YEAR	MAKE	MODEL	VIN	CUSTOMER UNIT #	CAB CARD	IN SERVICE	ODOMETER IN	ODOMETER OUT
09	FTL	CASCADIA	1FUJGLDR79LAK2935	51	SK0000394	11/19/2008	360141	360141

Sold Operations

JOB #1 26-00 SC TRANSMISSION REPAIR AND DIAGNOSE

CONCERN UNIT IS NOT SHIFTING PROPERLY, WILL SHIFT UP TO 10TH BUT THEN WILL NOT SHIFT AFTER THAT. RESET

UNIT AND THEN IT WILL NOT SHIFT INTO ODD GEARS. IT WILL NOT SHIFT INTO 18TH AT ALL.

ROOT CAUSE TRANSMISSION FAILED CORRECTION INSEPCTING TRANSMISS

INSEPCTING TRANSMISSION ISSUES, TEST DROVE UNIT, ONLY MADE IT OUT OF YARD AND DOWN THE SERVICE ROAD. IT WAS MAKING A LOT OF NOISE. REMOVED SPLITTER AND FOUND IT WAS RUSTED BADLY. DRAINED OIL FROM TRANS, FOUND ABOUT 3 LITERS OF OIL AND LOTS OF METAL CHUNKS. TEHE TRANSMISSION WILL NEED TO BE REPLACED. DISCONNECTED DRIVE LINE AND ALL LINES FRO TRANSMISSION. FOUND THE COOLER LINES WERE LEAKING ALOT. WAS ABLE TO DISCONECT THEM FROM THE RAD. TESTED THE RAD TO SEE IF THE COOLER WAS LEAKING. THE RAD IS GOOD. UNBOLTED AND REMOVED TRANS. REMOVED CLUTCH AND FLYWHEEL. SENT FLYWHEEL OUT TO BE RESURFACED. REPLACED REAR ENGINE SEAL. INSPECTED TRANS WHILE IT WAS OUT. FOUND THE XY SHIFTER IS ALSO RUSTED. SWAPPED AND REPLACED ALL PARTS TO THE NEW TRANS AS NEEDED. REPLACED COOLER LINES. SWAPPED BELLHOUSING FROM OLD TRANS TO NEW. INSTALLED FLYWHEEL AND NEW CLUTCH. INSTALLED NEW TRANS REMOVED. MADE ABRACKET FOR THE TRANSY COOLER LINES TO A VOIL RUBBING ON THE OIL PAN. ADDED OIL IN THE TRANNY (16L). WENT FOR A TEST DRIVE AND RECHECKED EVERYTHING AND CHECKED FOR

LEAKS. CLEANED TOOLS AND SHOP TOOLS.

678	DEM STEEL ST	PAGE 1	MASCRIPTON CARS	AND PROPERTY.	EXTOTES
1	02-12176-000	The Company of the Co	BEARING-PILOT,72 X 30 X 19MM	65.30	65.3
1	07-21864-000	TO THE PROPERTY OF THE PARTY OF	TUBE SUPPLY M-ITOC HDEP RH	285.92	285.9
1	07-21865-000		TUBE RETURN M-ITOC HDEP RH	285.92	285.9
2	23-12094-175		SCREW-CAP,HEX,7/16-14X	3.99	47.8
2	DDE A0029905500		BOLT - FLYWHEEL TO CRANKSHAFT	7.72	92.6
1	DDE A0159974946		OIL SEAL, CRANKSHAFT, REAR	64.15	64.1:
6	ESO 122951		TRANS FLUID, M-DELVAC 1 TF *D	21.83	349.2
l i	FUL 691955	# 1 3000	GASKET, RANGE COVER *D	16.12	16.1
ı	FUL K3681		KIT HARNESS TRANS *D	293.87	293.8
1	FUL K4148	11 16 16	KIT - SPEED SENSOR *D	63.64	63.64
1	FUL K4223R		KIT, GEN 3 XY SHIFTER, REMA *D	1,089.40	1,089.4
1	FUL K4223R-CORE		KIT, GEN 3 XY SHIFTER, REMA *D	330.63	-330.63
1	FUL K4223R-CORE		KIT, GEN 3 XY SHIFTER, REMA *D	330.63	330.63
1	SP 309701 20		CLUTCH-ADVANTAGE SELFADJUST *D	1,779.48	1,779.4
1	SP K4125CL		KIT, CLUTCH INSTALLATION (R *D	554.30	554.30
1	TDA M281X		CENTER PARTS KIT, 18N, U-JO *D	140.79	140.7
5	TYC DCT110HIR		TIE STRAP	1.24	6.20
1	115-A		Street Elbow	1.80	1.80
1.	K2170		Filter/Regulator	72.55	72.5
1	K3381		Halo O-ring Kit	18.46	18.4
136	1468-6C	1468-6C	#6 X 3/8NPT AB FITTING	3.63	3.6



TEL: (306) 693-7253 FAX: (306) 692-9253

TOLL FREE: (877) 302-0253 (IN SASKATCHEWAN)

Formerly Known as Warner Fire & Rescue G.S.T. Registration Number 881742126 P.S.T. Registration Number 1828656

SERVICE INVOICE: R200014656:01





				ENGINE HOU	RS	0		
DATE P	ROMISED	DATE INVOICE	SALES TYPE	ADVISO	R	TERMS	CUSTOMER	REFERENCE
3/17/2025	7:53:54AM	3/31/2025	SC	DWAY	NE	VISA		Paleni
YEAR	MAKE	MODEL	VIN	CUSTOMER UNIT#	CAB CARD	IN SERVICE	ODOMETER IN	ODOMETER OUT
09	FTL	CASCADIA	1FUJGLDR79LAK2935	51	SK0000394	11/19/2008	360141	360141

DINE	TEM	MRS	DESCRIPTION	Unit Pains	EXTERNO
2	5/8W	5/8W	5/8 FLAT WASHER	0.53	1.0
2	5/8X2NC	5/8X2NC	BOLT,5/8X2,NC,GR8	2.58	5.10
6	KFT 313	KFT 313	BRAKE AND PART CLEANER *D	5.42	32.5
1	PAC-RTLO18918AAS3	the state of the s	18918 AUTO SHIFT TRANSMISSION	5,950.38	5,950.3
-1	PAC-RTLO18918AAS3-CORE		18918 AUTO SHIFT TRANSMISSION	4,830.00	-4,830.0
1	PAC-RTLO18918AAS3-CORE		18918 AUTO SHIFT TRANSMISSION	4,830.00	4,830.0
8 243	LABOR 26-00	MI SYNE I SE	TRANSMISSION		3,000.0
16	ENV05		ENV CHARGE PER LITER	0.05	0.8
1	FRT	STATE OF THE STATE	FREIGHT	300.00	300.00
1	SOUTH	THE PERSON	SOUTHERN SEMI SERVICES	130.63	130.63

TOTAL JOB #1 26-00 14,651.88

JOB #2 20-00

SC

COOLING SYSTEM REPAIR AND DIAGNOSE

CONCERN

CUSTOMER HAS NOTICED THAT AFTER SITTING FOR A EXTENDED PERIOD THERE IS A COOALNT LOSS. NO PUDDLE ON THE GROUND CAN WE CHECK FOR A LEAK SOMEWHERE.

ROOT CAUSE LOOSE CLAMP

PRESSURIZED SYSTEM AND FOUND A LOOSE CLAMP LEAKING ON THE TURBO CORRECTION

LABOR 20-00	COOLING SYSTEMS	75.00
A South St. J. T. B. D. TA'E, J. J.	TOTAL JO	B #2 20-00 75.00



TEL: (306) 693-7253 FAX: (306) 692-9253 TOLL FREE: (877) 302-0253 (IN SASKATCHEWAN)

Formerly Known as Warner Fire & Rescue G.S.T. Registration Number 881742126 P.S.T. Registration Number 1828656

SERVICE INVOICE: R200014656:01





				ENGINE HOUR	.S	0		
DATE F	ROMISED	DATE INVOICE	SALES TYPE	ADVISOR	Million was been	TERMS	CUSYOMER	REFERENCE
3/17/2025	7:53:54AM	3/31/2025	SC	DWAYN	E	VISA	1.	
YEAR	MAKE	MODEL	VIN	CUSTOMER UNIT #	CAB CARD	IN SERVICE	ODOMETER IN	ODOMETER OUT
09	FTL	CASCADIA	1FUJGLDR79LAK2935	51	SK0000394	11/19/2008	360141	360141

Estimate is valid for thirty (30) days from date of the estimate.

At Warner Industries we are dedicated to providing elite service and products for our Customers. One of the ways we do this is by ensuring every unit has been quality inspected by a member of our service leadership team before leaving our shop -- including this one! But if the unit is not up to your standard, please ask to speak with our Service Manager. We appreciate your business and look forward to helping you in the future.

P.	\mathbf{LE}	A	SE	N	O'	TI	C

Conditions: Returned goods must be accompanied by original invoice. Special order goods subject to 20% restocking charge. Goods returned after 30 days subject to 20% restocking charge.

AUTHORIZED BY		DATE
PICK-UP BY		DATE
CONTACT CUST	Th	DATE/TIME



TEL: (306) 693-7253 FAX: (306) 692-9253

TOLL FREE: (877) 302-0253 (IN SASKATCHEWAN)

Formerly Known as Warner Fire & Rescue G.S.T. Registration Number 881742126 P.S.T. Registration Number 1828656

SERVICE INVOICE: R200014227:01





				ENGINE HOUR	S	0		
DATE	ROMISED	DATE WYORK	SALES TYPE	ADVISOR	£ 1/2	TERMS	CUSTOMER	REFERENCE
9/12/2024	4:28:31PM	9/26/2024	SC	DWAYN	Е	VISA		100 m 100
YEAR	MAKE	MODEL	VIŊ	CUSTOMER UNIT #	CAS CARD	IN SERVICE	ODOMETER IN	ODOMETER OUT
09	FTL	CASCADIA	1FUJGLDR79LAK2935	51	SK0000394	11/19/2008	28254	28254

Sold Operations

JOB #1 42-00

SC

BRAKE REPAIRS

CONCERN

CUSTOMER STATES THAT THE PASSENGER SIDE FIRST DRIVE AXLE BRAKE LOCKED ON AND GOT VERY HOT (GLOWING RED). THE REMOVED PINS FROM SLACK AND REMOVED FROM BRAKE POT. REPAIR DAMAGES.

PLEASE INSTALL NEW WHELL SEAL TOO.

CHECK ALL BRAKES ON TRUCK TO ENSURE THEY ARE FUNCTIONING CORRECTLY

ROOT CAUSE

BRAKE LOCKED UP

CORRECTION

REMOVED WHEELS, BRAKES, HUB ASSEMBLY, SLACK ADJUSTER, AND BRAKE POT AND FOUND THE SLACK\BRAKE POT TO BE DAMAGED FROM HEAT AND INSPECTED THE S CAM AND FOUND NO ISSUES. REMOVED SLACK AND BRAKE POT AND INSTALLED NEW ONES ON THEN CLEANED HUB ASSEMBLY. FOUND WHEEL BEARINGS TO BE NO GOOD SO I REMOVED BEARING RACES AND INSTALLED NEW ONES DUE TO OVER HEATING AND THEN INSTALLED NEW BEARING AND WHEEL SEAL THEN INSTALLED HUB ONTO TRUCK AND TOURQUED TO SPEC. THEN INSTALLED NEW SHOE PINS AND INSTALLED THE BRAKES THENM CLEANED UP

AXLE TUBE AND INSTALLED AXLE TUBE. THEN INSTALLED WHEELS.

	UNITERIOR	DESCRIPTION -	THE REPORT OF THE PARTY OF THE
89.49	89.49	BRAKES AOBKIT D	ABP MK4707Q 23STAN
-47.06	47.06	BRAKE SHOE KIT *D	ABP MK4707Q 23STAN-CORE
47.06	47.06	BRAKE SHOE KIT *D	ABP MK4707Q 23STAN-CORE
75.88	75.88	30/30 COMBINATION 3 *D	ABP N42A 33030C3D
69.00	69.00	SLACK MERITOR STYLE 5.5INARM 1	ABP N42AS R801073
17.62	17.62	GEAR OIL, M-DELVAC 1, 75W-9 *D	ESO 122046
179.99	179.99	KIC 16.50X7.00 BALANCED CAS *D	
96.29	96.29	BEARING *D	SBN SET401TRB
114.49	114.49	BEARING *D	SBN SET403TRB
83.54	83.54	DRIVE WHEEL SET *D	STM 392 9131
850.50		BRAKES	LABOR 42-00
0.05	0.05	ENV CHARGE PER LITER	ENV05
1,576.85	OTAL JOB #1 42-00	THE STATE OF THE S	

JOB#2 SGITRK SC CUSTOMER REQUEST TO PERFORM SGI INSPECTION TRUCK CUSTOMER REQUEST TO PERFORM SGI INSPECTION TRUCK

AS REQUESTED ROOT CAUSE

PERFORMED MACH SAFETY INSPECTION CORRECTION

STATISTICS I	GM common	MARCH	DESCRIPTION	Unitinged	5/10/03/03
1 S	GID	THE STREET	SGI SAFETY DECAL	25.00	25,00
L	ABOR SGIT		SGI TRUCK SAFETY		378.00

TOTAL JOB #2 SGITRK

403.00

JOB#3 60-00

SC

CAB AND BODY REPAIR AND DIAGNOSE

CONCERN

CONCERN

REPAIR MUDFLAPS



TEL: (306) 693-7253 FAX: (306) 692-9253

TOLL FREE: (877) 302-0253 (IN SASKATCHEWAN)

Formerly Known as Warner Fire & Rescue G.S.T. Registration Number 881742126 P.S.T. Registration Number 1828656

SERVICE INVOICE: R200014227:01





				ENGINE HOUR	SS 25	0		
DATEP	ROMISED	DATE INVOICE	SALES TYPE	ADVISOR		TERMS	CUSTOMER	REFERENCE
9/12/2024	4:28:31PM	9/26/2024	SC	DWAYN	IE .	VISA	II STATE	
YEAR	MAKE	MÓDÉL	VN	CUSTOMER UNIT #	CAB CARD	IN SERVICE	ODOMETER IN	ODOMETER OUT
09	FTL	CASCADIA	1FUJGLDR79LAK2935	51	SK0000394	11/19/2008	28254	28254

Sold Operations (Cont.)

ROOT CAUSE AS REQUESTED

DRILLED NEW HOLES IN FRAME FOR MUD FLAP BRACKETS AND THEN INSTALLED BRACKETS AND MUD FLAPS CORRECTION

Between	particular and the second	MR	MARIPHON CONTRACTOR	OVER PROOF FOR	EXTURNO
2	BTS A25RL	BTS A25RL	MUDFLAP HANGER	27.45	54.90
2	BTS B711	BTS B711	FLAP HANGER	7.20	14.40
1	BTS RT25	BTS RT25	STRIP-CONSPICUITY,STRAIGHT,PAI	45.77	45.77
736	LABOR 60-00		CAB & BODY		283.50

TOTAL JOB #3 60-00 398.57

JOB #4 60-00

SC

CAB AND BODY REPAIR AND DIAGNOSE

CONCERN

PASSENGER SIDE HOOD STRAP IS BROKEN

ROOT CAUSE FRAYED

REAMOVED AND REPLACED HOOD STRAP CORRECTION

Cals'de	TEX .	Mas	Statement of the statement of the		and tax or sule 8
1	A17-20380-006	JOICI	STRAP RESTRAINT, HODD	64.61	64.61
	LABOR 60-00	VOICI	CAB & BODY	1 - 1 - 1993	56.70
1	FRT	X and Y H.A. fig. "	REGINA FREIGHT	20.00	20.00
V1-			mom 4 1	TOD 04 (0.00	4 44 44

JOB #5 00-00

SC

MISC REPAIR

WINDSHIELD REPAIR AND REPLACEMENT

CONCERN

THERE IS A AIR LEAK AT THE FIREWALL

ROOT CAUSE

LOOSE AIR LINE

CORRECTION AIR LINE WAS NOT FULLY PUSHED INTO QUICK RELEASE FITTING, PUSHED IN FULLY AND NO MORE LEAKS

OTY	MIN.	945	DESCRIPTION	THE THEORY	Section of the section of
ALC: N	LABOR 00-00		MISC REPAIR	I HELDON MEDI	56.70
		8 6		TOTAL IOD 46 00 0	0 86.70

JOB #6 82-00

SC

WINDSHIELD REPAIR AND REPLACEMENT

CONCERN

ROOT CAUSE

CORRECTION

		1			
1			WINDSHIELD LH CURVED CASCADIA	166.22	166.22
1	PHA		GLASS REPAIR	100.00	100.00
7.30					

TOTAL JOB #6 82-00

266.22



TEL: (306) 693-7253 FAX: (306) 692-9253 TOLL FREE: (877) 302-0253

(IN SASKATCHEWAN)

Formerly Known as Warner Fire & Rescue G.S.T. Registration Number 881742126 P.S.T. Registration Number 1828656

SERVICE INVOICE: R200014227:01





					ENGINE HOUR	5	0		
DATE P	ROMISED		DATE INVOICE	SALÉS TYPE	ADVISOR	-	TERMS	CUSTOMER	REFERENCE
9/12/2024	4:28:31PM		9/26/2024	SC	DWAYNE		VISA		
YEAR	MARE	THE R. P. LEWIS CO., LANSING	MODEL	VIN	CUSTOMER UNIT#	CAB CARD	IN SERVICE	ODOMETERIN	ODOMETER OUT
09	FTL		CASCADIA	1FUJGLDR79LAK2935	51	SK0000394	11/19/2008	28254	28254

VOICE REPRI

Estimate is valid for thirty (30) days from date of the estimate.

At Warner Industries we are dedicated to providing elite service and products for our Customers. One of the ways we do this is by ensuring every unit has been quality inspected by a member of our service leadership team before leaving our shop -- including this one! But if the unit is not up to your standard, please ask to speak with our Service Manager. We appreciate your business and look forward to helping you in the future.

PI	JE A	SE	NO	TE

Conditions: Returned goods must be accompanied by original invoice. Special order goods subject to 20% restocking charge. Goods returned after 30 days subject to 20% restocking

AUTHORIZED BY	DATE
PICK-UP BY	DATE
CONTACT CUST	DATE/TIME

Thank you for your business

Introducing differential rebuilds that ase the difference between Pacific Truck and the other (https://www.pacifictruck.com)



Our Pacific branded differentials are always built by our professional technicians in our certified facility, uniquely tagged, and delivered where you need them to be.



- Ideal for All Applications
- 30 Month Unlimited km National Warranty From date of Inotal (March 17, 2025)

 Rebuilt to Last for Any Truck Application

 We Rebuild All Differentials from Dana, Meritor, Clark, International & Many Others

Warranty transfers with vin Not customer