

COPY



**JOBSITE
MECHANICAL
SERVICE**

Jobsite Mechanical Service Ltd.
P.O. BOX 22040 PARKLAND RPO
YORKTON SK S3N 4B2 CANADA
(306) 641-6766
jobsitemechanical.ca
GST/HST# 846229508RT0001

INVOICE

Date 02/06/2025

Date Open 12/04/2024

add to truck invoice

Page: 1 of 21

Ship To :

[Empty box for shipping address]

Written By GREG	Terms CHG	Time 13:31:10	Customer Po #	NOTE	Phone	Ship Via	
Unit # 11	Plate #	Year 1997	Make MACK	Model CH613 600	Kilometer/Hrs 890672/0.0	VIN 1M1AA13Y7VW075789	Engine 12.0L L6 DI

Qty	Description	Price	Amount
1.000	SGI TRUCK SAFETY INSPECTION - 3 AXLE	250.00	250.00
		SubTotal	250.00
	REPLACE SPEEDO CABLE, PRICE FIRST\$\$\$- NOT AVAILABLE	150.00	
4.000	BLOWER FAN/ CLEAN OUT & BLOW OUT VENTS/ AIR LEAK -removed 2 push rivets. -removed bolts in middle section of dash. -removed middle section and got access to blower motor. -blew out blow motor and vents. -removed section of vent from middle console and blew venting out. -had several dead mice and nesting. -blower motor had no low speed function. -checked fuses...ok. -found resistor was unplugged. -blew out blower motor. -removed centre dash. -noticed pitgail was burnt. -ordered new pigtail. -inspected pins....one pin is loose. -removed dash cover around valves to find leak. -could not find leak. -noticed the release button for brakes kick out right away...have to keep pushing it for a couple seconds and bottom stay min.	150.00	600.00

I authorize the above repair work, including sublet work, to be done along with necessary materials. JOBSITE MECHANICAL SERVICE LTD. and your employees may operate above listed vehicle for purposes of testing, inspection or delivery at my own risk. An express Mechanic's Lien is acknowledged on above listed vehicle to secure the amount of repairs thereto. JOBSITE MECHANICAL SERVICE LTD. will not be held responsible for loss or damage to above listed vehicle, or articles left in above listed vehicle I acknowledge receipt of a copy hereof. You agree to pay 2.5% per month on any outstanding balance.

Parts.....	5164.17
Labour.....	8537.50
Sublet.....	265.46
Shop Supplies	597.63
Freight.....	275.00

Sub Total	14839.76
Pst.....	873.89
Gst.....	741.99

Authorized By _____

TOTAL Continued



**JOBSITE
MECHANICAL
SERVICE**

Jobsite Mechanical Service Ltd.
P.O. BOX 22040 PARKLAND RPO
YORKTON SK S3N 4B2 CANADA
(306) 641-6766
jobsitemechanical.ca
GST/HST# 846229508RT0001

INVOICE **V**

Date 02/06/2025

Date Open 12/04/2024

Ship To :

Written By GREG	Terms CHG	Time 13:31:10	Customer Po #	NOTE	Phone	Ship Via
--------------------	--------------	------------------	---------------	------	-------	----------

Unit # 11	Plate #	Year 1997	Make MACK	Model CH613 600	Kilometer/Hrs 890672/0.0	VIN 1M1AA13Y7VW075789	Engine 12.0L L6 DI
--------------	---------	--------------	--------------	--------------------	-----------------------------	--------------------------	-----------------------

Qty	Description	Price	Amount
1.000	CAN037-2631-0 SCENT BOMB	24.27	24.27
1.000	AUT9505 A/C BELT	37.00	37.00
10.00	REDRD546390 PLUG	6.20	62.00
1.000	REDQ4379RD546941 BLOWER SWITCH	18.67	18.67
1.000	REDQ4379RD546930 SWITCH 5-PIN CONNECTOR	6.20	6.20
1.000	FRTINCOMING FREIGHT INCOMING	20.00	20.00
7.000	PATU46662 TERMINAL	3.07	21.50
1.000	RED4379RD354740 GASKET	31.98	31.98
1.000	FRTINCOMING FREIGHT INCOMING	25.00	25.00
		SubTotal	846.62
3.000	CLEANOUT HEADLINER/ SEE HOW MUCH OF A JOB IT IS/ WASH HEADLINER -removed 2 lights. -removed passenger handle, both visors and tabs. -removed upper compartment and radio. -radio bracket was riveted to cab. -drilled out rivets. -pulled liner. -vacuumed interior. -vacuumed headliner. -reinstalled headliner. -routed electrical for radio, lights and air horn through headliner. -installed screws in sun visors. -installed screws in visor holders.	150.00	450.00

I authorize the above repair work, including sublet work, to be done along with necessary materials. JOBSITE MECHANICAL SERVICE LTD. and your employees may operate above listed vehicle for purposes of testing, inspection or delivery at my own risk. An express Mechanic's Lien is acknowledged on above listed vehicle to secure the amount of repairs thereto. JOBSITE MECHANICAL SERVICE LTD. will not be held responsible for loss or damage to above listed vehicle, or articles left in above listed vehicle I acknowledge receipt of a copy hereof. You agree to pay 2.5% per month on any outstanding balance.

Parts.....	5164.17
Labour.....	8537.50
Sublet.....	265.46
Shop Supplies	597.63
Freight.....	275.00

Sub Total	14839.76
Pst.....	873.89
Gst.....	741.99

Authorized By _____

TOTAL Continued

COPY



**JOBSITE
MECHANICAL
SERVICE**

Jobsite Mechanical Service Ltd.
P.O. BOX 22040 PARKLAND RPO
YORKTON SK S3N 4B2 CANADA
(306) 641-6766
jobsitemechanical.ca
GST/HST# 846229508RT0001

INVOICE

Date 02/06/2025
Date Open 12/04/2024

Page: 3 of 21

Ship To :

Written By GREG	Terms CHG	Time 13:31:10	Customer Po #	NOTE	Phone	Ship Via	
Unit # 11	Plate #	Year 1997	Make MACK	Model CH613 600	Kilometer/Hrs 890672/0.0	VIN 1M1AA13Y7VW075789	Engine 12.0L L6 DI

Qty	Description	Price	Amount
1.000	-drilled rivets through for radio deck bracket. -installed new bolts and hardware for bracket. -hooked up radio electrical. -installed radio into place. -reinstalled lights and plugged pigtailed back in. -reinstalled rh grab handle. -installed push rivets into headliner.		
1.000	NAP665-2435 CLIP FASTENERS	12.93	12.93
1.000	NAP665-2399 RIVETS	12.93	12.93
2.000	WUR1/4X1CB 1/4X1 COARSE BOLT 074.14.1	0.47	0.93
4.000	WUR1/4FW 1/4 FLAT WASHER	0.23	0.93
2.000	WUR1/4LN 1/4 LOCK NUT 335.14	0.30	0.60
	SubTotal		478.32
5.000	CHECK ALL LIGHTS ARE WORKING/ DON'T WORRY ABOUT MIRROR LIGHTS -found damaged wire supplying box with power. -removed rear sill lamps and found all ground clips broken. -removed old wiring and rewired the rear of box with a ground return. -tested and all rear lamps are working. -repaired and cleaned ground clips until all lamps on the box work. -reinstalled all lamps. -inspected roof mounted lamps. -socket pins are corroded and breaking. -ordered new lamps. -replaced cab rod lights.	150.00	750.00

I authorize the above repair work, including sublet work, to be done along with necessary materials. JOBSITE MECHANICAL SERVICE LTD. and your employees may operate above listed vehicle for purposes of testing, inspection or delivery at my own risk. An express Mechanic's Lien is acknowledged on above listed vehicle to secure the amount of repairs thereto. JOBSITE MECHANICAL SERVICE LTD. will not be held responsible for loss or damage to above listed vehicle, or articles left in above listed vehicle I acknowledge receipt of a copy hereof. You agree to pay 2.5% per month on any outstanding balance.

Parts..... 5164.17
Labour..... 8537.50
Sublet..... 265.46
Shop Supplies 597.63
Freight..... 275.00

Sub Total 14839.76
Pst..... 873.89
Gst..... 741.99

Authorized By _____

TOTAL Continued



**JOBSITE
MECHANICAL
SERVICE**

Jobsite Mechanical Service Ltd.
P.O. BOX 22040 PARKLAND RPO
YORKTON SK S3N 4B2 CANADA
(306) 641-6766
jobsitemechanical.ca
GST/HST# 846229508RT0001

INVOICE

Date 02/06/2025
Date Open 12/04/2024

Ship To :

Written By GREG	Terms CHG	Time 13:31:10	Customer Po #	NOTE	Phone	Ship Via	
Unit # 11	Plate #	Year 1997	Make MACK	Model CH613 600	Kilometer/Hrs 890672/0.0	VIN 1M1AA13Y7VW075789	Engine 12.0L L6 DI

Qty	Description	Price	Amount
	-removed lenses from roof lights. -removed lights. -pre drilled mounting holes in each light. -cut wires at pigtailes and connected new lights. -installed lights. -tested..ok. -checked over unit and repairs.		
4.000	WUR555.51641 YELLOW CONNECTOR	2.47	9.87
10.00	WUR555.5714 BUTT CONNECTOR 14-16	4.28	42.77
2.000	WUR545.38 3/8" TUBE CLAMP RUBBER INSERT	2.60	5.20
2.000	WUR214.63.25 SELF TAPPING SCREWS	0.87	1.73
1.000	WUR555.51621 BLUE CONNECTOR	1.93	1.93
5.000	TRU67050 PLUG 2 WIRE	2.80	14.00
2.000	WUR772.7314 14 GAUGE 3 COND. WIRE	2.76	5.52
14.00	WUR772.7214 14 GAUGE 2 COND. WIRE	2.24	31.36
5.000	TRU46813 LIGHT	19.07	95.35
1.000	FRTINCOMING FREIGHT INCOMING	35.00	35.00
10.00	WUR555.51621 BLUE CONNECTOR	1.93	19.33

I authorize the above repair work, including sublet work, to be done along with necessary materials. JOBSITE MECHANICAL SERVICE LTD. and your employees may operate above listed vehicle for purposes of testing, inspection or delivery at my own risk. An express Mechanic's Lien is acknowledged on above listed vehicle to secure the amount of repairs thereto. JOBSITE MECHANICAL SERVICE LTD. will not be held responsible for loss or damage to above listed vehicle, or articles left in above listed vehicle I acknowledge receipt of a copy hereof. You agree to pay 2.5% per month on any outstanding balance

Parts.....	5164.17
Labour.....	8537.50
Sublet.....	265.46
Shop Supplies	597.63
Freight.....	275.00

Sub Total	14839.76
Pst.....	873.89
Gst.....	741.99

Authorized By _____

TOTAL Continued

COPY



**JOBSITE
MECHANICAL
SERVICE**

Jobsite Mechanical Service Ltd.
P.O. BOX 22040 PARKLAND RPO
YORKTON SK S3N 4B2 CANADA
(306) 641-6766
jobsitemechanical.ca
GST/HST# 846229508RT0001

INVOICE

Date 02/06/2025

Date Open 12/04/2024

Page: 5 of 21

Ship To :

Written By GREG	Terms CHG	Time 13:31:10	Customer Po #	NOTE	Phone	Ship Via	
Unit # 11	Plate #	Year 1997	Make MACK	Model CH613 600	Kilometer/Hrs 890672/0.0	VIN 1M1AA13Y7VW075789	Engine 12.0L L6 DI

Qty	Description	Price	Amount
1.000	WUR032.10.1 #10-32X1 MACHINE SCREW	0.50	0.50
	WHEN PUTTING FOOT IN TO THROTTLE, CUTS OUT/ SEE WHAT WE THINK AND LET CUSTOMER KNOW BEFORE FIXING -couldn't get truck to cut out -CUSTOMER SAID TO LEAVE	150.00	1012.56
11.00	CHECK A/C LEAK & LET CUSTOMER KNOW -connected machine and recovered remaining charge. -crimp on far side ac dryer. -line compressor to condensor high side. -high side fitting on expansion valve. -unthreaded lines from ac compressor. -unthreaded other end of high side from condensor. -removed both lines from expansion valve. -ordered new expansion valve. -inspected lines and new orings. -installed new orings onto ac compressor. -removed expansion valve...lower line was siezed. -soaked nut in fluid and let sit. -tried to remove valve. -removed intake piping to allow for more room. -removed coolant lines. -plugged and removed heater core. -removed bracket for expansion valve.	150.00	1650.00

I authorize the above repair work, including sublet work, to be done along with necessary materials. JOBSITE MECHANICAL SERVICE LTD. and your employees may operate above listed vehicle for purposes of testing, inspection or delivery at my own risk. An express Mechanic's Lien is acknowledged on above listed vehicle to secure the amount of repairs thereto. JOBSITE MECHANICAL SERVICE LTD. will not be held responsible for loss or damage to above listed vehicle, or articles left in above listed vehicle I acknowledge receipt of a copy hereof. You agree to pay 2.5% per month on any outstanding balance.

Parts.....	5164.17
Labour.....	8537.50
Sublet.....	265.46
Shop Supplies	597.63
Freight.....	275.00

Sub Total	14839.76
Pst.....	873.89
Gst.....	741.99

Authorized By _____

TOTAL Continued

COPY



**JOBSITE
MECHANICAL
SERVICE**

Jobsite Mechanical Service Ltd.
P.O. BOX 22040 PARKLAND RPO
YORKTON SK S3N 4B2 CANADA
(306) 641-6766
jobsitemechanical.ca
GST/HST# 846229508RT0001

INVOICE

Date 02/06/2025

Date Open 12/04/2024

Page: 6 of 21

Ship To :

Written By GREG	Terms CHG	Time 13:31:10	Customer Po #	NOTE	Phone	Ship Via	
Unit # 11	Plate #	Year 1997	Make MACK	Model CH613 600	Kilometer/Hrs 890672/0.0	VIN 1M1AA13Y7VW075789	Engine 12.0L L6 DI

Qty	Description	Price	Amount
	-removed valve and evaporator out in one piece.		
	-removed siezed line from valve.		
	-ordered new lines that were bent.		
	-installed new evaporator into place.	30.00	30.00
	-mounted expansion valve and connected lines.		
	-tightened all lines.		
	-installed heater core.	44.97	44.97
	-installed ac lines onto expansion valve.	338.24	338.24
	-pressured up ac system,	0.25	0.25
	-sprayed down lines and leak checked.		
	-blew line from drier to expansion valve.	30.00	30.00
	-removed line and ordered new.	0.75	0.75
	-installed ac line.	0.25	0.25
	-put nitrogen in system...is keeping pressure.	0.25	0.25
	-charged up ac.	0.25	0.25
	-removed intake pipe to fit new ac line.	2.25	2.25
	-secured one installed with p clamps.		
	-secure another line rubbing on bracket.	1.64	1.64
	-tested ac.	0.25	0.25
	-compressor not disengaging and it froze up.	0.25	0.25
	-troubleshoot...recovered freon to confirm charge and leak tested again.	0.25	0.25
	-removed doghouse cover and tested freeze switch.	0.25	0.25
	-vacuumed and filled freon.		
	-tested system.		
	-all appears ok.		

I authorize the above repair work, including sublet work, to be done along with necessary materials. JOBSITE MECHANICAL SERVICE LTD. and your employees may operate above listed vehicle for purposes of testing, inspection or delivery at my own risk. An express Mechanic's Lien is acknowledged on above listed vehicle to secure the amount of repairs thereto. JOBSITE MECHANICAL SERVICE LTD. will not be held responsible for loss or damage to above listed vehicle, or articles left in above listed vehicle I acknowledge receipt of a copy hereof. You agree to pay 2.5% per month on any outstanding balance.

Parts..... 5164.17
 Labour..... 8537.50
 Sublet..... 265.46
 Shop Supplies 597.63
 Freight..... 275.00

Sub Total 14839.76
 Pst..... 873.89
 Gst..... 741.99

Authorized By _____

TOTAL Continued

COPY



**JOBSITE
MECHANICAL
SERVICE**

Jobsite Mechanical Service Ltd.
P.O. BOX 22040 PARKLAND RPO
YORKTON SK S3N 4B2 CANADA
(306) 641-6766
jobsitemechanical.ca
GST/HST# 846229508RT0001

INVOICE

Date 02/06/2025
Date Open 12/04/2024

Page: 7 of 21

Ship To :

Written By GREG	Terms CHG	Time 13:31:10	Customer Po #	NOTE	Phone	Ship Via	
Unit # 11	Plate #	Year 1997	Make MACK	Model CH613 600	Kilometer/Hrs 890672/0.0	VIN 1M1AA13Y7VW075789	Engine 12.0L L6 DI

Qty	Description	Price	Amount
1.000	ATPAC-7501010 A/C REPAIR REPAIR 3 A/C LINES	389.41	389.41
1.000	FRTOUTGOING FREIGHT SEND HOSES TO REGINA FOR REPAIR	30.00	30.00
1.000	REDQ4379RD570151P EXPANSION VALVE	44.91	44.91
1.000	TRU83045020 EVAPORATOR	338.94	338.94
2.000	WURTS3 PLASTIC TIE STRAP 553.55040B	0.27	0.53
1.000	FRTINCOMING FREIGHT INCOMING	50.00	50.00
1.000	WUR1/4X2 1/2CB 1/4X2 1/2 COARSE BOLT 074.14.212	0.73	0.73
2.000	WUR1/4FW 1/4 FLAT WASHER	0.23	0.47
1.000	WUR1/4LN 1/4 LOCK NUT 335.14	0.30	0.30
1.000	WUR545.2 2" TUBE CLAMP RUBBER INSERT	2.23	2.23
2.000	WUR545.34 3/4" TUBE CLAMP RUBBER INSERT	1.64	3.29
1.000	WUR1/4X3/4CB 1/4X3/4 COARSE BOLT 074.14.34	0.37	0.37
1.000	WUR1/4LN 1/4 LOCK NUT 335.14	0.30	0.30
1.000	WUR1/4FW 1/4 FLAT WASHER	0.23	0.23
5.000	WURTS3 PLASTIC TIE STRAP 553.55040B	0.27	1.34
3.000	TRUR134A A/C REFRIGERANT	44.00	132.00
	SubTotal		2645.05

I authorize the above repair work, including sublet work, to be done along with necessary materials. JOBSITE MECHANICAL SERVICE LTD. and your employees may operate above listed vehicle for purposes of testing, inspection or delivery at my own risk. An express Mechanic's Lien is acknowledged on above listed vehicle to secure the amount of repairs thereto. JOBSITE MECHANICAL SERVICE LTD will not be held responsible for loss or damage to above listed vehicle, or articles left in above listed vehicle I acknowledge receipt of a copy hereof. You agree to pay 2.5% per month on any outstanding balance.

Parts..... 5164.17
Labour..... 8537.50
Sublet..... 265.46
Shop Supplies 597.63
Freight..... 275.00

Sub Total 14839.76
Pst..... 873.89
Gst..... 741.99

Authorized By _____

TOTAL Continued



**JOBSITE
MECHANICAL
SERVICE**

Jobsite Mechanical Service Ltd.
P.O. BOX 22040 PARKLAND RPO
YORKTON SK S3N 4B2 CANADA
(306) 641-6766
jobsitemechanical.ca
GST/HST# 846229508RT0001

COPY

INVOICE

Date 02/06/2025
Date Open 12/04/2024

Page: 8 of 21

Ship To :

Written By GREG	Terms CHG	Time 13:31:10	Customer Po #	NOTE	Phone	Ship Via
--------------------	--------------	------------------	---------------	------	-------	----------

Unit # 11	Plate #	Year 1997	Make MACK	Model CH613 600	Kilometer/Hrs 890672/0.0	VIN 1M1AA13Y7VW075789	Engine 12.0L L6 DI
--------------	---------	--------------	--------------	--------------------	-----------------------------	--------------------------	-----------------------

Qty	Description	Price	Amount
.5000	SAFETY: FIRE EXTINGUISHER NOT WITHIN DRIVERS REACH <i>-installed bracket and new fire extinguisher.</i>	150.00	75.00
1.000	TRUABC050VWDL FIRE EXTINGUISHER	78.29	78.29
4.000	WUR214.48.38 SELF TAPPING SCREWS	0.57	2.27
	SubTotal		155.56
.3500	SAFETY: 3RD AXLE R/H UPPER SHOCK MOUNT BOLT LOOSE <i>-heated nut and tightened it up.</i>	150.00	52.50
	SubTotal		52.50
2.500	SAFETY: EXHAUST LEAK- PIPE BEHIND TURBO BROKEN <i>-removed turbo clamp...was under cab and difficult to reach. -had to cut clamps from broken pipe and other end of pipe to remove. -found other end of pipe going to muffler was rusted. -removed pipe. -installed new flex and clamped into place. -installed clamp. -adjusted piping as needed. -tightened clamps.</i>	150.00	375.00
1.000	REDQ25100597 EXHAUST PIPE	563.08	563.08
1.000	TRU35806 V- BAND CLAMP	38.14	38.14
1.000	TRU33969 CLAMP 4"	16.36	16.36

I authorize the above repair work, including sublet work, to be done along with necessary materials. JOBSITE MECHANICAL SERVICE LTD. and your employees may operate above listed vehicle for purposes of testing, inspection or delivery at my own risk. An express Mechanic's Lien is acknowledged on above listed vehicle to secure the amount of repairs thereto. JOBSITE MECHANICAL SERVICE LTD. will not be held responsible for loss or damage to above listed vehicle, or articles left in above listed vehicle I acknowledge receipt of a copy hereof. You agree to pay 2.5% per month on any outstanding balance.

Parts..... 5164.17
Labour..... 8537.50
Sublet..... 265.46
Shop Supplies 597.63
Freight..... 275.00

Sub Total 14839.76
Pst..... 873.89
Gst..... 741.99

TOTAL Continued

Authorized By _____



**JOBSITE
MECHANICAL
SERVICE**

Jobsite Mechanical Service Ltd.
P.O. BOX 22040 PARKLAND RPO
YORKTON SK S3N 4B2 CANADA
(306) 641-6766
jobsitemechanical.ca
GST/HST# 846229508RT0001

COPY

INVOICE

Date 02/06/2025
Date Open 12/04/2024

Page: 9 of 21

Ship To :

Written By GREG	Terms CHG	Time 13:31:10	Customer Po #	NOTE	Phone	Ship Via
--------------------	--------------	------------------	---------------	------	-------	----------

Unit # 11	Plate #	Year 1997	Make MACK	Model CH613 600	Kilometer/Hrs 890672/0.0	VIN 1M1AA13Y7VW075789	Engine 12.0L L6 DI
--------------	---------	--------------	--------------	--------------------	-----------------------------	--------------------------	-----------------------

Qty	Description	Price	Amount
2.000	TRU33225 CLAMP	17.43	34.86
2.000	TRU49035 5" STAINLESS FLEXTUBE FT	27.65	55.30
	SubTotal		1082.74
2.500	SAFETY: REPLACE 3RD AXLE RADIUS ROD -covered air springs with torching bolt heads off from radius rod to diff housing. -removed bolts. -moved airlines and cut bolt heads off other side. -cleaned up plates. -installed new bolts and radius rod. -tightened. -removed damaged section of airline and repaired. -checked for any air leaks. -zip tied up lines.	150.00	375.00
1.000	TRUTMR63 RADIUS ROD	226.75	226.75
1.000	FRTINCOMING FREIGHT INCOMING	30.00	30.00
4.000	WUR5/8X5CB 5/8X5 COARSE BOLT	5.98	23.92
4.000	WUR5/8LN 5/8 LOCK NUT 335.58	1.13	4.53
8.000	WUR5/8FW 5/8 FLAT WASHER 422.58	0.63	5.07
2.500	TRU192601 3/8" SYNDFLEX PER FOOT	1.15	2.88

I authorize the above repair work, including sublet work, to be done along with necessary materials. JOBSITE MECHANICAL SERVICE LTD. and your employees may operate above listed vehicle for purposes of testing, inspection or delivery at my own risk. An express Mechanic's Lien is acknowledged on above listed vehicle to secure the amount of repairs thereto. JOBSITE MECHANICAL SERVICE LTD. will not be held responsible for loss or damage to above listed vehicle, or articles left in above listed vehicle I acknowledge receipt of a copy hereof. You agree to pay 2.5% per month on any outstanding balance.

Parts.....	5164.17
Labour.....	8537.50
Sublet.....	265.46
Shop Supplies	597.63
Freight.....	275.00

Sub Total	14839.76
Pst.....	873.89
Gst.....	741.99

Authorized By _____

TOTAL Continued



**JOBSITE
MECHANICAL
SERVICE**

Jobsite Mechanical Service Ltd.
P.O. BOX 22040 PARKLAND RPO
YORKTON SK S3N 4B2 CANADA
(306) 641-6766
jobsitemechanical.ca
GST/HST# 846229508RT0001

COPY

INVOICE

Date 02/06/2025

Date Open 12/04/2024

Page: 10 of 21

Ship To :

Written By GREG	Terms CHG	Time 13:31:10	Customer Po #	NOTE	Phone	Ship Via	
Unit # 11	Plate #	Year 1997	Make MACK	Model CH613 600	Kilometer/Hrs 890672/0.0	VIN 1M1AA13Y7VW075789	Engine 12.0L L6 DI

Qty	Description	Price	Amount
1.000	WUR884.1462-6 AIR BRAKE COUPLING DOT NYLON 3/8	6.16	6.16
1.000	WUR884.1462-4 AIR BRAKE COUPLING DOT NYLON 1/4 884.1462-4	4.64	4.64
1.000	WUR884.1460-6 AIR BRAKE SLEEVE FOR NYLON 3/8	0.97	0.97
1.000	WUR884.1468-4B 1/4 AIR BRAKE CONNECTOR	4.12	4.12
2.500	TRU14854 1/4" SYN FLEX	0.73	1.83
1.000	WURTS2 TS2 PLASTIC TIE 553.550301	0.08	0.08
		SubTotal	685.95
1.150	SAFETY: REPAIR BROKEN WELDS ON TAIL LAMP PLATE -cleaned rust up from area. -had to cut bolt for middle section to allow for more room. -cleaned weld are and welded. -bolted middle section back up.	150.00	172.50
		SubTotal	172.50
2.500	SAFETY: REPAIR ALL BROKEN FUEL TANK STRAPS -set jack up under tank to support. -removed bolts. -had to heat strap tension nut to remove. -removed slack and cut straps. -installed new straps and tightened them up. -had to replace 1 nut. -cleaned threads on strap and installed.	150.00	375.00

I authorize the above repair work, including sublet work, to be done along with necessary materials. JOBSITE MECHANICAL SERVICE LTD. and your employees may operate above listed vehicle for purposes of testing, inspection or delivery at my own risk. An express Mechanic's Lien is acknowledged on above listed vehicle to secure the amount of repairs thereto. JOBSITE MECHANICAL SERVICE LTD. will not be held responsible for loss or damage to above listed vehicle, or articles left in above listed vehicle I acknowledge receipt of a copy hereof. You agree to pay 2.5% per month on any outstanding balance.

Parts.....	5164.17
Labour.....	8537.50
Sublet.....	265.46
Shop Supplies	597.63
Freight.....	275.00

Sub Total	14839.76
Pst.....	873.89
Gst.....	741.99

TOTAL Continued

Authorized By _____

COPY



**JOBSITE
MECHANICAL
SERVICE**

Jobsite Mechanical Service Ltd.
P.O. BOX 22040 PARKLAND RPO
YORKTON SK S3N 4B2 CANADA
(306) 641-6766
jobsitemechanical.ca
GST/HST# 846229508RT0001

INVOICE

Date 02/06/2025
Date Open 12/04/2024

Ship To :

Written By GREG	Terms CHG	Time 13:31:10	Customer Po #	NOTE	Phone	Ship Via
--------------------	--------------	------------------	---------------	------	-------	----------

Unit # 11	Plate #	Year 1997	Make MACK	Model CH613 600	Kilometer/Hrs 890672/0.0	VIN 1M1AA13Y7VW075789	Engine 12.0L L6 DI
--------------	---------	--------------	--------------	--------------------	-----------------------------	--------------------------	-----------------------

Qty	Description	Price	Amount
4.000	REDQ25132753 FUEL TANK STRAP	195.84	783.38
1.000	FRTINCOMING FREIGHT INCOMING	35.00	35.00
3.000	WUR1/2X3CB 1/2X3 COARSE BOLT 074.12.3	4.60	13.80
6.000	WUR1/2FW 1/2 FLAT WASHER 410.12	0.28	1.67
3.000	WUR1/2LN 1/2 LOCK NUT 335.12	1.20	3.60
	SubTotal		1212.45
1.000	SAFETY: REPLACE L/H WINDSHIELD SUBLET ITEM 1 REPLACE L/H WINDSHIELD	0.00 265.46	 265.46
	SubTotal		265.46
.2500	SAFETY: REPLACE BOTH WIPER BLADES <i>-removed wiper blades and installed new.</i>	150.00	37.50
2.000	TRUA20M WIPER BLADE. ANCO 20"	18.73	37.46
	SubTotal		74.96
.8500	SAFETY: REPAIR WINDSHIELD WASHERS <i>-filled washer reservoir and checked pump function. -heard pump working. -inspected lines. -was damage to both sections. -removed damaged sections and replaced with new. -checked function...ok. -adjusted nozzles.</i>	150.00	127.50

I authorize the above repair work, including sublet work, to be done along with necessary materials. JOBSITE MECHANICAL SERVICE LTD. and your employees may operate above listed vehicle for purposes of testing, inspection or delivery at my own risk. An express Mechanic's Lien is acknowledged on above listed vehicle to secure the amount of repairs thereto. JOBSITE MECHANICAL SERVICE LTD. will not be held responsible for loss or damage to above listed vehicle, or articles left in above listed vehicle I acknowledge receipt of a copy hereof. You agree to pay 2.5% per month on any outstanding balance.

Parts.....	5164.17
Labour.....	8537.50
Sublet.....	265.46
Shop Supplies	597.63
Freight.....	275.00

Sub Total	14839.76
Pst.....	873.89
Gst.....	741.99

Authorized By _____

TOTAL Continued

COPY



**JOBSITE
MECHANICAL
SERVICE**

Jobsite Mechanical Service Ltd.
P.O. BOX 22040 PARKLAND RPO
YORKTON SK S3N 4B2 CANADA
(306) 641-6766
jobsitemechanical.ca
GST/HST# 846229508RT0001

INVOICE

Date 02/06/2025

Date Open 12/04/2024

Page: 12 of 21

Ship To :

Written By GREG	Terms CHG	Time 13:31:10	Customer Po #	NOTE	Phone	Ship Via	
Unit # 11	Plate #	Year 1997	Make MACK	Model CH613 600	Kilometer/Hrs 890672/0.0	VIN 1M1AA13Y7VW075789	Engine 12.0L L6 DI

Qty	Description	Price	Amount
3.000	TRU27041 WIPER/VACUUM HOSE	1.00	3.00
		SubTotal	130.50
1.000	SAFETY: REPLACE FAN BELT -loosened alternator tension bolt to loosen belt. -had to remove airline for fan hub to get belt out. -removed ac belt. -installed new ac belt. -installed new fan belts. -tensioned belts. -reinstalled airline.	150.00	150.00
1.000	REDQ23962315 BELT	68.18	68.18
		SubTotal	218.18
.7500	SAFETY: SECURE R/H HEADLAMP WIRING -removed old rusted p clamp. -installed new clamp with new bolt onto inner headlight housing. -secured new clamp.	150.00	112.50
2.000	WUR545.1 1" TUBE CLAMP RUBBER INSERT	1.70	3.40
2.000	WUR5/16X1CB 5/16X1 COARSE BOLT 074.516.1	0.67	1.33
4.000	SMS5/16FW STAINLESS FLAT WASHER	0.10	0.40
2.000	WUR5/16LN 5/16 LOCK NUT 335.516	0.33	0.67
		SubTotal	118.30

I authorize the above repair work, including sublet work, to be done along with necessary materials. JOBSITE MECHANICAL SERVICE LTD. and your employees may operate above listed vehicle for purposes of testing, inspection or delivery at my own risk. An express Mechanic's Lien is acknowledged on above listed vehicle to secure the amount of repairs thereto. JOBSITE MECHANICAL SERVICE LTD. will not be held responsible for loss or damage to above listed vehicle, or articles left in above listed vehicle I acknowledge receipt of a copy hereof. You agree to pay 2.5% per month on any outstanding balance

Parts.....	5164.17
Labour.....	8537.50
Sublet.....	265.46
Shop Supplies	597.63
Freight.....	275.00

Sub Total	14839.76
Pst.....	873.89
Gst.....	741.99

Authorized By _____

TOTAL Continued

COPY



**JOBSITE
MECHANICAL
SERVICE**

Jobsite Mechanical Service Ltd.
P.O. BOX 22040 PARKLAND RPO
YORKTON SK S3N 4B2 CANADA
(306) 641-6766
jobsitemechanical.ca
GST/HST# 846229508RT0001

INVOICE

Date 02/06/2025
Date Open 12/04/2024

Page: 13 of 21

Ship To :

Written By GREG	Terms CHG	Time 13:31:10	Customer Po #	NOTE	Phone	Ship Via	
Unit # 11	Plate #	Year 1997	Make MACK	Model CH613 600	Kilometer/Hrs 890672/0.0	VIN 1M1AA13Y7VW075789	Engine 12.0L L6 DI

Qty	Description	Price	Amount
1.900	SAFETY: REPAIR 3RD AXLE R/H AIR SPRING- HEIGHT CONTROL LINK RUBBED INTO BELLOWS BECAUSE LINK END IS BUCKLED <i>-removed upper and lower mounting nuts for rod. -measured up replacement kit...not correct. -got a direct replacement and installed. -cut rod to size and installed ends. -secured clamps. -mounted one end on valve arm and other end on repaired bracket at base of air springs. -started removing air line. -had to remove 2 siezed bolts on top of bracket. -removed bottom bolt and removed air bag. -ordered new air bag. -installed new air bag.</i>	150.00	285.00
1.000	TRU48100225 LINKAGE	32.27	32.27
1.000	WUR1/4X1CB 1/4X1 COARSE BOLT 074.14.1	0.47	0.47
2.000	WUR1/4FW 1/4 FLAT WASHER	0.23	0.47
1.000	WUR1/2NLN NYLON LOCKNUT 1/2"	0.53	0.53
1.000	TRUAS9375P AIR SPRING	201.43	201.43
1.000	FRTINCOMING FREIGHT INCOMING	15.00	15.00
	SubTotal		535.17

I authorize the above repair work, including sublet work, to be done along with necessary materials. JOBSITE MECHANICAL SERVICE LTD. and your employees may operate above listed vehicle for purposes of testing, inspection or delivery at my own risk. An express Mechanic's Lien is acknowledged on above listed vehicle to secure the amount of repairs thereto. JOBSITE MECHANICAL SERVICE LTD. will not be held responsible for loss or damage to above listed vehicle, or articles left in above listed vehicle I acknowledge receipt of a copy hereof. You agree to pay 2.5% per month on any outstanding balance

Parts..... 5164.17
Labour..... 8537.50
Sublet..... 265.46
Shop Supplies 597.63
Freight..... 275.00

Sub Total 14839.76
Pst..... 873.89
Gst..... 741.99

Authorized By _____

TOTAL Continued



**JOBSITE
MECHANICAL
SERVICE**

Jobsite Mechanical Service Ltd.
P.O. BOX 22040 PARKLAND RPO
YORKTON SK S3N 4B2 CANADA
(306) 641-6766
jobsitemechanical.ca
GST/HST# 846229508RT0001

INVOICE

Date 02/06/2025
Date Open 12/04/2024

Ship To :

Written By GREG	Terms CHG	Time 13:31:11	Customer Po #	NOTE	Phone	Ship Via	
Unit # 11	Plate #	Year 1997	Make MACK	Model CH613 600	Kilometer/Hrs 890672/0.0	VIN 1M1AA13Y7VW075789	Engine 12.0L L6 DI

Qty	Description	Price	Amount
2.000	SAFETY: REPAIR DRL'S -got universal DRL module. -found old module to test. -pulled dash panel to get to fuses. -got DRL wiring diagram. -checekd resistance on DRL module pins. -tested voltage. -tested module pins on dash to find constant power vs which pins are feeding the high beam / low beam and the park brake DRL switch....tested good. -searched for switch that turns DRLs on when park brake is removed. -found several air operated switches under steering column. -tested ohms at each one with brake brake on and off to find DRL valve switch. -tested ohms from switch to battery and had a poor ground. -wires go into a cluster behind the dash. -mapped out ground locations. -tested DRL module socket...ok. -installed aftermarket SRL module. -tested...ok.	150.00	300.00
1.000	TRU44270 DAY TIME RUNING LIGHT DRL	86.63	86.63
4.000	WUR555.94522 BLUE 1/4" MALE ELECTRICAL CONNECTORS	1.31	5.26
1.000	WUR555.9092 BLUE 5MM ELECTRICAL CONNECTOR	1.21	1.21
	SubTotal		393.10

I authorize the above repair work, including sublet work, to be done along with necessary materials. JOBSITE MECHANICAL SERVICE LTD. and your employees may operate above listed vehicle for purposes of testing, inspection or delivery at my own risk. An express Mechanic's Lien is acknowledged on above listed vehicle to secure the amount of repairs thereto. JOBSITE MECHANICAL SERVICE LTD will not be held responsible for loss or damage to above listed vehicle, or articles left in above listed vehicle I acknowledge receipt of a copy hereof. You agree to pay 2.5% per month on any outstanding balance.

Parts..... 5164.17
Labour..... 8537.50
Sublet..... 265.46
Shop Supplies 597.63
Freight..... 275.00

Sub Total 14839.76
Pst..... 873.89
Gst..... 741.99

TOTAL Continued

Authorized By _____



**JOBSITE
MECHANICAL
SERVICE**

Jobsite Mechanical Service Ltd.
P.O. BOX 22040 PARKLAND RPO
YORKTON SK S3N 4B2 CANADA
(306) 641-6766
jobsitemechanical.ca
GST/HST# 846229508RT0001

INVOICE \

Date

02/06/2025

Date Open

12/04/2024

Page: 15 of 21

Ship To :

Written By GREG	Terms CHG	Time 13:31:11	Customer Po #	NOTE	Phone	Ship Via	
Unit # 11	Plate #	Year 1997	Make MACK	Model CH613 600	Kilometer/Hrs 890672/0.0	VIN 1M1AA13Y7VW075789	Engine 12.0L L6 DI

Qty	Description	Price	Amount
2.000	SAFETY: PERFORM CLUTCH ADJUSTMENT -removed 2 inspection cover bolts. -housing was packed full of grease. -cleaned out grease. -adjustment bolt looked like it was rubbing on something. -removed clutch bolts. -cleaned adjustment piece and inspected. -pulled the adjuster back in. -found a piece of metal in the grease while cleaning. -inspected. -adjusted clutch. -found there was too much free play. -backed off clevis nut on clutch cable in cab. -removed hair and clevis pins. -adjusted free play...was at max. -reinstalled pins.	150.00	300.00
		SubTotal	300.00
.2500	SAFETY: REPAIR INSECURE VALVE BESIDE #2 R/H AXLE SPRING HANGER -located valve and confirmed issue. -installed p clamp and new bolt.	150.00	37.50
1.000	WUR545.1 1" TUBE CLAMP RUBBER INSERT	1.70	1.70
1.000	WUR5/16X1CB 5/16X1 COARSE BOLT 074.516.1	0.67	0.67

I authorize the above repair work, including sublet work, to be done along with necessary materials. JOBSITE MECHANICAL SERVICE LTD. and your employees may operate above listed vehicle for purposes of testing, inspection or delivery at my own risk. An express Mechanic's Lien is acknowledged on above listed vehicle to secure the amount of repairs thereto. JOBSITE MECHANICAL SERVICE LTD. will not be held responsible for loss or damage to above listed vehicle, or articles left in above listed vehicle I acknowledge receipt of a copy hereof. You agree to pay 2.5% per month on any outstanding balance.

Parts.....	5164.17
Labour.....	8537.50
Sublet.....	265.46
Shop Supplies	597.63
Freight.....	275.00

Sub Total	14839.76
Pst.....	873.89
Gst.....	741.99

Authorized By _____

TOTAL Continued



**JOBSITE
MECHANICAL
SERVICE**

Jobsite Mechanical Service Ltd.
P.O. BOX 22040 PARKLAND RPO
YORKTON SK S3N 4B2 CANADA
(306) 641-6766
jobsitemechanical.ca
GST/HST# 846229508RT0001

INVOICE \

Date 02/06/2025

Date Open 12/04/2024

Ship To :

Written By GREG	Terms CHG	Time 13:31:11	Customer Po #	NOTE	Phone	Ship Via
--------------------	--------------	------------------	---------------	------	-------	----------

Unit # 11	Plate #	Year 1997	Make MACK	Model CH613 600	Kilometer/Hrs 890672/0.0	VIN 1M1AA13Y7VW075789	Engine 12.0L L6 DI
--------------	---------	--------------	--------------	--------------------	-----------------------------	--------------------------	-----------------------

Qty	Description	Price	Amount
2.000	WUR5/16LW 5/16 LOCK WASHER 444.516	0.23	0.47
1.000	WUR5/16LN 5/16 LOCK NUT 335.516	0.33	0.33
		SubTotal	40.67
1.000	SAFETY: REPAIR #2 L/H AXLE ASA INSTALL OR BRAKE NOT RETURNING FULLY #2 L/H AXLE BRAKE SHOES APPEAR RUST JACKED -aired up unit. -released brakes. -loosened adjustment nut. -adusted ASA. -tightened nut. -tested. -removed wheels off hub. -broke drum loose and removed. -brakes looked ok. -cleaned off hub and inner drum. -measured drum. -mounted drum. -mounted wheel. -torqued wheel.	150.00	150.00
		SubTotal	150.00
.7500	SAFETY: REPAIR #3 AXLE L/H CLEVIS/PIN/BUSHING -removed plug from air tank. -threaded in adapter for airline to tank. -aired unit up.	150.00	112.50

I authorize the above repair work, including sublet work, to be done along with necessary materials. JOBSITE MECHANICAL SERVICE LTD. and your employees may operate above listed vehicle for purposes of testing, inspection or delivery at my own risk. An express Mechanic's Lien is acknowledged on above listed vehicle to secure the amount of repairs thereto. JOBSITE MECHANICAL SERVICE LTD. will not be held responsible for loss or damage to above listed vehicle, or articles left in above listed vehicle I acknowledge receipt of a copy hereof. You agree to pay 2.5% per month on any outstanding balance.

Parts.....	5164.17
Labour.....	8537.50
Sublet.....	265.46
Shop Supplies	597.63
Freight.....	275.00

Sub Total	14839.76
Pst.....	873.89
Gst.....	741.99

Authorized By _____

TOTAL Continued



**JOBSITE
MECHANICAL
SERVICE**

Jobsite Mechanical Service Ltd.
P.O. BOX 22040 PARKLAND RPO
YORKTON SK S3N 4B2 CANADA
(306) 641-6766
jobsitemechanical.ca
GST/HST# 846229508RT0001

INVOICE

Date 02/06/2025
Date Open 12/04/2024

Ship To :

Written By GREG	Terms CHG	Time 13:31:11	Customer Po #	NOTE	Phone	Ship Via	
Unit # 11	Plate #	Year 1997	Make MACK	Model CH613 600	Kilometer/Hrs 890672/0.0	VIN 1M1AA13Y7VW075789	Engine 12.0L L6 DI

Qty	Description	Price	Amount
	-aired up unit. -released brakes. -puller cotter pin. -removed clevis pin. -backed ASA out of clevis. -removed bushing. -got new parts. -installed new bushing. -applied anti sieze and installed new clevis. -installed new cotter pin. -made brake adjustment. -tested repair.		
1.000	TRU45210129 CLEVIS BUSHING	4.93	4.93
1.000	WUR471.18.1 1/8X1/2 COTTER PIN	0.20	0.20
1.000	ENVIRO1	0.55	0.55
	SubTotal		118.18
12.00	REPLACE RADIATOR -placed blocks under hood. -released hood springs. -drained coolant. -removed hood catch cables. -removed air ducts from intercooler. -had to cut siezed clamps to remove. -removed upper rad hose. -removed lower rad hose.	150.00	1800.00

I authorize the above repair work, including sublet work, to be done along with necessary materials. JOBSITE MECHANICAL SERVICE LTD. and your employees may operate above listed vehicle for purposes of testing, inspection or delivery at my own risk. An express Mechanic's Lien is acknowledged on above listed vehicle to secure the amount of repairs thereto. JOBSITE MECHANICAL SERVICE LTD will not be held responsible for loss or damage to above listed vehicle, or articles left in above listed vehicle I acknowledge receipt of a copy hereof. You agree to pay 2.5% per month on any outstanding balance.

Parts..... 5164.17
Labour..... 8537.50
Sublet..... 265.46
Shop Supplies 597.63
Freight..... 275.00

Sub Total 14839.76
Pst..... 873.89
Gst..... 741.99

Authorized By _____

TOTAL Continued



**JOBSITE
MECHANICAL
SERVICE**

Jobsite Mechanical Service Ltd.
P.O. BOX 22040 PARKLAND RPO
YORKTON SK S3N 4B2 CANADA
(306) 641-6766
jobsitemechanical.ca
GST/HST# 846229508RT0001

INVOICE

Date

02/06/2025

Date Open

12/04/2024

Page: 18 of 21

Ship To :

Written By GREG	Terms CHG	Time 13:31:11	Customer Po #	NOTE	Phone	Ship Via	
Unit # 11	Plate #	Year 1997	Make MACK	Model CH613 600	Kilometer/Hrs 890672/0.0	VIN 1M1AA13Y7VW075789	Engine 12.0L L6 DI

Qty	Description	Price	Amount
	<ul style="list-style-type: none"> -unbolted rad mounts and lifted. -had to cut lh mount bolt out. -removed mounting bolts from intercooler to rad housing. -had to cut 4 fan shroud bolt heads off. -unbolted fan shroud. -removed receiver dryer. -removed intercooler and condensor. -removed lower portion of sides of rad. -stripped down rad. -pre drilled housing mounts for new rad. -unpacked new rad. -collected rad housing pieces. -installed housing. -cleaned bottom mount. -installed bottom of rad. -tightened bolts. -had to install new bolts where ones were cut. -mounted shroud. -installed al bolts and tightened. -tightened bottom of housing. -cut head of carriage bolt from rad to remove bushing plate. -had to cut other side bolt as well. -removed plate. -installed plate with new bolts. -installed rad tension rods. -installed intercooler. -installed receiver dryer. 		

I authorize the above repair work, including sublet work, to be done along with necessary materials. JOBSITE MECHANICAL SERVICE LTD. and your employees may operate above listed vehicle for purposes of testing, inspection or delivery at my own risk. An express Mechanic's Lien is acknowledged on above listed vehicle to secure the amount of repairs thereto. JOBSITE MECHANICAL SERVICE LTD. will not be held responsible for loss or damage to above listed vehicle, or articles left in above listed vehicle I acknowledge receipt of a copy hereof. You agree to pay 2.5% per month on any outstanding balance

Parts.....	5164.17
Labour.....	8537.50
Sublet.....	265.46
Shop Supplies	597.63
Freight.....	275.00

Sub Total	14839.76
Pst.....	873.89
Gst.....	741.99

Authorized By _____

TOTAL Continued



**JOBSITE
MECHANICAL
SERVICE**

Jobsite Mechanical Service Ltd.
P.O. BOX 22040 PARKLAND RPO
YORKTON SK S3N 4B2 CANADA
(306) 641-6766
jobsitemechanical.ca
GST/HST# 846229508RT0001

INVOICE

Date 02/06/2025
Date Open 12/04/2024

Ship To :

Written By GREG	Terms CHG	Time 13:31:11	Customer Po #	NOTE	Phone	Ship Via
--------------------	--------------	------------------	---------------	------	-------	----------

Unit # 11	Plate #	Year 1997	Make MACK	Model CH613 600	Kilometer/Hrs 890672/0.0	VIN 1M1AA13Y7VW075789	Engine 12.0L L6 DI
--------------	---------	--------------	--------------	--------------------	-----------------------------	--------------------------	-----------------------

Qty	Description	Price	Amount
	-installed ac hoses on intercooler and secured with clamps.		
	-installed bushings.		
	-hoisted rad into place and aligned mounts.		
	-installed bushing plate.		
	-torqued into place.		
	-hooked up hood catch and springs.	3.43	3.43
	-installed upper rad hose.	81.97	81.97
	-installed lower rad hose.	2.25	2.25
	-installed intercooler pipes and ac hoses.	465.78	465.78
	-tightened hose clamps.	15.00	15.00
	-plugged ground harness back in.	0.00	0.00
	-connected airlines for fan hub and rad housing.	4.00	4.00
	-plugged drier receiver pigtail back in.	4.00	4.00
	-filled coolant.	0.00	0.00
	-plugged blower motor back in.	0.00	0.00
	-reinstalled blower motor into place.	1.13	1.13
	-ran unit to temp and drained coolant.	16.73	16.73
	-installed line from receiver drier to condensor and tightened.	3.43	3.43
	-changed coolant filter.	16.14	16.14
	-drained overflow reservoir.	0.33	0.33
	-topped up with water for 2nd flush.	0.00	0.00
	-while flushing the reservoir upper rad hose blew.	0.00	0.00
	-removed line and replaced with new.	0.00	0.00
	-turned head up on cab temp control and ran at high idle.	0.00	0.00
	-topped up coolant.	0.00	0.00
	-checked for leaks.		
	-secured coolant reservoir sensor harness.		

I authorize the above repair work, including sublet work, to be done along with necessary materials. JOBSITE MECHANICAL SERVICE LTD. and your employees may operate above listed vehicle for purposes of testing, inspection or delivery at my own risk. An express Mechanic's Lien is acknowledged on above listed vehicle to secure the amount of repairs thereto. JOBSITE MECHANICAL SERVICE LTD. will not be held responsible for loss or damage to above listed vehicle, or articles left in above listed vehicle I acknowledge receipt of a copy hereof. You agree to pay 2.5% per month on any outstanding balance.

Parts.....	5164.17
Labour.....	8537.50
Sublet.....	265.46
Shop Supplies	597.63
Freight.....	275.00

Sub Total	14839.76
Pst.....	873.89
Gst.....	741.99

Authorized By _____

TOTAL Continued

COPY



**JOBSITE
MECHANICAL
SERVICE**

Jobsite Mechanical Service Ltd.
P.O. BOX 22040 PARKLAND RPO
YORKTON SK S3N 4B2 CANADA
(306) 641-6766
jobsitemechanical.ca
GST/HST# 846229508RT0001

INVOICE

Date 02/06/2025
Date Open 12/04/2024

Page: 20 of 21

Ship To :

Written By GREG	Terms CHG	Time 13:31:11	Customer Po #	NOTE	Phone	Ship Via	
Unit # 11	Plate #	Year 1997	Make MACK	Model CH613 600	Kilometer/Hrs 890672/0.0	VIN 1M1AA13Y7VW075789	Engine 12.0L L6 DI

Qty	Description	Price	Amount
	-secured wiring. -installed a missing bolt at rad. -topped up coolant.		
1.000	WUR664.1307611 3" CUT OFF WHEEL	8.43	8.43
2.000	REDQ20961320546 RAD SUPPORT ROD	61.57	123.13
2.000	WUR0942.350.008 RIVNUT	2.89	5.78
1.000	REDQ1000RAD37155P RAD	965.76	965.76
1.000	FRTINCOMING FREIGHT INCOMING	35.00	35.00
4.000	WURM8X20 M8X20 BOLT 068.8..20	0.60	2.39
2.000	WUR5/8X4CB 5/8X4 COARSE BOLT 074.58.4	4.90	9.80
4.000	WUR5/8FW 5/8 FLAT WASHER 422.58	0.63	2.54
2.000	WUR5/8LN 5/8 LOCK NUT 335.58	1.13	2.27
2.000	REDM62447 BUSHINGS	24.73	49.47
1.000	TRUHC6128 GEAR CLAMP	3.43	3.43
6.000	TRUHC19412 CLAMP	15.14	90.84
1.000	SNPCTGR-CW50MP 5" CUTTING DISC	6.33	6.33
4.000	WURM8X20 M8X20 BOLT 068.8..20	0.60	2.39
4.000	WURM8FW M8 FLAT WASHER 402.8	0.23	0.93

I authorize the above repair work, including sublet work, to be done along with necessary materials. JOBSITE MECHANICAL SERVICE LTD. and your employees may operate above listed vehicle for purposes of testing, inspection or delivery at my own risk. An express Mechanic's Lien is acknowledged on above listed vehicle to secure the amount of repairs thereto. JOBSITE MECHANICAL SERVICE LTD. will not be held responsible for loss or damage to above listed vehicle, or articles left in above listed vehicle I acknowledge receipt of a copy hereof. You agree to pay 2.5% per month on any outstanding balance.

Parts.....	5164.17
Labour.....	8537.50
Sublet.....	265.46
Shop Supplies	597.63
Freight.....	275.00

Sub Total	14839.76
Pst.....	873.89
Gst.....	741.99

TOTAL Continued

Authorized By _____

COPY



**JOBSITE
MECHANICAL
SERVICE**

Jobsite Mechanical Service Ltd.
P.O. BOX 22040 PARKLAND RPO
YORKTON SK S3N 4B2 CANADA
(306) 641-6766
jobsitemechanical.ca
GST/HST# 846229508RT0001

INVOICE

Date 02/06/2025
Date Open 12/04/2024

Page: 21 of 21

Ship To :

Written By GREG	Terms CHG	Time 13:31:11	Customer Po #	NOTE	Phone	Ship Via
--------------------	--------------	------------------	---------------	------	-------	----------

Unit # 11	Plate #	Year 1997	Make MACK	Model CH613 600	Kilometer/Hrs 890672/0.0	VIN 1M1AA13Y7VW075789	Engine 12.0L L6 DI
--------------	---------	--------------	--------------	--------------------	-----------------------------	--------------------------	-----------------------

Qty	Description	Price	Amount
4.000	WUR329.10.32 #10-32 HEX NUT	0.10	0.40
4.000	WUR403.8 #8 WASHER	0.13	0.53
4.000	WUR403.10 #10 LOCKWASHER	0.60	2.38
1.000	TRUBW5178 COOLANT FILTER	15.20	15.20
2.000	WUR884.1461-4 AIR BRAKE NUT FOR NYLON 1/4	1.53	3.07
2.000	WUR884.1460-4 AIR BRAKE SLEEVE FOR NYLON 1/4	0.42	0.83
1.000	WUR#32 1 1/2-2 1/2 CLAMP 535.32	2.86	2.86
2.000	HYD124-1950 HYD COUPLING	15.66	31.32
76.00	HYD456-8432 #4 HYDRAULIC HOSE MEASURED IN CM	0.22	16.72
29.00	LUBCOOLANT COOLANT/PER LITER	4.17	120.96
1.000	WURM8X20 M8X20 BOLT 068.8..20	0.60	0.60
		SubTotal	3303.36

I authorize the above repair work, including sublet work, to be done along with necessary materials. JOBSITE MECHANICAL SERVICE LTD. and your employees may operate above listed vehicle for purposes of testing, inspection or delivery at my own risk. An express Mechanic's Lien is acknowledged on above listed vehicle to secure the amount of repairs thereto. JOBSITE MECHANICAL SERVICE LTD. will not be held responsible for loss or damage to above listed vehicle, or articles left in above listed vehicle I acknowledge receipt of a copy hereof. You agree to pay 2.5% per month on any outstanding balance.

Parts.....	5164.17
Labour.....	8537.50
Sublet.....	265.46
Shop Supplies	597.63
Freight.....	275.00

Sub Total	14839.76
Pst.....	873.89
Gst.....	741.99

Authorized By _____

TOTAL 16455.64