



# Vehicle History Detail



Fleet #	PM400
Registration	XQ35SE
Make	Kenworth
Model	K200
VIN / Chassis #	6F5000000MA469823

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
		<b>JUMPSTART</b> R-7204	WARREGO TRANSPORT REPAIRS PTY LTD		\$220.00
25/02/2026	941,100 kms	<b>A S-16255</b> A SERVICED CUSTOM AIR SYSTEM @4402HRS NEXT DUE 4561HRS REPLACED 4X BRAKE SHOES AND DRUMS	QLD WORKSHOP		\$0.00
25/02/2026	941,100 kms	<b>ROTATE DRIVES, ROTATE STEER</b> T-4030	TREADCARE PTY LTD		\$0.00
25/02/2026	941,100 kms	<b>BRAKE RELINE</b> R-7115 REMOVED AND REPLACED BRAKE LININGS AND DRUMS	QLD WORKSHOP		\$1,088.56
16/02/2026	937,015 kms	<b>AIR CONDITIONER</b> R-7075	QLD WORKSHOP		\$220.00
22/01/2026	928,764 kms	<b>REPLACE BATTERIES</b> R-6991 REMOVE AND REPLACED FAULTY BATTERY'S 4X NEW HEAVY HAULER BATTERY'S, CHECKED CHARGE RATE WAS @ 14.4 VLTS, TRUCK ALL GOOD SENT BACK INTO SERVICE	QLD WORKSHOP		\$594.00
14/01/2026	928,328 kms	<b>A S-15917</b> carry out a service replace drive brakes next service coolant transfer pipe weeping	QLD WORKSHOP		\$0.00
14/01/2026	928,329 kms	<b>ROTATE DRIVES, ROTATE STEER</b> T-3917 8 X ROTATE DRIVES 2 X ROTATE STEERS	DARREN BUDD'S TYRES PTY LTD		\$0.00
09/12/2025	911,475 kms	<b>B S-15721</b> CARRY OUT B SERVICE	MELBOURNE VIC WORKSHOP		\$434.81
25/11/2025	898,583 kms	<b>A S-15537</b>	MELBOURNE VIC WORKSHOP		\$0.00
20/10/2025	885,051 kms	<b>295/80R BRIDGESTONE</b> T-3677	DARREN BUDD'S TYRES PTY LTD		\$0.00
07/10/2025	881,700 kms	<b>A S-15186</b> CARRY OUT A SERVICE 100K TOP TUNE EXHAUST FLEX HORN AD BLU TANK BREATHER UNBLOCKED	QLD WORKSHOP		\$110.00

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
17/09/2025	868,000 kms	<b>bushes</b> R-6390 REPLACED BUSH ON THE BACK OF THE GANTRY.	QLD WORKSHOP		\$19.06
15/09/2025	868,000 kms	<b>A S-15037</b> REPLACED GANTRY BUSH EXTENDED THE ROCKER COVER BREATHER. 1ST AND 2ND UNIS ARE DESTROYED.	QLD WORKSHOP		\$0.00
01/09/2025	856,136 kms	<b>tv antenna</b> R-6331 REPLACE AXIS TV ANTENNA	QLD WORKSHOP	3639055	\$373.80
25/08/2025	853,633 kms	<b>B S-14923</b> CARRY OUT B SERVICE	QLD WORKSHOP		\$172.23
11/08/2025	844,370 kms	<b>AIR DRYER</b> R-6181	QLD WORKSHOP		\$550.00
11/08/2025	844,370 kms	<b>C S-14665</b> C SERVICE NEW AIR DRYER SYSTEM NO TOP TUNE.	QLD WORKSHOP		\$928.72
11/08/2025	844,370 kms	<b>Heavy Vehicle Inspection Checklist - Truck</b> I-778	QLD WORKSHOP		\$0.00
04/08/2025	838,902 kms	<b>A S-14593</b> A SERVICE COMPLETED CUSTOM AIR SYSTEM SERVICED @3755HRS NEXT DUE @4055HRS TRUCK IS STILL HAVING FUEL DRAIN BACK ISSUES DROPPING ALL PRESSURE IN 15 SECONDS, REPLACED CHECK VALVE OFF A SOLD TRUCK AND FUEL RAIL PRESSURE WAS HOLDING. TRUCK USING OIL HEAVLY 10LTRS ADDED IN 15,000KLMS. ENGINE IS BREATHING HEAVY 1ST DIFF LEAKING HEAVILY.	QLD WORKSHOP		\$0.00
21/07/2025	827,935 kms	<b>AIR LEAK</b> R-6112 REPLACED GOVENOR VALVE AS IT WAS CONSTANTLY EXHAUSTING RE-KITTED AIR DRYER UNLOADER VALVE TIDY ENGINE WIRING LOOM	QLD WORKSHOP		\$103.58
11/07/2025	823,400 kms	<b>A S-14491</b>	QLD WORKSHOP		\$0.00
04/07/2025		<b>blow by, fuel consumption, rpm spiking</b> R-6045			\$0.00
27/06/2025	802,214 kms	<b>ELECTRICAL</b> R-6009 REPLACED THE SPEED SENSOR ON THE BACK OF THE GEARBOX AS THE MAGNET HAD GONE OUT, THE SENSOR WAS ALL SCRAPED UP AND OUT OF SPEC	QLD WORKSHOP		\$0.00
16/06/2025	809,214 kms	<b>ROTATE DRIVES, ROTATE STEER</b> T-3400 ROTATE DRIVES DIAGONAL STEER AS REQ	QLD WORKSHOP		\$0.00
16/06/2025	809,214 kms	<b>A S-14302</b> CARRY OUT A SERVICE CUSTOM AIR 3642 HRS SERVICE DUE 3735 HRS ENGINE BREATHING HEAVY MOVEMENT IN BOTH TAILSHAFT UNIS	QLD WORKSHOP		\$0.00
03/06/2025	800,085 kms	<b>CLUTCH</b> R-5924 TRUCK CAME IN WITH CLUTCH OPERATING ISSUES, FOUND ON INSPECTION CLUTCH PINCH BOLT LOOSE RE-TIGHTENED AND HAVE MARKED THE PINCH BOLT WITH A PAINT MARKER TRUCK ALL GOOD SENT BACK TO WORK	KENWORTH TRUCKSPACCAR PARTS		\$220.00

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
26/05/2025	794,000 kms	<b>B S-14140</b> CUSTOM AIR @3580HRS NEXT DUE @3735HRS REPLACED PYRO AS IT WAS BROKEN REPLACED V BAND CLAMP REPLACED	QLD WORKSHOP		\$525.27
06/05/2025	782,729 kms	<b>A S-13935</b> CUSTOM AIR SERVICED @3518 NEXT DUE @3735 NEW LOWER STEERING UNI RESEALED AIR DRYER TANK	QLD WORKSHOP		\$83.48
01/04/2025	765,810 kms	<b>ENGINE REBUILD R-5667</b> TRUCK ENGINE REMOVED AND NEW BLOCK ASSEMBLED NEW ENIGINE REINSTALLED SENT BACK TO SRV 7/4/25	CUMMINS SOUTH PACIFIC PTY LTD		\$0.00
31/03/2025	766,198 kms	<b>NEW DRIVES, ROTATE TYRES T-3269</b> 8 X NEW DRIVES FITTED OFF XB08A0 2 X STEER ROTATE	DARREN BUDD'S TYRES PTY LTD		\$165.00
31/03/2025	766,198 kms	<b>A S-13749</b> FILLED WITH 15LTRS OF COOLANT NEW HIGH BEAM GLOBES BOTH SIDES CUSTOM AIR SERVICED @3435 NEXT DUE @3735 TIGHTENED TOP CUSTOM AIR MOUNT FIXED MANUAL CAB JACK NEW RADIATOR CAP	QLD WORKSHOP		\$72.87
05/03/2025	752,101 kms	<b>A S-13583</b> REPLACED DRIVERS SIDE INDICATOR SERVICED CUSTOM AIR SYSTEM	QLD WORKSHOP		\$74.60
13/02/2025	739,135 kms	<b>ADBLUE FAULT R-5504</b> FLUSHED ADBLUE SYSTEM CLEARED CODES CARRIED OUT FLOW TEST FOUND SYSTEM PUMPING 120ML IN 6 MINS.	QLD WORKSHOP		\$0.00
10/02/2025	736,381 kms	<b>ROTATE DRIVES, ROTATE STEER T-3146</b> ROTATED DRIVES DIAGONAL STEERS SIDE/SIDE	DARREN BUDD'S TYRES PTY LTD		\$165.00
10/02/2025	736,810 kms	<b>B S-13380</b> CUSTOM AIR UNIT AT 3208 HOURS DUE 3300 HOURS REPLACED STEERING WHEEL AS NEEDED	QLD WORKSHOP		\$701.42
28/01/2025	729,908 kms	<b>ADBLUE FAULT R-5440</b>	QLD WORKSHOP		\$494.24
17/01/2025	720,223 kms	<b>A S-13224</b> ADDED 15 LITRE OF COOLANT ADDED 4 LITRES OIL	QLD WORKSHOP		\$0.00
09/01/2025	713,700 kms	<b>INDICATOR LIGHT R-5346</b> REMOVED AND REPLACED DRIVERS SIDE INDICATOR LIGHT, TEST ALL OK	QLD WORKSHOP	3426881	\$75.53
19/12/2024	708,074 kms	<b>TENSIONERS R-5290</b> DROVE TO BREAKDOWN UP THE HUME HWY ON INSPECTION FOUND BELT TENSIONER HAD FAILED AND THREW THE DRIVE BELT REMOVED OLD TENSIONER AND FITTED NEW ONE AND REINSTALLED BELT TESTED OK TRUCK SENT TO WORK	MELBOURNE DIESEL MECHANICS		\$726.77
16/12/2024	706,222 kms	<b>A S-12971</b> ADJUSTED CLUTCH AS REQUIRED BROKEN CROSS MEMBER GUSSET 2ND DRIVE 2 TORQUE ROD BUSHES U/S	QLD WORKSHOP		\$0.00

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
16/12/2024	706,222 kms	<b>GUSSET, STARTER MOTOR, TORQUE ROD BUSHES, WINDSCREEN</b> R-5245 REMOVED AND REPLACED STARTER MOTOR ON KILOMETERS AS REQUIRED. SECURED ALL WIRING INTO PLACE AS REQUIRED, TESTED ALL OPERATIONS, ALL WORKING AS NEEDED. REPLACED U/S GUSSET AS REQUIRED, SECURED INTO PLACE, ALL OKAY. REPLACED U/S TORQUE ROD BUSHES ON 2ND DRIVE AXLE, 2 NEW BUSHES FITTED ALL OKAY.	QLD WORKSHOP, THE FIXER CORPORATION PTY LTD	FIX-19406	\$1,451.47
22/11/2024	690,746 kms	<b>A S-12821</b> A SERVICE , HORN NOT WORKING , WIPER WASHERS NOT WORKING	QLD WORKSHOP		\$0.00
07/11/2024	677,073 kms	<b>DIFF LEAK, WARRANTY</b> R-5111 TRUCK SENT TO BROWN AND HURLEY FOR FRONT DIFF LEAKING REPAIRED UNDER DRIVE-LINE WARRANTY THRUST WASHER IN POWER DIVIDER ALSO REPLACED DUE TO WEAR	BROWN & HURLEY GROUP		\$0.00
01/11/2024	677,073 kms	<b>B S-12594</b> B-SERVICE FRONT DIFF LEAKING HEAVILY	QLD WORKSHOP		\$210.41
11/10/2024	662,090 kms	<b>ROTATE DRIVES</b> T-2886 ROTATE DRIVES SIDE/SIDE STEER AS REQ CARRIED OUT BY QLD WORKSHOP	QLD WORKSHOP		\$0.00
11/10/2024	662,090 kms	<b>A S-12398</b> A-SERVICE TYRE ROTATE	QLD WORKSHOP		\$0.00
24/09/2024	651,104 kms	<b>NEW STEERS</b> T-2865 2 X R154 BRIDGESTONE STEER TYRES FITTED TOO POS 1 & 2	DARREN BUDD'S TYRES PTY LTD		\$1,485.00
17/09/2024	648,549 kms	<b>DOSER PUMP</b> R-4965 ATTEMPTED ADBLUE FLUSH PUMP NOT RESPONDING RUN TESTS FOUND PUMP U/S REMOVED AND REPLACED PUMP FLUSHED AND RUN PUMP OVER RIDE TEST ALL OPERATIONAL SENT BACK TO SERVICE.	QLD WORKSHOP		\$3,038.53
13/09/2024	646,695 kms	<b>A S-12187</b>	QLD WORKSHOP		\$0.00
02/09/2024	638,127 kms	<b>A S-12064</b> A-SERVICE FRONT DIFF LEAKING HEAVILY	QLD WORKSHOP		\$0.00
15/08/2024	626,816 kms	<b>SPEED SENSOR</b> R-4851 Replacing faulty speed senser with new. road tested all ok Using INSITE to reset faults	QLD WORKSHOP		\$182.40
06/08/2024	620,988 kms	<b>Heavy Vehicle Inspection Checklist - Truck</b> I-545	QLD WORKSHOP		\$0.00
05/08/2024	620,988 kms	<b>C S-11770</b> D/S AXLES COMPLETED BY JACK. B P/S AXLES COMPLETED BY MATT. C TOP TUNE COMPLETED BY MATT. C D/S KING PIN HAS MOVEMENT	QLD WORKSHOP		\$997.22

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
05/08/2024	620,988 kms	<b>COMPRESSOR, NOx SENSOR, TRANSFER WATER PIPE</b> R-4797 REMOVE AND REPLACED ORINGS FOR COOLANT TRANSFER PIPE, CLEANED ALL SURFACES, TEST DRIVE, NO LEAKS FOUND DONE BY MATT. C REPLACED NOX SENSOR WITH NEW, TESTED ALL WORKING CORRECTLY , DONE BY MATT. C DROPPED ALL COOLANT OUT OF THE SYSTEM ,REMOVED OLD COMPRESSOR, CLEANED OLD GASKET OFF THE TIMING COVER AND FRONT OF POWER STEERING PUMP, SPRAY PAINTED NEW COMPRESSOR ON THE BENCH WITH THE NEW COMPRESSOR NEW O RINGS AND FITTINGS WERE ADDED AND TIGHTENED INTO THE CORRECT SPOT IN THE COMPRESSOR HEAD, NEW OUTPUT FITTING ADDED ON TO THE COMPRESSOR, NEW GASKET ADDED ONTO THE TIMING COVER AND BOLTED UP THE COMPRESSOR TO THE TIMING COVER TORQUED TO SPEC. BOLTED THE POWER STEERING PUMP UT TO THE BACK OF THE COMPRESSOR USING A NEW GASKET, CONNECTED ALL THE COOLANT HOSES, AIR OUTLET HOSE AND VACUME HOSE OFF INTAKE BACK TO ORIGINAL POSITIONING, TORQUING EVERYTHING TO SPEC. ADDED COOLANT AND STARTED TRUCK, TEST DRIVE, EVERYTHING WAS DRY, NUT AND BOLT CHECK. TRUCK SENT BACK INTO SERVICE	QLD WORKSHOP	3286420/3291641	\$5,391.36
26/06/2024	616,939 kms	<b>B S-11419</b> B-SERVICE BOTH DIFFS LEAKING BOTH WITH LOOSE BOLTS 2ND UNI MOVEMENT D/S KING PIN HAS MOVEMENT COOLANT TRANSFER PIPE LEAKING	QLD WORKSHOP		\$222.80
26/06/2024	616,939 kms	<b>ROTATE DRIVES, ROTATE STEER</b> T-2662 ROTATE DRIVES DIAGONAL STEERS SIDE / SIDE	DARREN BUDD'S TYRES PTY LTD	00032304	\$165.00
29/05/2024	600,915 kms	<b>GEAR STICK BOOT</b> R-4560 UNBOLT DRIVER SEAT TO LIFT UP BASE TO REMOVE GEAR STICK BOOT, REMOVE AND REPLACED GEAR STICK BOOT, BOLT DOWN DRIVER SEAT SENT BACK INTO SERVICE	QLD WORKSHOP	3218981	\$89.21
28/05/2024	600,915 kms	<b>A S-11171</b> CUSTOM AIR SERVICED AT 2375HRS 1ST DIFF LEAKING ( WARRENTY) REPAIRED D/S HI-BEAM EARTH CONNECTION	QLD WORKSHOP		\$39.63
22/05/2024	597,329 kms	<b>ebs plug</b> R-4531 REMOVED AND REPLACED FAULTY EBS PLUG WITH NEW REPLACED BLOWN FUSES, ALL WORKING CORRECTLY SENT BACK INTO SERVICE	QLD WORKSHOP		\$91.87
12/04/2024	589,351 kms	<b>ROTATE STEER</b> T-2479 ROTATE STEERS AS REQUIRED DRIVES ONLY FITTED FROM XQ70HH 4/3/24	DARREN BUDD'S TYRES PTY LTD		\$33.00
04/04/2024	585,625 kms	<b>AFTER TREATMENT</b> R-4284 FLUSHED ADBLUE SYSTEM WITH HOT WATER AS REQUIRED, RAN PUMP OVERRIDE TEST AND CLEARED ADBLUE FAULT AS NEEDED. PUMP HAS BEEN FLUSHED EACH WEEK AS AFTERTREAT LIGHT CONTINUES TO COME ON, NEXT TIME LIGHT COMES ON TRUCK IS TO GO BACK TO BROWN AND HURLEY FOR WARRANTY ON DOSER PUMP, KILOMETERS 585625. HOURS 7435.	QLD WORKSHOP		\$0.00
04/04/2024	585,625 kms	<b>A S-10721</b> ADJUSTED CLUTCH AS REQUIRED TIGHTENED BELLY BAR 1ST DRIVE DIFF CENTRE GASKET LEAKING BOTH UNI ON DRIVESHAFT U/S	QLD WORKSHOP		\$0.00

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
07/03/2024	575,996 kms	<b>AIR LINE, AIR LINE FITTINGS</b> R-4187 REMOVED DECK PLATE AND PULLED THROUGH ALL AIR LINES BACK INTO CHASSIS AND REMOVED FROM SUPPLY VALVES, NEW AIR LINES RUN ALONG CHASSIS AND THROUGH OCTOHOSE AND CUT TO CORRECT LENGTH TO SUIT TRAILER CONFIGURATION AS REQUIRED, FITTED 45 DEGREE 1/2 INCH FITTINGS AND THEN FITTED BULKHEADS TO AIR LINES AS REQUIRED, REFITTED DECK PLATE AND HOOKED UP TRUCK TO TRAILER SET TO ENSURE ALL HOSE LENGTHS WERE CORRECT, TRUCK ALL GOOD, ALL OKAY USED 5 METERS OF 1/2 INCH AIRLINE HOSE	QLD WORKSHOP		\$78.96
04/03/2024	575,655 kms	<b>STRIP/FIT</b> T-2424 10 STRIP/FIT RUNOUTS FROM XQ70HH	DARREN BUDD'S TYRES PTY LTD		\$275.00
27/02/2024	575,635 kms	<b>cab shocker</b> R-4152 ON INSPECTION FOUND BOTH CAB SHOCKS LEAKING REMOVE AND REPLACED BOTH CAB SHOCKS WITH NEW	QLD WORKSHOP		\$932.76
26/02/2024	575,636 kms	<b>LATCH CORD</b> R-4149 REPLACED THE LATCH CORD	QLD WORKSHOP		\$15.94
08/02/2024	571,990 kms	<b>A S-10261</b> Cleaned out worklight terminals, light working Topped up wiper washer bottle, cleaned out washerlines, all working Oil filter was leaking, tightened filter as it was loose Belly bar was loose tightened	QLD WORKSHOP		\$0.00
19/01/2024	557,606 kms	<b>B S-10090</b> b service	MELBOURNE VIC WORKSHOP		\$173.80
12/01/2024	552,152 kms	<b>ADBLUE FAULT, AIR FITTINGS</b> R-3946 PLUGGED IN COMPUTER AND FOUND AD-BLUE PUMP ISSUES, REMOVED INJECTOR, FOUND BLOCKED CLEANED OUT. FOUND SMALL FITTINGS OFF AD-BLUE PUMP WORN, AND REPLACED SMALL FITTING WITH NEW. PERFORMED HOT FLUSH WHILE ACTIVATING CLICK TEST TO PUMP HOT WATER THROUGH PUMP UP TO INJECTOR. PLUGGED BACK IN AIR LINE AND PERFORMED PUMP OVERRIDE TEST ALL WORKING OCCRRECTLY. ALL CODES CLEARED. REPLACED LEAKING FITTING AT SUZI COILS FOUND CONNECTOR FROM INTAKE MANIFOLD TO BOOST GAUGE BLOCKED SENT BACK INTO SERIVCE	QLD WORKSHOP	3082500	\$147.68
08/12/2023	542,225 kms	<b>A S-9728</b> ICE-PACK SERVICED AT 2073HRS	QLD WORKSHOP	3073245	\$41.14
04/12/2023	538,531 kms	<b>ALTERNATOR</b> R-3800 CHECK ALTERNATOR RATE WHILE RUNNING, CHARGING AT 11.6 VOLTS DISCONNECTED BATTERIES, REMOVE AND REPLACED ALTERNATOR, CLEANED ALL TERMINALS. FITTED UP ALL TERMINALS TO NEW ALTERNATOR, REPLACED VAULT GAUGE 10AMP FUSE. CONNECTED BATTERY TERMINALS RAN TRUCK UP AND CHECKED CHARGE RATE, CHARGING AT 13.6V SENT TRUCK BACK INTO SERVICE	QLD WORKSHOP		\$533.10
22/11/2023	530,701 kms	<b>REKIT HORTON FAN HUB</b> R-3745 REKITTED THE HORTON FAN WITH ALL NEW COMPONENTS ALL NEW BEARINGS AND ORINGS	QLD WORKSHOP	3054540	\$707.72
17/11/2023	525,449 kms	<b>A S-9542</b> REPLACED LEAKING GEAR BOX PRESSURE SWITCH ADBLUE FLUSH	QLD WORKSHOP	3049335	\$58.64

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
07/11/2023	520,654 kms	<b>TURBO ON KLMS</b> R-3717 REMOVED AND REPLACED TURBO, EXHAUST GASKETS AND ALL OIL O-RINGS. REITTED ALL PARTS ALL OK, MARKED ALL BOLTS TO ENSURE NO MOVMENT IN THE FUTURE, TEST DROVE ALL OK, SENT TRUCK BACK INTO SERVICE	QLD WORKSHOP	3055058	\$5,563.21
27/10/2023	513,233 kms	<b>A S-9352</b> EXCESSIVE MOVEMENT IN BOTH TAILSHAFT UNI JOINTS ICE PACK AT 1890 HOURS DUE AT 2040 HOURS	QLD WORKSHOP		\$0.00
27/10/2023	513,234 kms	<b>ROTATE DRIVES, ROTATE STEER</b> T-2064 2X STEERS ROTATE SIDE SIDE 4X ROTATE DIAGONAL 4X T.O.R	DARREN BUDD'S TYRES PTY LTD	30241	\$209.00
05/10/2023	496,516 kms	<b>B S-9168</b> MOVEMENT IN 1ST,2ND UNI TIGHTEN STEERING ARM BOLT ICE-PACK CURRENTLY 1830HRS DUE 2040HRS	QLD WORKSHOP	3009434	\$172.76
11/09/2023	480,677 kms	<b>A S-8976</b> SERVIED THE ICEPACK	QLD WORKSHOP	2989387	\$41.14
05/09/2023	476,799 kms	<b>ICE PACK</b> R-3440 FOUND BROKEN EARTH WIRE BETWEEN STARTER MOTOR AND EARTHING POINT FIXED WIRE EVERYTHING WORKING CORRECTLY	QLD WORKSHOP		\$0.00
25/08/2023	469,483 kms	<b>Heavy Vehicle Inspection Checklist - Truck</b> I-310			\$0.00
24/08/2023	469,483 kms	<b>CLUTCH, TRANSFER WATER PIPE, WIPER BLADE</b> R-3401 LOOKED THROUGH CLUTCH INSPECTION HOLE AND FOUND CLUTCH SPRING. DRAINED GEARBOX OIL REMOVED TOP AIR INTAKES TO PREVENT DAMAGE, DROP OUT DRIVELINE REMOVED GEARBOX AND CLEANED IN FRONT HOUSING, REMOVED FRONT HOUSING FROM GEARBOX AND REMOVED ALL GASKET AND O-RINGS AND REPLACED WITH NEW, REMOVED INPUT SHAFT AND BEARINGS REPLACED WITH NEW. REMOVED CLUTCH AND FOUND MORE BROKEN SPRINGS. REMOVED FLYWHEEL AND SENT TO BROWN AND HURLEY TO BE MACHINED. RE-INSTALLED FLYWHEEL AND TORQUED TO 92-184FT/LB, INSTALLED CLUTCH AND TORQUED TO 60FT/LB. INSTALLED GEARBOX AND FITTED UP WIRING AND ALL FITTINGS. FOUND COOLANT LEAK FROM BOTTOM O-RING ON COOLANT PIPE BEHIND TURBO. DRAINED COOLANT AND REMOVED ALL PIPING AND O-RINGS AND GASKET, CLEANED ALL SURFACES, FITTED UP NEW ORINGS AND RUBBER GASKET APPLIED RUBBER GREASE TO PREVENT SPLITTING OF O-RINGS. MOUNTED UP ALL PIPING, FILLED RADIATOR UP WITH COOLANT RAN UNIT AND CHECKED FOR LEAKS. REMOVE AND REPLACED BROKEN AD-BLUE INJECTOR FITTING REMOVE AND REPLACED WIPER BLADES. NO LEAKS FOUND SENT TRUCK BACK INTO SERVICE	QLD WORKSHOP	2972641	\$3,211.46
18/08/2023	469,483 kms	<b>C S-8710</b>	QLD WORKSHOP	2964321	\$1,091.27
10/08/2023	462,363 kms	<b>Reverse Alarm</b> R-3347 REMOVE AND REPLACE ALARM/ BUZZER	QLD WORKSHOP		\$105.95
21/07/2023	450,941 kms	<b>A S-8513</b> FUEL PUMP HAS LEAK FROM REAR MOVEMENT IN 2ND UNI ICE-PACK 1616HRS CURRENTLY DUE 1740HRS	QLD WORKSHOP		\$0.00
03/07/2023	436,028 kms	<b>B S-8359</b>	QLD WORKSHOP	2926384	\$170.55

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
03/07/2023	436,028 kms	<b>ROTATE DRIVES</b> T-1801 ROTATED DRIVE AXLE TYRES DIAGONAL AS REQUIRED	QLD WORKSHOP		\$0.00
05/06/2023	420,158 kms	<b>R154 BRIDGESTONE</b> T-1767 fitted new steer tyres	TREADCARE PTY LTD	147086	\$1,457.50
05/06/2023	420,158 kms	<b>TORQUE ROD BUSHES</b> R-3212 removed torque rod, pressed out torn bushes, pressed in new bushes, refitted torque rod to truck	MELBOURNE VIC WORKSHOP	583906	\$448.58
05/06/2023	420,158 kms	<b>A S-8173</b> 2 new steer tyres Left hand front torque rod bush torn (replaced)	MELBOURNE VIC WORKSHOP		\$0.00
12/05/2023	406,726 kms	<b>A S-7984</b>	QLD WORKSHOP		\$0.00
17/04/2023	391,026 kms	<b>ICE PACK, REVERSE BUZZER</b> R-3034 REMOVED REVERSE ALARM AND INSTALL REVERSE SQUAWKER ICEPACK SERVICED AT 1440HRS	QLD WORKSHOP	2853083 PO7505	\$79.34
17/04/2023	391,027 kms	<b>ROTATE DRIVES, ROTATE STEER</b> T-1649 ROTATED ALL DRIVES SIDE TO SIDE ROTATED AND BALANCED STEERS SIDE TO SIDE	DARREN BUDD'S TYRES PTY LTD	00028796	\$165.00
12/04/2023	391,026 kms	<b>A S-7760</b> ICEPACK SERVICED AT 1440HRS INSTALLED REVERSE SQUAWKER	QLD WORKSHOP		\$0.00
21/03/2023	376,215 kms	<b>A S-7571</b>	MELBOURNE VIC WORKSHOP		\$0.00
21/02/2023	361,309 kms	<b>B S-7284</b> MOVEMENT IN 2ND UNI	QLD WORKSHOP		\$0.00
27/01/2023	343,838 kms	<b>A S-7074</b>	QLD WORKSHOP		\$0.00
24/01/2023	341,885 kms	<b>FLIP ON RIM, ROTATE/BALANCE STEER, ROTATE DRIVES</b> T-1456 ROTATED, BALANCED AND FLIPPED BOTH STEERS ROTATED ALL DRIVES SIDE TO SIDE	DARREN BUDD'S TYRES PTY LTD	28079 PO6941	\$198.00
18/01/2023	337,223 kms	<b>BATTERY, CHECK BATTERIES</b> R-2764 CHECK BATTERY WATER LEVEL, LEVEL IS GOOD LOAD TEST ALL BATTERY, ALL FAILED REMOVE AND REPLACE ALL BATTERY CHECK ALTERNATOR CHARGE RATE, CHARGING AT 14 VOLTS	QLD WORKSHOP	2735856 PO6877	\$1,227.60
05/01/2023	328,996 kms	<b>A S-6873</b> ICE PACK SERVICED AT 1066 HOURS WATER IN FUEL KERO ADDED TO TANKS 500ML	QLD WORKSHOP	2726544 PO6775	\$40.10
03/12/2022	312,241 kms	<b>A S-6635</b> 2ND UNI AS MOVEMENT	QLD WORKSHOP		\$0.00
15/11/2022	298,920 kms	<b>FANBELT IDLER</b> R-2558 SENT TRUCK TO CUMMINS BRISBANE FOR REPAIRS, REMOVED PLATES AND RETHREADED BOLTH HOLES, REPLACED ROCKER COVER GASKET ALL COVERED UNDER WARRENTY.	CUMMINS SOUTH PACIFIC PTY LTD		\$0.00
11/11/2022	298,890 kms	<b>B S-6447</b> FRONT FANBELT IDLER TRIANGLE LEAKING FROM THREADED BOLT LEAK FROM TAPPET COVER	QLD WORKSHOP	2703371 PO6364	\$159.66
21/10/2022	285,489 kms	<b>A S-6288</b>	QLD WORKSHOP		\$0.00

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
13/10/2022	281,421 kms	<b>NEW DRIVE TYRES</b> T-1319 ALL NEW M766 BRIDGESTONE DRIVE TYRES FITTED UP ALL OK	DARREN BUDD'S TYRES PTY LTD	27310 PO6165	\$6,206.20
26/09/2022	269,895 kms	<b>A S-6115</b>	QLD WORKSHOP		\$0.00
02/09/2022	254,981 kms	<b>A S-5946</b> POWER STEER HOSE FROM PUMP LOOSE ROCKER COVER LEAKING RETIGHTEND	MELBOURNE VIC WORKSHOP		\$0.00
08/08/2022	239,811 kms	<b>B S-5792</b> SMALL OIL WEEP FROM TIMING COVER BEHIND BELT PULLY SMALL OIL WEEP FROM TAPPET COVER - RETIGHTEND WIRE LOOM RUBBING ON ICEPACK BELT - ZIPTIE UP OUT OF WAY	QLD WORKSHOP	2550100 PO5744	\$159.67
20/07/2022	236,149 kms	<b>C S-5663</b>	QLD WORKSHOP	2542287 PO5605	\$892.50
20/07/2022		<b>Heavy Vehicle Inspection Checklist - Truck</b> I-102			\$0.00
11/07/2022	230,758 kms	<b>GEAR BOX</b> R-2197 GEAR BOX FAILED DUE TO DRIVER ABUSE, NEW GEAR BOX WAS SENT DOWN TO GET FITTED UP ALL OK	BROWN & HURLEY GROUP	2510596 PO5409	\$12,025.84
13/06/2022	224,350 kms	<b>A S-5378</b> AIR CLEANER GANTRY BRACKET SNAPPED SENTED WAY TO GET WELDED NEEDS UNI 1ST DIFF TIGHTEN CLAMP ON BOTTOM RADIATOR PIPE TIGHTEN CLAMP ON OIL FED LINE OIL LEAK FRONT BOTTOM ENG POWER STEERING PUMP LEAKING	QLD WORKSHOP		\$0.00
30/05/2022	214,155 kms	<b>ROTATE/BALANCE STEER, ROTATE DRIVES</b> T-1152 ROTATED AND BALANCED STEER TYRES ALL OK ROTATED ALL DRIVES CROSS TO CROSS FLIPPED ALL INSIDE TYRES ON RIMS	DARREN BUDD'S TYRES PTY LTD	00026314 PO5249	\$231.00
28/05/2022	214,155 kms	<b>A S-5242</b> power steering pump leaking oil on front off eng maybe from idler plant	QLD WORKSHOP		\$0.00
05/05/2022	194,182 kms	<b>A S-5114</b>	QLD WORKSHOP		\$0.00
04/05/2022	191,013 kms	<b>REVERSE IDELER PLATE</b> R-1929 CUMMIND ATTENED TRUCK SOUTH OF SYDNEY, REMOVED AND REPLACED PLATE BOLTS AND CHECKED OVER ALL PARTS. TOPPED UP ENGINE OIL 25L. ALL OK COVERED UNDER WARRENTY	CUMMINS SOUTH PACIFIC PTY LTD		\$0.00
14/04/2022	180,200 kms	<b>B S-4983</b> SERVICED ICE PACK AT 620 HRS	QLD WORKSHOP	2453543 PO4847	\$177.38
26/03/2022	165,012 kms	<b>A S-4845</b>	QLD WORKSHOP		\$0.00
24/03/2022	165,003 kms	<b>R154 BRIDGESTONE</b> T-1048 2 X NEW STEER TYRES BALANCE AND FITTED ALL OK	DARREN BUDD'S TYRES PTY LTD	00025846 PO4688	\$1,397.00
07/03/2022	151,974 kms	<b>WIPER BLADE</b> R-1707 REPLACE BOTH WIPER BLADES REPLACED HUB CAP	QLD WORKSHOP	2422761 PO4520	\$78.74
05/03/2022	151,974 kms	<b>A S-4695</b> POWER STEERING PUMP LEAKING FROM FITTEINGS GEARBOX LEAKING DONW THE SIDE NEEDS A UNI	QLD WORKSHOP	2422769 PO4519	\$0.00

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
11/02/2022	135,595 kms	<b>A S-4525</b> gearbox leaking down the side power steering pump leaking	QLD WORKSHOP		\$0.00
21/01/2022	121,964 kms	<b>ESOC FITTINGS R-1527</b> fitted e-soc fitting to truck	QLD WORKSHOP	2385854 PO4088	\$251.64
21/01/2022	121,964 kms	<b>TURBO WASTE GATE R-1509</b> TURBO WASTE GATE ACTUATOR WAS REPLACED UNDER WARRENTY.	BROWN & HURLEY GROUP		\$0.00
20/01/2022	121,964 kms	<b>B S-4346</b>	QLD WORKSHOP	2385849 PO4087	\$142.43
22/12/2021	104,104 kms	<b>A S-4187</b> SLIGHT MOVEMENT IN 2ND UNI JOINT WASTGATE FAULTY OVER BOOSTING ICE PACK SERVICED AT 300HR TIGHTEN U-BOLTS MARKED NUTS CHECK FOR MOVEMENT NEXT SERVICE	QLD WORKSHOP	2366768 PO3896	\$32.11
21/12/2021	104,104 kms	<b>100,000KLM ENGINE TUNE] R-1452</b> CARRIED OUT 100,000KM TOP TUNE INSPECT ENGINE	QLD WORKSHOP		\$0.00
06/12/2021	89,867 kms	<b>A S-4050</b>	QLD WORKSHOP		\$0.00
06/12/2021	89,938 kms	<b>ROTATE/BALANCE STEER, ROTATE DRIVES T-819</b> ROTATED AND BALANCED STEER TYRES ALL OK ROTATED ALL DRIVES SIDE TO SIDE	DARREN BUDD'S TYRES PTY LTD	00025121 PO3851	\$126.50
15/11/2021	75,200 kms	<b>A S-3869</b>	QLD WORKSHOP		
21/10/2021	60,300 kms	<b>B S-3697</b> p/steering box leaking - needs to go to kenworth for warranty	MELBOURNE VIC WORKSHOP	542809 PO3455	\$133.75
11/10/2021	51,115 kms	<b>ROTATE/BALANCE STEER, ROTATE DRIVES T-712</b> ROTATED ALL DRIVE TYRES DIAGONAL ROTATED AND BALANCED STEER TYRES ALL OK	DARREN BUDD'S TYRES PTY LTD	00024691 PO3409	\$126.50
28/09/2021	44,591 kms	<b>A S-3552</b> fitted new steering pump - warranty removed front bar to get repaired fitted 2nd hand bar for the meantime	MELBOURNE VIC WORKSHOP		
28/09/2021	44,591 kms	<b>POWER STEERING PUMP R-1435</b> NEW PUMP FITTED UNDER WARRENTY FROM HALLEM TRUKS IN VIC. FITTED UP AND TESTED ALL OK	MELBOURNE VIC WORKSHOP	540992 PO3329	\$49.69
03/09/2021	29,154 kms	<b>A S-3361</b>	QLD WORKSHOP		
10/08/2021	13,901 kms	<b>DIFF OILS R-1012</b>	QLD WORKSHOP	2422761 PO4520	\$20.43
09/08/2021	15,000 kms	<b>A S-3265</b> BROWN AND HURLY CARRIED OUT FIRST SERVICE ALL OK	BROWN & HURLEY GROUP		
01/08/2021		<b>C S-3341</b>			
<b>138 Records</b>				<b>Total:</b>	<b>\$60,874.08</b>