



# Vehicle History Detail



Fleet #	PM402
Registration	XQ52SE
Make	Kenworth
Model	K200
VIN / Chassis #	6F5000000MA469825

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
		<b>A S-16407</b> CARRY OUT A SERVICE	QLD WORKSHOP		\$0.00
		<b>DRIVE HUB SEAL R-7207</b>	QLD WORKSHOP		\$279.82
16/03/2026		<b>tv antenna R-7236</b>	QLD WORKSHOP		\$59.76
26/02/2026		<b>A/C REPAIRS R-7121</b> REPLACED HIGH PRESSURE HOSE OFF OF A/C COMPRESSOR TO CONDENSOR REPLACED A/C COMPRESSOR, RECEIVER DRYER AND ALL "O" RINGS INSTALLED 1420GRAMS OF A/C GAS REMOVED 0 GRAMS OF GAS	QLD WORKSHOP		\$110.00
20/02/2026	1,021,831 kms	<b>B S-16159</b> B SERVICED CUSTOM AIR SYSTEM OK NEEDS DIFF STAIBLISER BUSHES NEEDS NEW OIL FILL GASKET ON BLOCK TIGHTENED BELLY BAR	QLD WORKSHOP		\$172.35
27/01/2026	1,005,260 kms	<b>A/C BLOWER FAN R-7010</b> A/C FAN BLOWER	QLD WORKSHOP		\$395.43
27/01/2026	1,004,589 kms	<b>MINI RELAY R-6997</b>	QLD WORKSHOP		\$64.83
16/01/2026	998,168 kms	<b>B S-15865</b> CARRIED OUT B SERVICE DOWNLOADED ECM ADJUSTED CLUTCH PUMPED UP STEERS	QLD WORKSHOP		\$382.70
14/01/2026	996,383 kms	<b>MINI RELAY R-6937</b> 1 X 12V RELAY-BLACK	QLD WORKSHOP		\$44.00
14/01/2026	996,383 kms	<b>ADBLUE CAP R-6927</b> AD BLUE CAP	QLD WORKSHOP		\$55.00
09/01/2026	993,644 kms	<b>INDICATOR LIGHT R-6909</b>	QLD WORKSHOP		\$170.14
07/01/2026	993,339 kms	<b>11R 22.5 ATT 312 T-3893</b> 8X 11R22.5 HAULMAX ATT 312	DARREN BUDD'S TYRES PTY LTD		\$0.00

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
24/12/2025	987,662 kms	<b>RUNOUTS</b> T-3858 1 X RUNOUT DOCKET NO 18825	DARREN BUDD'S TYRES PTY LTD		\$0.00
08/12/2025	976,137 kms	<b>A S-15701</b> CARRY OUT A SERVICE replace steer hub cap cover oil filler tube gasket needs replacing rear diff weeping	QLD WORKSHOP		\$44.20
06/11/2025	955,247 kms	<b>A S-15434</b> CARRY OUT A SERVICE CARRIED OUT DOWNLOAD FRONT DRIVE BREAKS NEED TO BE DONE NEXT SERVICE	SRV ROAD FREIGHT		\$0.00
08/10/2025	939,796 kms	<b>O RING</b> R-6508	QLD WORKSHOP		\$5.36
08/10/2025	940,600 kms	<b>Heavy Vehicle Inspection Checklist - Truck</b> I-817	QLD WORKSHOP		\$0.00
01/10/2025	940,600 kms	<b>C S-15129</b> CARRY OUT C SERVICE	QLD WORKSHOP		\$1,116.63
05/09/2025	927,831 kms	<b>A S-14922</b> carried out a service as per checklist crimped new terminal to custom air ALT	QLD WORKSHOP		\$0.00
13/08/2025		<b>PARK BRAKE ALARM</b> R-6202 SENT TO AMPED UP AUTO ELECTRICS	QLD WORKSHOP		\$461.09
05/08/2025	910,522 kms	<b>nox sensor fault</b> R-6199 PLUGGED COMPUTER INTO TRUCK, FOUND AFTERTREATMENT LIGHT WAS ON AND ACTIVE FOUND THAT THE NOX SENSOR CODE FOR LOSS OF POWER WAS ACTIVE CAUSING THE LIGHT TO BE ON TOOK TRUCK FOR A HIGH NOX SENSOR RESET, DROVE TO HELENSVALE SOUTH EXIT AND CAME BACK TO DEPOT, THAT WAS ENOUGH FOR THE TRUCK TO COMPLETE THE REST CLEARED INACTIVE CODE AND TRUCK WAS SENT BACK INTO SERVICE.	QLD WORKSHOP		\$0.00
29/07/2025	910,473 kms	<b>starting issue</b> R-6138 TRUCK CAME IN WORKSHOP AFTER BEING JUMP STARTED LOAD TESTED AND THE BATTERY SAID CONDITION OK AND RECHARGE, REMOVED BOTTOM 2X BATTERY AND REPLACED FOR NEW AND PUT THE OLD 2 ON CHARGE TO BUT BACK INTO THE PARTS CONTAINER WHEN CHECKING AROUND BATTERY BOX FOUND THAT THE ALTERNATOR FUSE WAS BLOWN NOT ALLOWING THE TRUCK TO CHARGE, PUSHED RESETTABLE FUSE IN AND TRYED TO CHECK CHARGE RATE, IT READ NOTHING ALTERNATOR WAS INTERNALLY SHORTED, REPLACED FOR NEW SILVER ALTERNATOR OUT OF THE PARTS CONTAINER AND INSTALLED, STARTED TRUCK AND CHECKED CHARGE RATE, READS 14.3VLTs TRUCK GOOD AND SENT BACK INTO SERVICE	QLD WORKSHOP		\$838.10
15/07/2025		<b>ENGINE OIL</b> R-6102	QLD WORKSHOP		\$0.00
10/07/2025		<b>STARTER MOTOR</b> R-5660	QLD WORKSHOP		\$443.45
04/07/2025	905,358 kms	<b>BATTERY</b> S R-6033 REPLACED ALL 4 BATTERIES AND CHECKED CHARGE RATE 14.3 V	QLD WORKSHOP		\$594.00
27/06/2025	905,357 kms	<b>NEW STEERS</b> T-3418	DARREN BUDD'S TYRES PTY LTD, QLD WORKSHOP		\$1,518.00

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
26/06/2025	905,357 kms	<b>COOLANT LEAK R-6000</b> REMOVED COOLANT, PULLED APART COOLANT TRANSFER PIPE AS IT WAS LEAKING, CLEANED ALL SURFACES, REPLACED ALL O RINGS AND PUT BACK TOGETHER, ADDED COOLANT, TEST DROVE AND NO LEAKS, TOPPED UP COOLANT AGAIN.	QLD WORKSHOP		\$118.35
26/06/2025	905,357 kms	<b>B S-14401</b> CARRY OUT B SERVICE CUSTOM AIR SERVICED @4750HRS NEXT DUE @5050HRS COOLANT TRANSFER PIPES GOT NEW O RINGS 2X AFM GASKETS REPLACED 1X 5" V BAND 1X 15PSI COOLANT RADIATOR CAP FIXED BROKEN AIR LINE IN AIRSEAT	QLD WORKSHOP		\$367.37
03/06/2025	890,259 kms	<b>CARRY OUT ADR SPEED LIMITER INSPECTION R-5919</b> CARRY OUR ADR 65 SPEED LIMITER INSPECTION AND ADJUST IF REQUIRED PRINT BEFORE AND AFTTER DATA SHOWING CHANGES MADE TO SETTINGS	BROWN & HURLEY GROUP		\$236.50
03/06/2025	890,256 kms	<b>A S-14213</b> CARRY OUT A SERVICE CHANGE SUZI COIL AIR FITTINGS	QLD WORKSHOP		\$125.64
06/05/2025	867,149 kms	<b>A S-13964</b> NEW 2ND HAND MUDGUARDS OFF XQ70WM	QLD WORKSHOP		\$43.88
06/05/2025	867,150 kms	<b>ROTATE DRIVES, ROTATE STEER T-3322</b> ROTATED DRIVES SIDE/SIDE	DARREN BUDD'S TYRES PTY LTD		\$132.00
31/03/2025	843,810 kms	<b>B S-13751</b> CUSTOM AIR UNIT AT 4537 HOURS DUE 4770 HOURS TURNTABLE ADJUSTED AS REQUIRED	QLD WORKSHOP		\$175.51
14/03/2025	830,695 kms	<b>A S-13645</b> CUSTOM AIR SERVICED AT 4470HRS REPLACED POWER STEERING PUMP GASKET	QLD WORKSHOP		\$41.83
26/02/2025	814,941 kms	<b>JAKE BRAKES R-5552</b> REPLACED MICROSWITCH	QLD WORKSHOP		\$0.00
20/02/2025	813,037 kms	<b>A S-13481</b> CUSTOM AIR 4370HRS DUE 4470HRS REPLACED TV ANTENNA	QLD WORKSHOP		\$0.00
20/02/2025	813,037 kms	<b>ROTATE DRIVES, ROTATE STEER T-3122</b> ROTATED DRIVES DIAGONAL, FLIPPED POS 2 TYRE ON RIM	DARREN BUDD'S TYRES PTY LTD, QLD WORKSHOP		\$0.00
17/02/2025	809,029 kms	<b>CLUTCH ADJUSTMENT R-5513</b> Inspect clutch components & assembly * Adjust & test clutch operation * Clutch working to specification . ENGINE BRAKE ENGINE BRAKE NOT WORKING OFF CLUTCH PEDAL PLEASE DIAGNOSE AND REPORT . * Inspect components to diagnose * Located switch arm fouling near pedal * Put bend in switch arm to prevent fouling * Test & confirmed repair .	TWIN CITY TRUCK CENTRE PTY LTD		\$55.00
05/02/2025	798,539 kms	<b>A S-13297</b>	QLD WORKSHOP		\$41.83
05/02/2025	798,539 kms	<b>100,000KLM ENGINE TUNE] R-5455</b> TOP TUNED	QLD WORKSHOP		\$0.00

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
07/01/2025	782,939 kms	<b>CLUTCH R-5327</b> LOOKED THROUGH CLUTCH INSPECTION HOLE AND FOUND CLUTCH SPRING. DRAINED GEARBOX OIL REMOVED TOP AIR INTAKES TO PREVENT DAMAGE, DROP OUT DRIVELINE REMOVED GEARBOX AND CLEANED IN FRONT HOUSING. REMOVED CLUTCH AND FOUND MORE BROKEN SPRINGS. REMOVED FLYWHEEL AND SENT TO BROWN AND HURLEY TO BE MACHINED. RE-INSTALLED FLYWHEEL AND TORQUED TO 92-184FT/LB, INSTALLED CLUTCH AND TORQUED TO 60FT/LB. PULLED DOWN FRONT OF GEARBOX TO REPLACE FRONT HOUSING GASKET, O-RINGS, INPUT SHAFT AND BEARING, MOUNTED FRONT GEARBOX HOUSING AND TORQUED TO SPEC CLUTCH HOUSING NUTS 190FT/LB, CLUTCH HOUSING CAPSCREWS 100FT/LB, FRONT BEARING COVER CAPSCREWS 40FT/LB. REPLACED ALL 1/4 AIR FITTINGS ON GEARBOX X4 INSTALLED GEARBOX AND FITTED UP WIRING AND ALL FITTINGS. REPLACED DAMAGED AD-BLUE INJECTOR FITTING TOPPED UP GEARBOX OIL TO CORRECT LEVEL WENT FOR TEST DRIVE ALL WORKING CORRECTLY RE-CHECKED ALL BOLTS AND COMPONENTS ALL IN GOOD CONDITION SENT TRUCK BACK INTO SERVICE	QLD WORKSHOP		\$3,454.52
06/01/2025	782,917 kms	<b>B S-13099</b> B-SERVICE CUSTOM AIR SERVICED AT 4172 FRONT DIFF INPUT SHAFT SEAL WEAPING SENT TO HURLEY FOR WARRENTY REPLACEMENT	QLD WORKSHOP		\$217.59
06/01/2025		<b>BREAKDOWN R-5572</b> TWIN CITY SENT TO BREAKDOWN EPLACED ALTERNATOR AND BATTERIES TESTED OK AND SENT BACK TO WORK TRUCK THEN BROKEDOWN FOR SAME PROBLEM THE NEXT DAY AND TWIN CITY SENT BACK, FOUND ALTERNATOR WIRES MELTED REPLACE AND SENT BACK WORK	TWIN CITY TRUCK CENTRE PTY LTD		\$6,710.40
09/12/2024	766,146 kms	<b>A S-12937</b>	QLD WORKSHOP		\$41.83
09/12/2024	766,146 kms	<b>DRIVE BRAKES R-5232</b> RELINED BOTH REAR AXLE BRAKES AND CHANGED DRUMS	QLD WORKSHOP		\$654.17
16/11/2024	752,064 kms	<b>ROTATE DRIVES, ROTATE STEER T-2975</b> QLD WORKSHOP ROTATED DRIVES SIDE TO SIDE AND STEERS SIDE TO SIDE	QLD WORKSHOP		\$0.00
16/11/2024	752,064 kms	<b>A S-12683</b> CUSTOM AIR SERVICED AT 3760HRS REPLACED BROKEN LATCH CORD 1ST DIFF INPUT LEAKING LOWEST BRAKE 7MM ( REPLACE NEXT SERVICE )	QLD WORKSHOP		\$41.83
23/10/2024	735,716 kms	<b>A S-12503</b> ADDED 4 LITRES OF OIL CUSTOM AIR UNIT AT 3606 HOURS DUE AT 3670 HOURS LOWEST BRAKES 9MM	QLD WORKSHOP		\$42.09
23/09/2024	721,715 kms	<b>Heavy Vehicle Inspection Checklist - Truck I-578</b>	QLD WORKSHOP		\$0.00
23/09/2024	721,715 kms	<b>B S-12227</b> PARTS BOOKED OT TO C SERVICE	QLD WORKSHOP		\$173.80
23/09/2024	721,715 kms	<b>C S-12228</b> REMOVED, INSPECTED AND REPACKED STEER BEARINGS AND HUBS. ADJUSTED TURNTABLE AS REQUIRED. TOP TUNE NOT CARRIED OUT 60,000KM SINCE REBUILD. ADJUSTED CLUTCH AS NEEDED ADJUSTED ALL DRIVE BEARINGS AS NEEDED.	QLD WORKSHOP		\$1,091.37

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
23/09/2024	721,715 kms	<b>DIFF OIL LEAK, WARRANTY</b> R-4983 REMOVED AND RESEALED FRONT DIFF, REPLACED POWER DIVIDER THRUST WASHER AND SEALS AS NEEDED. NEW DIFF OIL FITTED TO DIFF (SUPPLIED BY SRV) ALL COVERED UNDER WARRENTY	BROWN & HURLEY GROUP		\$0.00
02/09/2024	707,108 kms	<b>A S-12071</b> A-SERVICE FRONT DIFF FLUFFY	QLD WORKSHOP		\$0.00
02/09/2024	707,108 kms	<b>ROTATE DRIVES, ROTATE STEER</b> T-2799 ROTATED DRIVES DIAGONAL ROTATED STEERS SIDE/SIDE	DARREN BUDD'S TYRES PTY LTD, QLD WORKSHOP		\$165.00
14/08/2024	693,985 kms	<b>A S-11869</b> ICE PACK 3369hrs Due @ 3670hrs (serviced this service) POWER DIVIDER INOPERATIVE CHROME STRIP MISSING FROM RH REAR GUARD MONITOR TOUQUE ROD BUSHES REAR BRAKES DUE NEXT SERVICE	QLD WORKSHOP		\$41.83
18/07/2024	675,590 kms	<b>A S-11655</b> 1ST DIFF INPUT LEAKING, 1ST DIFF SEAL LEAKING	QLD WORKSHOP		\$0.00
09/07/2024	668,140 kms	<b>CHECK BATTERIES</b> R-4715 LOAD TESTED ALL BATTERIES, TOP BACK BATTERY AND BOTTOM FRONT BATTERY AT 12.6V AND OTHER 2 AT 8.6V. REPLACED ALL 4 START BATTERIES, ALL CHARGING AT 13.6V AFTER BATTERIES WERE REPLACED	QLD WORKSHOP		\$644.16
25/06/2024	665,847 kms	<b>ENGINE REBUILD</b> R-4652 TRUCK USING WATER, FILLED UP AND TETSED FOR DROPPED LINER. FOUND WATER SYSTEM PRESURIZING SENT TRUCK TO CUMMINS FOR FURTHER TESTING. FOUND CYLINDER 2 BYPASSED WATER, REMOVED AND REPLACED ALL RINGS AND LINNERS, REPLACED ALL SEALS AND GASKETS AS NEEDED ALL COVERED UNDER WARRENTY.	CUMMINS SOUTH PACIFIC PTY LTD		\$0.00
21/06/2024	662,255 kms	<b>NEW DRIVE TYRES, ROTATE STEER</b> T-2591 8 X M866 DRIVES FITTED BY QLD WORKSHOP	QLD WORKSHOP	00032275	\$5,984.00
21/06/2024	662,255 kms	<b>B S-11357</b> CHECK ENGINE LIGHT COMING ON AND OFF, BECAUSE OF LOW COOLANT TOPPED UP COOLANT 20L CUSTOM AIR HRS, CURRENTLY 3270HRS DUE 3250HRS OIL LEAK FRONT COVER, GUSSET BROKEN P/S LOWER GUSSET TIGHTEN PITMAN ARM	QLD WORKSHOP		\$169.50
21/06/2024	662,255 kms	<b>CHECK ENGINE LIGHT, GUSSET, WATER LEAK</b> R-4644 CHECK ENGINE LIGHT WAS COMING ON FOR LOW COOLANT, TOPPED UP 20L OF COOLANT, TESTED FOR DROPPED LINER, TEST FAILED SENDING TO CUMMINS FOR WARRENTY. ALSO FOUND FRONT COVER LEAKING. PULLED APART HEATER COMPONENTS ALL WORKING CORRECTLY, REMOVED HOSES FROM HEATER TAPS AND BLEW DOWN LINE. WENT FOR TEST DRIVE WITH LOADED TRAILER, HEATER GETTING HOT. REMOVE AND REPLACED P/S BOTTOM GUSSET BEHIND GEARBOX.	QLD WORKSHOP	3254566	\$368.28
18/06/2024	659,047 kms	<b>BREAK DOWN</b> R-4640 REMOVE L/H REAR WHEELS AND REPLACE 2 X AIRBAGS AND FITTED SPARE TYRE TIGHTNED WHEEL NUTS	INLAND TRUCK CENTRE PTY LTD		\$2,347.49
28/05/2024	644,932 kms	<b>A S-11190</b> 1ST DIFF LEAKING	QLD WORKSHOP		\$0.00

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
09/05/2024	631,446 kms	<b>A S-10997</b> A-SERVICE ROTATED DRIVES SIDE TO SIDE REAR DIFF SWEATING	QLD WORKSHOP		\$39.63
09/05/2024	629,526 kms	<b>NEW STEERS, ROTATE DRIVES</b> T-2553 2 NEW STEERS FITTED POS 1,2 ROTATED DRIVES SIDE/SIDE BY QLD WORKSHOP	DARREN BUDD'S TYRES PTY LTD		\$1,485.00
23/04/2024	612,818 kms	<b>A S-10860</b> A-SERVICE ROTATE NOT REQUIRED AS NEW STEERS NEXT SERVICE AND DRIVES WATCH AND WAIT	QLD WORKSHOP		\$39.63
22/03/2024	601,232 kms	<b>B S-10616</b> ICE PACK SERVICED AT 3052 HOURS INPUT SEAL TO FIRST DIFF IS LEAKING	QLD WORKSHOP		\$212.03
22/03/2024	601,232 kms	<b>FAN HUB, REPLACE COMP ON KLMS</b> R-4243 REMOVE FAN FROM HUB AND REMOVE HUB FROM MOTOR PULL DOWN HORTEN HUB ON BENCH AND CLEAN ALL MAIN PARTS REKIT AND ASEMBLE AND REINSTALL INTO TRUCK, REFIT FAN START TRUCK UP AND TEST HORTEN FAN DRAIN COOLANT OUT OF TRUCK, REMOVE ALL AIR PIPING AND COOLANT LINES FROM COMPRESSOR, REMOVE POWER STEERING PUMP FROM COMPRESSOR, REMOVE COMPRESSOR, USE FITTINGS FROM OLD COMPRESSOR BUT REPLACED ALL O-RINGS, CLEANED ALL SURFACE AND REPALCED COMPRESSOR GASKET, INSTALLED COMPRESSOR AND FITTED ALL LINES BACK ON REMOVE AND REAPLCED GOVERNER VALVE, REPLACED GASKET BETWEEN COMPRESSOR AND POWER STEERING PUMP, PUT COOLANT BACK INTO TRUCK AND SENT FOR A TEST DRIVE, AFTER TEST DRIVE CHECKED ALL COMPONENTS FOR LEAKS, NO LEAKS FOUND. SENT TRUCK BACK INTO SERVICE	QLD WORKSHOP		\$4,878.03
20/03/2024	599,862 kms	<b>WINDSCREEN</b> R-4241 CALLED IN THE FIXER GROUP TO REMOVE AND REPLACE DRIVERS WINDSCREEN ALL OK	THE FIXER CORPORATION PTY LTD		\$385.00
04/03/2024	586,302 kms	<b>A S-10492</b> ICE PACK AT 3012 HOURS DUE AT 3070 HOURS 1ST DRIVE CENTRE GASKET WEEPING	QLD WORKSHOP		\$41.66
01/02/2024	573,283 kms	<b>TRUCK PROTECTION VALVE</b> R-4020 TOOK OFF OLD PROTECTION VALVE COLOUR CODED ALL AIR LINES TO CORRECT FITTINGS TOOK OLD PROTECTION VALVE TO WORK BENCH AND TOOK OFF ALL FITTINGS ONE BY ONE AND PUT THREAD SEALANT ON AND PUT ONTO NEW PROTECTION VALVE AND TIGHTENED UP FITTINGS THEN PUT BACK ONTO TRUCK WITH ALL CORRECT LINES TO CORRECT COLOURED LOCATION	QLD WORKSHOP		\$336.29
30/01/2024	571,418 kms	<b>A S-10183</b> A SERVICE 2924H ON ICEPACK	MELBOURNE VIC WORKSHOP		\$0.00
09/01/2024	557,635 kms	<b>A S-9935</b> ICE-PACK SERVICED AT 2770HRS REPLACED PENUT VALVE BESIDE GEAR BOX	QLD WORKSHOP		\$41.66
27/12/2023	552,148 kms	<b>WINDSCREEN</b> R-3869 CALLED OUT THE FIXER GROUP TO REPLACE PASSENGER SIDE WOINDSCREEN AS NEEDED. FITTED UP ALL OK SENT BACK INTI SERVICE	THE FIXER CORPORATION PTY LTD		\$368.50
07/12/2023	542,438 kms	<b>B S-9704</b>	MELBOURNE VIC WORKSHOP	597486	\$169.05
01/12/2023	538,500 kms	<b>CALLOUT FEE, PUNCTURE REPAIR</b> T-2178 1X CALLOUT TO ORCHARD ST 7:00-10:00 AM 1X PUNCTURE REPAIR TO POS 10	DARREN BUDD'S TYRES PTY LTD	00030533	\$198.00

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
15/11/2023	527,392 kms	<b>Turbo R-3739</b> REMOVE TURBO AND EXHAUST MANIFOLD CLEAN ALL AREAS FOR NEW GASKETS, SPLIT TURBO FROM MANIFOLD AND CLEAN AREA INBETWEEN, REMOVE AND REPLACE ALL TURBO STUDS. MOUNT NEW TURBO TO MANIFOLD, REPLACED OLD NUTS WITH NEW AND TORQUE TO 66FT lbs, REPLACED ALL O-RINGS FOR OIL FEED LINES. REPLACED ALL MANIFOLD GASKETS, MOUNT TURBO AND MANIFOLD TO ENGINE TORQUE MANIFOLD BOLTS TO 44FT lbs. FINISHED INSTALLING ALL OTHER PIPING FOR TURBO, TEST RUN ALL WORKING CORRECTLY. TEST DROVE UNIT AND CHECKED OVER AFTER RUN NO LEAKS PRESENT, ALL OKAY.	QLD WORKSHOP	3048769	\$5,563.23
13/11/2023	525,559 kms	<b>A S-9499</b> 2436 HOURS DUE AT 2597 HOURS	QLD WORKSHOP		\$0.00
13/11/2023	525,560 kms	<b>ROTATE DRIVES, ROTATE STEER T-2055</b> ROTATE DRIVES SIDE TO SIDE ROTATE STEER SIDE TO SIDE	DARREN BUDD'S TYRES PTY LTD	00030384	\$165.00
23/10/2023	510,571 kms	<b>A S-9306</b> I/P SERVICED AT 2297 HOURS DUE AT 2597 HOURS REMOVED ROCKER COVER AS WAS LEAKING, INSPECTED GASKET NO DAMAGE TO GASKET OR ROCKER COVER,CLEANED DOWN AND REFITTED,ALL OKAY. WINDSCREEN HAS CRACK 4 INCHES	QLD WORKSHOP	3048213	\$41.14
05/10/2023	496,763 kms	<b>A S-9194</b> CARRIED OUT A-SERVICE	QLD WORKSHOP		\$0.00
26/09/2023	496,763 kms	<b>C S-9040</b> CARRIED OUT C-SERVICE	QLD WORKSHOP		\$0.00
26/09/2023		<b>Heavy Vehicle Inspection Checklist - Truck I-347</b>	QLD WORKSHOP		\$0.00
18/09/2023	489,301 kms	<b>AIR LEAKS R-3488</b> FOUND RIDE HEIGHT AIR LINE HAD RUBBED THROUGH ON ICE-PACK FUEL LINE, CUT BACK LINE AND RAN INFRONT OF ICE-PACK TO PREVENT FUTURE DAMAGE REPLACED BOTH OLIVE FITTINGS, TIGHTNED ALL FITTINGS NO AIR LEAKS FOUND SEND BACK INTO SERVICE	QLD WORKSHOP		\$0.00
11/09/2023	485,497 kms	<b>ALTERNATOR R-3470</b> TESTED ALTERNATOR WITH ENGINE RUNNING ONLY HAD 12.6VOLTS, TURNED ENGINE OFF AND RECHECKED STILL HAD 12.6VOLTS CHECKED WIRING FOR ANY LOOSE OR DAMAGED TERMINALS ALL VISUALLY OK, TESTED BATTERY ALL OK, REMOVED ALTERNATOR, FITTED PULLY OFF OLD ALTERNATOR TO NEW ONE, FITTED ALTERNATOR AND TORQUED ALL BOLTS TO SPEC HOOKED MULTI UP AND TESTED READING 12.6VOLTS STARTED ENGINE VOLTS JUMPED TO 14.3VOLTS, ALL FAULTS WENT AWAY ALL OK	MELBOURNE VIC WORKSHOP	591774	\$525.22
06/09/2023	481,796 kms	<b>B S-8879</b> ICE PACK SERVICED AT 1997 HOURS NOW DUE AT 2300 HOURS. 1ST DRIVE DIFF SEAL LEAKING.	QLD WORKSHOP	2987599	\$213.90
15/08/2023	466,726 kms	<b>A S-8711</b> TYRE ROTATION DONE, PITMAN ARM AND INTAKE PIPES TIGHTENED, ADJUSTED CLUTCH FRONT DIFF SWEATING	MELBOURNE VIC WORKSHOP		\$0.00
15/08/2023	466,726 kms	<b>ROTATE/BALANCE STEER, ROTATE DRIVES T-1879</b> ROTATED DRIVES CROSS TO CROSS ROTATED STEERS SIDE TO SIDE	TREADCARE PTY LTD		\$0.00

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
28/06/2023	453,675 kms	A S-8332	QLD WORKSHOP		\$0.00
08/06/2023	437,723 kms	A S-8179	QLD WORKSHOP		\$0.00
16/05/2023	422,768 kms	<b>NEW STEERS</b> T-1712 new steers fitted	MELBOURNE VIC WORKSHOP		\$0.00
15/05/2023	422,768 kms	B S-8003	MELBOURNE VIC WORKSHOP	581758	\$312.52
20/04/2023	405,820 kms	A S-7815 ICE PACK SERVICED AT 1668 HOURS FIRST DRIVE STARTING TO WEEP FROM TOP OF DIFF CENTER	QLD WORKSHOP		\$0.00
20/04/2023	405,820 kms	<b>ICE PACK, REVERSE BUZZER</b> R-3047 SERVICE ICE PACK CHANGING OIL AND OIL FILTER AND CHANGE FUEL FILTER. 1668 HOURS ON UNIT. REMOVE OLD REVERSE BEEPER AND INSTALL NEW BUZZER AS TO SRV SPEC.	QLD WORKSHOP		\$0.00
20/04/2023	405,820 kms	<b>ROTATE/BALANCE STEER</b> T-1666 ROTATE STEERS FROM SIDE TO SIDE DONE BY QLD WORKSHOP	QLD WORKSHOP		\$0.00
30/03/2023	392,845 kms	<b>ROTATE DRIVES</b> T-1619 ROTATED DRIVES CROSS TO CROSS	TREADCARE PTY LTD		\$0.00
30/03/2023	392,845 kms	A S-7600	MELBOURNE VIC WORKSHOP		\$0.00
08/03/2023	374,574 kms	A S-7413	MELBOURNE VIC WORKSHOP		\$0.00
15/02/2023	362,529 kms	<b>ROTATE/BALANCE STEER</b> T-1553 ROTATE AND BALANCE STEERS	TREADCARE PTY LTD		\$0.00
15/02/2023	362,528 kms	B S-7185	MELBOURNE VIC WORKSHOP	575808 PO7093	\$156.40
24/01/2023	348,042 kms	A S-7024	QLD WORKSHOP		\$0.00
04/01/2023	335,107 kms	<b>BATTERY, WATER IN FUEL</b> R-2719 Have removed the old batteries and fitted X4 brand new delkor maintenance free batteries also have drained water out of the fuel pro and tested batteries works perfectly and connected computer to clear water in fuel faults Also added 9L of coolant to top up and 5.5L of engine oil as it needed to be topped up	MELBOURNE VIC WORKSHOP	573013 PO6856	\$767.23
21/12/2022	331,259 kms	A S-6840	QLD WORKSHOP		\$0.00
13/12/2022	331,259 kms	<b>NEW DRIVE TYRES</b> T-1488 fitted 8 new drive tyres	TREADCARE PTY LTD	142940 PO6746	\$6,047.18
24/11/2022	318,269 kms	A S-6533	MELBOURNE VIC WORKSHOP		\$0.00
03/11/2022	302,733 kms	B S-6386	MELBOURNE VIC WORKSHOP	568802 PO6317	\$153.04
02/11/2022	302,733 kms	<b>ROTATE/BALANCE STEER, ROTATE DRIVES</b> T-1375 rotated steers left to right rotated drives cross to cross will have another service or 2 left on drives	TREADCARE PTY LTD		\$0.00

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
11/10/2022	286,047 kms	<b>FRIDGE R-2450</b> Have removed fridge to take to get fixed	MELBOURNE VIC WORKSHOP		\$0.00
05/10/2022	284,141 kms	<b>A S-6178</b>	QLD WORKSHOP		\$0.00
05/10/2022	284,141 kms	<b>BREAK LINE R-2431</b> REPLACED WORN AIRLINE BEHIND 2ND DIFF REPALCED BOTH STEER CAPS	QLD WORKSHOP	2647613 PO6086	\$99.33
15/09/2022	270,050 kms	<b>ROTATE STEER T-1310</b> rotated steers side to side	MELBOURNE VIC WORKSHOP		\$0.00
14/09/2022		<b>Heavy Vehicle Inspection Checklist - Truck I-108</b>			\$0.00
14/09/2022	270,050 kms	<b>C S-6040</b>	MELBOURNE VIC WORKSHOP	565856 PO5987	\$804.54
09/09/2022	270,050 kms	<b>A S-6039</b>	MELBOURNE VIC WORKSHOP		\$0.00
29/08/2022	256,739 kms	<b>A S-5887</b>	MELBOURNE VIC WORKSHOP		\$0.00
05/08/2022	240,633 kms	<b>B S-5760</b> FOUND ALGEEA IN SECENDRY FUEL FILTER WHILE DRAINING FUEL 1L OF KERO IN EACH TANK ORDERED BY MAT.A	QLD WORKSHOP	2550110 PO5731	\$319.34
13/07/2022	228,934 kms	<b>ROTATE DRIVES T-1233</b> TIRES ROTATED FROM FRONT TO REAR DONE BY WORKSHOP	QLD WORKSHOP		\$0.00
13/07/2022	223,519 kms	<b>A S-5591</b>	MELBOURNE VIC WORKSHOP		\$0.00
21/06/2022	211,181 kms	<b>A S-5413</b>	MELBOURNE VIC WORKSHOP		\$0.00
21/06/2022	211,181 kms	<b>NEW STEERS T-1184</b> fitted and balanced new steers NEW BALANCE RINGS FITTED TO STEER TYRES	TREADCARE PTY LTD	INV-4427 PO5327	\$2,020.00
15/06/2022	206,237 kms	<b>BATTERY S R-2072</b> LOAD TESTED ALL BATTERY S ONE COME BACK BAD REPLACES REMOVED FROM TRUCK AND PLACED ON CHARGE FOR 2 HRS. RETESTED COME BACK BAD REPLACE REOMOVED BAD BATTERY AND GOT NEW ONE UNDER WARRANTY	QLD WORKSHOP		\$0.00
24/05/2022	196,614 kms	<b>A S-5236</b> WARRANTY WORK CAB RAM P/S LEAKING GEARBOX PRESSER SENSOR LAEKING DIFF O-RING LEAKING FROM BEHIND DIFF FITTER HOUESING OIL FILLER KEAKING TIGHTEN FRONT HUB CUPS ADJUSTED CLUTCH AS NEEDED	QLD WORKSHOP		\$0.00
24/05/2022	196,614 kms	<b>CAB RAM, DIFF OIL LEAK, GEAR BOX PRESSURE SWITCH R-2008</b> NEW CAB JACK FITTED UNDER WARRENTY NEW LEFT HAND CAB RAM FIUTTED UNDER WARRENTY RESEALED DIFF LEAK UNDER WARRENTY REPLACE DRIVERS WINDSCREEN ALL OK	BROWN & HURLEY GROUP, THE FIXER CORPORATION PTY LTD		\$0.00
28/04/2022	179,456 kms	<b>B S-5036</b>	MELBOURNE VIC WORKSHOP	555732 PO4985	\$137.05

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
28/04/2022	179,456 kms	<b>ROTATE DRIVES</b> T-1073 rotated drives cross to cross didnt rotate the steers as they are wearing very flat and even	TREADCARE PTY LTD		\$0.00
06/04/2022	166,862 kms	<b>A S-4882</b> ICE PACK SERVICED @ 629HRS	MELBOURNE VIC WORKSHOP	554572 PO4859	\$32.79
15/03/2022	143,556 kms	<b>A S-4725</b> checked fuel pro and found algae, drained and cleaned fuel pro , checked fuel tanks	MELBOURNE VIC WORKSHOP		\$0.00
21/02/2022	134,521 kms	<b>ROTATE/BALANCE STEER, ROTATE DRIVES</b> T-950 rotate drives front to back rotate and balance steers	TREADCARE PTY LTD		\$0.00
20/02/2022	134,521 kms	<b>A S-4557</b>	MELBOURNE VIC WORKSHOP		\$0.00
31/01/2022	119,205 kms	<b>ESOC FITTINGS</b> R-1562 fitted esoc fittings	MELBOURNE VIC WORKSHOP		\$0.00
31/01/2022	119,205 kms	<b>B S-4424</b>	MELBOURNE VIC WORKSHOP	549054 PO4190	\$144.80
13/01/2022	106,832 kms	<b>100,000KLM ENGINE TUNE]</b> R-1482 adjusted all valves to spec, checked cam and tappets for any premature wear	MELBOURNE VIC WORKSHOP		\$0.00
13/01/2022	106,832 kms	<b>A S-4276</b>	MELBOURNE VIC WORKSHOP		\$0.00
21/12/2021	92,367 kms	<b>A S-4103</b> serviced ice pack 302HRS	MELBOURNE VIC WORKSHOP	547297 PO3960	\$32.00
19/12/2021	92,367 kms	<b>ROTATE/BALANCE STEER, ROTATE DRIVES</b> T-843 ROTATED STEERS AS NEEDED ROTATED ALL DRIVES CROSS TO CROSS	TREADCARE PTY LTD	132882 PO3900	\$41.89
23/11/2021	74,165 kms	<b>A S-3921</b> l/h cam ram leaking will need to go to kenworth for warranty	MELBOURNE VIC WORKSHOP		
03/11/2021	58,454 kms	<b>B S-3770</b>	QLD WORKSHOP	2326502 PO3543	\$136.87
03/11/2021	58,454 kms	<b>ESOC FITTINGS</b> R-1455 NEW ESOC FITTINGS FITTED AND AND TESTED ALL OK	QLD WORKSHOP	2326503 PO3751	\$251.64
13/10/2021	44,817 kms	<b>A S-3579</b>	MELBOURNE VIC WORKSHOP		
13/10/2021	44,817 kms	<b>ROTATE/BALANCE STEER, ROTATE DRIVES</b> T-697 drive rotated diagonal and steers rotated and balanced -treadcare	TREADCARE PTY LTD		
20/09/2021	29,412 kms	<b>A S-3439</b>	QLD WORKSHOP		
31/08/2021	15,000 kms	<b>A S-3359</b> BROWN AND HURLY CARRIED OUT FIRST SERVICE	BROWN & HURLEY GROUP		
25/08/2021		<b>C S-3343</b>			

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
------	---------	-----------------------	----------	---------	------

143 Records

Total: \$56,400.22