



# Vehicle History Detail



Fleet #	PM395
Registration	XQ83QI
Make	Kenworth
Model	K200
VIN / Chassis #	6F5000000MA469575

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
		<b>custom air repair R-7074</b>	QLD WORKSHOP		\$110.00
16/02/2026	1,015,694 kms	<b>B S-16182</b>	QLD WORKSHOP		\$497.48
15/01/2026	996,870 kms	<b>A S-15779</b> carry out a service	QLD WORKSHOP		\$35.75
25/11/2025	964,498 kms	<b>B S-15535</b>	MELBOURNE VIC WORKSHOP		\$173.45
11/11/2025		<b>CUSTOM AIR KIT R-6652</b>	QLD WORKSHOP		\$60.14
04/11/2025	955,156 kms	<b>CHECKOVER, DETAIL AND WASH R-6621</b>	QLD WORKSHOP		\$0.00
24/10/2025	950,330 kms	<b>WINDSCREEN R-6592</b>	THE FIXER CORPORATION PTY LTD		\$0.00
23/10/2025	950,330 kms	<b>A S-15310</b> CARRIED OUT A SERVICE WINDSCREEN REPLACED STRIP ON MUDGUARD FIXED SILENCER TAKEN OFF TRODDLE VALVE CHECKED BATTERY ALL CHARGING AND WORKING AS SHOULD	QLD WORKSHOP		\$0.00
13/10/2025	942,000 kms	<b>AIR LEAKS R-6514</b>	QLD WORKSHOP		\$0.00
10/10/2025	937,028 kms	<b>11R22.5 TYRE, STRIP/FIT T-3651</b>	DARREN BUDD'S TYRES PTY LTD		\$0.00
07/10/2025	936,316 kms	<b>295/80R BRIDGESTONE T-3648</b>	DARREN BUDD'S TYRES PTY LTD		\$0.00
02/10/2025	936,316 kms	<b>INDICATOR STALK, WIPER BLADE R-6482</b>	SRV ROAD FREIGHT		\$628.84
26/09/2025	934,395 kms	<b>A S-15095</b> CARRY OUT A SERVICE WIPERS COMPRESSOR O-RING-VIC W/SHOP	MELBOURNE VIC WORKSHOP		\$66.00
12/09/2025	923,024 kms	<b>A S-14944</b> CARRIED A SERVICE AS PER CHECKLIST ICE PACK DUE @3250 DONE@3100 REPAIRED ENG WATER TEMP GUAGE LIGHT STRAIGHTENED STEERING WHEEL SPREAD TERMINALS ON TRAILER LIGHT PLUG	QLD WORKSHOP		\$0.00

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
30/08/2025	911,353 kms	<b>ALTERNATOR, BATTERY</b> R-6299 TRAVELLED TO CASINO, NSW REMOVED BATTERY AND REPLACED FOR NEW, CLEANING UP ALL THE TERMINALS AND WIRING. REMOVED ALTERNATOR AND REPLACED FOR NEW, INSPECTED BELT CONDITION AND IT WAS ALSO GOOD. TRAVELLED BACK TO QLD DEPOT.	QLD WORKSHOP		\$1,127.10
08/08/2025	902,832 kms	<b>B</b> S-14675 B SERVICE	QLD WORKSHOP		\$172.12
07/07/2025	881,727 kms	<b>A</b> S-14430 Carry out A service Fuel gauge light in dash not working Check movement in steering shaft	QLD WORKSHOP		\$0.00
07/07/2025	881,727 kms	<b>DRIVE BRAKES</b> R-6053 RELINED FRONT DRIVE AXLE AND REPL DRUMS , REPL HOSES	QLD WORKSHOP		\$1,345.61
12/06/2025		<b>CLUTCH ADJUSTMENT</b> R-5960	QLD WORKSHOP		\$0.00
03/06/2025	860,810 kms	<b>ROTATE DRIVES</b> T-3230 8 X DRIVES OFF SOLD ASSET XQ07MJ , 150K KMS ON THEM	QLD WORKSHOP		\$0.00
28/05/2025		<b>FANBELT IDLER</b> R-5873 REMOVED BRKT FOR IDLER	QLD WORKSHOP		\$76.54
28/05/2025	860,222 kms	<b>A</b> S-14145 A SERVICE CUSTOMAIR HRS ARE 3020 SER DUE AT 3250 HRS	QLD WORKSHOP		\$0.00
24/04/2025	842,366 kms	<b>ABS FAULT</b> R-5745	QLD WORKSHOP		\$0.00
22/04/2025	843,167 kms	<b>B</b> S-13915 B SERVICE COMPLETED	QLD WORKSHOP		\$261.89
20/03/2025	824,186 kms	<b>A</b> S-13669 CUSTOM AIR SYSTEM SERVICED @2950HRS NEXT DUE @3250HRS MIRROR CONTROLER SWITCH REPLACED FUEL GUAGE LIGHT FIXED NEW PLASTIC HUB CAP ON STEER NEW TOP ENGINE MOUNT ON CUSTOM AIR SYSTEM NEW STAINLESS HUB CAP COVER STAINLESS LOAD TESTED BATTERY AND CAME BACK GOOD	QLD WORKSHOP		\$282.20
20/02/2025	803,826 kms	<b>FRIDGE</b> R-5372 INSTALLED NEW FRIDGE IN XB77EF, USED 2ND HAND FRIDGE TO INSTALL INTO XQ83QI TESTED ALL WORKING CORRECTLY SENT BACK INTO SERVICE	QLD WORKSHOP		\$906.95
20/02/2025	804,238 kms	<b>Heavy Vehicle Inspection Checklist - Truck</b> I-694	QLD WORKSHOP		\$0.00
20/02/2025	804,238 kms	<b>A</b> S-13521	QLD WORKSHOP		\$0.00
20/02/2025	803,826 kms	<b>ALTERNATOR ON KLMS, STARTER MOTOR</b> R-5519 REPLACED STARTER MOTOR AND ALTERNATOR	QLD WORKSHOP		\$923.45
20/02/2025	804,238 kms	<b>C</b> S-13146 NEW STARTER AND ALTERNATOR SETH.F COMPLETED FRONT HUBS	QLD WORKSHOP		\$1,094.42

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
31/01/2025	793,610 kms	<b>A S-13323</b> CUSTOM AIR 2757HRS DUE 2880HRS REPLACED CUSTOM AIR BELTS INSTALLED FRIDGE	QLD WORKSHOP		\$64.44
10/01/2025	778,559 kms	<b>B S-13124</b>	QLD WORKSHOP	3427921	\$204.48
19/12/2024	768,153 kms	<b>NEW STEERS T-3049</b> 2 X NEW BRIDGESTONE R154 FITTED POS 1,2	DARREN BUDD'S TYRES PTY LTD		\$1,529.00
16/12/2024	764,484 kms	<b>A S-12981</b>	QLD WORKSHOP		\$164.80
06/12/2024	757,645 kms	<b>HOBBS SWITCH R-5223</b> REMOVE AND REPLACED BRAKE PEDAL HOBBS SWITCH, TESTED WORKING CORRECTLY SENT BACK INTO SERVICE	QLD WORKSHOP		\$95.16
27/11/2024	750,104 kms	<b>ROTATE DRIVES, ROTATE STEER T-2999</b> QLD WORKSHOP ROTATED DRIVES DIAGONAL LEFT STEERS AS DIDNT NEED SIDE TO SIDE	QLD WORKSHOP		\$0.00
27/11/2024	750,104 kms	<b>A S-12816</b> CUSTOM AIR 2480HRS DUE 2570HRS 1ST DIFF FLUFFY	QLD WORKSHOP		\$0.00
27/11/2024	751,104 kms	<b>FRIDGE R-5187</b> INSTALLED REPAIRED FRIDGE, TEST ALL WORKING CORRECTLY SENT BACK INTO SERVICE	QLD WORKSHOP		\$0.00
11/11/2024	738,641 kms	<b>A S-12626</b> NEW FUEL SENDER REPLACED WIPER BLADES	QLD WORKSHOP		\$150.11
14/10/2024	719,323 kms	<b>B S-12404</b> REPLACED DASH GLOBES FIXED TANK LIGHT WIRING FIXED LEAKING STEER HUB CUSTOM AIR SYSTEM AT 2377 NEXT DUE 2573 REMOVED BROKEN FRIDGE AND ADDED SECONDARY FRIDGE PLUG	QLD WORKSHOP		\$239.98
27/09/2024	709,777 kms	<b>SPOT LIGHTS, tv antenna R-4962</b> FITTED UP DRIVING LIGHTS TO GRILL REMOVED TV AND CABINET THAT T.V IS MOUNTED TO, REMOVE AND REPLACED TV ANTENNA WIRING AND AERIAL. MOUNTED T.V CABINET BACK TO WALL TESTED ALL WORKING CORRECTLY DRIVERS HEAD LIGHT COVER IS FINE FOR NEW, REPLACED IF IT GETS WORSE SENT BACK INTO SERVICE	QLD WORKSHOP		\$0.00
19/09/2024	705,296 kms	<b>AIR DRYER SILENCER, DRIVE BRAKES, UNLOADER VALVE R-4976</b> FITTED NEW REAR DRIVE AXLE BRAKES AND DRUMS FITTED NEW AIR DRYER UNLOADER VALVE AND SILENCER TEST ALL OK	QLD WORKSHOP		\$726.94
19/09/2024	705,296 kms	<b>ROTATE DRIVES, ROTATE STEER T-2840</b> ROTATE REAR TYRES ONLY SIDE TO SIDE. STEER TIRES ARE NEW	QLD WORKSHOP		\$0.00
18/09/2024	705,296 kms	<b>A S-12195</b> ICE PACK 2346hrs Due @ 2573hrs AD BLUE FLUSH DONE	QLD WORKSHOP		\$0.00
27/08/2024	689,617 kms	<b>A S-12020</b> FOUND WASTEGATE ARM OFF TURBO CAUSING TRUCK TO HAVE NO BOOST AND GET HOT AND THROW ECM CODES FOR HOT INTAKE TEMP PRESSURES TO MANIFOLD AND SCR, FITTED NEW C CLIP TO TURBO AFTER REFITTING WASTEGATE ARM, MEASURED STROKE OF WASTEGATE ALL WITHIN SPEC, ALL OKAY.	QLD WORKSHOP		\$0.00

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
05/08/2024	674,636 kms	<b>A S-11772</b> Ice pack 2281 HRS Due @ 2573 hrs	QLD WORKSHOP		\$0.00
22/07/2024	665,222 kms	<b>DRIVERS WINDOW R-4764</b> REMOVED D/S DOOR CARD TESTED NEW WINDOW MODULE FAULT STILL THERE REFITTED OLD MODULE FITTED NEW WINDOW SWITCH WINDOWS OPERATIVE REFITTED DOOR CARD RETESTED WINDOWS ALL OPERATIONAL SENT BACK TO SERVICE.	QLD WORKSHOP	3268988	\$113.29
26/06/2024	660,047 kms	<b>ROTATE DRIVES, ROTATE STEER T-2657</b> ROTATE DRIVES DIAGONAL STEERS SIDE/SIDE	DARREN BUDD'S TYRES PTY LTD	00032294	\$165.00
25/06/2024	660,047 kms	<b>B S-11403</b> B-service SERVICED ICE PACK AT 2273HRS SLIGHTS D/S KING PIN PLAY REPLACED D/S WINDOW CONTROL MODULE REPLACED LEAKING COOLANT FILTER	QLD WORKSHOP	3247651	\$268.04
25/06/2024	660,047 kms	<b>COOLANT FILTER, DRIVERS WINDOW R-4655</b> REMOVED DOOR CARD COULDN'T SEE ANY ISSUES USED TEST WINDOW CONTROL MODULE COULDN'T FAULT WITH TESTER IN USE REPLACED WITH NEW TESTED STILL OPERATIONAL FITTED DOOR CARD BACK UP. COOLANT FILTER LEAKING HEAVILY REMOVED FOUND SEALING SURFACE COVERED IN GRIME CLEANED WITH SCOTCH BRIGHT SPARYED WITH BRAKE CLEAN INSPECTED OLD SEAL FOUND DAMAGED REPLACED WITH NEW FILTER.	QLD WORKSHOP		\$364.36
14/06/2024		<b>WINDSCREEN R-4540</b> CALLED IN THE FIXER GROUP TO REMOVE AND REPLACE THE DRIVER SIDE WINDSCREEN ALL OK	QLD WORKSHOP		\$385.00
10/06/2024	650,580 kms	<b>STRIP/FIT RUNOUT T-2642</b> STRIP/FIT RIM STRIP/FIT RUNOUT TO SPARE	DARREN BUDD'S TYRES PTY LTD	00032155	\$55.00
29/05/2024	642,771 kms	<b>A S-11141</b> A-SERVICE	QLD WORKSHOP		\$0.00
21/05/2024	637,155 kms	<b>AD BLUE PUMP, AIRCON, DOSER PUMP R-4516</b> REPLACED DOSER PUMP FOR NEW ONE, CLEARED ALL CODES, GOOD A/C LOUVRE WAS WORN OUT, REPLACED	QLD WORKSHOP		\$3,199.17
24/04/2024	626,866 kms	<b>BATTERY R-4390</b> LOAD TEST ALL BATTERIES, 3X FAILED LOAD TEST REMOVED AND REPLACED ALL BATTERIES, CHARGED RATE FROM ALTERNATOR IS 14V, AT BATTERIES WAS 13.2V REMOVED CONNECTIONS OFF ALTERNATOR AND CLEANED, IMPROVED CHARGE RATE AT BATTERIES TO 13.7V SENT BACK INTO SERVICE	QLD WORKSHOP		\$613.80
24/04/2024	626,866 kms	<b>A S-10906</b> FLUSED AD-BLUE SYSTEM REMOVED AND REPLACED ALL BATTERIES	QLD WORKSHOP		\$0.00
03/04/2024	620,843 kms	<b>A/C REPAIRS, ADBLUE FAULT, BRAKE HOSE R-4280</b> REMOVED AND REPLACED 1/2 INCH BRAKE SUPPLY HOSE ON 2ND DRIVE LHS AS REQUIRED, SECURED INTO PLACE ALL OKAY. FOUND SMALL DOSER PUMP BARB CORRODED AND U/S REMOVED AND REPLACED AS REQUIRED, PUMP OVERRIDE TEST CARRIED OUT AND DOSER PUMP ALL WORKING AS REQUIRED, ALL OKAY. FOUND BROKEN WIRE FROM BULKHEAD TO PRESSURE SWITCH, CUT SNAKE SKIN OFF AND INSPECTED LOOM AND FOUND BROKEN WIRE, REPAIRED BROKEN WIRE AND TESTED ALL FUNCTIONS OF AIR CON SYSTEM, ALL WORKING AS REQUIRED, ALL OKAY	QLD WORKSHOP		\$163.24

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
18/03/2024	612,327 kms	<b>NEW DRIVE TYRES</b> T-2441 FIT 8 BRIDGESTONE M866 DRIVES TYRES	DARREN BUDD'S TYRES PTY LTD		\$6,600.00
15/03/2024	612,327 kms	<b>A S-10595</b> A-SERVICE ICE PACK SERVICED AT 1955	QLD WORKSHOP		\$41.66
07/03/2024	606,837 kms	<b>ICE PACK</b> R-4190 TESTED ICE PACK COMPRESSOR KICKING IN HAS FULL GAS LOW PRESSURE LINE NOT COLD SUSPECTED INTERNAL COMPRESSOR FAILURE. VACCED OUT A/C GASSES FROM SYSTEM REMOVED AND REPLACED A/C COMPRESSOR, RECEVIER DRYER AND PRESSURE SENSOR REGASSED SYSTEM TESTED AND CHECKED FOR LEAKS WORKING WELL SENT BACK TO SERVICE.	QLD WORKSHOP	CAG003337	\$454.31
29/02/2024	603,086 kms	<b>Heavy Vehicle Inspection Checklist - Truck</b> I-435	QLD WORKSHOP		\$0.00
28/02/2024	603,086 kms	<b>REKIT HORTON FAN HUB, REPLACE COMP ON KLMS, TIMING COVER BOLTS</b> R-4155 REMOVE FAN FROM HUB AND REMOVE HUB FROM MOTOR PULL DOWN HORTEN HUB ON BENCH AND CLEAN ALL MAIN PARTS REKIT AND ASEMBLE AND REINSTALL INTO TRUCK, REFIT FAN START TRUCK UP AND TEST HORTEN FAN REMOVED TIMING COVER BOLTS MEASURED FOUND INCORRECT LENGTH REPLACED WITH CORRECT BOLTS TOURQUED TO SPEC DRAIN COOLANT OUT OF TRUCK, REMOVE ALL AIR PIPING AND COOLANT LINES FROM COMPRESSOR, REMOVE POWER STEERING PUMP FROM COMPRESSOR, REMOVE COMPRESSOR, USE FITTINGS FROM OLD COMPRESSOR BUT REPLACED ALL O-RINGS, CLEANED ALL SURFACE AND REPALCED COMPRESSOR GASKET, INSTALLED COMPRESSOR AND FITTED ALL LINES BACK ON REMOVE AND REAPLCED GOVERNER VALVE, REPLACED GASKET BETWEEN COMPRESSOR AND POWER STEERING PUMP, PUT COOLANT BACK INTO TRUCK AND SENT FOR A TEST DRIVE, ANFTER TEST DRIVE CHECKED ALL COMPONENTS FOR LEAKS, NO LEAKS FOUND. SENT TRUCK BACK INTO SERVICE	QLD WORKSHOP		\$4,791.95
28/02/2024	603,086 kms	<b>C S-10461</b> C-SERVICE FAN HUB AND COMPRESSOR REPLACED REPLACED BOTTOM AIR INTAKE MOUNT REPLACED COOLANT DRAIN FITTING AS WAS LEAKING	QLD WORKSHOP		\$1,056.68
20/02/2024	597,292 kms	<b>B S-10368</b> ICE-PACK HRS, CURRENTLY 1820HRS DUE 2000HRS	QLD WORKSHOP		\$173.80
30/01/2024	582,121 kms	<b>A S-10132</b> JACKED UP STEERS TO GREASE KINGPINS, FOUND SLIGHT MOVEMENT BOTH SIDES, TIGHTNED ALL RETAINER BOLTS FOUND MOVEMENT IN D/S REAR SHACKLE PIN, TIGHTNED STEER AXLE U-BOLTS REMOVED AND CLEANED ALL FRONT ABS SENSORS REPLACED AD-BLUE CAP RUBBER ICE-PACK SERVICED AT 1700HRS DUE 2000HRS	QLD WORKSHOP		\$41.66
05/01/2024	656,223 kms	<b>DIESEL INJECTOR TUBE</b> R-3890 SENT TRUCK TO CUMMINS, FOUND 2ND CYLINDER INJECTOR TUBE HAD FAILED. REMOVED AND REPLACED ALL OK. TEST DROVE TRUCK ALL OK REMOVED COOLAENT FROM FUEL TANK AND ADDED FUEL DOCTOR TO HELP REMOVE AND WATER FROM FUEL TANK SENT TRUCK BACK INTO SERVICE	CUMMINS SOUTH PACIFIC PTY LTD	1115958	\$905.91
29/12/2023	565,118 kms	<b>A S-9866</b> CLEANED OUT AND GOT D/S BACK UP LIGHT WORKING FOUND COOLANT IN FUEL PRO BOWL WHILE CLEANING OUT	QLD WORKSHOP		\$65.44

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
29/12/2023	565,118 kms	<b>ROTATE DRIVES, ROTATE STEER</b> T-2209 QLD WORKSHOP, ROTATED DRIVES SIDE TO SIDE ROTATED STEERS SIDE TO SIDE	QLD WORKSHOP		\$0.00
04/12/2023	548,075 kms	<b>A S-9668</b> ICE-PACK HRS SERVICED AT 1430HRS	QLD WORKSHOP	3065295	\$41.14
14/11/2023	533,715 kms	<b>B S-9509</b> Fitted new tv antenna	MELBOURNE VIC WORKSHOP	595633	\$235.63
25/10/2023	518,877 kms	<b>ROTATE DRIVES, ROTATE STEER</b> T-1956 ROTATE ALL DRIVES DIAGONAL AS REQUIRED ROTATE STEERS SIDE TO SIDE AS REQUIRED	QLD WORKSHOP		\$0.00
25/10/2023	518,877 kms	<b>A S-9356</b> 1245 HOURS DUE AT 1390 HOURS DOSER PUMP AND FILTER HOUSING HELD BY ZIPTIE NO BOLTS, SECURED DOSER PUMP AND FILTER HOUSING INTO PLACE WITH CORRECT BOLTS	QLD WORKSHOP		\$0.00
16/10/2023	514,355 kms	<b>ENGINE REBUILD</b> R-3665 FOUND DROPPED LINNER CYLINDER 5, REMOVED AND REPLACED ALL PISTON RINGS AND LINNERS ALL OK DYNO TEST ENGINE ALL OK SENT TRUCK BACK INTO SERVICE ALL COVER UNDER WARRENTY.	CUMMINS SOUTH PACIFIC PTY LTD		\$0.00
21/09/2023	509,291 kms	<b>SLACK ADJUSTER</b> R-3512 R&R D/S REAR AXLE U/S SLACK ADJUSTER, ADJUSTED TO SPEC, CHECKED OPERATION	QLD WORKSHOP	2995331	\$338.26
14/09/2023	505,700 kms	<b>A S-8983</b> DRIVERS SIDE, 3RD AXEL SLACK ADJUSTER OUT OF ADJUSTMENT RE ADJUSTED THE SLACK ADJUSTER CHECK NEXT WEEK	QLD WORKSHOP		\$0.00
22/08/2023	489,573 kms	<b>REVERSE BUZZER</b> R-3387 REMOVED FACTORY REVERSE BUZZER TESTED FOUND INOPRATIVE, FITTED AND WIRED NEW BUZZER IN TESTED BUZZER WORKING	QLD WORKSHOP	2958272	\$105.95
22/08/2023	489,573 kms	<b>A S-8770</b> ICE PACK SERVICED 1090 HOURS.	QLD WORKSHOP	2973388	\$41.14
21/07/2023	475,594 kms	<b>B S-8516</b> REPLACED FULE PRO NUT	QLD WORKSHOP	2945325	\$237.09
12/06/2023	459,167 kms	<b>A S-8226</b> DRIVERS SIDE WINDSCREEN CHIPPED/CRACKED	QLD WORKSHOP		\$0.00
17/05/2023	445,938 kms	<b>A S-8008</b>	QLD WORKSHOP		\$0.00
02/05/2023	445,938 kms	<b>NEW STEERS, ROTATE DRIVES</b> T-1700 NEW STEER TYRES FITTED UP ALL OK ROTATED DRIVES SIDE TO SIDE ALL DONE BY SRV WORKSHOP	QLD WORKSHOP	29025	\$1,476.20
28/04/2023	430,000 kms	<b>A S-7855</b> 45 deg fittings put on suzi coil air lines	QLD WORKSHOP	2859041	\$7.44

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
17/04/2023	419,876 kms	<b>Turbo R-3039</b> DRIVER COMPLAINT THAT TRUCK IS NOT BOOSTING. TILT CAB OVER AND INSPECT FIND THAT WASTEGATE CLIP HAS BROKEN OFF AND DAMAGED PART WHERE IT CLIPS ON TO. REMOVE AIR INTAKE AND HEAT SHROUD TO GAIN ACSESSES TO TURBO AND REMOVE ALL OIL FEED AND RETURN PIPES. REMOVE EXHAUST MANIFOLD WITH TURBO ATTACHED TO IT FROM TRUCK AND THEN REMOVE TURBO FROM EXHAUST CLEAN UP ALL HEAD AND EXHAUST FACES FIT UP NEW TURBO WITH NEW GASKETS AS WELL AND TIGHTEN ALL BOLTS UP TO SPEC. INSTALL EXHAUST AND TURBO BACK ON TO MOTOR AND TIGHTEN ALL BOLTS UP TO SPEC. INSTALL ALL OIL FEED AND RETURN LINES WITH NEW O RINGS. INSTALL AIR INTAKE BACK ON AND CHECK FOR LEAKS, ALL GOOD SEND BACK INTO FLEET TURBO COVERED UNDER WARRANTY BY BROWN AND HURLEY	QLD WORKSHOP	2852588 PO7539	\$797.02
06/04/2023	417,592 kms	<b>DASH GLOBES, TURBO ACTUATOR R-3004</b> LOW BOOST= INSPECT BOOST SYSTEM AND FIND THE TURBO ACTUATOR HAS FAILED REPLACE AND TEST CUBORD DOOR HINGE= REMOVE OLD BROKEN HINGE AND REPLACE WITH NEW RATTLE IN DASH= REMOVE ACCESS PANEL TO FIND LOOSE BOLTS TIGHTEN UP AND REASSEMBLE DASH GLOBE OUT=REMOVE AND REPLACE GLOBE THAT HAS BLOWN ON AXLE OIL RR	QLD WORKSHOP		\$0.00
30/03/2023	414,969 kms	<b>B S-7616</b>	QLD WORKSHOP	2839737 PO7395	\$169.05
13/03/2023	403,136 kms	<b>AIR LEAK R-2928</b> FOUND HOSE HAD RUBBED THROUGH BEHIND REAR DIFF, REPLACED WITH NEW AND RE-DIRECTED WHERE HOSE RAN	QLD WORKSHOP	2810114 PO7265	\$47.37
28/02/2023	399,112 kms	<b>A S-7378</b>	QLD WORKSHOP		\$0.00
27/02/2023	399,112 kms	<b>Heavy Vehicle Inspection Checklist - Truck I-123</b>			\$0.00
27/02/2023	399,112 kms	<b>C S-7337</b>	QLD WORKSHOP	2792149 PO7165	\$895.29
02/02/2023	385,375 kms	<b>ROTATE/BALANCE STEER, ROTATE DRIVES T-1490</b> TREAD CARE ROTATED AND BALANCED STEERS AND ROTATED DRIVES CROSS TO CROSS	TREADCARE PTY LTD		\$0.00
02/02/2023	385,375 kms	<b>A S-7100</b> Ice pack service @ 754HRS	MELBOURNE VIC WORKSHOP	575335 PO7085	\$38.85
09/01/2023	368,116 kms	<b>MIRROR R-2734</b> Have fitted a brand new passenger spotter mirror and adjusted to drivers setting	MELBOURNE VIC WORKSHOP	573736 PO6860	\$36.32
09/01/2023	368,117 kms	<b>A S-6883</b>	MELBOURNE VIC WORKSHOP		\$0.00
19/12/2022	356,505 kms	<b>B S-6732</b>	MELBOURNE VIC WORKSHOP	572231 PO6697	\$156.40
25/11/2022	343,212 kms	<b>BATTERY'S R-2598</b> load tested battery's not holding charge drops off very quick, replaced all 4 battery's	MELBOURNE VIC WORKSHOP	570989 PO6559	\$767.23
14/11/2022	337,370 kms	<b>A S-6511</b> Tire rotation have been done on drives and steers	MELBOURNE VIC WORKSHOP		\$0.00

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
14/11/2022	337,370 kms	<b>ICE PACK, WIPER BLADE</b> R-2550 auto elec checked for leaks and re gased Have removed worn wiper blades and fitted brand new trp wiper blades on	TRUCK PRO AUTO ELECTRICS	569905 PO6406	\$654.26
31/10/2022	327,990 kms	<b>A</b> S-6344	MELBOURNE VIC WORKSHOP		\$0.00
30/10/2022	327,990 kms	<b>ROTATE/BALANCE STEER</b> T-1367 rotated and balanced steers - side to side	MELBOURNE VIC WORKSHOP		\$0.00
03/10/2022	312,923 kms	<b>A</b> S-6151	MELBOURNE VIC WORKSHOP		\$0.00
09/09/2022	295,809 kms	<b>B</b> S-6048 Brand new tires in drives	MELBOURNE VIC WORKSHOP	565360 PO5986	\$148.64
09/09/2022	295,809 kms	<b>NEW DRIVE TYRES</b> T-1304 fitted 8 new drive tyres	TREADCARE PTY LTD	140380 PO5958	\$5,747.98
23/08/2022	282,363 kms	<b>A</b> S-5883 tightened front engine mount bolts marked with red paint pen	MELBOURNE VIC WORKSHOP		\$0.00
19/08/2022	280,407 kms	<b>HUB CAP COVERS</b> R-2312 Have fitted a brand new Kenworth steer hub cap	MELBOURNE VIC WORKSHOP	563780 PO5802	\$29.19
01/08/2022	266,337 kms	<b>A</b> S-5701	MELBOURNE VIC WORKSHOP		\$0.00
01/08/2022	266,337 kms	<b>ROTATE/BALANCE STEER, ROTATE DRIVES</b> T-1250 rotated drives cross to cross rotated and balanced steers side to side	TREADCARE PTY LTD		\$0.00
08/07/2022	251,279 kms	<b>A</b> S-5546	MELBOURNE VIC WORKSHOP		\$0.00
20/06/2022	238,086 kms	<b>B</b> S-5403	MELBOURNE VIC WORKSHOP	559752 PO5428	\$145.33
20/06/2022	238,086 kms	<b>EXHAUST LEAK</b> R-2097 replaced exhaust gasket	MELBOURNE VIC WORKSHOP	559753 PO5429	\$28.19
31/05/2022	226,213 kms	<b>PUNCTURE REPAIR</b> T-1160 double d tyres in somerton put a patch on it but its very close to side wall and tyre fitter thinks its not gonna hold for long	DOUBLE-D TRUCK TYRES PTY LTD	CAM35304 PO5187	\$60.00
27/05/2022	224,109 kms	<b>ROTATE/BALANCE STEER, ROTATE DRIVES</b> T-1143 drives rotated side to side steer tyres flipped and balanced	TREADCARE PTY LTD		\$0.00
26/05/2022	224,109 kms	<b>A</b> S-5265	MELBOURNE VIC WORKSHOP		\$0.00
06/05/2022	210,000 kms	<b>A</b> S-5100	MELBOURNE VIC WORKSHOP		\$0.00
23/03/2022	192,693 kms	<b>A</b> S-4843	MELBOURNE VIC WORKSHOP		\$0.00
01/03/2022	179,566 kms	<b>C</b> S-4645	MELBOURNE VIC WORKSHOP	551719 PO4495	\$789.05

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
01/03/2022	179,566 kms	<b>B S-4643</b>	MELBOURNE VIC WORKSHOP	551718 PO4494	\$133.75
01/03/2022	179,566 kms	<b>NEW STEERS</b> T-994 new bridgestone steers balanced and fitted	TREADCARE PTY LTD	134919 PO4473	\$1,313.40
13/02/2022	165,384 kms	<b>GEAR BOX LEAKS</b> R-1618 sent back for warranty	KENWORTH TRUCKSPACCAR PARTS	1082023 PO4294	\$451.00
07/02/2022	163,895 kms	<b>A S-4471</b> serviced ice pack 303hrs	MELBOURNE VIC WORKSHOP	549610 PO4246	\$127.50
11/01/2022	151,102 kms	<b>ENGINE OIL LEAK</b> R-1494 sent to cummins for timing cover reseal under warranty	CUMMINS SOUTH PACIFIC PTY LTD		\$0.00
03/01/2022	149,940 kms	<b>A S-4214</b>	MELBOURNE VIC WORKSHOP		\$0.00
08/12/2021	136,161 kms	<b>A S-4039</b>	MELBOURNE VIC WORKSHOP		\$0.00
06/12/2021	136,161 kms	<b>ROTATE/BALANCE STEER, ROTATE DRIVES</b> T-814 rotated and balanced steers rotated drives cross to cross	TREADCARE PTY LTD		\$0.00
16/11/2021	120,741 kms	<b>B S-3902</b>	MELBOURNE VIC WORKSHOP		\$133.75
24/10/2021	105,406 kms	<b>A S-3693</b>	MELBOURNE VIC WORKSHOP		
10/09/2021	90,550 kms	<b>100,000KLM ENGINE TUNE]</b> R-1124 carried out a 100,000km engine tune inspected cam and rockers for any premature wear			
26/08/2021	90,535 kms	<b>ROTATE/BALANCE STEER, ROTATE DRIVES</b> T-608 rotated and balanced steer tyres rotated drives side to side	TREADCARE PTY LTD		
26/08/2021	90,535 kms	<b>A S-3274</b>	MELBOURNE VIC WORKSHOP		
30/07/2021	75,112 kms	<b>A S-3074</b>	QLD WORKSHOP		
14/07/2021	61,829 kms	<b>ESOC FITTINGS, FITTED GPS</b> R-890 fitted esoc fittings fitted tracker out of xq56cl			
14/07/2021	61,829 kms	<b>B S-2843</b> fitted gps tracker out of xq56cl fitted esoc fittings	MELBOURNE VIC WORKSHOP	535997 PO2708	\$133.75
14/06/2021	42,500 kms	<b>ROTATE/BALANCE STEER, ROTATE DRIVES</b> T-475	MELBOURNE VIC WORKSHOP		
08/06/2021	42,500 kms	<b>A S-2648</b>	MELBOURNE VIC WORKSHOP		
24/05/2021	29,520 kms	<b>A S-2431</b> havnt fitted tracker due to not having any	MELBOURNE VIC WORKSHOP		
12/05/2021		<b>ROOF LEAKS</b> R-667 RUCK SENT TO B&H FOR ROOF REPAIRS	BROWN & HURLEY GROUP		

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
08/04/2021	9,854 kms	<b>FIRST SERVICE</b> R-554 BOTH DIFF OILS AND FILTER CHANGED OUT ALL OK	QLD WORKSHOP	2158167 PO1738	\$22.03
<b>136 Records</b>				<b>Total:</b>	<b>\$45,703.36</b>