



Vehicle History Detail



Fleet #	PM398
Registration	XQ27SE
Make	Kenworth
Model	K200
VIN / Chassis #	6F5000000MA469821

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
		ROTATE DRIVES, ROTATE STEER T-3857 2 x steer rotation 4 x drive rotation	DARREN BUDD'S TYRES PTY LTD		\$0.00
		hub cap R-6859 STEER HUB CAP	QLD WORKSHOP		\$0.00
19/01/2026	1,220,303 kms	A S-15946 carry out a service top up engine oil 5ltrs top up coolant 3ltrs download ecm	QLD WORKSHOP		\$25.85
05/01/2026		custom air repair, custom air service R-6861	QLD WORKSHOP		\$360.25
23/12/2025		BREAKDOWN, COMPRESSOR R-6848	WARREGO TRANSPORT REPAIRS PTY LTD		\$770.00
19/12/2025	1,208,375 kms	A S-15776 carry out a service replace unloader valve rear drive brakes getting low	QLD WORKSHOP		\$0.00
02/12/2025	1,188,060 kms	A S-15621 carry out a service download ecm check ecm oil pressure compared to gauge replace headlight globe custom air serviced 3968hrs next due 4268hrs take oil sample	QLD WORKSHOP		\$236.03
11/11/2025	1,172,017 kms	B S-15462	QLD WORKSHOP		\$433.59
07/11/2025	1,172,017 kms	JAKES NOT WORKING, SUMP LEAK R-6641	CUMMINS SOUTH PACIFIC PTY LTD		\$0.00
06/11/2025	1,164,899 kms	HORTON FAN STUCK ON R-6633	QLD WORKSHOP		\$0.00
29/10/2025	1,159,535 kms	DIFF OIL LEAK, Horton Fan R-6585	QLD WORKSHOP		\$330.00
23/10/2025	1,157,486 kms	ROTATE DRIVES, ROTATE STEER T-3692	QLD WORKSHOP		\$0.00
23/10/2025	1,157,486 kms	ALTERNATOR, CHECK BATTERIES, CHECK ENGINE LIGHT, MUDFLAPS, MUD GUARD R-6558 KINGPIN CAP GASKETS LEAKING SUMP LEAKING REAR DIFF INPUT SEAL LEAKING	QLD WORKSHOP		\$1,155.63

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
23/10/2025	1,157,486 kms	A S-15309 STEERING UNI JOINT	QLD WORKSHOP		\$164.45
15/10/2025	146,303 kms	COOLANT TRANSFER PIPE, GEARBOX HARNESS R-6526	QLD WORKSHOP		\$667.89
13/10/2025	1,146,303 kms	A S-15206 CARRIED OUT A SERVICE REPLACED GEARBOX HARNESS REPLACED COOLANT TRANSFER PIPE ""0" RINGS CUSTOM AIR UNIT @ 4433 DUE @ 4692	QLD WORKSHOP		\$0.00
25/09/2025	1,131,931 kms	CLUTCH ADJUSTMENT, WASTEGATE R-6435	QLD WORKSHOP		\$646.70
25/09/2025	1,131,931 kms	GOVERNOR VALVE R-6444	QLD WORKSHOP		\$35.75
25/09/2025	1,131,931 kms	CUSTOM AIR KIT R-6443 3,668 hrs	QLD WORKSHOP		\$60.14
23/09/2025	1,131,931 kms	A S-15054 CARRY OUT A SERVICE TOOK TRUCK FOR DRIVE TO CHECK REVING ISSUE. ALL OK TRUCKED REVED OVER 1500 RPM EVERY TIME	QLD WORKSHOP		\$0.00
03/09/2025	1,112,486 kms	B S-14893	QLD WORKSHOP		\$229.23
27/08/2025	1,127,745 kms	GEARSTICK, TRAILER ABS LIGHT R-6283	QLD		\$0.00
19/08/2025	1,101,634 kms	A S-14724 CARRY OUT A SERVICE REPLACED BOTH WIPER ARMS AND WIPER BLADES	QLD WORKSHOP		\$109.20
07/08/2025	1,085,415 kms	AD BLUE FAULT R-6170	QLD WORKSHOP		\$1,331.04
06/08/2025	1,088,960 kms	ABS FAULT, ENGINE OIL LEAK R-6165 TRUCK ENTERED THE WORKSHOP FOR ABS FAULTS PULLED APART THE ABS LEAD AND FOUND THE TRUCK HAD PULLED OUT WIRES IN THE PLUG ASWELL AS NOT WIRED CORRECTLY FIXED UP WIRING, REPLACED ABS FUSES IN THE TRUCK. ALL GOOD NEW STEER TYRES FITTED BY CURTIS.G. ENGINE OIL LEAK WAS ROCKER COVER WASNT SEALED CORRECTLY TO THE HEAD, REMOVED CLEANED SURFACE AND ALL GOOD POTENTIAL CAM CAP LEAK ON THE BACK OF THE ENGINE, CLEANED AND MONITOR	QLD WORKSHOP		\$68.97
06/08/2025	1,088,960 kms	NEW STEERS T-3488	QLD WORKSHOP		\$0.00
15/07/2025		FUEL PRESSURE SENSOR, FUEL SENSOR R-6103	CUMMINS SOUTH PACIFIC PTY LTD		\$330.00
08/07/2025	1,075,256 kms	A S-14455	QLD WORKSHOP		\$54.41
08/07/2025	1,097,125 kms	NEW DRIVES T-3427 8 X NEW M866 BRIDGESTONE DRIVES FITTED	DARREN BUDD'S TYRES PTY LTD		\$8,206.00

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
23/06/2025	1,079,460 kms	AIR LEAKS, DOOR CARD, ELECTRICAL, ENGINE OIL LEAK, HEADLIGHT COVER, Horton Fan , WIPER BLADE R-5988 CUMMINS FIXED CAM AND OIL LEAKS REPLACED THE FRONT MAIN SEAL replaced by srv workshop REPLACED THE PASSENGER S/D INDICATOR AS IT WAS FULL OF WATER VOLT GUAGE KEPT CRACKING FUSES AS IT WAS ZIPTIED TO TIGHT REPLACED AIR TANK FITTING BROKEN HORTON FAN WIRE CAUSING THE HORTON FAN TO ACT ERRATIC NEW DRIVERS SIDE HEADLIGHT PROTECTOR NEW UPHOLSTERY PIN FOR DRIVERS DOOR CARD REPLACED ABS FUSES AS THEY WERE BLOWN IN TRUCK REPLACED BOTH WIPER BLADES	QLD WORKSHOP		\$84.28
19/06/2025		Engine R-5985	CUMMINS SOUTH PACIFIC PTY LTD		\$0.00
12/06/2025	1,069,553 kms	A S-14273 CARRY OUT A SERVIE REPLACE LEFT HAND HEAD LIGHT GLOBE SUMP RESEALED BY CUMMINS REPAIR VOLT GUAGE BLOWN FUSE TIGHTEN CROSS OVER BAR BOLTS CHECKED VEHICLE FOR AIRLEAKS SPRAYED ALL AIR BAGS FITTINGS AND LINES NO LEAKS FOUND	QLD WORKSHOP		\$0.00
12/06/2025	69,553 kms	CAB SHOCK, ENGINE OIL LEAK R-5963	CUMMINS SOUTH PACIFIC PTY LTD, QLD WORKSHOP		\$517.46
21/05/2025	1,047,552 kms	ENGINE REBUILD R-5845 - Drive truck to workshop - Pre-checks & JSA - Removed ducting & rocker cover - Inspect camshaft, found to be scored - Inspect rockers, found Rocker rollers are scored - Removed drive belt & damper - Remove lower gear cover, found broken/crack on top left hand - Remove Air Intake Connection Adapter & fuel lines - Remove fuel pump actuator housing & fuel pump head - Remove fuel pump head. - Upon inspection, fuel pump tappet roller is worn/scoring - And fuel pump camshaft is worn/scoring as well - Removed engine intake plumbing, stripped top of engine, stripped front of engine. - Removed cam gear and cam idler gear. - Removed fuel pump; had lower pump bolt break during removal process. - Sublet repaired needed to remove broken bolt - Pin crank - Inspect rocker levers - Cylinders #1 Intake, #3 intake, #3 exhaust, #5 intake, #6 Exhaust rollers are scored - Clean camshaft gear & tone wheel - Cleaned & inspected all parts - Clean secondhand camshaft, fuel pump body & rocker levers - Refit camshaft cover plate & rocker assembly - Refit cross heads & completed base engine timing - Refit tin covers, crank speed sensor & damper - Disassembled and replaced fuel pump gear pump. - Fit fuel pump & fuel pump actuator - Fit fuel pump braces/brackets & plumbed. - Carried out overhead set - Refit rocker cover, fan hub, belts & backside idler. - Refit air intake ducting - Fill fluids - Complete dyno run - Checked all features & parameters, all ok - Noticed oil leak at sump - Drained engine oil & removed belly bar - Lowered sump - Cleaned surfaces - Fit new gasket, refit sump & belly bar - Checked over, packed up, filled out paperwork & returned vehicle to service ***** Cummins Goodwill coverage for second hand camshaft, fuel pump & rocker levers *****	CUMMINS SOUTH PACIFIC PTY LTD		\$3,361.04
12/05/2025	1,051,144 kms	B S-14011 B SERVICE (OIL AND FILTER DONE AT CUMMINS DUE TO ENGINE REBUILD)	QLD WORKSHOP		\$175.51
12/05/2025		wheel alignment R-5790	BRETT STEELE LASER ALIGNMENTS PTY LTD		\$550.00
16/04/2025	1,033,259 kms	C S-13828 REPLACED EBS PLUG, CHIP IN P/S WINDSCREEN, REPLACED UNLOADER VALVE, REPLACED TANK PRESSURE RELIEF VALVE	QLD WORKSHOP		\$1,080.98

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
16/04/2025	1,033,259 kms	ROTATE DRIVES, ROTATE STEER T-3294 ROTATED STEERS AND DRIVES SIDE TO SIDE	QLD WORKSHOP		\$0.00
16/04/2025	1,033,259 kms	Heavy Vehicle Inspection Checklist - Truck I-693	QLD WORKSHOP		\$0.00
16/04/2025	1,033,259 kms	EBS PLUG, KING PINS, UNLOADER VALVE R-5520 -JACKED UP THE FROUNT AXEL, RIPPED WHEELS AND DRUMS OFF , PULLED HUBS OFF THE SPINDLE STRIPPED DOWN BREAK ASSEMBLY. - PULLED KING PIN CAPS OFF, PULLED WEDGES OUT AND DROPPED THE KINGPINS OUT, DEGREASED SPINDLE, BREAK ASSEMBLY AND HUB. - TOOK THE SPINDLE TO BROWN AND HURLEY TO PUT THE KINGPIN BUSHES AND SEAL IN THEY REAMED THE BUSH, CHECKED TO SEE HOW TIGHT THE KINGPIN WAS IN THE BUSHES ALL WAS GOOD. - REMOVED AND REPLACED WHEEL BEARINGS - PLACED THE SPINDLE ON PLACED THE CORRECT AMOUNT OF SHIMS BETWEEN FOR MINIMAL PLAY. - KINGPIN, CAPS, WEDGES, GREASE NIPPLES ALL ON - BREAK ASEMBLY RE ATACHED, TORQED TO SPEC, ADDED GREASE TO WHEEL BEARINGS AND HUBS, PLACED HUB AND WHEEL BEARINGS ON, TORQUED TO SPEC -WHEELS, DRUMS, BALANCE RINGS ATTACHED TORQUED TO SPEC - CHECKED KINGPIN AND WHEEL BEARINGS NO PLAY - REPLACED EBS PLUG - REPLACED UNLOADER VALVE AND TANK PRESSURE RELIEF VALVE SENT BACK INTO SERVICE	QLD WORKSHOP		\$0.00
09/04/2025	1,026,027 kms	A S-13834 CUSTOM AIR 3400HRS DUE 3660HRS	QLD WORKSHOP		\$0.00
26/03/2025	1,013,733 kms	A S-13677 ADDED 6 LITRES ENGINE OIL FIXED RHS 1ST AXLE GUARD HANGER BRACKET ALL LOWER SHOCK BUSHES U/S 2 TORQUE ROD BUSHES U/S 2ND DRIVE 1ST DRIVE BRAKE LININGS 6MM CUSTOM AIR SERVICED AT 3362 HOURS NOW DUE 3662 HOURS.	QLD WORKSHOP		\$43.88
26/03/2025	1,013,733 kms	DRIVE BRAKES, SHOCK BUSHES, TORQUE ROD BUSHES R-5649 REPLACED 1ST DRIVE BRAKE SHOES, DRUMS AND HARDWARE. ADJUSTED BRAKES ALL OKAY. REPLACED 2 U/S TORQUE ROD BUSHES ON 2ND DRIVE, ALL OKAY. REPLACED ALL LOWER SHOCK BUSHES AS WERE HEAVILY WORN AND U/S, ALL OKAY	QLD WORKSHOP		\$1,072.53
18/02/2025	983,330 kms	B S-13467 B-SERVICE	QLD WORKSHOP		\$173.80
07/02/2025	973,563 kms	ROTATE DRIVES, ROTATE STEER T-3166 DRIVES ROTATED DIAGONAL STEERS ROTATED SIDE/SIDE	DARREN BUDD'S TYRES PTY LTD		\$165.00
07/02/2025	973,563 kms	A S-13325 CUSTOM AIR SERVICED AT 3083 HOURS NOW DUE AT 3383 HOURS REPLACED WIPER BLADES REPLACED TV AERIAL	QLD WORKSHOP		\$178.48
21/01/2025	957,509 kms	BREAKDOWN, COOLANT SENSOR R-5414 TRAVEL TO TRUCK AT AMPOL SERVICE STATION WARWICK INSPECT ISSUE WITH TRUCK DERATING AND CHECK/STOP ENGINE LIGHTS ON FOUND ISSUE TO BE LOW COOLANT CHECKED COOLANT LEVEL- OK GENERAL CHECK OVER WIRING AND LOOM FROM SENSOR TO ECU-OK REPLACED LOW COOLANT SENSOR AND COOLANT LEVEL MODULE DASH LIGHTS INTERMITTENTLY COMING ON/OFF TEST VARIOUS WIRING & PLUGS FOR POWER AND EARTH/ CONTINUITY CHECK AND TIGHTEN ECU PLUGS VEHICLE TURNED ON AND LOOM WRIGGLE TESTED-OK CHECK/STOP ENGINE LIGHTS NOW NOT ILLUMINATING AND ECU FAULTS INACTIVE TRUCK SENT BACK TO SERVICE	COUNTRY SIDE DIESEL		\$670.36

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
14/01/2025	951,888 kms	A S-13192 CLUTCH ADJUSTMENT CUSTOM AIR SERVICED NEXT DUE 3210HRS	QLD WORKSHOP		\$0.00
02/01/2025	936,124 kms	A S-13084 NEW ADBLUE CAP RUBBER NEW RADIATOR CAP RE CRIMPED TERMINAL ON THE COOLANT TEMP SENSOR CUSTOM AIR SYSTEM @2598HRS NEXT DUE@2650HRS	QLD WORKSHOP		\$15.17
11/12/2024	921,962 kms	B S-12942 FRONT DRIVE BRAKE RIGHT HAND SIDE HAS AROUND 7MM LEFT SERVICED UNIT , 2712 HOURS NEXT DUE AT 3012	QLD WORKSHOP		\$217.34
11/12/2024	921,962 kms	ROTATE DRIVES, ROTATE STEER T-3023 ROTATED STEER TYRES AS REQUIRED. ROTATED DRIVES SIDE TO SIDE AS REQUIRED DONE BY QLD WORKSHOP	QLD WORKSHOP		\$0.00
20/11/2024	902,535 kms	A S-12767 A SERVICE COMPLETED.	QLD WORKSHOP		\$0.00
05/11/2024	891,180 kms	A S-12629 CUSTOM AIR 2553HRS DUE 2650HRS P/S FRONT ENGINE MOUNT SPLITTING LOWEST BRAKE 9MM	QLD WORKSHOP		\$0.00
05/11/2024	891,180 kms	STRIP/FIT T-2959 1 X STRIP/FIT TYRE TO NEW RIM TO REPLACE CRACKED ALCOA RIM AROUND VALVE NEW RIM SOURCED UNDER WARRANTY FROM ALCOA	DARREN BUDD'S TYRES PTY LTD		\$27.50
05/11/2024	891,180 kms	ROTATE DRIVES, ROTATE STEER T-2936 QLD WORKSHOP ROTATED DRIVES DIAGONAL LEFT STEERS FOR NEXT ROTATE	QLD WORKSHOP		\$0.00
16/10/2024	876,510 kms	NEW STEERS T-2900 2 X BRIDGESTONE R154 POS 1,2	DARREN BUDD'S TYRES PTY LTD		\$1,485.00
16/10/2024	876,510 kms	A S-12432 TOPPED UP ENGINE OIL TOPPED UP COOLANT REPLACED STEERS.	QLD WORKSHOP		\$0.00
20/09/2024	856,881 kms	B S-12255 ICE PACK 2433hrs Due @ 2653hrs	QLD WORKSHOP		\$222.57
05/09/2024	843,163 kms	REVERSE SQUAWKER, WATER TEMP SENSOR R-4939 REVERSE SQUAWKER NOT WORKING, CHECKED FOR POWER AT PLUG, HAD BOTH POWER AND EARTH, FITTED NEW SQUAWKER INTO PLACE AS REQUIRED, TESTED ALL OPERATIONS, ALL OKAY. FOUND WATER TEMP SENSOR AND GAUGE FAULTY, REPLACED BOTH GAUGE AND TEMP SENSOR AS REQUIRED, TESTED ALL OPERATIONS, ALL WORKING, ALL OKAY	QLD WORKSHOP		\$228.32
03/09/2024	841,394 kms	ROTATE DRIVES, ROTATE STEER T-2802 ROTATED DRIVES SIDE/SIDE STEERS ROTATED SIDE/SIDE	DARREN BUDD'S TYRES PTY LTD		\$165.00
03/09/2024	841,389 kms	A S-12093 REPLACED O-RINGS FOR COOLANT TRANSFER PIPE. P/S FRONT ENGINE MOUNT SMALL SPLIT. A/C HOSE PIN HOLE LEAK	QLD WORKSHOP		\$0.00

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
30/08/2024	841,389 kms	AIR CONDITIONER, TRANSFER WATER PIPE R-4911 PRESSURISE SYSTEM FOR LEAKS, FOUND PIN HOLE LEAK IN LOW PRESSURE HOSE REMOVE AND REPLACED A/C COMPRESSOR, LOW PRESSURE SIDE HOSE AND AIR DRYER, VAC DOWN SYSTEM, HOLDS NEGATIVE PRESSURE PUT 1.4 GRAMS OF R134A INTO SYSTEM A/C IS COLD AND WORKING CORRECTLY DRAINED COOLANT AND REMOVE AND REPLACED RUBBER O-RINGS FOR TRANSFER PIPE, CLEANED DOWN MOTOR, TAKEN FOR TEST DRIVE, RE-CHECKED FOR LEAKS, NO COOLANT LEAKS FOUND SENT BACK INTO SERVICE	QLD WORKSHOP	3310332/3310344	\$976.02
19/08/2024	830,706 kms	A S-11949 REPLACED BROKEN SUNVISOR CLIP AS REQUIRED CUSTOM AIR AT 2363 HOURS DUE AT 2653 HOURS POS 1 TYRE LOOSING MIDDLE TREAD PATTERN ALMOST 2ND LAYER	QLD WORKSHOP		\$10.18
29/07/2024	812,162 kms	A S-11755 FITTED BOLTS TO SECURE CLUTCH INSPECTION PLATE TIGHTENED ALL CLAMPS AND V BANDS LHS ENGINE MOUNT DISC SPLIT CUSTOM AIR UNIT AT 2357 HOURS DUE AT 2653 HOURS	QLD WORKSHOP		\$0.00
03/07/2024	797,286 kms	BATTERYS, WATER TEMP SENSOR R-4686 REMOVED ALL TERMINALS AND LOAD TESTED ALL BATTERIES, ALL FAILED, REMOVED ALL 4 BATTERIES AND REPLACED WITH NON SERVICABLE TRP BATTERIES, SECURED INTO PLACE AND REFITTED ALL TERMINALS, STARTED UNIT AND CHECKED CHARGE RATE FROM ALTERNATOR WHICH WAS 14 VOLTS, ALL OKAY. REMOVED AND REPLACED WATER TMP SENSOR REMOVED AND REPLACED RAD STAY BUSHES ALL OK	QLD WORKSHOP		\$711.22
25/06/2024	797,269 kms	ROTATE DRIVES T-2659 ROTATE DRIVES DIAGONAL STEERS DONE 13/6	DARREN BUDD'S TYRES PTY LTD	00032291	\$132.00
25/06/2024	797,269 kms	Heavy Vehicle Inspection Checklist - Truck I-537	QLD WORKSHOP		\$0.00
25/06/2024	797,269 kms	B S-11352 B-SERVICE CARRIED OUT ICE PACK SERVICED AT2353 FITTED ALTERNATOR AND STARTER MOTOR DUE BY KMS FITTED FRONT RIDGE MOUNTS	QLD WORKSHOP		\$209.13
24/06/2024	797,269 kms	ALTERNATOR ON KLMS, GEAR BOX OIL ON KLMS, STARTER MOTOR R-4656 DISCONNECTED BATTERIES REMOVED AND REPLACED ALTERNATOR AS REQUIRED ON KILOMETERS, SECURED INTO PLACE WITH ALL WIRING. REMOVED AND REPLACED STARTER MOTOR AS REQUIRED ON KILOMETERS, SECURED INTO PLACE WITH ALL REQUIRED WIRING ALL OKAY RECONNECTED BATTERIES STARTED UNIT AND CHECKED CHARGE RATE ALL OKAY. SENT BACK TO SERVICE REMOVED AND REPLACED GEARBOX OILS ON KLMS	QLD WORKSHOP	3242067	\$976.56
21/06/2024	797,269 kms	C S-11197 C-SERVICE GEARBOX OIL REPLACED ON KMS	QLD WORKSHOP		\$1,041.09
13/06/2024	790,922 kms	ROTATE STEER, TURN TYRE ON RIM T-2647 1 T.O.R POS 1 ROTATE POS 2 1 NEW VALVE	DARREN BUDD'S TYRES PTY LTD		\$60.50
30/05/2024	780,168 kms	A S-11226 2ND DIFF LEAKING, COOLANT TRANSFER PIPE LEAKING MIDDLE O-RING BATTERY WATER LEVEL IS GOOD CUSTOM AIR HRS, CURRENTLY 2336HRS, DUE 2622HRS	QLD WORKSHOP		\$280.00

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
27/05/2024	777,069 kms	cab shocker, HORN, WASTEGATE ACTUATOR R-4549 REPLACED DRIVERS SIDE CAB SHOCK WITH NEW, RATCHET STRAP AROUND OLD CAB SHOCK, TIGHTEN TILL HARD, (DONE BY JACK.B) REPLACED FAULTY HORMS (DONE BY MATT.C) REPLACED FAULTY WASTEGATE (DONE BY MATT.C)	QLD WORKSHOP		\$582.43
13/05/2024	765,624 kms	FRONT SUSPENSION R-4460 REMOVE AND REPLACED FRONT STEER SHOCKS AND BUSHES	QLD WORKSHOP	3202639	\$706.29
08/05/2024	765,592 kms	A S-11029 ICE PACK WAS SERVICED AT 2322 NOW DUE AT 2622 FIRST DIFF IS LEAKING FRONT DRIVER SIDE CAB SHOCK LEAKING MOVEMENT IN FIRST UNI FROM GEAR BOX REMOVED AND REPLACED GUSSIT BEHIND GEAR BOX	QLD WORKSHOP		\$49.13
16/04/2024	748,310 kms	A S-10820 ICE PACK 2291 HOURS DUE AT 2349 HOURS	QLD WORKSHOP		\$0.00
02/04/2024	735,809 kms	DOSER PUMP, DRIVE BRAKES, FRIDGE R-4277 REMOVED AND REPLACED DOSER PUMP AND CARRIED OUT OVER RIDE TEST ALL WORKING NO LEAKS REMOVED AND REPLACED REAR AXLE DRIVE BRAKES ADJUSTED TO SPEC FITTED DRAW FRIDGE AND 2ND FRIDGE SOCKET. TESTED WORKING SENT BACK TO SERVICE	QLD WORKSHOP		\$4,498.12
02/04/2024	735,809 kms	B S-10698 B-SERVICE FOUND REAR DRIVE BRAKES LOW REPLACED FITTED NEW FRIDGE AND 2ND FRIDGE SOCKET NEW ADBLUE PUMP FIXED INTAKE MOUNT	QLD WORKSHOP	3168382	\$168.39
02/04/2024	732,809 kms	NEW DRIVE TYRES, ROTATE STEER T-2406 8 X M866 DRIVE TYRES ROTATED STEERS SID/SIDE	DARREN BUDD'S TYRES PTY LTD		\$6,633.00
06/03/2024	713,668 kms	A S-10491 ICE PACK AT 2142 HOURS DUE AT 2349 HOURS ALL BATTERIES TOPPED UP TO CORRECT LEVEL AS REQUIRED 1ST DRIVE CENTRE GASKET LEAKING TAILSHAFT UNI HAS EXCESSIVE MOVEMENT AT GEARBOX END	QLD WORKSHOP		\$0.00
12/02/2024	700,745 kms	A S-10271 REPLACED ADBLUE RUBBER TOPPED UP SERVICEABLE BATTERIES, REPLACED BOTTOM 2 BATTERIES FOR GOOD SERVICEABLE ONES SERVICED ICEPACK, NEXT DUE 2349HRS TIGHTENED BELLY BAR CLUTCH ADJUSTED	QLD WORKSHOP		\$41.66
24/01/2024	685,363 kms	A S-10148 front diff breather blocked	MELBOURNE VIC WORKSHOP		\$0.00
03/01/2024	668,609 kms	NEW STEERS, ROTATE DRIVES T-2227 ROTATED ALL DRIVES SIDE TO SIDE 2 X NEW BRIDGESTONE STEER TYRES FITTED UP ALL OK ALL COMPLETED BY QLD WORKSHOP	QLD WORKSHOP		\$1,430.00
29/12/2023	668,609 kms	B S-9912 6,650 hrs	QLD WORKSHOP		\$172.76

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
11/12/2023	653,571 kms	ENGINE OIL LEAK R-3818 FOUND ACCESSORY DRIVE BOLTS ON LHS OF ENGINE HAD COME LOOSE AND LEAKING OIL THROUGH GASKET, REMOVED ALL 3 BOLTS AND FITTED 3 NEW UPGRADED SIZE BOLTS AND TORQUED TO CORRECT SPEC OF 30FTLB REFITTED DRIVE BELT AND STARTED TRUCK, CHECKED OVER AND GOOD TO GO BACK INTO SERVICE, DEGREASED AND WASHED DOWN ENGINE BAY AND SUMP AREA, ALL OKAY	QLD WORKSHOP	3070129	\$44.65
11/12/2023	653,571 kms	A S-9738 ICE PACK AT 1695 HOURS DUE AT 1910 HOURS TOPPED UP COOLANT LEVEL 3 LITRES REPAIRED FRONT TIMING COVER OIL LEAK	QLD WORKSHOP		\$0.00
22/11/2023	638,734 kms	A S-9594 ICE-PACK SERVICED AT 1610HRS FLUSHED AB-BLUE SYSTEM UNBLOCKED AD-BLUE TANK BREATHER FUEL PUMP LEAKS FROM REAR 1ST DIFF LEAKING	QLD WORKSHOP		\$0.00
07/11/2023	625,791 kms	ROTATE DRIVES, ROTATE STEER T-2097 ROTATED ALL DRIVES DIAGONAL ROTATED STEERS SIDE TO SIDE	QLD WORKSHOP		\$0.00
07/11/2023	625,791 kms	A S-9442 CARRIED OUT A-SERVICE REPLACED 7 DASH BULBS	QLD WORKSHOP	3039744	\$17.94
17/10/2023	607,780 kms	B S-9252	QLD WORKSHOP	3023887	\$172.76
16/10/2023	607,780 kms	Horton Fan , REPLACE COMP ON KLMS R-3638 REMOVE FAN FROM HUB AND REMOVE HUB FROM MOTOR PULL DOWN HORTEN HUB ON BENCH AND CLEAN ALL MAIN PARTS REKIT AND ASEMBLE AND REINSTALL INTO TRUCK, REFIT FAN START TRUCK UP AND TEST HORTEN FAN DRAIN COOLANT OUT OF TRUCK, REMOVE ALL AIR PIPING AND COOLANT LINES FROM COMPRESSOR, REMOVE POWER STEERING PUMP FROM COMPRESSOR, REMOVE COMPRESSOR, USE FITTINGS FROM OLD COMPRESSOR BUT REPLACED ALL O-RINGS, CLEANED ALL SURFACE AND REPALCED COMPRESSOR GASKET, INSTALLED COMPRESSOR AND FITTED ALL LINES BACK ON REMOVE AND REAPLCED GOVERNER VALVE, REPLACED GASKET BETWEEN COMPRESSOR AND POWER STEERING PUMP, PUT COOLANT BACK INTO TRUCK AND SENT FOR A TEST DRIVE, AFTER TEST DRIVE CHECKED ALL COMPONENTS FOR LEAKS, NO LEAKS FOUND. SENT TRUCK BACK INTO SERVICE	QLD WORKSHOP	3023872	\$4,671.20
27/09/2023	589,752 kms	A S-9083 REPLACED DRIVERS WIPER BLADE ARM	MELBOURNE VIC WORKSHOP	592442	\$98.52
11/09/2023	575,438 kms	A S-8907 TOPPED UP BATTERIES ICEPACK CURRENTLY 1430HRS DUE 1630HRS	QLD WORKSHOP		\$0.00
11/09/2023	575,438 kms	ROTATE DRIVES, ROTATE STEER T-1873 10 X ROTATE SIDE TO SIDE	DARREN BUDD'S TYRES PTY LTD	29866	\$165.00
11/09/2023	575,438 kms	TORQUE ROD BUSHES, WIPER BLADE R-3468 REMOVE AND REPLACED WIPER BLADES REMOVE 1ST AXLE BOTTOM SWAY BAR, REMOVE BUSHES AND REPLACED WITH NEW USING HYDRAULIC PRESS RE-INSTALL SWAY BAR WITH NEW REAR BUSHES, SLIDE UP INTO PLACE AND USE CORRECT AMOUNT OF WASHERS FOR ALLIGNMENT. TIGHTEN ALL BOLTS SEND TRUCK BACK INTO SERVICE	QLD WORKSHOP	2990317	\$425.74

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
09/08/2023	564,925 kms	A S-8663	QLD WORKSHOP		\$0.00
18/07/2023	548,490 kms 6,650 hrs	B S-8504	QLD WORKSHOP	2945713	\$168.81
30/06/2023	533,528 kms	A S-8375 1ST DRIVE DIFF SEAL LEAKING LHS ENGINE MOUNT TORN MINOR WEAP FROM FRONT LHS SUMP	QLD WORKSHOP		\$0.00
15/06/2023	524,188 kms	C S-8252	QLD WORKSHOP	2900520	\$986.66
15/06/2023	524,188 kms	A S-8195	QLD WORKSHOP		\$0.00
15/06/2023	524,188 kms	Heavy Vehicle Inspection Checklist - Truck I-278			\$0.00
15/06/2023	524,193 kms	ROTATE DRIVES, ROTATE STEER T-1791 ROTATED ALL DRIVES DIAGONAL ROTATED STEERS SIDE TO SIDE FLIPPED POS # 1 ON RIM	DARREN BUDD'S TYRES PTY LTD	29170	\$126.50
14/06/2023	524,188 kms	TURBO ON KLMS R-3198 REMOVED FRONT TURBO HOUSING TO GAIN MORE ACCESS TO OIL DRAIN AND OIL FEED FITTINGS, REMOVED OIL DRAIN AND OIL FEED LINES, REMOVED EXHAUST MANIFOLD FROM BLOCK, REMOVED TURBO FROM MANIFOLD ON TABLE NEW STUDS FITTED TO FLANGE NEW TURBO FITTED AND ALL NUTS TORQUED TO SPEC, CLEANED UP ALL EXHAUST GASKET FROM OFF HEAD, WIRE WHEELED ALL MANIFOLD BOLTS TO CLEAN ALL SURFACE MATERIAL OFF, FITTED MAINFOLD AND TURBO BACK TO BLOCK WITH NEW GASKETS TORQUED ALL EXHAUST MANIFOLD BOLTS TO SPEC, FITTED FRONT TURBO HOUSING ALONG WITH OIL PICKUP AND OIL DRAIN WITH NEW O RINGS, FITTED CHARGE PIPE BAKC INTO PLACE AND SECURED ALL CLAMPS, RAN ENGINE UP TO OPERATING TEMP NO LEAKS, ALL OKAY.	QLD WORKSHOP	2900559	\$7,678.20
22/05/2023	503,837 kms	A S-8066 SLIGHT MOVEMENT IN 1ST UNI SLIGHT MOVEMENT IN 1ST DIFF INPUT	QLD WORKSHOP		\$0.00
02/05/2023	489,348 kms	B S-7874	MELBOURNE VIC WORKSHOP	581754	\$62.59
29/03/2023	472,150 kms	ROTATE DRIVES, ROTATE STEER T-1702 ROTATED STEERS SIDE TO SIDE ROTATED DRIVES SIDE TO SIDE DONE BY QLD WORKSHOP	DARREN BUDD'S TYRES PTY LTD		\$0.00
29/03/2023	472,150 kms	BALANCE RINGS, REVERSE BUZZER R-2972 REPLACED REVERSE ALARM WITH REVERSE SQUAWKER BALANCE RINGS FITTED UP TO STEER AXLE	QLD WORKSHOP	INV-4941 PO7471	\$644.24
29/03/2023	472,150 kms	A S-7614 SLIGHT MOVEMENT IN 1ST UNI SLIGHT MOVEMENT IN 1ST DIFF INPUT ICE PACK SERVICED AT 1330HRS	QLD WORKSHOP	2820819 PO7386	\$40.10
08/03/2023	454,944 kms	A S-7439	QLD WORKSHOP		\$0.00
20/02/2023	441,303 kms	A S-7280 INJECTOR TEST DONE DUE TO DRIVER SAYING TRUCK STARTS RUFF SOME TIMES, ALL PASSED ON TEST	QLD WORKSHOP		\$0.00
30/01/2023	425,852 kms	B S-7075 ICE PACK SERVICED AT 1056HRS	QLD WORKSHOP	2752573 PO6967	\$209.15

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
30/01/2023	425,856 kms	NEW STEERS, ROTATE DRIVES T-1503 2 X NEW BRIDGESTONE STEER TYRES BALANCE AND FITTED UP ALL OK ROTATED ALL DRIVES DIAGONAL	QLD WORKSHOP	28114 PO6965	\$1,674.20
09/01/2023	409,894 kms	A S-6918	QLD WORKSHOP		\$0.00
07/12/2022	391,491 kms	A S-6709 548 hrs FRONT SHACKEL BUSH BOLTS TIGHTEND POWER STEER PUMP HOSE FITTINGS TIGHTED ON PUMP	QLD WORKSHOP		\$0.00
16/11/2022	376,693 kms	A S-6530 548 hrs	MELBOURNE VIC WORKSHOP		\$0.00
31/10/2022	364,042 kms	ROTATE/BALANCE STEER T-1351 ROTATE AND BALANCE STEER TYRES AS NEEDED FLIPPED POS # 2 ON RIM	DARREN BUDD'S TYRES PTY LTD	27479 PO6372	\$93.50
31/10/2022	364,042 kms	B S-6388 REPLACED WHIPPER BLADES	QLD WORKSHOP	2672608 PO6287	\$214.07
24/10/2022	358,598 kms	NEW DRIVE TYRES T-1423 ALL NEW M766 BRIDGSTONE DRIVE TYRES FITTED UP ALL OK 4 X DUMPS	DARREN BUDD'S TYRES PTY LTD	27404 PO6260	\$6,032.40
20/10/2022	356,720 kms	CLUTCH ADJUSTMENT, DASH GLOBES R-2476 Have removed X2 dash gauges and globes pulled out and fitted X2 brand new dash gauge globes tested and works good Have removed the clutch inspection plate check gap was off about so have adjusted clutch to where it was needed and put the inspection plate back on also adjusted free play about as well to drivers preference	MELBOURNE VIC WORKSHOP	568327 PO6305	\$4.67
12/10/2022	349,454 kms	A S-6196 X3 dash globes replaced X2 steer hub covers replaced	MELBOURNE VIC WORKSHOP		\$0.00
11/10/2022	349,454 kms	DASH GLOBES, HUB COVER R-2451 Have fitted X2 brand new hub covers Have removed the X3 blown dash globes and fitted X3 new globes in	MELBOURNE VIC WORKSHOP	567826 PO6187	\$78.12
29/09/2022	338,451 kms	ROTATE/BALANCE STEER T-1408 ROTATED AND BALANCE STEER TYRES ALL OK	DARREN BUDD'S TYRES PTY LTD	27276 PO6148	\$77.00
21/09/2022	332,050 kms	A S-6120 548 hrs WARRENTY MOVEMENT IN 1ST UNI GEARBOX OUTPUT COOLANT STARTING TO LEAK FROM COOLANT PIPE BEHIND TUBRO	QLD WORKSHOP		\$0.00
02/09/2022	318,386 kms	A S-5983 548 hrs	QLD WORKSHOP		\$0.00
15/08/2022	303,528 kms	B S-5828	QLD WORKSHOP	2555878 PO5770	\$159.67
15/08/2022	303,528 kms	BALANCE STEERS, ROTATE DRIVES T-1278 ROTATED ALL DRIVES DIAGONAL ROTATED STEERS SIDE TO SIDE AND BALANCED AS NEEDED FLIPPED 1 X STEER ON RIM	DARREN BUDD'S TYRES PTY LTD	00026908 PO5831	\$181.50
27/06/2022	278,062 kms	WINDSCREEN R-2126 BOTH WINDSCREENS REPALCED AND RE-BONDED, NEW WINDSCREEN RUBBERS FITTED BY THE FIXER WINDSCREENS	THE FIXER CORPORATION PTY LTD	FIX-6572 PO5418	\$1,300.58

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
24/06/2022		Heavy Vehicle Inspection Checklist - Truck I-97			\$0.00
24/06/2022	278,062 kms	C S-5475 REPLACED V-BAN CLAMP ON TOP BOOST HOSE	QLD WORKSHOP	2510960 PO5411	\$1,080.17
14/06/2022	271,230 kms	A S-5405 front and back diff leaking tighten oil feed pipe	QLD WORKSHOP		\$0.00
31/05/2022	257,450 kms	ROTATE/BALANCE STEER, ROTATE DRIVES T-1161 ROTATED ALL DRIVES FRONT TO BACK ROTATED AND BALANCED STEER TYRES ALL OK	DARREN BUDD'S TYRES PTY LTD	00026325 PO5253	\$165.00
30/05/2022	257,449 kms	A S-5266 ICE PACK SERVICE AT 715HRS	QLD WORKSHOP	2490480 PO5201	\$35.82
10/05/2022	241,623 kms	B S-5155	QLD WORKSHOP	2486253 PO5052	\$149.15
19/04/2022	225,454 kms	A S-5013	QLD WORKSHOP		\$0.00
16/04/2022	224,215 kms	BATTERYS R-1889 CALLED OUT PACCA TRUCK ASSIST TO CHECK ALL BATTERIES, FOUND ALL 4 WERE BAD AND REPLACED ON TEST. REMOVED AND REPLACED ALL BATTERIES UNDER WARRENTY	BROWN & HURLEY GROUP		\$0.00
01/04/2022	214,914 kms	ROTATE DRIVES T-1055 ROTATED ALL DRIVES SIDE TO SIDE	DARREN BUDD'S TYRES PTY LTD	00025928 PO4827	\$66.00
30/03/2022	213,044 kms	A S-4892 removed and replaced wiper blades	QLD WORKSHOP	2442222 PO4738	\$54.41
10/03/2022	205,833 kms	NEW STEERS T-947 NEW BRIDGESTONE STEER TYRES BALANCED AND FITTED UP ALL OK	DARREN BUDD'S TYRES PTY LTD	00025841 PO4686	\$1,397.00
10/03/2022	196,678 kms	A S-4730 ADJUJSTED CLUTCH	QLD WORKSHOP		\$0.00
21/02/2022	181,639 kms	B S-4509 NEEDES UNI GEARBOX LEAKING FROM TOP CHECKED LEVEL AND ALL OK	QLD WORKSHOP	2409313 PO4394	\$113.66
19/01/2022	165,709 kms	A S-4341 548 hrs	QLD WORKSHOP		\$0.00
30/12/2021	151,726 kms	A S-4235	QLD WORKSHOP		\$0.00
10/12/2021	141,116 kms	ROTATE/BALANCE STEER, ROTATE DRIVES T-835 ROTATED ALL DRIVES SIDE TO SIDE ROTATED FLIPPED AND BALNACED BOTH STEER TYRES ALL OK	DARREN BUDD'S TYRES PTY LTD	00025165 PO3863	\$154.00
10/12/2021	139,158 kms	A S-4044 548 hrs	QLD WORKSHOP		\$0.00
18/11/2021	121,127 kms	B S-3894	QLD WORKSHOP	2338432	\$136.87
27/10/2021	105,715 kms	A S-3680	QLD WORKSHOP		

Date	Reading	Type / Repairer Notes	Repairer	Invoice	Cost
27/10/2021	105,715 kms	100,000KLM ENGINE TUNE] R-1246 Top tube done at 100,000 Done by Matt C	QLD WORKSHOP		
06/10/2021	90,464 kms	A S-3574	QLD WORKSHOP		
06/10/2021	90,464 kms	ROTATE/BALANCE STEER, ROTATE DRIVES T-709 ROTATED ALL DRIVES FRONT TO BACK ROTATED AND BALANCED STEER TYRES	DARREN BUDD'S TYRES PTY LTD	00024684 PO3400	\$126.50
14/09/2021	77,219 kms	A S-3268 548 hrs SERVICED ICE PACK	QLD WORKSHOP	2289767 PO3199	\$31.16
08/09/2021	69,910 kms	wheel alignment R-1106 FOUND REAR END OUT BY 60MM AND FIX AND TESTED OK	BRETT STEELE LASER ALIGNMENTS PTY LTD	51668 PO3135	\$330.00
27/08/2021	61,821 kms	B S-3252	QLD WORKSHOP	2271577 PO3049	\$391.73
03/08/2021	44,737 kms	ROTATE/BALANCE STEER, ROTATE DRIVES T-572 ROTATE ALL DRIVES DIAGONAL BALANCED BOTH STEER TYRES ONLY	DARREN BUDD'S TYRES PTY LTD	00024177 PO2918	\$126.50
03/08/2021	44,737 kms	A S-3049 548 hrs FIT TRACKER	QLD WORKSHOP		
14/07/2021	29,794 kms	DIFF OILS R-888 C/O OIL ON 1ST SERVICE	QLD WORKSHOP	2237387 PO2668	\$20.43
14/07/2021	30,000 kms	A S-2933	QLD WORKSHOP		
01/07/2021		C S-3340			

157 Records

Total: \$74,034.00