



# Vehicle History Summary



Fleet #	TRI012
Registration	TRI012
Make	KENWORTH
Model	T409
VIN / Chassis #	6F5000000HA458299
Build Date	2017

Date	Reading / Units	Type / Repairer Notes	Repairer
20/04/2026	998,832 kms	<b>B - 20k</b> S-6892	Ivan Plevnarovski
31/03/2026	994,604 kms	<b>power steer oil leak</b> R-9124 1. removed power steer pump and resealed. topped up engine oil and topped up power steering fluid 2. inspect vehicle for leaks no leaks found. topped up coolant as required	
10/03/2026	987,956 kms	<b>A - 15k</b> S-6857	Ivan Plevnarovski
10/03/2026	987,956 kms	<b>crankshaft position sensor, Engine Check Light</b> R-9098 1. replaced crank sensor and monitor over next few days	Ivan Plevnarovski
18/12/2025	973,132 kms 19,529 hrs	<b>C - Annual</b> S-6816 shock rubbers power divider, front diff seal leak thru shaft leak power steer pump leak possible rocker cover leak, wash and monitor	Ivan Plevnarovski
04/11/2025	958,509 kms	<b>A - 15k</b> S-6785	Ivan Plevnarovski
24/10/2025		<b>Tyres</b> T-84	South West Sydney Tyres
22/10/2025	953,044 kms 19,106 hrs	<b>King pin kit</b> R-8955 1. Replaced kingpins	Outback Industries
20/10/2025		<b>AIR BAGS</b> R-8950 sprayed down truck couldnt see any air leaks, loaded truck in our yard and sent back over the pit. found A3 RHS air bag leaking, removed and replaced	Ivan Plevnarovski
29/09/2025	949,208 kms	<b>ABS, Aftertreatment Warning light, power steer oil leak, tarps, wiper motor</b> R-8934 1. straightened and tensioned tarp 2. plugged in cummins diag found code for ambient air temp, found sensor and tested all ok. cut out wiring from sensor to ecu and inspected. found wiring broken. repaired and re run wiring to sensor. replaced sensor with new. all ok. 3. removed wiper washer motor and inspected. found excess dirt buildup on terminals cleaned and operated, working as required although the handle in cab which controls it is a bit sticky 4. 5.Removed axle 3 LHS wheels and replaced ABS sensor. monitor vehicle in coming days	Ivan Plevnarovski
26/08/2025	943,211 kms	<b>B - 30k</b> S-6715	Ivan Plevnarovski
26/08/2025	943,211 kms	<b>Brakes</b> R-8868 replaced A2 brakes as required	Ivan Plevnarovski
27/05/2025	928,488 kms 18,493 hrs	<b>A - 15k</b> S-6609	Ivan Plevnarovski
23/05/2025	927,971 kms 18,481 hrs	<b>Adblue</b> R-8700 1. replaced doser unit as required. performed wet/air side flush. all ok	Ivan Plevnarovski, Outback Industries

Date	Reading / Units	Type / Repairer Notes	Repairer
09/05/2025	923,612 kms 18,963 hrs	<b>Steering wheel</b> R-8668  1. Opened dash and tested all power supplies to the steering wheel and found that the clock spring had failed. ordered, removed & replaced clock spring. tested operation and all functions work as intended. dash was re assembled.	Ivan Plevnarovski
07/05/2025	923,104 kms 18,383 hrs	<b>Battery, Fault report, Lights, Truck Body</b> R-8662  1. replaced parker light 2. refit panel to truck with all new bolts 3. load tested all batteries. all ok. Tested charge rate - 13.9 V ok. Found 3x batteries needing charge. left on charge overnight to see if issue persists.	Ivan Plevnarovski
11/04/2025	922,045 kms 18,356 hrs	<b>Ringfeder Measurements</b> I-232	
11/04/2025	922,045 kms 18,356 hrs	<b>fuel gauge</b> R-8630  1. after bringing truck into workshop issue couldnt be replicated. monitor until issue persists. IP	Ivan Plevnarovski
31/03/2025	921,519 kms 18,347 hrs	<b>AdBlue</b> R-8604  1. plugged cummins insite to find codes relating to ad blue doser pump power and priming loss. Disconnected lines and performed ad blue flush. found air solenoid not operating on system. removed doser pump, removed air solenoid and found crystalized from the DEF fluid. Cleared contaminants and re installed air solenoid. refit doser pump and tested. air solenoid was operating. completer air and wet side flush on system which brought codes inactive. cleared faults and ran truck to test dosing. all working correctly. IP 2. wiring for the doser unit was located in chassis and cut open to inspect for any issues on the electrical side. Above LHS engine mount a rubbed area on the harness was found. cut open and found exposed copper. The wiring was cleaned up and secured correctly. Outback Industries 2hrs	Ivan Plevnarovski, Outback Industries
13/03/2025	918,873 kms 18,259 hrs	<b>B - 30k</b> S-6468	Ben Potts, Ivan Plevnarovski
07/03/2025	917,829 kms	<b>Fault report, Weight gauges</b> R-8530  Adjusted gauge to 1 second mode. Checks ok	Ben Potts
25/02/2025	915,319 kms	<b>ASA, Brakes, diff oil misting, Tarp cable</b> R-8492  1. Undone cable u-bolt clamps. Took slack out of cable as required. Adjusted cable. Checks ok. Ben/IP 2. Degreased as required. Will check misting location tomorrow after a day at work. IP 3. Adjusted brakes as requiried. Ordered new brake ASA's as the ratchet operation is poor. IP	Ben Potts, Ivan Plevnarovski
30/01/2025	909,658 kms	<b>Ringfeder Measurements</b> I-207	
29/01/2025		<b>Fault report, HVAC</b> R-8400  Jake/Joel took to their repaired as they had it they reported having it there to get the a/c repaired recently. They reported an issue with blower fan fuse?	
24/01/2025	909,183 kms 18,019 hrs	<b>Air Dryer, Blower, D2 Governor valve</b> R-8368  1. Gsc changed governor valve problem still exceeded went inspected further whilst changing the purge valve found contamination coming from air compressor 2. A/c blower fan started to work as I was pulling it apart as there was no problem I put it back together	
23/01/2025	909,183 kms 18,019 hrs	<b>Exhaust</b> R-8369  Gsc changed the exhaust stack with a new one. Was old stock in container.	Gavin Smith-Croucher
23/01/2025	909,183 kms 18,019 hrs	<b>Headlight</b> R-8370  1. Gsc changed right hand head light globe	Gavin Smith-Croucher
10/01/2025		<b>AIR CON, Repairs</b> R-8455  Ace Air and Auto Electrical completed repairs as per invoice attached.	ace air & auto electrical
08/01/2025	906,085 kms 17,957 hrs	<b>Battery</b> R-8298	Gavin Smith-Croucher

Date	Reading / Units	Type / Repairer Notes	Repairer
		1. Gsc changed batteries with new ones	
06/01/2025	906,085 kms 17,957 hrs	<b>AIR CON</b> R-8294	Gavin Smith-Croucher
		1. Gsc replaced the dash vents with new ones	
16/12/2024	906,084 kms 17,955 hrs	<b>Brakes, hub seal, Shock absorber</b> R-8261	Gavin Smith-Croucher
		1. Will monitor for next service 2. Will monitor for next service 3. Gsc replaced shocks with new ones 4. Gsc adjusted all drive brakes 5. Gsc took off starter earth cables cleaned and tightened	
13/12/2024	906,084 kms 17,955 hrs	<b>A - 15k</b> S-6337	Ben Potts, Gavin Smith-Croucher
		1. A2 o/s brake low (next service) 2. N/s steer hub seal misting (next service) 3. A3 shocks blown 4. All drive brakes over stroked 5. Starter earth cables loose	
04/11/2024	893,532 kms 17,712 hrs	<b>Engine/Gearbox mount, Grille</b> R-8125	Gavin Smith-Croucher
		1. Gsc replaced front engine mounts with new ones 2. Replaced all missing mount bolts and tighten all other ones. Ben	
04/11/2024	893,532 kms	<b>Jack knife buzzer, Ringfeeder</b> R-8126	Ben Potts
		1. Cleaned out as required. 2. Turned plates around.	
04/11/2024	893,532 kms 17,712 hrs	<b>Ringfeder Measurements</b> I-147	
		1. Rocks stuck in return spring. 2. Turned jackknife buzzer switch actuating plates need turning around.	
15/10/2024	887,151 kms 17,584 hrs	<b>B - 30k</b> S-6203	Alex Martin, Ben Potts
		1. Aftertreatment light staying on and driver report derating. 2. Front engine mounts worn. Still serviceable. Schedule for next service. 3. Engine valve check/adjust due at next service. 6. Engine oil top up 5L 7. A2 shocks are damaged	
15/10/2024	887,151 kms 17,584 hrs	<b>Aftertreatment Warning light, shock absorber, Wipers</b> R-8051	Alex Martin, Ben Potts
		1. Ran through doser air/wet side flush. Cleared injector etc. Checks ok. Ben 2. Replaced damaged shock at o/s and replaced n/s worn one too. AM 3. Fit new wiper blade. Ben	
26/09/2024	881,299 kms 17,481 hrs	<b>D2 Governor valve, Fault report</b> R-7986	Ben Potts
		Fit new D2 governor valve. checks ok.	
23/09/2024		<b>steering column</b> R-7967	Gavin Smith-Croucher
		1. GSC replaced the steering column shock absorber and steering column adjustment cable	
10/09/2024	875,355 kms 17,370 hrs	<b>head light, Headlight</b> R-7913	Alex Martin
		Fitted new headlight globe	
29/08/2024	871,162 kms 17,290 hrs	<b>A - 15k</b> S-6098	Gavin Smith-Croucher
		1. Front engine mounts are worn	
13/08/2024	866,557 kms 17,188 hrs	<b>air leaks, Air spring, Breakdown, steering column, Warning/Indicator Light</b> R-7786	Alex Martin, Ben Potts
		1. Fit new globes. Alex 2. Found tilt adjust shock has failed and adjust cable stretched. Ordered new parts. 3. Replaced air spring. Ben/Alex	
08/08/2024		<b>Breakdown, Suspension, torque rod</b> R-7788	Ben Potts, Gavin Smith-Croucher
		Travelled to breakdown. Removed broken torque rod and fit good used one with new bushes. Travel back to workshop.	
06/08/2024	864,847 kms	<b>diff oil misting, Fault report</b> R-7760	Ben Potts
		Found A2 o/s axle nuts lose (x3). Re-tensioned all nuts. checked oil level and degreased.	
16/07/2024	857,082 kms	<b>Ringfeder Measurements</b> I-135	

Date	Reading / Units	Type / Repairer Notes	Repairer
16/07/2024	857,082 kms 16,987 hrs	<b>accelerator pedal, Brakes, hub seal, Suspension</b> R-7664  1. Replaced drive axle torque rod bushes. Used new mount nuts/bolts as required. GSC 2. Removed brakes. Cleaned and inspect. Fit new brake shoe kits. Found N/S hub seal was starting to leak also. Fit new hub seal as required. GSC 3 .Fit new pedal roller kit. AM	Tripodi
16/07/2024	857,082 kms 16,987 hrs	<b>C - Annual</b> S-6022  1. Drive axle torque rod bushes worn. 2. A3 brakes low. 3. Accelerator pedal roller excess wear. 4. Replaced engine oil/fuel/as2474/air. 5. Replaced power steer oil/filter/nut seal. 6. Replaced coolant filter. 7. Replaced in-tank adblue filter. 8. Carried out doser pump wet/air side flush. 9. Replaced air dryer filter and purge valve. 10. Replaced cabin filter. 11. Replaced diff/drive hub/steer hub oils/filters. GSC/AM	Tripodi
19/06/2024	853,984 kms	<b>Breakdown, Clutch, ECA, UltraShift</b> R-7675  Travelled to breakdown and found clutch is no good. Had truck towed back to workshop as it was loaded and unable to tip it off. Then had truck towed to Hi-torque for repair as per attached document. They replaced clutch kit/ECA. Used original gearbox oil.	Hi-torque, Tripodi
25/05/2024		<b>Windscreen</b> R-7514  SWAG fit new windscreen to driver side.	South West Auto Glass
14/03/2024	840,917 kms 16,647 hrs	<b>Diff Oil Leak, Drive Hub, Fault report</b> R-7249  Tensioned loose axle mount nuts. Degreased. check oil level. Ben/AR	Tripodi
14/03/2024	840,917 kms 16,647 hrs	<b>Bonnet, Exhaust, Power window</b> R-7287  1. Found loose v-clamp. Fit new gasket as required. Used double nuts on v-clamp stud. GSC 2. Fit new bonnet strut to N/S. GSC 3 .Found switch to be faulty. Fit new drivers door window switch. GSC/Ben	Tripodi
14/03/2024	840,917 kms 16,647 hrs	<b>Fault report, Seat belt</b> R-7286  Passenger seat belt found to be hard against rear wall as seat was adjusted all the way back. Driver seatbelt wear and tear. Fit new seatbelt assembly to driver seat. Ben/GSC	Tripodi
14/03/2024	840,917 kms 16,647 hrs	<b>Fault report, Steer Hub</b> R-7285  Checks as serviceable. Cleaned off wheel. Hub oil level good. Ben	Tripodi
14/03/2024	840,917 kms 16,647 hrs	<b>Fault report, Lights</b> R-7284  Unable to fault at time of inspection. Ben	Tripodi
14/03/2024	840,917 kms 16,647 hrs	<b>Diff Oil Leak, Fault Codes</b> R-7283  Tighten axle nuts. Degreased. Oil level ok.	Tripodi
14/03/2024	840,917 kms 16,647 hrs	<b>Bonnet, Fault report</b> R-7248  Ordered new bug deflector. truck still serviceable. Fit new bug deflector 14/03/2024 Ben/GSC	Tripodi
14/03/2024	840,917 kms 16,647 hrs	<b>Chassis, Fault report, Truck Body</b> R-7247  Repaired crack as required. Nick	Tripodi
14/03/2024	840,917 kms 16,647 hrs	<b>Fault report, Lights</b> R-7246  1. Inner blinkers are reverse lights not blinkers? 2. Fit new N/S mirror marker lamp.	Tripodi
06/03/2024	837,985 kms	<b>B - 30k</b> S-5793  1. Driver report belt noise when Horton fan comes on. 2. Fire extinguisher no tag/just off full. AM/GSC	Tripodi

Date	Reading / Units	Type / Repairer Notes	Repairer
06/03/2024	837,985 kms 16,580 hrs	<b>Fault report, Fire extinguisher</b> R-7206  Fit new fire extinguisher. AM	Tripodi
09/02/2024	609,936 kms 12,224 hrs	<b>Fault report, Speedo</b> R-7240  Speedo checks as good?? Ben Picture attached is a T610 Kenworth not a T409 which TRI012 is?	Tripodi
01/02/2024	824,769 kms 16,336 hrs	<b>Windscreen</b> R-7122	South West Auto Glass
31/01/2024	824,025 kms 16,317 hrs	<b>Belt tensioner, Drive belt</b> R-7103  Fit new drive belt and tensioner. GSC	Tripodi
10/01/2024	820,071 kms	<b>A - 15k</b> S-5676  1. N/S steer mudflap damaged/coming off. 2. Air leak at Horton fan filter air fitting. (minor) 3. Steering column adjust shock not holding position. 4. Cruise control light n/w. 5. Engine oil weep at rear o/s of sump area. 6. Front engine mounts worn. 7. Hole in exhaust elbow pipe (comes out of the flex pipe out of the muffler) GSC/Ben	Tripodi
10/01/2024	820,071 kms 16,237 hrs	<b>Mudflap</b> R-6981  Fit new one. Had to fit a right side one as no left ones in stock. Ben	Tripodi
04/12/2023	811,435 kms	<b>B - 30k</b> S-5632  1. Radiator cap seal perished. 2. Exhaust leak at turbo outlet connection. 3. Turbo exhaust dump pipe rubbers worn. 4. Speedo flickering. 5. O/S headlight not working. 6. N/S bonnet indicator not working. 6. Bug deflector broken. 7 Steer hub seal minor weep. 8. Drive axle brakes over stroked. 9. Replaced engine oil/fuel/air. 10. Replaced cabin filter. GSC/AM	Tripodi
30/11/2023	811,435 kms 16,100 hrs	<b>Exhaust, Lights, Radiator, Speedo</b> R-6893  1. Fit new cap and top up coolant. 2. Fit new AFM gasket. AM 3. Fit new mount bushes. GSC 4. Traced to vehicle speed sensor. Fit new sensor. GSC/Ben 5. Fit new headlight globe. AM 6. Repaired damaged DT connector near lamp. AM	Tripodi
02/11/2023		<b>Tarp cable</b> R-6318  1.replaced tarp cable and adjusted so it runs smoothly	Tripodi
20/10/2023	799,732 kms 15,851 hrs	<b>HVAC, Spotter mirror</b> R-6827  1. Recovered refrigerant. Fit new refrigerant compressor. Suction hose was seized to compressor. Hand to fit new hose from compressor to firewall. fit new TX-valve outlet pipe too. Fit new receiver -dryer. Carried out regas. Ben L115841 2 .Fit new set of drive belts. Ben. 3. Fit new bonnet mirror kit. Ben	Tripodi
18/09/2023	786,143 kms	<b>A - 15k</b> S-5487  1. Coolant leak at heater tap module. Coolant leak at header tank hose connection. 2. Exhaust pipe loose leak at SCR outlet connection. 3. Starter motor very lazy. 4. Charge air hose clamp broken at turbo connection. GSC/AM	Tripodi
18/09/2023	786,143 kms 15,594 hrs	<b>COOLANT LEAKS, Exhaust, Intercooler, Starter Motor</b> R-6772  1. Had to replace heater tap module. Tightened loose clamp on header tank hose. Topped up coolant. AM 2. Gasket missing? Fit two gaskets to take up wear. checks ok. Ben/AM 3. checked all starter motor and battery connections. Test batteries as required. Found no external faults for starting system. Fit new starter motor. Checks ok. AM 4. Fit new hose and clamps. GSC	Alex Martin, Ben Potts
07/09/2023	783,665 kms 15,542 hrs	<b>HVAC</b> R-6758  Had to fit new evaporator assembly. Fit new tx-valve. Fit new evaporator temp sensor as aftermarket one had been fitted at previous repair. Had to fit new evaporator inlet and out let pipe as they where damaged on removal. Fit new refrigerant hose from compressor to condensor. Fit new receiver-dryer and carried our regas. Ben L115841/GSC	Tripodi
10/08/2023	776,128 kms	<b>B - 30k</b> S-5411  1. A/C blower fan not working. 2. Engine reported to be running cold. 3. Starter motor lazy/poor operation. 4. Driver seat belt frayed. 5. Engine brake indicator light not working. GSC/AM	Tripodi

Date	Reading / Units	Type / Repairer Notes	Repairer
10/08/2023	776,128 kms	<b>Engine coolant temperature, HVAC, SEAT, Starter Motor, Warning/Indicator Light</b> R-6715  1. Tried the fan resistor and found fault still there. Traced fault to wiring harness issue near control panel plug behind dash. Tightened terminals in connector and refitted. Checked ok. Found evaporator blocked/has very poor air flow through vents. Will need the evaporator replaced. Ben 2. Found coolant thermostat seal damaged. Coolant by-passing thermostat operation. Fit new thermostat and seal as required. Ben/AM 3. Ran out of time and they took truck to work. Will have to schedule for replacement. Ben 4. Fit new seat belt as required. Ben. 5. Fit new globe. AM	Tripodi
28/07/2023	770,295 kms 15,503 hrs	<b>Air</b> R-6699  Found low air pressure Hobbs switches faulty. Fit good used ones. (75PSI NC) x2. Fit new ones as required. Ben	Tripodi
11/07/2023	760,827 kms	<b>A - 15k</b> S-5347  GSC/AM	Tripodi
21/06/2023	750,385 kms 14,986 hrs	<b>Aftertreatment Warning light, HVAC</b> R-6618  1. Found NOX sensor to have internal fault. Fit new NOX sensor and run through NOX reset. Checks ok. Cleared fault codes. Ben/GSC 2. Found blower fan only working on speed 4. Fit new fan resistor but found still not working. Ran out of time. requires further inspection. Ben/GSC	Tripodi
12/06/2023	745,695 kms	<b>C - 100k/Annual</b> S-5298  1. Fit new air dryer filter kit. 2. Fit new coolant/in tank adblue/as2474 filters. 3. Replaced power steer oil/filter/nut seal. 4. Both axle temp gauge lights not working. 5. Tarp switch insecure in dash. 6. Bottom heater hose tap leaking. 7. Coolant sight glass leaking. 8. A3 shock mount loose. 9. Exhaust flex pipe leak before SCR Bailey/GSC/AM	Tripodi
12/06/2023	745,695 kms 14,914 hrs	<b>COOLANT LEAKS, Gauge lights, Suspension, Truck tarp</b> R-6611  1. Fit new globes. GSC. 2. Made up plate to mount switch back to dash. Bailey. 3. Fit new heater hose tap. Bailey. 4. Fit new sight glass. Bailey. 5. Had to fit new shocks to A3. GSC. 6. Fit new AFM gaskets and v-clamp as required with a new flex pipe. Bailey	Tripodi
03/05/2023	724,142 kms 14,579 hrs	<b>ABS, air leaks, Steering</b> R-6518  Removed broken fitting and fit new one. Fit new brake hose. Fit new wheel speed sensor. GSC/Ben.	Tripodi
21/02/2023		<b>Ringfeder Measurements</b> I-76  Ringfeeder: Coupling bolt bulge OD: 48.35mm, Coupling bolt lower OD: 34.92mm, Lower bush ID: 35.6mm, Axial: 2mm, Wear plate: 1mm.	
12/01/2023	686,525 kms	<b>A - 10k</b> S-4972  Replace inop R/H parker globe Replace worn A2 L/H torque rod bushes Replace worn engine mounts Replace oil and fuel	Tripodi
12/01/2023		<b>Engine/Gearbox mount, Lights, Suspension</b> R-6316  Replace inop R/H parker globe Replace worn torque rod bushes on A2 L/H Replaced rear engine mount set Bailey	Tripodi
12/12/2022	677,225 kms	<b>Power window</b> R-6265  Fit new driver door window regulator assembly. Ben.	Tripodi
17/11/2022	671,526 kms	<b>A - 10k</b> S-4830  1. Rear engine mounts next service. 2. Drive shocks mounts sign of fatigue. Ok till next service. 3. Drive air springs signs of fatigue. Schedule for next service. 4. Engine valve adjust due at next service. 5. Diff/drive hub/steer hub oils due at next service. GSC	Tripodi
26/10/2022	664,696 kms 13,561 hrs	<b>Brakes</b> R-6126  Removed brakes. clean/inspected. Fit new brake shoe kits and brake drums. Bailey/AM	Tripodi
25/10/2022	664,696 kms	<b>B - 20k</b> S-4744  Rnr oil and fuel Reline middle axle brake shoes and drums rnr cabin filter hole in exhaust torque rod bushes starting to blow out rear eng mounts splitting R/H parker light out body pivot pins have movement cracks in sub frame	Tripodi
27/09/2022		<b>Brakes, Engine/Gearbox mount, Lights, Suspension</b> R-6077	Tripodi

Date	Reading / Units	Type / Repairer Notes	Repairer
		9.BC changed parker light globes 10.GSC changed dash globes	
27/09/2022	657,928 kms	<b>B - 20k</b> S-4678  1. Rear engine mounts cracked worn 2.Hole in the exhaust after flexipipe after the muffler 3.A2 n/s torque rod bush worn 4.A3 n/s shock loose 5.A2 brakes low 6.Cab mounts loose 7.Sub frame cracked o/s front 8.Tipping pins worn 9.Parker lights not working 10.Turbo temp gauge light out in dash and engine water temp light out in dash	Tripodi
05/09/2022	650,970 kms 13,212 hrs	<b>Brakes</b> R-6030  1. Fit new brake return spring to steer o/s. Ben 2. Had to remove brake ASA and fit/adjust position correctly. Ben/AM. 3. Removed air hoses from t-piece then trimmed ends and refit. Checks okay. GSC	Tripodi
02/09/2022		<b>Ringfeeder, Truck Body</b> R-6192  Invoice cost shared with trailer TD62KE	Sloanebuilt trailers
31/08/2022	650,443 kms 13,251 hrs	<b>Alternator, Drive belt, HVAC</b> R-6018  Removed rock from pulley. New alternator came so fitted new alternator as required. Alternator had slight bearing noise and was 9000hrs/442000km old. Fit new a/c belt. Fit new alt/fan belt as it had slight damage from broken a/c belt. Ben.	Tripodi
30/08/2022	650,020 kms 13,240 hrs	<b>air leaks, Gearbox</b> R-6016  1. Fit new splitter solenoid as required. AM/Ben	Tripodi
25/08/2022	650,020 kms	<b>B - 20k</b> S-4628  1. Transmission solenoid leaking air and oil coming out of air exhaust on soleniod. 2.brakes over stroked 3.n/s a2 shock loose 4.ringfeeder mud flap torn 5.number plate light out 6.n/s mirror light out 7. Starter operation is lazy. 8. Bearing noise in front of engine. 9. Ringfeeder measures close to max spec.	Tripodi
27/07/2022		<b>Engine/Gearbox mount, Exhaust, Intercooler, Suspension</b> R-5931  5. GSC changed charge hose clamp 9.GSC changed o/s brake booster	Tripodi
27/07/2022	639,294 kms	<b>B - 20k</b> S-4557  1.rear engine mounts cracked 2.hole in the exhaust 3.a2 n/s torque rod rushes 4.a3 n/s shock loose 5.missing air charge hose clamp o/s intercooler side 6.tarp cables loose 7.mudflap on ringfeeder needs changing 8.air dryer leaking 9..a2 o/s brake booster leaking	Tripodi
20/06/2022	628,629 kms	<b>C - 100k/Annual</b> S-4466  1. Replaced engine oil/fuel/air. 2. Replaced power steer oil/filter/nut seal. 3. Replaced coolant filter. 4. Replaced AS2474 filter. 5. Replaced adblue in-tank filter. 6. Carried out air side flush on adblue doser lump. Cleaned doser inlet filter.	Tripodi
30/05/2022	621,464 kms	<b>B - 20k</b> S-4426  3rd axle both sides shock bushes worn drive belt starting to wear engine oil due 30 hours !!!	Tripodi
12/04/2022		<b>B - 20k</b> S-4300  GSC	Tripodi
29/03/2022	598,811 kms	<b>A - 10k</b> S-4262  1. A3 brakes low. BM/GSC	Tripodi
29/03/2022	598,811 kms 12,231 hrs	<b>Brakes</b> R-5659  Removed brakes. Cleaned/inspect.	Tripodi
03/03/2022	591,032 kms	<b>B - 20k</b> S-4207  1. Engine drive belts worn/noisy. 2. Oil weep at thru-shaft yoke. 3. o/s rear mudflap coming off/damaged. 4. Excess water in air tanks. 5. Replaced diff/drive hub/steer hub oil/filter. 6. Replaced engine oil/fuel/air. GSC/BM	Tripodi
03/03/2022	591,032 kms 12,155 hrs	<b>Diff Oil Leak, Drive belt</b> R-5610  1. Fit new set of drive belts. BM 2. Yoke nut loose. Fit new nut kit. Used new tailshaft bolts. BM 3. Found tap at air dryer nearly closed all the way?? Drained all water from tanks (did process several times to get water out of tanks). Fit new air/water filter for adblue doser pump air supply. Fit rebuild kit to air dryer assembly as contamination was high.AM/Ben	Tripodi

Date	Reading / Units	Type / Repairer Notes	Repairer
11/02/2022		<b>air leaks, Brakes</b> R-5572 Fit new brake booster as required. (Ben/Ben)	Tripodi
28/01/2022	581,350 kms 11,943 hrs	<b>Brakes, Engine Valve Adjustment, Steering</b> R-5537 1. AS above 2. Adjusted as required. (Ben) 3. Greased and checked steering/suspension. Checks okay. (Phil)	Tripodi
28/01/2022	581,350 kms	<b>B - 20k</b> S-4136 1. Engine valve set due. 2. Driver complain off steering pulls under brakes. 3. Driver complain of steering not centralizing properly. 4. A3 brakes next service. 5. Oil weep at thru-shaft and A3 pinion seals. Washed and monitor. 6. Rear engine mounts next service. 7. Trio coupling lid spring damaged.	Tripodi
10/01/2022		<b>Battery, Steering</b> R-5474 1. Fit new set of batteries as required. Checks okay. 2. Adjusted cable and secured/lubed. Ordered new cable (part was not available)	Tripodi
17/12/2021	572,600 kms	<b>B - 20k</b> S-4050 1. Replaced engine oil/fuel/air. 2. Steering column adjuster wont tilt. 3. Needs new floor mats.	
08/11/2021	558,599 kms	<b>TECH REPAIR</b> R-5360	
04/11/2021	557,559 kms	<b>Tech repair</b> R-5355	
13/10/2021	550,941 kms 11,280 hrs	<b>Steering</b> R-5327 Fit new king pin kit to both sides as required. Note: One top bush was damaged while fitting so had to get one bush to replace. Ben/Gavin	Tripodi
11/10/2021	550,941 kms 11,280 hrs	<b>Fault report, HVAC, UHF</b> R-5321	Tripodi
11/10/2021	550,941 kms 11,280 hrs	<b>air leaks</b> R-5322 Fit new PPV as required. GAvin	
11/10/2021	550,941 kms	<b>B - 20k</b> S-3909 1. Fault report FR3606. 2. Replaced steer hub oil only 3. Replaced engine oil/fuel/air. 4. Fit number plate protectors. 5. King pins need replacing next service. 6. Fit tap to air dryer exhaust 7. Air leak at PPV . GavinPhil	Tripodi
06/10/2021	536,126 kms 11,035 hrs	<b>Fault report, HVAC</b> R-5220 Fit new resistor assembly. Checks okay.	Tripodi
09/09/2021	537,136 kms 11,052 hrs	<b>air leaks, Steer Hub</b> R-5228 1. Fit new PPV as required. 2. Removed hub/cleaned/inspected. Bearings check okay. Refit using new hub seal, hub nut lock washer, hub cover gasket. Replaced oil in other side hub too. Had to fit new brake shoe kits to both sides and fit new brake drums. (Gavin/Alex)	Tripodi
09/09/2021	537,136 kms	<b>A - 10k</b> S-3922 Ben	Tripodi
09/09/2021	537,136 kms	<b>B - 20k</b> S-3797 1. Replaced engine oil/fuel/air. 2 .Replaced cabin filter 3. PPV top hat valve leaking air. 4. O/S steer hub seal leaking oil. 5.Oil weep at 1st drive yokes. 6. Engine mounts cracked. Next service. 7.Trailer hydraulic hose wearing/rubbing. Gavin	Tripodi
31/08/2021	532,186 kms	<b>Ringfeeder, Trailer Drawbar</b> R-5180 Checks as serviceable/in spec/ringfeeder/eye bush/drawbar bushes/ballrace.	Tripodi
18/08/2021	526,394 kms	<b>A - 10k</b> S-3760 John/Gavin	Tripodi
16/08/2021	506,969 kms	<b>Fault report, Starter Motor, Steering</b> R-5122	Tripodi

Date	Reading / Units	Type / Repairer Notes	Repairer
		1. No fault found. This is how they are. 2. Tensioned loose connection. Checks okay.	
06/08/2021	521,076 kms 10,798 hrs	<b>Bonnet R-5121</b>  Fit new bonnet strap as required.	Tripodi
27/07/2021	516,542 kms	<b>B - 20k S-3715</b>  1. Cummins to fit new turbo. Was not done at MIDLIFE D-service by them as part was not available as per R-5100 2. Aftertreatment light on as per R-5100 John	Tripodi
27/07/2021	516,542 kms 10,721 hrs	<b>Aftertreatment Warning light, Turbo R-5100</b>  1. Cummins fit new turbo. Was paid for when D-service (midlife was done by Cummins). 2. Cummins had left it unplugged?? Plugged in. Cleared codes. Checks okay.	Cummins Wetherill Park, Tripodi
09/07/2021		<b>Driveline, Gauge, Horton Fan, Reverse camera/screen, Warning/Indicator Light R-5038</b>  1. Fit new Horton fan rebuild kit as required. (John) 2. Removed yoke nut and clean. Fit new nut kit and used new bolts on uni mount. (Gavin) 3. Fit new globes as required. (Gavin) 4. Fit new reverse buzzer as required. (Gavin)	Tripodi
01/07/2021	509,438 kms 10,596 hrs	<b>Fault report, HVAC R-5005</b>  Fit new blower fan resistor assy. Checks okay.	Tripodi
24/06/2021	482,331 kms	<b>B - 20k S-3627</b>	
24/06/2021	506,961 kms	<b>C - Annual S-3629</b>  1. Replaced engine oil/fuel/air. 2. Replaced air dryer filter kit. 3. Replaced power steer oil and filter. 4. Replaced adblue in-tank filter. 5. Replaced coolant filter. 6. Replaced air/oil filter. 7. Thru-shaft oil weep. 8. Ringfeeder: Pin bulge OD: 47.73mm, Lower pin OD: 34.84mm, Lower bush ID: 35.90mm, Axial: 2mm, Wear plate: 1mm. (Gavin/John/Graham)	Tripodi
27/05/2021		<b>B - 20k S-3571</b>  1. Topped up engine oil/coolant. John/graham	Tripodi
11/05/2021	491,192 kms 10,220 hrs	<b>Fault report, Truck tarp R-4819</b>  Had to undo u-bolt clamps on cable and reposition cables as required. Adjusted cable as required. Graham	Tripodi
06/05/2021	489,403 kms	<b>A - 10k S-3499</b>  1. Cruise control indicator light not working. 2. Horton clutch getting low. 3. Topped up engine oil. 4. Fit new type wheel nut indicators to truck/trailer. Graham/John/Gavin	Tripodi
04/05/2021	487,996 kms 10,162 hrs	<b>Truck tarp R-4790</b>  Fit new tarp cable as required. Gavin/Ben	Tripodi
28/04/2021	485,420 kms 10,115 hrs	<b>Starter Motor R-4764</b>  Fit new starter motor as required. Graham	Tripodi
24/04/2021	483,809 kms 10,081 hrs	<b>Park brake warning R-4740</b>  Fit new park brake hobbs pressure switch as required.	Tripodi
21/04/2021	482,838 kms	<b>B - 20k S-3443</b>  1. Replaced engine oil/fuel/air. 2. Replaced steer hub oil. 3. Fit new headlight surround to N/S headlamp as it damaged/fallen off. 4. Horton clutch getting low. Graham/John	Tripodi
19/03/2021	473,871 kms	<b>B - 20k S-3364</b>  1. N/S mudflap damaged. 2. O/S light in beacon lamp not working. 3. Topped up engine oil. 4. Topped up coolant. Leigh/graham	Tripodi
17/03/2021	462,566 kms 9,946 hrs	<b>AdBlue, Belt tensioner, Compressor, Engine brake, Engine Valve Adjustment, Water Pump R-4688</b>	Cummins Wetherill Park

Date	Reading / Units	Type / Repairer Notes	Repairer
		Cummins Wetherill Park carried out D-service.	
15/03/2021	473,170 kms 9,873 hrs	<b>Steer Hub R-4628</b>  Removed steer hub/clean/inspect. Wheel bearings check as serviceable. Fit new hub seal. Refit hub assembly. Had to fit new brake shoe kits and brake drums. Brakes where low anyway. Leigh	Tripodi
25/02/2021	466,044 kms	<b>A - 10k S-3306</b>  1. Steer brakes next service. 2. Adjusted grain locks. 3. Relocated UHF microphone position. Leigh	Tripodi
10/02/2021	460,008 kms	<b>B - 20k S-3242</b>  1. Horton fan getting low. 2. Gearbox oil weeping at splitter cylinder. 3. A2 shock absorber rubber excess wear as per R-4490	Tripodi
09/02/2021	460,008 kms 9,593 hrs	<b>Suspension R-4490</b>  Found shocks poor operation upon removal. Fit new shocks as required. Graham/Gavin	Tripodi
19/01/2021	454,595 kms	<b>A - 10k S-3180</b>  1. Replaced diff/drive hub/steer hub oils/filter. Graham/Leigh	Tripodi
05/01/2021	449,563 kms 9,402 hrs	<b>Suspension R-4325</b>  Fit new bushes to A2/A3 upper torque rods. Used new nyloc mount nuts. Graham	Tripodi
05/01/2021	449,563 kms	<b>B - 20k S-3149</b>  1. Ringfeeder: Bolt dia: 47.94mm, lower bolt dia: 34.80mm, Lower bush ID: 35.60mm, Axial: 3mm, Wear plate 1.5mm. 2. Upper torque rod bushes worn as per R4325. Leigh/Graham	Tripodi
08/12/2020	442,277 kms 9,279 hrs	<b>Windscreen R-4258</b>  Had South West Auto Glass attend workshop and replace windscreen as required.	Tripodi
01/12/2020	438,145 kms 9,205 hrs	<b>air leaks R-4225</b>  Drilled out faulty fitting. Fit 1/4" straight joiner. Seal up go-thru block. Check for air leaks. Checks okay.	Tripodi
01/12/2020	438,145 kms 9,205 hrs	<b>Diff Oil Leak R-4224</b>  Resealed yoke nut and used new tailshaft bolts. Leigh	Tripodi
30/11/2020	438,145 kms	<b>A - 10k S-3079</b>  1. Oil weep at A2 thru-shaft yoke as per R-4224. 2. Excess air leak at go-thru bock in firewall as per R-2225. 3. N/S windscreen has large crack. Booked in South West Auto Glass to repair. 4. Torque rod bushes worn. Need replacing asap.	Tripodi
27/11/2020		<b>DEFECT SELF CLEARING, Windscreen R-4207</b>  Booked in for new windscreen with South West Auto Glass.	
10/11/2020	428,567 kms	<b>B - 20k S-3018</b>  1. Ringfeeder: Lower bush 35.33mm, Lower bolt: 34.90mm, Axial: 3mm, Bolt: 48.27mm, Wear plate 1-2mm. 2. Fit new wiper blades. 3. Air leak at go-through block on firewall. 4. A2 and A3 brakes next service. 5. Replaced cabin filter. 6. Torque rod bushes sign of fatigue. 7. Gearbox oil filter leaking. Fit new one and check oil level. 8. Large bullseye/crack in N/S windscreen.	Tripodi
09/10/2020	405,707 kms 8,699 hrs	<b>Engine Oil Leak, Engine Valve Adjustment, Tune Up R-4070</b>  1. Cummins fix oil leak at fuel pump (WARRANTY REPAIR). 2. Cummins carried out engine valve adjust. Adjusted turbo wastegate.	Cummins
09/10/2020	415,622 kms	<b>B - 20k S-2941</b>	Tripodi
08/09/2020	403,285 kms	<b>A - 10k S-2864</b>	Tripodi

Date	Reading / Units	Type / Repairer Notes	Repairer
		Leigh/Graham	
03/09/2020	400,291 kms 8,547 hrs	<b>DEFECT MINOR</b> R-3885  Fit DT 2pin connector as required.	Tripodi
18/08/2020	394,325 kms 8,433 hrs	<b>Suspension</b> R-3829  Shock just fitted 03/072020. 379012km/8132hrs. Fit new shock as required. (Part from Gleeman. Still under warranty).	Tripodi
18/08/2020	394,325 kms	<b>A - 10k</b> S-2811  1. A3 n/s shock leaking as per R-3829.	Tripodi
04/08/2020	389,086 kms 8,331 hrs	<b>air leaks, Gearbox</b> R-3740  Removed damaged section of hose. Fit new length of hose and used joiner as required. Secured harness. Leigh	Tripodi
20/07/2020	383,769 kms	<b>B - 20k</b> S-2744  1. Fit new cabin filter.	Tripodi
03/07/2020	379,012 kms	<b>C - Annual</b> S-2708  1. Replaced engine oil/fuel/air 2. Replaced gearbox oil and took oil sample. 3. Replaced power steer oil and filter. Fit new reservoir cap nut seal. 4. Replaced air/oil separator filter. 5. Replaced in-tank ad-blue filter. 6. Reconditioned air dryer assembly fitted and new D2 governor valve fitted not long ago. 8. Replaced coolant filter. 9. Lower engine heater hose tap leaking coolant as per R-3608. 10. A3 n/s shock leaking as per R-3609. 11. Adjusted tarp cables. 12. Diff oil leaks. 03/07/20 13. Replaced gearbox oil and took oil sample. 14. Cruise control indicator light not working as per R-3609.	Tripodi
03/07/2020	379,012 kms 8,132 hrs	<b>Suspension</b> R-3610  Fit new shocks to both sides A3.	Tripodi
03/07/2020	379,012 kms 8,132 hrs	<b>Warning/Indicator Light</b> R-3609  Fit new globe as required. Graham	Tripodi
03/07/2020	379,012 kms 8,132 hrs	<b>COOLANT LEAKS</b> R-3608  Fit new heater hose tap as required. Topped up coolant. Leigh	Tripodi
10/06/2020	369,435 kms	<b>B - 20k</b> S-2635  1. Tightened loose bonnet mirror.	Tripodi
02/06/2020	366,524 kms 7,892 hrs	<b>Lights</b> R-3467  Fit new headlamp assembly and H4 globe as required. Leigh	Tripodi
28/05/2020	365,059 kms 7,861 hrs	<b>Truck tarp</b> R-3449  Adjusted as required. Graham	Tripodi
22/05/2020	363,046 kms 7,823 hrs	<b>Brakes</b> R-3416  Fit new adjusters as required. Leigh.	Tripodi
18/05/2020	361,471 kms 7,790 hrs	<b>Gearbox, Tech repair</b> R-3376  Upgraded ultrashift TECU software as required. (TECU 059)	Tripodi
18/05/2020	361,471 kms 7,790 hrs	<b>Ringfeeder</b> R-3377  Fit new pin/spring kit as required. Tow pin bushes and tow eye wear plate check okay.	Tripodi
18/05/2020	361,471 kms	<b>A - 10k</b> S-2576	Tripodi

Date	Reading / Units	Type / Repairer Notes	Repairer
		1. Ultrashift software upgrade available as per R-3376. 2. Ringfeeder tow pin measures close to minimum as per R-3377.	
18/05/2020	361,206 kms	<b>DEFECT MINOR R-3352</b>  CLEARED 18/05/2020	
12/05/2020	358,422 kms 7,738 hrs	<b>DEFECT MINOR, Fault report, Lights R-3342</b>  Fit new H4 headlight globe as required.	Tripodi
05/05/2020	355,082 kms 7,678 hrs	<b>Brakes R-3328</b>  Removed brake components. Cleaned and inspected as required. Fit new brake shoe kits and brake drums. Graham/Leigh	Tripodi
05/05/2020	355,082 kms 7,678 hrs	<b>Suspension R-3329</b>  Fit new lower shock mount bushes to N/S and o/s drive axles.	Tripodi
04/05/2020	354,467 kms	<b>A - 10k S-2541</b>  1. Oil weep at fuel pump area 04/05/20 2. Fuel/oil pressure gauge light not working. Fit new globe as required. 3. Replaced steer axle hub oil.	Tripodi
04/05/2020	354,467 kms 7,665 hrs	<b>Engine Valve Adjustment R-3316</b>  Carried out valve adjustment as required. Fit new rocker cover gasket. Found four rocker cover bolts missing rubbers. Fit new bolt assemblies as required. Used original front cover plug. Leigh	Tripodi
04/05/2020	354,467 kms 7,665 hrs	<b>COOLANT LEAKS R-3317</b>  Fit new coolant filter and top up coolant. Leigh	Tripodi
27/04/2020	351,766 kms 7,615 hrs	<b>Brakes R-3277</b>  Removed brake components. Clean and inspect as required. Fit new brake shoe kits. Fit good used brake drums.	Tripodi
27/04/2020	351,766 kms 7,615 hrs	<b>Truck tarp R-3278</b>  Adjusted cable and drive chain as required.	Tripodi
27/04/2020	351,766 kms	<b>B - 20k S-2527</b>  1. Replaced engine oil/fuel/air. 2. A2 brakes low as per R-2377. 3. A3 brakes next service. 4. Tarp cable slipping as per R-2378. 5. Tightened loose crossmember under gearbox. 6. Replaced gearbox oil and filter (EATON synthetic oil)	Tripodi
25/03/2020	340,673 kms	<b>A - 10k S-2434</b>  1. Topped up engine oil. 2. Horton clutch getting low. 3. Engine wont start as per R-3099. 4. Excess coolant leak at water pump as per R-3100.	Tripodi
25/03/2020	340,673 kms 7,405 hrs	<b>COOLANT LEAKS, Water Pump R-3100</b>  Found source of leak at water pump. Had CUMMINS come to Tripodi site to carry out R&R of water pump under warranty. (Had to give order number: 17469 for travel)	Cummins, Tripodi
24/03/2020	340,673 kms 7,405 hrs	<b>Engine, Starter Motor R-3099</b>  Traced to damaged starter also giving code 17 starter lock relay. Fit new starter motor as required.	Tripodi
10/03/2020	344,448 kms	<b>B - 20k S-2398</b>  1. Ringfeeder: Bolt dia:47.3mm, axial play:<5mm, lower clearance :<2.5mm, Wear plate :<4mm 2. Check and clean cabin filter.	Tripodi
02/03/2020	331,380 kms 7,226 hrs	<b>Air R-2997</b>  Was able to do temporary repair at site to get truck back to workshop. Fit new air dryer assembly and D2 governor valve. Checks okay.	Tripodi

Date	Reading / Units	Type / Repairer Notes	Repairer
02/03/2020	331,380 kms 7,226 hrs	<b>Tech repair</b> R-2998  Adjusted truck body pressure switch as required.	Tripodi
10/02/2020	324,302 kms	<b>B - 20k</b> S-2322  1. Replaced diff/drive hub oils and filter. 2. Replaced steer axle hub oil. Graham/Emily.	Tripodi
04/02/2020	323,202 kms	<b>B - 20k</b> S-2305  1. Replaced engine oil/fuel/air. 2. Ringfeeder: Bolt dia:47.4mm OKAY. Bolt axial:2.5mm OAY, Lowewr bush <2mm OKAY, Wear plate 1mm OKAY.	Tripodi
16/12/2019	310,811 kms	<b>A - 10k</b> S-2173  1. Oil weep at thru-shaft and input yoke. 2. Horton clutch low. 3. Topped up engine oil. 4. Reset GI. Lee/Graham.	Tripodi
02/12/2019	305,551 kms 6,686 hrs	<b>Engine</b> R-2639  Re-tensioned rear engine mount main bolts as required.	Tripodi
02/12/2019		<b>A - 10k</b> S-2131  1. N/S rear engine mount bolt loose as per R-2639. 2. A2 and A3 upper torque rod bushes close to needing replacing. 3. Replaced steer axle hub oil. 4. Chips in windscreen. Will monitor.	
11/11/2019	299,358 kms	<b>Fault report</b> R-2596  Repaired air hoses and trailer light wiring harness as required. Had to pull harness through to get more lenght as wiring had many previous repairs. Repaired reverse camera harness also. Emily	Tripodi
11/11/2019	298,905 kms	<b>A - 10k</b> S-2057	Tripodi
24/10/2019	294,354 kms	<b>A - 10k</b> S-2014  1.Torque rod bushes fatigued.	Tripodi
11/10/2019	289,700 kms 6,329 hrs	<b>Hydraulics</b> R-2448  Fit new male coupling and fit boot/cover to coupling.	Tripodi
11/10/2019	289,700 kms 6,329 hrs	<b>Tech repair</b> R-2446  Fit new wear pad kit as required.	Tripodi
11/10/2019	289,700 kms	<b>B - 20k</b> S-1959  1. Replaced engine oil/fuel/air. 2. A3 shock weeping. 3. Air dryer muffler restricted flow. Removed as required. 4. Tightened loose A2 shock mount nut. 5. Cleaned trio and hydraulic couplings as required. 6. Fit hydraulic coupling boot as required. Leak at coupling also as per R2448. 7. Fit new cabin filter. 8. Upper torque rod bushes soon. 9. N/S park light not working as per R-2447. 10. Ringfeeder wear plate low as per R-2446.	Tripodi
11/10/2019	289,700 kms 6,329 hrs	<b>Lights</b> R-2447  Fit new globe as required.	Tripodi
28/09/2019	277,248 kms	<b>Fault report</b> R-2297  Batteries load tested as good. Batteries where new 05/2019. All connections check okay. Operation checked okay. Will have to monitor.	Tripodi
23/09/2019	284,829 kms	<b>A - 10k</b> S-1921  1. Ringfeeder wear plate nearly at minimum 4mm.	Tripodi
31/08/2019	277,249 kms 6,054 hrs	<b>Exhaust</b> R-2290  Fit new mount rubbers to turbo dump pipe as required.	Tripodi
31/08/2019	277,249 kms 6,054 hrs	<b>Brakes</b> R-2289	Tripodi

Date	Reading / Units	Type / Repairer Notes	Repairer
		Remove A3 brake components. Clean and inspect all brake components as required. Fit new brake shoe kits. Fit new brake drums.	
30/08/2019	277,249 kms 6,054 hrs	<b>Driveline</b> R-2287	Tripodi
		Fit new correct type filter as required.	
30/08/2019	277,249 kms 6,054 hrs	<b>Gauge lights</b> R-2285	Tripodi
		1. Fit new warning light globe. 2. Fit new gauge globe holder assemblies.	
30/08/2019	277,249 kms	<b>A - 10k</b> S-1836	Tripodi
		1. Gauge/cruise light not working R-2285. 2. A3 brakes nearly on rivets. Booked to do 31/08/19. 3. Grease clutch and reset grease interval. 4. 1st drive diff filter leaking oil R2287. 5. Topped up engine oil 5L. only a minor oil weep evident at air compressor to block. Need to monitor oil usage. 6. Top up coolant 2.5L. No leaks evident. Will monitor. 7. O/S steer tyre only had 80psi. Could only get 100psi in it. Filled out tyre repair report as required. 8. Power steer oil leak at resevoir botom fitting. Found fitting was loose. Tightened and clean as required. Oil level checked okay.	
12/08/2019	270,458 kms 5,921 hrs	<b>Driveline</b> R-2253	Tripodi
		Carry out updates as required.	
25/07/2019	263,541 kms 5,789 hrs	<b>Engine</b> R-2180	Cummins
		Cummins came to Tripodi site. Cummins finally fitted new doser pump under warranty.	
24/07/2019	263,117 kms	<b>A - 10k</b> S-1742	Tripodi
		1. Horton fan clutch getting low.	
18/07/2019	261,202 kms 5,732 hrs	<b>air leaks</b> R-2148	Tripodi
		Fit new female trio coupling as required. Checked okay. Graham	
18/07/2019	261,202 kms 5,732 hrs	<b>air leaks</b> R-2149	Tripodi
		Fit new trio coupling to O/S as required. Graham.	
16/07/2019	261,202 kms 5,732 hrs	<b>AdBlue</b> R-2138	Tripodi
		Ran through diagnosis as per CUMMINS INsite. Cummins say to do flush procedure three times. If not okay, to replace Doser Pump. Ran through procedure 7 times. Blockage still there. Sent to Cummins Wetherill Park to flush with their machine. Fault now okay even thou Cummins did procedure 5 times.	
16/07/2019	261,202 kms 5,732 hrs	<b>COOLANT LEAKS</b> R-2136	Tripodi
		Fit new improved type heater tap module. Top up coolant and washed engine. Pressure checks okay.	
16/07/2019	261,202 kms 5,732 hrs	<b>Driveline</b> R-2137	Tripodi
		Finally got Eaton Service Ranger 4. Was able to correct all faults as above using this.	
09/07/2019	259,754 kms 5,691 hrs	<b>Alternator</b> R-2115	Tripodi
		Fit new alternator as required. Fit new alt/fan belt and A/C belt as required.	
09/07/2019	259,754 kms	<b>C - Annual</b> S-1707	Tripodi
		1. Replaced engine oil and filter. 2. Replaced engine air filter. 3. Replaced fuel filters. 4. Replaced air/oil separator filter. 5. Fit new air dryer filter kit. 6. Replaced power steering oil and filter. 7. Replaced Adblue in-tank filter. 8. Replaced steer hub oils. 9. Replaced differential oils and filter. 10. Replaced drive hub oils. 11. Replaced cabin filter. 12. Coolant test at -31degrees. 13. Fit new radiator cap. Seal swollen.	
27/05/2019	244,662 kms 5,367 hrs	<b>Gauge lights</b> R-1979	Tripodi
		Fit new dash indicator globes as required. Check operation. Checks okay.	

Date	Reading / Units	Type / Repairer Notes	Repairer
27/05/2019	244,662 kms 5,367 hrs	<b>Tech repair</b> R-1978  Found inactive fault codes 27 and 64. Checked over wiring harness and connectors for gearbox/ECA. All check okay. Thoroughly greased clutch release bearing and drove truck. Unable to fault. Will have to monitor.	Tripodi
22/05/2019	243,300 kms	<b>A - 10k</b> S-1543  1. Fire extinguisher out of date. Fit new fire extinguisher as required. 2. Drive shock rubbers minor cracks/fatigue. 3. Minor split/crack in intake pipe off air box. Cleaned and taped up. Will order new one. 4. Reset (GI).	Tripodi
09/05/2019	239,550 kms 5,243 hrs	<b>Tech repair</b> R-1888  Fit (x4) four new batteries as required. Cleaned terminals. Applied terminal protector. Engine cranking good.	Tripodi
09/05/2019	239,550 kms 5,243 hrs	<b>AdBlue</b> R-1887  Fit new AdBlue pump inlet filter and o-ring as required. Check for leaks. Checks okay.	Tripodi
06/05/2019	238,406 kms	<b>A - 10k</b> S-1444  1. Replaced steer axle hub oil as per schedule. 2. Re-tensioned loose exhaust clamp at muffler. 3. Carried out clutch adjustment.	Tripodi
02/05/2019	237,088 kms 5,182 hrs	<b>TECH EPAIR</b> R-2015  FIT NEW CB HAND PIECE	
30/04/2019	235,964 kms 5,159 hrs	<b>TECH REPAIR</b> R-1930  AFTER TREAT LIGHT ON 3548 LOSS OF PRIME	Tripodi
12/04/2019	233,020 kms	<b>B - 20k</b> S-1562  COMPRESSOR UN LOADER VALVE LEAKING AIR LOOSE RAM BOLT DS TOPPED UP COOLANT 2.5L CHNAGED FRONT HUB OIL FUEL LEAK (FITTING AT JUNCTION BELOW GBOX LOOSE, TIGHTENED 1 A BRAKES STARTING A LITTLE SLUGISH BENT MUD FLAP BRACKET DS IST A	Tripodi
27/03/2019	228,987 kms 4,980 hrs	<b>TECH REPAIR</b> R-1877  RR BONNET STRAP DS	
21/02/2019	216,147 kms	<b>A - 10k</b> S-1331  1. Fit new wiper blade set.	Tripodi
15/02/2019	213,331 kms	<b>Fault report</b> R-1485  1. Cable still serviceable. Adjusted as required. 2. Fit new set of wiper blades. 3. Fault code for ambient air temp sensor 0249. Tightened terminal pins and appliued silicone grease. Code now gone. Roadtested okay.	Tripodi
01/02/2019	208,512 kms	<b>B - 20k</b> S-1281	Tripodi
21/01/2019	205,374 kms	<b>PINK SLIP</b> R-1302	
15/01/2019		<b>Driveline</b> R-1400  Removed axle. Re-sealed using sealant. Fill hub up with oil as required. Degreased.	Tripodi
15/01/2019	203,003 kms	<b>A - 10k</b> S-1247	Tripodi
15/01/2019	203,003 kms 4,421 hrs	<b>Chassis</b> R-1401  Fit new mudflap as required.	Tripodi
08/01/2019	200,915 kms	<b>A - 10k</b> S-1222	Tripodi
11/12/2018	195,895 kms 4,266 hrs	<b>Gauge lights</b> R-1343	Tripodi

Date	Reading / Units	Type / Repairer Notes	Repairer
		Fit new warning light globe as required	
11/12/2018	195,895 kms	D S-1162	Tripodi
		Replaced A2 and A3 differential oil and filter. Replaced A2 and A3 drive hub oils. Replaced A1 (steer axle) hub oils.	
11/12/2018	195,895 kms	A - 10k S-1161	Tripodi
07/11/2018	184,673 kms	B - 20k S-74	
30/10/2018	181,633 kms	A - 10k S-76	
08/10/2018	173,650 kms 3,780 hrs	TECH REPAIR R-94	
		FIT NEW FIRE EXTINGUISHER, MOUNTED TO BATTERY BOX , FIT FIRE EXTINGUISHER STICKER	
08/10/2018	165,944 kms	TECH REPAIR R-96	
		FIT NEW BRAKE SHOE KITS TO A1 FIT NEW BRAKE DRUMS REFIT WHEELS AND TENSIONED WHEEL NUTS, REFIT NUT INDICATORS ADJUST BRAKES SCAM SLACK ADJUSTERS CHECK AS SERVICEABLE	
08/10/2018	173,650 kms 3,780 hrs	TECH REPAIR R-95	
		1. FIT NEW GLOBE TO FRONT DIFF TEMP GAUGE 2. FIT NEW MUFFLER TO AIR DRYER 3. FIT SPOT MIRROR TO PASSENGER DOOR AS REQUIRED (TOP OF DOOR FACING DOWN)	
08/10/2018	173,650 kms	A - 10k S-73	
26/09/2018	171,550 kms 3,728 hrs	R-1278	
		Steering wheel crooked / not straight - Check out front end suspension / steering all checks ok - Removed steering wheel and align correctly	
19/09/2018	168,628 kms 3,667 hrs	R-1261	
		1. Engine brake indicator light not working 2. A2 NS axle to hub oil leak 3. Air hoses at draw bar damaged 4. Reflective tape to truck and trailer 1. Fit new globe to engine brake indicator light 2. Re seal axle to hub A2 NS , fill hub with new oil 3. Fit	
13/07/2018	144,079 kms 3,141 hrs	R-1094	
		Cab heter not working intermittently - Found fault as above , fit new heater tap module , top up coolant pressure check system , check operation all check ok	
13/06/2018		Registration O-64	RMS - Rego
01/06/2018	129,071 kms 2,826 hrs	R-942	
		head light not working/Removed and fit new headlight globe	
26/05/2018	126,440 kms 2,772 hrs	R-915	
		comsumables & labour	
08/05/2018	119,404 kms 2,625 hrs	R-852	
		Heater Tap leaking/ A4 o/s Axle leaking oil/repaired and resealed Axle fit new heater tap module	
23/04/2018	113,260 kms 2,504 hrs	R-805	
		Oil leak at 2nd drive axel	
19/04/2018	111,988 kms	R-799	
		Exthost leak in fleux pipe, L.H side rear outside hub seal leaking	

Date	Reading / Units	Type / Repairer Notes	Repairer
09/04/2018		T-9 Fitting of tyre, secondhand tyre, disposal of tyre	
15/03/2018		R-746 Service due	
10/02/2018	86,946 kms	R-723 Reminder cable on dog need replacement tarp cig lighter not working - replaced PJS	
18/01/2018	78,972 kms 1,730 hrs	R-713 Brake worn on dolly axle - Replaced 2 x brake shoes and 1 brake drum	
09/08/2017	20,456 kms	R-568 1. Load gauges not turning on . 2. Truck phone cant hear when get talked to, 3. AC fan only works on high. 4. Hyd oil leak from hose to dog - all work repaired	
26/07/2017	15,002 kms	R-545 1. In cab AC fan onl works on #4, 2. Flashing light on truck not working, 3. Tailgate on dog bent, 4. Set up air hose to blow out cab and change headlight covers to screws - Booked AC issue in. Beacon repaired, tailgate OK, blower fitted.	
11/07/2017	8,558 kms	R-530 Flashing light on truck not working 2 tailgate on dog bent - repaired 05/08/2017	
06/07/2017	7,459 kms	<b>A - 10k</b> S-570 A service	

Signed: \_\_\_\_\_  
Name: \_\_\_\_\_  
Date: \_\_\_\_\_