



Vehicle History Summary



Fleet #	TRI014
Registration	TRI014
Make	KENWORTH
Model	T409
VIN / Chassis #	6F5000000HA458300
Build Date	2017

Date	Reading / Units	Type / Repairer Notes	Repairer
14/05/2026	1,192 kms	Aftertreatment Warning light, Brakes, mudflaps R-9152 1. replaced as required 2. flipped all mudflaps as required 3. plugged in cummins insite and found active faults for blockage in aftertreatment system. Air & Wet flush was underogone on the aftertreatment system. after repairs codes became inactive and were cleared. 4. adjusted all brakes, greased truck and trailer, checked suspension, bushes and fluids.	Ivan Plevnarovski
21/04/2026	997,237 kms	Brakes, Breakdown, FAULT, Gearbox, hose burst valve, oil leaks R-9139 1. no faults present. plugged in EATON service ranger and reset grease interval to clear light on dash 2. travelled to site in rosemeadow where tuck had bin stuck in air. found hose burst valve stuck freed up valve and got bin back down. sent truck back to yard for repairs 3. removed hoses and HYD pump off of PTO. Ordered and replaced pump from Heavy Hydraulics with new fittings to suit. refit pump and hoses to PTO. Washed all areas until completely dry. topped up 20L hydraulic oil and tested. No further leaks. Bled air from top of main hoist for proper operation 4. Adjusted all brakes and greased braking components	Ivan Plevnarovski
15/04/2026	993,967 kms	B - 20k S-6883	Ivan Plevnarovski
27/03/2026		Tyres T-283	South West Sydney Tyres
17/02/2026		Indicator light, roof console, trailer lights R-9079 1. found broken wiring to RHS indicator. repaired as required. 2. broken wiring for bonnet indicators, repaired as required 3. found bolt missing on RHS, fit new bolt as required. 4. could not fault lights at this time. monitor issue	Ivan Plevnarovski
19/12/2025		Tyres T-227	South West Sydney Tyres
19/12/2025		Tyres T-226	South West Sydney Tyres
18/12/2025	981,573 kms	drawbar leg, exhaust R-9031 1. removed and replaced exhaust stack with good 2nd hand one found in container 2. fabricated new drawbar leg holder and welded to drawbar. straightened out bent drawbar leg	Ivan Plevnarovski
11/12/2025		Lights, MT Data, mudflaps R-9026 1. found damaged wiring at rear light assembly, repaired wiring and lights work fine 2. flipped 7 tripodi mudflaps for sale purposes. 3. removed all dash and cabin panels to locate MT data system, carefully removed all wiring, cameras & aerials for the tracking and recording system.	Ivan Plevnarovski
25/11/2025	980,549 kms	A - 15k S-6799	Ivan Plevnarovski
06/10/2025	976,608 kms 19,549 hrs	Air Dryer, air leaks, horse hair, PPV R-8938 1. found air leaks at PPV and air dryer. stripped and reconditioned air dryer as required & replaced faulty PPV 2. replaced horse hair with new	ivan
29/09/2025	975,158 kms	Aftertreatment Warning light, cab air blower, Engine Oil Leak R-8935 1. cut and resealed broken air blower 2. performed wet/air side flush to adblue system 3. inspected leaks and verified where coming from. booked into gilbys truck repairs on monday 6/10 for repairs	Ivan Plevnarovski
27/09/2025		Lights R-8930	Ivan Plevnarovski

Date	Reading / Units	Type / Repairer Notes	Repairer
		1. replaced as required	
26/08/2025	968,375 kms	Reverse Lights R-8886	Ivan Plevnarovski
		1. checked all wiring to gearbox for reverse circuit. found no power. found blown fuse in fuse box for reverse power supply. changed fuse and re tested all ok. inspected wiring in chassis and on reverse lights for any reason of the blown fuse could not fault.	
11/08/2025	964,058 kms 19,289 hrs	B - 30k S-6703	Ivan Plevnarovski
08/08/2025	964,058 kms 19,289 hrs	Brakes, brake s-cam, King pin kit, oil leaks, slack adjuster, Thru-shaft R-8840	Ivan Plevnarovski
		1. replaced king pins as required 2. rectified oil leak from timing cover inspection rubber plug 3. replaced A3 brake shoes as required 4. replaced A3 S-cams as required 5. replaced 2x A3 slack adjusters as required 6. replaced all lower shock bushes as required. 7. tensioned up radiator isolator bushes. as required	
25/06/2025	948,560 kms 18,790 hrs	Number plate, Spotter mirror R-8766	Outback Industries
		1. Number plate secured on by zip ties. Removed number plate and bracket. Straightened out both parts and refitted with new bolts 2. Replaced broken spotter mirror	
25/06/2025	948,560 kms 18,970 hrs	A - 15k S-6645	Outback Industries
		1. Monitor Kingpins (more RHS) 2. Monitor radiator isolator bushes 3. Air leak coming from air dryer main seal 4. Monitor TPS roller and pin	
10/06/2025	942,474 kms	fuel system, Starter Motor R-8739	Ivan Plevnarovski
		1. replaced starter motor as required 2. replaced fuel line and primed system. all ok.	
29/05/2025		Speedo R-8736	HILLS AUTO ELECTRICS
		repaired by hills auto electrics	
07/04/2025		Battery R-8616	Ivan Plevnarovski
		1. load tested all batteries - found 2 failed batteries covered in calcium buildup. replaced batteries as required.	
29/11/2024		Fault report, HVAC R-8230	Ben Potts
		Found loose terminal in refrigerant pressure switch connector. Tighten and checks ok.	
27/11/2024		Fault report, HVAC R-8229	Ben Potts
		AS per Repair#8230	
07/11/2024		Ringfeder Measurements I-165	
06/11/2024	933,994 kms 18,595 hrs	Air Dryer, air leaks, Diff Oil Leak, Gauge lights, head light, shock absorber R-8132	Gavin Smith-Croucher
		1. Gsc pulled apart, cleaned and put back together a2 o/s a3 n/s axles replacing the hub gaskets with new ones 2. Gsc replaced wedge globe in dash 3. Gsc replaced air dryer cartridge d2 governer valve and blow off valve 4. Gsc replaced head light with a used one in better condition 5. Reported to management to order parts 6. Gsc replaced 3/8 fitting with a new one 7. Gsc tightened loose shock 8. Washed off and will monitor 9. Bp turned jack knife buzzer plates around	
06/11/2024	933,994 kms 18,595 hrs	B - 30k S-6241	Ben Potts, Gavin Smith-Croucher
		1. Oil leak at A2 o/s and A3 o/s axle to hub. 2. Engine water temp gauge light out in dash 3. Air dryer tap was turned of and air system is full of water 4. N/s head light cracked 5. O/s high beam surround is missing 6. Air leak at the rear of gear box 7. A3 n/s shock loose 8. Thru shaft nut misting 9. Jack knife buzzer plates need turning around 10. Gsc. Carried out engine valve adjustment	
24/10/2024		Aftertreatment Warning light, Fault report, Lights R-8100	Ben Potts
		1 & 2. Unable to fault both things at time of inspection ??	
16/10/2024	927,773 kms 18,484 hrs	Combination switch, Wipers R-8053	Alex Martin
		1. Re fitted wiper arm on N/S and also put a new wiper blade 2. Fitted new combination switch to replace faulty combination switch	

Date	Reading / Units	Type / Repairer Notes	Repairer
14/10/2024	927,773 kms 18,484 hrs	Tarp cable R-8048 Replaced truck tarp cable with new cabal	Alex Martin, Gavin Smith-Croucher
19/09/2024		Fault report, Hydraulic coupling R-7958 Unable to fault at time of inspection. Leak had been repaired last week.	Ben Potts
12/09/2024	920,033 kms 18,334 hrs	Engine coolant temperature R-7939 Fitted new temp sensor	Alex Martin
12/09/2024	920,033 kms 18,334 hrs	AIR CON, Fault report R-7942 Unable to fault at time of inspection. Checked refrigerant pressures. Checked air flow.	Ben Potts
11/09/2024	920,033 kms 18,334 hrs	bushes, Engine/Gearbox mount, hub seal, Suspension R-7926 1. Removed hub and replaced leaking hub seal and clean oil off brake shoes: AM 2. reported to Pat Tripodi. ben 3. Ordered new fire extinguisher. Ben 4. Fit new hose as required. 5. GSC pulled sway bars out pressed sway bar bushes out and replaced them with new bushes put sway bars back in and also replaced bolts and nuts 6. GSC tightened shock nuts 7. Straighten number plate and bracket and fitted 2 new nuts and bolts: AM 8. Replaced front engine mounts. Used new nyloc mount nuts. AM/GSC 9. Drained diff oil. removed leaking fitting and resealed as required. Refit cooler pipe. Diff oil was getting replaced at this service. GSC	Alex Martin, Gavin Smith-Croucher
11/09/2024	920,033 kms 18,334 hrs	Hydraulic hose, Hydraulic oil leak, Hydraulics R-7917 Resailed 90° fitting on truck	Alex Martin
11/09/2024	920,033 kms 18,334 hrs	A - 15k S-6134 1. N/s steer hub seal leaking 2. Hole in rear of bin 3. Fire extinguisher missing date tag 4. Power steer suction hose porous 5. Sway bar bushes worn 6. A3 drive shocks loose a2 n/s shock loose 7. Number plate about to fall off 8. Front engine mounts worn 9. Diff oil leak at 1st drive oil cooler pipe connection. 10. Replaced diff/drive hub/steer hub oils/filters. Replaced gearbox filter.	Alex Martin, Ben Potts, Gavin Smith-Croucher
20/08/2024	911,246 kms 18,128 hrs	Warning/Indicator Light R-7815	Alex Martin, Gavin Smith-Croucher
20/08/2024		Brakes, Fault report R-7818 Adjusted brakes. checks ok.	Ben Potts
13/08/2024	911,245 kms 18,127 hrs	Cruise control, Engine brake, Wipers R-7785 1. replaced wiper blades. 2. Checked engine parameters. Found this parameter had been adjusted very high to prevent it from coming on . Reset as required.	Ben Potts
01/08/2024		New T-43	
27/07/2024	906,365 kms 18,004 hrs	Drive belt R-7731 Found A/C belt noisy. Fit new A/C drive belt and tensioner.	Alex Martin, Ben Potts
19/07/2024	901,386 kms	C - Annual S-6004 1. A2/A3 brakes low. 2. Replaced cabin filter. 3. Replaced as2474. 4. Replaced power steer oil/filter/nut seal. 5. Replaced coolant filter. 6. Replaced air dryer filter kit and purge valve. 7. Replaced in-tank adblue filter and carried out doser air/wet side flush. 8. replaced engine air filter. 9. Airglide swaybar bushes next service. 10. Engine oil weep at front area. GSC/AM/Ben	Tripodi
10/07/2024	901,386 kms 17,895 hrs	Brakes R-7652 Removed brakes. cleaned and inspect. Fit new brake shoe kits and brake drums to both axles. GSC/AM	Tripodi
10/07/2024	901,386 kms 11,895 hrs	Fault report, HVAC R-7604	Tripodi

Date	Reading / Units	Type / Repairer Notes	Repairer
		Unable to fault at time of inspection. Will have to monitor. Ben	
10/07/2024	901,386 kms 11,895 hrs	coolant, Fault report R-7603	Tripodi
		Replaced weeping heater hose tap and top up coolant.	
10/07/2024	901,386 kms 17,895 hrs	Burning Smell, coolant, Fault report R-7602	Tripodi
		Found lower heater hose tap weeping leaking coolant. Replaced as required.	
10/07/2024	901,386 kms	Ringfeder Measurements I-140	
08/07/2024	900,652 kms 17,877 hrs	Fault report, Flat tyre R-7608	Black Rubber Tyres
		Had Black Rubber Tyres repair/replace as required. Ben	
01/07/2024		Fault report, Speedo R-7604	Tripodi
		Checked and cleaned dirty speedo sensor harness plug. Tighten terminals in harness plug. Check operation. Checks ok.	
04/06/2024	891,895 kms	B - 30k S-5949	Tripodi
		1. Excess air leaks evident. 2. Top radiator hoses bulging/worn. 3. Bonnet assist strut O/S is seizing/rattling/sticking/worn. 4. Charge air hose at o/s engine to intercooler worn/cracked. 5. A2/A3 brakes next service. 6. A2/A3 swaybar bushes next service. 7. Engine oil weeping at front seal. 8. Front and rear engine mounts next service. GSC/Ben/AM	
04/06/2024	891,895 kms 17,656 hrs	air leaks, Bonnet, Charge air hose, D2 Governor valve, PPV, radiator hose, Suspension R-7549	Tripodi
		1. Found PPV at n/s and o/s air tanks leaking badly. Fit new PPV to both sides as required. Found N/S front A3 air spring leaking air. Fit new air spring. Found D2 governor valve hoses porous. Fit new hoses as required. Ben 2. Replace top radiator hoses and used new clamps. Top up coolant. Ben 3. Fit new bonnet assist strut. Ben. 4. Fit new charge air hose and clamps. Ben	
04/06/2024		exhaust manifold, Gauge lights, Lights, Steering, Windscreen washers R-7325	Tripodi
		1. Adjust pressure as required. Ben 2. Degreased and will monitor. 3. R&R exhaust manifold gaskets as required. Ben 4. 5. 6. Fit new steering column tilt lock shock and cable as required. Ben/GSC 7. Adjust as required. Ben	
22/05/2024	887,221 kms 17,564 hrs	Fault report, mat R-7462	Tripodi
		Fit new mat as required. Ben	
22/05/2024	887,221 kms 17,564 hrs	Fault report, Headlight R-7464	Tripodi
		Fit new headlight globe and park light globe to o/s headlamp. Replaced broken headlight chrome surround too. Ben	
22/05/2024	887,221 kms 17,564 hrs	Fault report, Gauge lights R-7463	Tripodi
		Replaced globes and globe/holders as required. Ben	
13/05/2024		Fault report, Gauge lights R-7434	Tripodi
		repaired as required. Ben	
13/05/2024	883,474 kms 17,497 hrs	Fault report, Lights R-7440	Tripodi
		Replaced blown headlight globe. Ben	
21/03/2024	871,918 kms	A - 15k S-5818	Tripodi
		1. Air leak. Loses air fairly quickly when sitting there. 2. Air pressure needs adjusting. To high. 3. Engine oil weeping front engine area. 4. Exhaust manifold leaking. 5. O/S park light not working. 6. Gauge and indicator not working speedo/tacho/fuel/coolant temp/volts/cruise control. 7. Steering tilt lock shock not holding steering column/insecure. 8. Driver side washer jet needs aiming.	
05/03/2024	865,357 kms 17,128 hrs	DEFECT MINOR, Lights, Steering R-7208	Sloanebuilt trailers, Tripodi

Date	Reading / Units	Type / Repairer Notes	Repairer
		1. Found broken wire to bonnet side indicator lamp. Repaired wiring harness and secured as required. Ben. 2. Fit new tie-rod end. GSC/Ben	
05/03/2024	865,357 kms 17,128 hrs	Fault report, Lights R-7257 repaired as per R#7208	Tripodi
29/02/2024	863,780 kms 17,096 hrs	Drive belt R-7194 Fit new fan belt as required. Ben	Tripodi
29/02/2024	863,780 kms 17,096 hrs	Drive belt, Horton Fan R-7255 Repaired as per R#7194	Tripodi
22/02/2024		Fault report, Gauge lights R-7251 Fit new globe. AM	Tripodi
20/02/2024		Fault report, Gauge R-7245 fit new globe. AM	Tripodi
19/02/2024		Fault report, Lights R-7244 Fit new globe. AM	Tripodi
05/02/2024	856,023 kms	B - 30k S-5728 1. Driver report A/C poor performance. 2. Driver report belt noise. 3. A2/A3 O/S brakes over stroked. 4. Drive shocks mounts loose/oil weep. 5. Drive axle swaybar bushes slight signs of fatigue. Will monitor 6. Engine oil weep at front seal area. Degreased and monitor. 7. Minor hole in exhaust elbow after flex pipe out of muffler. Will monitor. 8. Starter motor to be scheduled for replacement. 9. Engine valve set needs scheduling for inspection/adjust. 10. Minor air leak at footbrake valve fittings. 11. Minor air leak at top hat valve in N/S rear air tank. 12. Engine/gearbox mounts soon. Still servieable. 13. Replaced engine oil/fuel. Cleaned engine air filter. 14. Replaced cabin filter. 15 .Replaced steer hub oil and drive line filters. AM/GSC	Tripodi
05/02/2024	856,023 kms 16,919 hrs	Fan Belt R-7086 Repaired as per R#7130.	Tripodi
05/02/2024	856,023 kms 16,919 hrs	AIR CON R-7087 Repaired as per R#7130.	Tripodi
05/02/2024	856,023 kms 16,919 hrs	Brakes, Drive belt, HVAC, Suspension R-7130 1. Fit new evaporator/tx-valve assembly. Fit new a/c compressor. Flushed out a/c condensor. Fit new a/c hoses and evaporator inlet/outlet pipes/receiver-dryer. Carried out re-gas. Ben L115841/GSC 2. Fit new belt tensioner. Ben 3. Adjusted brakes. Measured strokes, all check ok. AM/Ben 4. Fit new set of drive shock absorbers. AM 5. Scheduled for replacement. 6. Scheduled for repair.	Tripodi
20/12/2023	847,694 kms	A - 15k S-5664 1. Trio couplings leaking air.. 2. Trans temp and axle temp gauge lights not working. 3. Windscreen wiper arms worn/not clearing screen. 4. Drive belt noise evident. 5. Exhaust manifold gasket leaking. Minor at the moment. 6. Drive axle shock bushes signs of fatigue. Next service. 7. Belly bar bolts loose. Next service. 8. Thru-shaft yoke oil mist. 9. Radiator stay rod bushes worn. Next service. 10. Steering column middle uni-joint has slight play. Next service. 11. Turbo exhaust mount rubbers have play. Next service. 12. Engine oil weep from front seal. 13. Air leaks evident at PPV (x2). Minor- Next service. 14. Accelerator pedal roller worn. Next service. 15. Drive air springs minor leaks/cracks. Next service. 16. Cab shock absorber misting. Next service. 17. Steering column lock shock/adjuster has play. Next service. 18. Washer combo switch intermittent not working. Next service. 19. Fault report FR3514 20. Topped up engine oil. 21. Cleaned air cab filter. Ben/GSC	Tripodi
20/12/2023	847,694 kms 16,721 hrs	Fault report, HVAC, Lights, Weight gauges R-6965 1 .Found evaporator is nearly blocked. Needs new evaporator. Have to schedule for repair. 2. Found taps turned off at drawbar. Also found tandem gauge not even working. Had to fit new tandem weight gauge. 3. Unable to fault. Will have to monitor. Requires further inspection.	Tripodi

Date	Reading / Units	Type / Repairer Notes	Repairer
20/12/2023	847,694 kms 16,721 hrs	Belt tensioner, Drive belt, Gauge lights, trio, Wipers R-6964 1 .Cleaned couplings. Checks ok. GSC 2. Fit new globes. Ben. 3. Fit new wiper arm assemblies to both sides. Ben/GSC 4. Fit new drive belts. Fit new tensioners. A/c idler checks ok. Ben	Tripodi
24/11/2023		Breakdown, Electrical, Gearbox R-6885 Travelled to breakdown. was unable to fault when i got there. Truck parked in dangerous spot too. Followed truck back to Campbelltown. Driver tipped off at Prestons and brought back to the workshop. Found no power at UltraShift wiring harness diagnostic connector (four pin square-three wires). Fit new transmission wiring harness. Checks ok. Road-test ok (Pat) Note: only fault code 73 inactive 4 counts. Ben/GSC	Tripodi
08/11/2023	833,649 kms 16,413 hrs	Charge air hose, COOLANT LEAKS, Lights, reverse buzzer R-6854 1. Fit new reverse buzzer. Ben/GSC 2. Fit new clamp. GSC 3. Fit new globe. AM 4. Fit new tap and top up coolant. GSC	Tripodi
08/11/2023	833,649 kms	B - 30k S-5602 1. Reverse buzzer not working. 2. Charge air hose clamp broken at turbo connection. 3. N/S park light not working. 4. Lower heater hose tap leaking. GCS/AM	Tripodi
07/09/2023	815,017 kms 16,015 hrs	HVAC R-6759 Recovered refrigerant. Fit new Schrader valves into high and low service ports. Fit new receiver-dryer. Carry our regas. Ben L115841	Tripodi
31/08/2023	812,699 kms	A - 15k S-5445 1. Engine starting sluggish. 2. A2/A3 upper torque rod bushes need replacing. GSC/AM	Tripodi
31/08/2023	812,699 kms 15,968 hrs	Battery, Suspension R-6742 1. Replaced torque rod bushes as required. Used new nyloc mount nuts. Used new HD type bush too. GSC/AM 2. Batteries loadtest as fair/replace. Fit new set of batteries. Fit new positive battery terminals due to corrosion. Ben	Tripodi
24/07/2023	799,144 kms	C - 100k/Annual S-5373 1. Replaced engine oil/fuel/air. 2. Replaced power steer oil/filter/nut seal. 3. Replaced in-tank adblue filter. 4. Replaced coolant filter. 5. Replaced AS2474. Did doser air side flush. 6. Replaced cabin filter. 7. Fit new air dryer filter. GSC/AM/Ben	Tripodi
14/06/2023		Ringfeeder R-6678	Sloanebuilt trailers
14/06/2023		Ringfeder Measurements I-78 Sloanbui;It inspected/serviced said OK. Ringfeeder: Coupling bolt bulge OD: 47.41mm, Coupling bolt lower OD: 34.73mm, Lower bush ID: 35.72mm, Axial: 3.5mm, Wear plate: 2mm.	
01/05/2023	764,092 kms 15,042 hrs	Brakes, Steer Hub R-6514 Removed hub/brakes. cleaned and inspect. Fit new hub seal and fit hub using new gasket and oil. Brakes low and worn. fit new brake shoe kits and brake drums. AM/GSC	Tripodi
28/04/2023	763,467 kms 15,032 hrs	Hoist , Hydraulics, Truck Body R-6500 Found air in system. Bled hoist assembly. Topped up hydraulic oil. Found truck and trailer body's to not both go up at the same time. Found oil level very low. Topped up as requiried to have body's operate correctly. Ben.	Tripodi
11/04/2023	758,053 kms 14,934 hrs	light brackets R-6467 Fit new globe.	Tripodi
11/03/2023	744,208 kms	A - 10k S-5101 1. N/S steer wheel has a cracked wheel nut. 2. Turbo charge air hose has a broken clamp. 3. Replaced engine oil/fuel/air. Bailey/AM	Tripodi
11/03/2023	744,208 kms 14,689 hrs	Turbo, wheel nut indicator R-6399	Tripodi

Date	Reading / Units	Type / Repairer Notes	Repairer
		1. Fit new nut as required. 2. Fit new hose clamp as required. AM/Bailey	
04/03/2023	740,829 kms 14,631 hrs	Aftertreatment Warning light, Gearbox R-6391	Tripodi
		1. Doser not priming codes. Found doser blocked. Cleaned doser inlet filter. Cleaned doser injector. Fit new in-tank adblue filter. Carried out air side and wet side flush as required. Doser now working good. cleared fault codes. Checks okay. 2. Carried out UltraShift ECU reconfiguration to suite quad trailr. Ben.	
04/03/2023	740,829 kms	B - 20k S-5086	Tripodi
		1. Driver report engine derating. 2. truck now towing a quad. Needs UltraShift re-configuration.	
29/10/2022		Hydraulic coupling R-6218	
		Had to get PIRTEK at Blacktown to repair as required.	
24/10/2022	708,149 kms	B - 20k S-4740	Tripodi
		1. Replaced engine oil/fuel/air cracks in subframe mounting plates leaking trio coupling audible leaking through shaft seal through shaft nut loose	
14/09/2022	697,459 kms 13,840 hrs	Aftertreatment Warning light, Gearbox, Lights R-6055	Tripodi
		1. Fit new X-Y shifter assembly as required. Roadtested okay. 2. Carried out air side flush. Cleaned doser injector and doser pump inlet filter. 3. Fit new covers to both sides. Had to fit new locating washers/rings too. AM. 4. Fit new headlamp assembly. Fit new park light globe too. AM 5. Fit new park light globe. GSC	
14/09/2022	697,459 kms	A - 10k S-4661	Tripodi
		1. Replaced UltraShift gearbox oil and filter.	
15/08/2022	686,193 kms	B - 20k S-4600	Tripodi
30/06/2022	665,138 kms	C - 100k/Annual S-4497	Tripodi
		1. Drive belt signs of wear. 2. Signs of minor exhaust leak at manifold. 3. Steer brake soon. 4. Torque rod bushes signs of wear. 5. Oil leak at front cover on 1st drive diff. 6. Bonnet rubbing on intercooler. 7. Driver side mirror broken/cracked (motomirror). 8. n/s top hat valve leaking 9. electrical line dragging on rd 10. o/s engine mount cracked	
29/06/2022	665,138 kms 13,261 hrs	Bonnet, Brakes, Diff Oil Leak, Drive belt, Spotter mirror, Suspension R-5857	Tripodi
		1. Check as serviceable Ben. 2. Ordered parts and will schedule in job. Still serviceable. 3. Next service. ben 4. Still serviceable. ben. 5. Removed cover. Cleaned and resealed. GSC 6. Adjusted intercooler. BM/AM. 7. Fit new mirror as required. BM	
28/05/2022	651,164 kms	B - 20k S-4418	Tripodi
		1. Front engine mounts worn. Next service 2. Rear engine mounts cracks. Next service 3. Half pyro/tacho gauge lights not working 4. Rear diff temp gauge light not working. 5. 1st drive input yoke nut loose. 6. A2 brakes low. 7. A3 n/s lower shock mount bush washer damaged and bush worn. 8. Diff oil weep at 2nd drive diff head to housing. Degrease and will monitor 9. A2 diff drain plug oil weep. Resealed. Checked oil level. Ok 10. Removed BURY phone from cab. 11. Wiper blades not clearing screen 12. Replaced engine oil/fuel/air. 13. A2 s-cam bushes slight play. Monitor. GSC/Ben/AM	
28/05/2022		Bonnet, Brakes, Diff Oil Leak, Driveline, Engine/Gearbox mount, Gauge lights, Wipers R-5785	Tripodi
		1. Next service. Ben 2. Next service. Ben 3. Fit new globes. Ben. 4. Fit new globe. Ben. 5. Fit new nut kit to yoke,. Used new tailshaft uni mount bolts. Ben 6. Removed brakes. Cleaned and inspect. Fit new brake shoe kits. Ben/GSC. 7. Removed lower shock mount bushes/washers. Fit new washer and good bushes as required. AM. 8. Degreased and will monitor. 9. Resealed plug. Checked oil level. Ok. GSC 10. Removed as required. Ben. 11. Fit new wiper blades. Ben 12. N/S bonnet strut internal fault/damaged/worn. Fit new bonnet strut to n/s. GSC 13. Carried out service.	
09/05/2022	641,324 kms 12,832 hrs	Alternator, Drive belt R-5739	Tripodi
		travelled to truck. Fit new alternator and drive belt as required. Had to use new pulley.	
28/03/2022	626,500 kms	B - 20k S-4269	Tripodi
		GSC/BM	
28/03/2022	626,500 kms	A - 10k S-4256	Tripodi

Date	Reading / Units	Type / Repairer Notes	Repairer
01/03/2022	623,347 kms	A - 10k S-4204 1. Engine valve adjust almost due. 2. Truck needed a jump start yesterday. Inspect batteries/cables/charge. 3. Alt/fan belt worn/noisy.	Tripodi
01/03/2022	629,347 kms 6,377 hrs	Battery, Drive belt, Engine Valve Adjustment R-5603 1. Carried out engine valve train inspection/adjustment. BM/Ben 2. Batteries and check all connections. Checks okay. BM/Ben. 3. Fit new belt as required. BM 4. Pyro sender faulty. Fit new sender unit. 5. Wiring plug at buzzer and harness corroded/damaged. Fit new DT connector assembly. BM/Ben	Tripodi
17/02/2022	618,556 kms	B - 20k S-4180 1. Replaced engine oil/fuel/air. 2 .Replaced diff/drive hub/steer hub. BM/AM/Ben	Tripodi
10/01/2022	601,990 kms	B - 20k S-4076	Tripodi
21/11/2021		Fault report, Hoist , Hydraulics, Trailer Drawbar R-5428 1. had to replace tipper duel spool valve (internal fault). replaced hydraulic oil too. 2 .Straighten as required.	Tripodi
10/11/2021	583,010 kms 11,728 hrs	Cab, Engine Check Light R-5408 1. Topped up coolant. Tightened loose hose clamp at heater tap. Cleared codes. Checks okay. 2. Fit new rocker button to switch.	Tripodi
10/11/2021	583,010 kms	B - 20k S-3957 1. Engine check/stop light has been coming on and off most of the day 2. Weight gauge power switch fallen off. 3. Replaced engine oil/fuel/air. 4. Ringfeeder: Coupling bolt bulge OD: 47.77mm, Coupling bolt lower OD: 34.73mm, Lower bush ID: 35.20mm, Axial: 2.5mm, Wear plate: 1mm. 5. Replaced steer hub oil. Gavin/ALex	Tripodi
20/09/2021	559,740 kms	Fault report, Lights R-5257 Fit new globe as required. Phil	Tripodi
17/09/2021	559,007 kms 11,312 hrs	Lights R-5254 Fit new globe.	Tripodi
17/09/2021	559,007 kms	B - 20k S-3815 1. Tightened loose lower crossmember bolts.' 2. 1st drive pinion seal weep. Next service. 3. Cracks in rear engine mounts. Next service. 4. N/S park light not working. Gavin	Tripodi
06/09/2021	554,004 kms 11,232 hrs	Engine Check Light R-5189 Repaired wiring harness as required. Cleared codes. Roadtested okay..	Tripodi
23/08/2021	547,241 kms 11,133 hrs	Exhaust, Warning/Indicator Light R-5167 1. fit new globes as required. (Phil) 2. Tightened loose u-bolt clamp as required. (Gavin)	Tripodi
23/08/2021	547,241 kms	A - 10k S-3773 1. Cruise and engine brake indicator lights not working. 2. Turbo exhaust dump pipe mount bracket loose. 3. O/S light protector cover damaged. Ordered new ones. 4. Oil weep at 1st drive input yoke. Next service. Phil/Gavin	Tripodi
18/08/2021	545,322 kms 11,104 hrs	Fault report, Gauge, Lights R-5158 1. Gauge was on 60sec delay mode. Switched back to 1 sec and showed driver. 2. Fit new globe as required.	Tripodi
05/08/2021	540,412 kms	B - 20k S-3731 1. Coolant sight glass has been replaced by a plug? 2. Wiper arms pivots excess wear/not clearing windscreen 3. Charge air hose at O/S intercooler connection is very fatigued. 4. A2 brakes low 5. Topped up engine oil. 6. Re-secured number plate. 7. Tensioned tarp motor drive chain. 8. Tightened loose/weeping hydraulic coupling fitting. 9. Tightened loose A2 drive shock mount nut. 10. Ringfeeder: Coupling bolt bulge OD: 47.77mm, Coupling bolt lower OD: 34.83mm, Lower bush ID: 34.97mm, Axial: 3mm, Wear plate: 1mm. John/Phil	Tripodi
05/08/2021	540,412 kms 11,025 hrs	Brakes, Cooling System, Intercooler, Wipers R-5117	Tripodi

Date	Reading / Units	Type / Repairer Notes	Repairer
		1. Fit new sight glass as required. Topped up coolant. (John) 2. Fit new wiper arms to both sides. Driver side wiper arm spindle damaged upon removal. Fit new spindle/spline sleeve and spindle nut. (Phil) 3. Fit new hose as required. (John) 4. Removed brakes. Clean and inspect. Fit new brake shoe kits only. Drums check okay. (Phil)	
16/07/2021		Aftertreatment Warning light R-5080 Cleaned both fuel tank breathers. Cleared codes. Road-tested okay. Ben	Tripodi
14/07/2021	534,641 kms 10,925 hrs	air leaks, COOLANT LEAKS, Drive belt, Gearbox R-5045 1. Found oil leak at X-Y shifter. Cleaned all electrical plugs/wiring harness. Cleared codes. Road test okay. Will monitor. 2. Fit new a/c belt as required. (Gavin) 3. Removed leaking fittings from go-through block. Drilled out as required. Fit new 1/4" straight joiner. Refit components removed. Checks okay. Fit new air supply fitting at Horton fan air filter also. 4. Tighten clamps. Top up coolant. Pressure check system. Checks okay. (Gavin)	Tripodi
14/07/2021	534,089 kms 10,917 hrs	Aftertreatment Warning light R-5042 Fit new NOX sensor as required. Clear codes. Road test. Checks okay.	Tripodi
12/07/2021	534,089 kms	A - 10k S-3681 1. Fault report as per R-5041 2. Aftertreatment light on as per R-5042 Graham.	Tripodi
12/07/2021	10,917 kms 534,089 hrs	Fault report, Steering, Wipers R-5041 1. Pat road tested, said not bad. Did tyre rotation. Will monitor.' 2. Fit new wiper blades as required. (Graham)	Tripodi
28/06/2021	529,145 kms	C - Annual S-3636 1. Replaced diff/drive hub/steer hub oils. 2. Replaced engine oil/fuel/air. 3. Fit air dryer filter service kit. 4. Headlight covers damaged. 5. Tightened loose drive shock mount nuts. 6. Carried out C-service as per sheet. 7. Air spring bellow damaged at A3 n/s rear as per 8. Ringfeeder: Pin Bulge OD: 47.22mm, Lower pin OD: 34.88mm, Lower bush ID: 35.28mm, Axial: 3mm, Wear plate 1mm. Gavin/Graham	Tripodi
21/05/2021		B - 20k S-3551 1. Topped up engine oil. 2. Replaced cabin filter. 3. Fit new type wheel nut indicators. Graham/John	Tripodi
26/04/2021	499,769 kms 10,287 hrs	Suspension R-4741 Fit new bushes to A2 n/s upper torque rod. Used new nyloc nuts on mount bolts. Fit new A2 drive shock absorbers. gavin	Tripodi
26/04/2021	499,769 kms	A - 10k S-3452 1. Replaced engine oil/fuel/air. 2. A2 n/s upper torque rod bush worn as per R-4741 3. A2 drive shocks poor operation as per R-4741 4. Headlight protectors have cracks. 5. A3 brakes next service. Gavin	Tripodi
08/04/2021	492,219 kms	B - 20k S-3404 1. Upper torque rod bushes soon. 2. Oil weep at A2 diff head to housing. John/Graham/Gavin	Tripodi
15/03/2021	483,559 kms	A - 10k S-3352 Graham	Tripodi
12/03/2021	471,356 kms 10,048 hrs	AdBlue, Belt tensioner, Compressor, Engine brake, Engine Valve Adjustment, Water Pump R-4678 Cummins Wetherill Park carried out MIDLIFE as per attached invoice. (TURBOCHARGER was not replaced due to CUMMINS worldwide shortage). CUMMINS have acknowledged truck was returned for MIDLIFE and will notify us when turbochargers is available for replacement or if Turbo failure occurs they will cover it. NOTE: CUMMINS have a turbocharger shortage on at time of service. Turbocharger was not replaced due to this. CUMMINS have inspected Turbocharger as serviceable for now. When Turbocharger becomes available they will fit new one at reduced cost as per March 2021 special.	Cummins Wetherill Park
16/02/2021	472,444 kms 9,778 hrs	Gauge lights R-4512 Fit new gauge light globes as required.	Tripodi
15/02/2021	472,444 kms	B - 20k S-3261	Tripodi

Date	Reading / Units	Type / Repairer Notes	Repairer
		1. replaced engine oil/fuel/air. Next due 10300hrs. 2. Tightened loose bonnet mirror. 3. Tighten loose exhaust flex pipe clamp. 4. Headlight shields damaged. 5. Gauge lights not working as per R-4512. 6. Fit new chrome cover to n/s headlight as it was broken. 7. Fit new cabin filter. Graham/Leigh	
29/01/2021	465,338 kms 9,646 hrs	Starter Motor, Steering R-4420	Tripodi
		1. Fit new king pin kit to N/S as required. 2. Tighten connections as required. Checks okay.	
27/01/2021		Windscreen R-4345	Tripodi
		Had SWAG (South West Auto Glass) replace as required.	
25/01/2021	448,091 kms	B - 20k S-3194	Tripodi
		1. Bellow damaged on A3 n/s air spring. 2. Play in N/S king pin. 3. A/C compressor noisy. Will monitor. 4. Ringfeeder: Bolt dia: 48.45mm, Lower bolt dia: 34.89mm, Lower bush ID: 35.34mm, Axial: 3mm, Wear plate 1mm. Graham/Leigh	
22/01/2021	464,091 kms 9,618 hrs	Windscreen R-4399	Tripodi
		Refit dash cam with new double sided tape. Graham	
18/01/2021	461,676 kms	FAULT REPORT R-4464	
		OPERATION CHECK OK, REFIT AS REQUIRED	
11/01/2021	458,433 kms	FAULT REPORT R-4332	
		RESECURED DASH CAM ORGANISED WINDSCREEN REPLACEMENT CHECKED AND REPAIRED INACTIVE FAULT CODES	
24/12/2020	457,675 kms 9,496 hrs	Aftertreatment Warning light R-4310	Tripodi
		Checked doser pump supply inline filter. Found to be dirty. Was able to clean/refit. Carried out air side flush of doser as required. Removed Adblue injector. Found to have Adblue crystallization blocking couple of holes. Cleaned as required and refit. Cleared all fault codes. Checks okay.	
17/12/2020	454,758 kms	A - 10k S-3125	Tripodi
		1. Oil weep at top of gearbox. 2. Cabin filter cover damaged. Fit new one as required. Fit new cab filter also. 3. N/S kingpin developing play. 4. Torque rod bushes developing wear. Leigh/Graham	
18/11/2020	439,799 kms	B - 20k S-3044	Tripodi
		1. Replaced engine oil/fuel/air. 2. Replaced diff/steer hub oils/filter. 3. Next oil/fuel/air 9700hrs.	
09/11/2020	434,110 kms 9,081 hrs	air leaks, Brakes R-4123	Tripodi
		Fit new brake booster to A2 n/s as required. Check operation/leaks. Checks okay.	
26/10/2020	427,825 kms 8,978 hrs	Gearbox, Tech repair R-4069	Tripodi
		Carried out software upgrade from 059 to 065 TECU. Found code 71 would not go away but no fault evident. Found value in configuration OPTION for ACTIVE FAULT, DEFAULT and one other value. Was set at ACTIVE FAULT. Changed to DEFAULT and code 71 went inactive.	
20/10/2020	425,499 kms	A - 10k S-2963	Tripodi
28/09/2020	416,007 kms	B - 20k S-2920	Tripodi
		1. Coolant filter leaking. Fit new filter as required. (Leigh).	
03/09/2020		Cab R-3886	Tripodi
		Had to borrow from BX35NP as it was in workshop for repairs. Checks okay. Ordered new one.	
27/08/2020	402,215 kms 8,513 hrs	Suspension R-3863	Tripodi
		Fit new shocks to both sides of A3 as required. Graham/Leigh	
27/08/2020	402,215 kms 8,513 hrs	Mudflap R-3864	Tripodi

Date	Reading / Units	Type / Repairer Notes	Repairer
		Straighten as required. Leigh	
27/08/2020	402,215 kms	B - 20k S-2843 1. A3 shock absorber leaking as per R-3863. 2. Coolant sight glass missing. 27/08/2020.?? 3 .Straighten rear mudflap bracket as per R-3864.	Tripodi
11/08/2020	396,338 kms	A - 10k S-2794	Tripodi
30/07/2020	392,072 kms	A - 10k S-2769 1. Air leak with park brake released as per R-3717.	Tripodi
30/07/2020	392,072 kms 8,326 hrs	air leaks, Brakes R-3717 Fit new brake booster as required. Leigh	Tripodi
20/07/2020	377,797 kms 8,277 hrs	Engine Valve Adjustment R-3792 Cummins carried out as required.	Cummins
20/07/2020	377,797 kms 8,277 hrs	COOLANT LEAKS, Engine Oil Leak R-3793 1. Cummins repair under warranty 2. Cummins repaired under warranty.	Cummins
16/07/2020	387,092 kms 8,227 hrs	Engine R-3666 Fit new Horton fan rebuild kit as required. Fit new Horton filter assembly. Fit new drive belt tensioner assemblies. Fit new a/c idler pulley bearing. Leigh	Tripodi
27/06/2020	380,916 kms	C - Annual S-2690 1. Replaced power steer oil and filter. Fit new reservoir cap nut seal. 2. Replaced air/oil separator filter. 3. Replaced in-tank ad-blue filter. 4. Reconditioned air dryer assembly. 5. Fit new D2 governor valve. 6. Replaced coolant filter. 7. Replaced steer axle hub oil. 8.Topped up engine oil. 9. A3 brakes next service. 27/06/20. 10. A3 air spring has a tear. 27/06/20. 11. Oil weeps at 1st and 2nd drive diff heads. 27/06/20 12. Replaced cabin filter Leigh/Graham	Tripodi
10/06/2020	373,108 kms 7,957 hrs	Gauge R-3493 Fit new pyro sender unit as required.	Tripodi
10/06/2020	373,108 kms 7,957 hrs	COOLANT LEAKS R-3492 Tensioned hose clamps. Topped up coolant . Degreased engine. Ran engine to operating temp.Checks okay.	Tripodi
03/06/2020	370,657 kms 7,908 hrs	COOLANT LEAKS R-3469 Fit new heater tap module as required. Leigh	Tripodi
03/06/2020	370,657 kms	B - 20k S-2624 1. O/S park light and cruise control indicator light not working not working as per R-3468. 2. Heater tap module cracked/leaking coolant as per R-3469. 3. Exhaust flex pipe under gearbox leaking/loose clamp as per R-3470. 4. Fit new ASA to drive axle as per R3471. 5. Replaced engine oil/fuel/air. 6. Horton fan clutch lining very low. 03/06/20.	Tripodi
03/06/2020	370,657 kms 7,908 hrs	Brakes R-3471 Fit new Automatic brake slack adjusters to drive axles as required.	Tripodi
03/06/2020	370,657 kms 7,908 hrs	Lights R-3468 Fit new globes as required.	Tripodi
03/06/2020	3,706,567 kms 7,908 hrs	Exhaust R-3470 Fit new clamp as required. Graham	Tripodi

Date	Reading / Units	Type / Repairer Notes	Repairer
21/05/2020	363,012 kms 7,773 hrs	Gearbox R-3381 Carried out upgrade as required. (059) software fitted.	Tripodi
20/05/2020	364,258 kms 7,798 hrs	Brakes R-3404 Removed brake components. Clean and inspect as required. Fit new brake shoe kits and brake drums.	Tripodi
18/05/2020	363,012 kms 7,773 hrs	Warning/Indicator Light R-3382 Fit new globe as required.	Tripodi
18/05/2020	363,012 kms	B - 20k S-2581 1. Ultrashift software upgrade available as per R-3381. 2. Oil weep at top of gearbox. Still not repaired from Warranty clutch replace. 3. Coolant weep at rear of water pump. 4. A2 pinion weep. 5. A2 brakes getting low. 6. Engine brake indicator light not working as per R-3382.	Tripodi
07/05/2020	358,242 kms 7,685 hrs	Engine Check Light R-3339 Went through insite diagnosis procedure. Found air actuator working but very poor flow through doser pump. Carried out air side flush of adblue doser pump/supply hose/injector several times. Flow got better. Carried out several times more and air supply now good. Code now inactive. Cleared codes and roadtested. Checks okay.	Tripodi
04/05/2020	356,625 kms 7,653 hrs	Engine Check Light, Fault report, Lights R-3319 1. Fit new headlight globe. 2. No active codes present. Had an inactive code for air solenoid on doser pump. Unable to fault at time of inspection.	Tripodi
16/04/2020	348,263 kms	B - 20k S-2494 1. Replaced gearbox oil and filter. 2. Replaced diff/drive hub and steer axle hub oil. 3. Topped up engine oil. 4. Exhaust flex pipe leaking/damaged as per R-3218. 5. Fit new wiper blades.	Tripodi
16/04/2020	348,263 kms 7,505 hrs	Exhaust R-3218 Fit new improved exhaust flex pipe. Lee	Tripodi
07/04/2020	345,759 kms	A - 10k S-2464 1. N/S park light not working as per R-3173. Emily/Graham	Tripodi
07/04/2020	345,759 kms 7,460 hrs	Lights R-3173 Fit new globe as required.	Tripodi
16/03/2020	335,922 kms	B - 20k S-2408 1. Replaced engine oil/fuel/air. 2. Replaced cabin filter. 3. Ringfeeder pin wear near maximum as per R-3066.	Tripodi
16/03/2020	335,922 kms 7,276 hrs	Tech repair R-3066 Fit new Ringfeeder rebuild kit as required. Ben.	Tripodi
12/03/2020	334,692 kms	Fault report R-3061 Just a service indicator. Serviced/greased 17th March, 2020. Reset GI as required.	Tripodi
11/03/2020	334,004 kms 7,238 hrs	Fault report, Lights R-3051 Fit new headlight globe as required.	Tripodi
04/02/2020	319,696 kms	A - 10k S-2303	Tripodi
29/01/2020	317,149 kms	B - 20k S-2283	Tripodi
23/01/2020	315,741 kms	Cab, Fault report R-2890 Fit new double sided tape and remounted as required.	Tripodi

Date	Reading / Units	Type / Repairer Notes	Repairer
06/01/2020		A - 10k S-2212 1. Replaced steer axle hub oil. 2. Coolant leak at lower engine heater hose tap as per R-2746	
06/01/2020	6,720 kms 308,490 hrs	COOLANT LEAKS R-2746 Fit new tap as required. Topped up coolant.	Tripodi
16/12/2019	301,675 kms 6,673 hrs	air leaks R-2698 Fit new hoses as required. graham/Lee	Tripodi
16/12/2019	301,675 kms	B - 20k S-2175 1. Replaced oil/fuel/air. 2. Lower heater hose tap weeping. 3. Adjusted hoist alarm switch. 4. Oil weep at g/box x-y shifter. 5. D2 governor valve hoses leaking air/porous as per R-2698.	Tripodi
13/12/2019	305,769 kms 6,653 hrs	Air, Fault report R-2694 Fit new D2 governor valve as required. Checks good.	Tripodi
27/11/2019	299,233 kms	A - 10k S-2113 1. Minor coolant weep at lower engine heater hose tap. Will monitor.	Tripodi
05/11/2019	290,274 kms	A - 10k S-2036	Tripodi
05/11/2019	290,273 kms 6,327 hrs	Tech repair R-2535 Had to load older software 995 back in as 057 wont be fixed until approx April next year according to Adam Bell at Eaton.	Tripodi
23/10/2019	285,746 kms	Fault report R-2479 was able to cut off damaged section of hose and refit to booster. Check operation/leaks. ' Checks okay.	Tripodi
14/10/2019	289,700 kms 6,150 hrs	Driveline R-2451 Fit new yoke nut washer kit. Used new tailshaft mount bolts. Graham.	Tripodi
14/10/2019	281,957 kms 6,150 hrs	Tech repair R-2450 Re-tensioned mount bolts. Cleaned as required.	Tripodi
14/10/2019	281,957 kms	B - 20k S-1961 1. Coolant leak back of w/pump. 2. Oil leak at PTO as per R-2450. 3. Bonnet rubbing on intercooler. Adjusted intercooler mount as required. 4. 1st drive input yoke nut loose as per R-2451. 5. Cleaned cabin filter. 6. Horton clutch low. Just over 4mm. 7. Cleaned intake manifold pressure/temp sensor. 8. Topped up engine oil 2.5L.	Tripodi
10/10/2019	281,361 kms	Fault report R-2454 Code 71: Unable to disengage gear. If this code was accurate the truck would not be able to drive. Appears to be a software fault. Have sent Service Activity Report to Eaton through Service Ranger 4. Have spoken to Adam Bell at Eaton. Now waiting on Eaton engineers to review fault. Eaton say truck still serviceable for now.	Tripodi
17/09/2019	273,575 kms 5,963 hrs	Tech repair R-2366 1. Fit new set of wipers. 2. Thoroughly cleaned coupling. Fit new hydraulic coupling boot.	Tripodi
16/09/2019	273,575 kms	B - 20k S-1899 1. Replaced engine oil/fuel/air. 2. Replaced diff/drive hub and steer axle oils and filter.	Tripodi
22/08/2019	263,900 kms 5,780 hrs	Fault report R-2275 1. Fit new CB hand piece. Check operation. Checks okay. 2. Fit new D2 governor valve. Check operation. Checks okay.	Tripodi
12/08/2019	259,650 kms 5,692 hrs	Driveline R-2254 Carry out updates as required.	Tripodi

Date	Reading / Units	Type / Repairer Notes	Repairer
07/08/2019	257,871 kms	Fault report R-2206 repaired wiring as required.	Tripodi
31/07/2019	255,197 kms	Fault report R-2193 Found no refrigerant to recover. Fit new service port valves. Fit new receiver-dryer. Carry out re-gas as required. (L115841) Checks okay.	Tripodi
23/07/2019	251,482 kms 5,529 hrs	COOLANT LEAKS R-2171 Fit new top engine heater hose tap.n Top up coolant and fit new radiator pressure cap. Washed engine.	Tripodi
23/07/2019	251,482 kms 5,529 hrs	Tech repair R-2170 Carry out software and configuration upgrade to Ultrashift.	Tripodi
22/07/2019	250,918 kms	Fault report R-2188 Requires further inspection.	Tripodi
15/07/2019	248,294 kms 5,465 hrs	Brakes R-2132 Removed worn brake shoes as required. Clean and inspect all components. Fit new brake shoe kits and brake drums as required.	Tripodi
15/07/2019	248,294 kms 5,465 hrs	Driveline R-2133 1. Fit new bolt/nut to p-clamps at sides of gearbox. Had no bolts fitted. Wiring hoses where insecure. 2. Fuel hose connections loose at junction under gearbox. Tightened as required. Washed down as required from leaking fuel. 3. Excess oil at top of gearbox near X-Y shifter. Washed and will monitor.	Tripodi
15/07/2019	248,294 kms	A - 10k S-1721 1. A3 brake linings low as per repair R-2132. 2. Fuel/oil leak as per repair R-2133. 3. Hoses wiring insecure as per repair R-2133.	Tripodi
12/07/2019	248,285 kms 5,464 hrs	HOTSET TUNE UP R-2125 Adjust valves as required. Fit new rocker cover gasket. Emily	Tripodi
17/06/2019	241,720 kms 5,327 hrs	Suspension R-2043 Fit new shock absorbers to A2 as required.	Tripodi
17/06/2019	241,720 kms 5,327 hrs	Driveline R-2046 Went over all gearbox wiring plugs. Found all plugs contaminated by excess dirt. Connections had been compromised when gearbox was removed for clutch replacement at Gilbert and Roach. Thoroughly cleaned all connections as required. Also found wiring had been cable tied with excess tension and sharp angles on wiring. Secured all wiring correctly. Had to remove lower cab side cover to access top of gearbox. Also appears to have oil leak at x-y shifter to box. Also looks like from when gearbox was removed. Will have to see how it goes now.	Tripodi
17/06/2019	241,720 kms 5,327 hrs	Steering R-2044 Remove and inspect wheel bearings. Checked as serviceable. Refit and adjust as required. Used new hub nut lock washer. Used new hub cover gasket and fill with new oil.	Tripodi
17/06/2019	241,720 kms 5,327 hrs	Suspension R-2042 Fit new bushes to A2 and A3 upper torque rods. Fit new nyloc nuts to mount bolts.	Tripodi
17/06/2019	241,720 kms	C - Annual S-1635 1. Replaced coolant filter. 2. Replaced power steer oil and filter. 3. Replaced air/oil separator filter. 4. Replaced air dryer filter kit. 5. Replaced Adblue in-tank filter. 6. A2 and A3 upper torque rod bushes worn as per repair R-2042. 7. O/S A2 shock absorber leaking oil as per repair R-2043. 8. Steer axle N/S wheel bearing has play as per repair R-2044. 9. Gearbox still has intermittent fault with getting stuck in gear and fault codes (27, 64, 71) as per repair R-2046	Tripodi

Date	Reading / Units	Type / Repairer Notes	Repairer
13/06/2019	241,088 kms	B - 20k S-1629	Tripodi
13/06/2019	241,088 kms	A - 10k S-1627	Tripodi
11/06/2019	239,961 kms 5,296 hrs	Fault report R-2027 1. Code came up approx a week after Gilbert and Roach fitted new clutch and ECA. Found at time the release bearing to be excessively dry. Carried out release bearing grease as per Eaton requirement. Gears went okay for a week but have come back. Thoroughly greased again. Drove vehicle a couple of times and repeated grease steps. Drove truck. Gears are okay at time of inspection. Noticed: 1. Clutch fork roller not rolling/seized. 2. Initial inspection found large gap between bearing and clutch fork at times (like pressure plate getting stuck. Did not notice this occurring after greasing. See how it goes tomorrow. Booked in at Gilbert and Roach for Wednesday morning. 2. Adjusted tarp cables as required.	Tripodi
22/05/2019	233,252 kms 5,151 hrs	COOLANT LEAKS R-1952 Removed coolant transfer pipe and connection block. Cleaned/inspected parts as required. Flushed cooling system. Fit new o-rings/seals to coolant transfer pipe and connection block. Fit new coolant filter and fill with new coolant. Pressure check system. Checks okay.	Tripodi
22/05/2019	233,252 kms 5,151 hrs	Engine R-1953 Fit new set of batteries. Cleaned all terminals. Applied terminal protector. Checks okay	Tripodi
22/05/2019	233,252 kms 5,151 hrs	Exhaust R-1955 Fit new mount rubbers as required.	Tripodi
15/05/2019	231,073 kms	A - 10k S-1508 1. Clutch was just replaced at Gilbert and Roach Huntingwood, found clutch release bearing very dry. Ran through grease procedure as per EATON Bulletin: TR187. Had issue today with gearshifting. Had fault codes 27, 42,67 as Inactive and code 27 as Active. Cleared all codes and roadtested. Drove okay. Will have to monitor. 2. Coolant leak at water transfer pipe O/S of engine. Will need repair tomorrow. 3. Batteries load testing as fair/poor. Needs new batteries.	Tripodi
14/05/2019	230,747 kms 5,098 hrs	air leaks R-1916 Fit new longer length 1/4" air hose and secured as required. Check for leaks. Checks okay.	Tripodi
14/05/2019	230,747 kms 5,098 hrs	COOLANT LEAKS R-1917 Cleaned as required. Topped up cooling system. Order parts for repair tomorrow, but will check with warranty.	Tripodi
18/04/2019	224,711 kms 4,964 hrs	TECH REPAIR R-2009 FAULT CODE 21	
25/03/2019	153,483 kms	B - 20k S-1474 LOWER TORQUE RODS SIGNS OF WEAR UPPER TORQUE RODS SIGN OF WEAR TD64KE GRAIN SHOOT HANDLE BENT	Tripodi
19/02/2019	203,460 kms	A - 10k S-1328	Tripodi
19/02/2019	203,460 kms 4,474 hrs	Repairs R-1516 Fit new mudflap as required.	Tripodi
24/01/2019	4,280 kms	A - 10k S-1265	Tripodi
21/01/2019	194,243 kms 4,245 hrs	Lights R-1418 Fit new globe to N/S headlight. Checks ok.	Tripodi
21/01/2019	194,243 kms	A - 10k S-1257	Tripodi

Date	Reading / Units	Type / Repairer Notes	Repairer
21/01/2019	194,243 kms 4,245 hrs	Gauge lights R-1417 Fit new gauge globe as required. Checks ok.	Tripodi
15/11/2018	174,694 kms	A - 10k S-78	
24/10/2018	167,184 kms	B - 20k S-81	
08/10/2018	162,513 kms	A - 10k S-77	
08/10/2018	162,513 kms 3,535 hrs	TECH REPAIR R-97 1. FIT FIRE EXTINGUISHER 2. FIT DOOR SPOT MIRROR (TOP OF DOOR FACING DOWN)	
08/10/2018	162,503 kms	Pink Slip I-41 Pink slip	
28/09/2018	160,999 kms 3,503 hrs	R-1286 1. Dash light not working 2. Bonnet rubbing on intercooler 3. Engine slot to crank 1. Fit new globes to rear aur gauge , front diff oil temp , pyrometer, fit new globe to cruise control 2. Adjusted radiator to come back repainter inter cooler 3. Retension	
28/09/2018	160,999 kms	A - 10k S-1127 A service	
01/09/2018	152,390 kms	A - 10k S-1098 A service	
14/08/2018	146,293 kms	B - 20k S-1073 B service	
19/07/2018	137,377 kms	A - 10k S-1044 A service	
28/06/2018	131,394 kms	C - Annual S-1019 C service	
21/06/2018	129,220 kms 2,802 hrs	R-1013 Driver side windscreen damaged - had windscreen replaced	
13/06/2018		Registration O-65	RMS - Rego
04/06/2018	123,695 kms	B - 20k S-1000 B service	
17/05/2018	117,813 kms	A - 10k S-986 A Service drain & replace differential oils	
24/04/2018	109,003 kms 2,378 hrs	R-811 Holcim A service. Consumables & Labour	
24/04/2018	109,003 kms	A - 10k S-957 Holcim A service. Consumables & Labour	
24/04/2018	109,003 kms	A - 10k S-958 A service	
03/04/2018	101,292 kms	A - 10k S-934 A service	

Date	Reading / Units	Type / Repairer Notes	Repairer
19/03/2018	96,682 kms	B - 20k S-917 B service	
14/03/2018		HOTSET TUNE UP R-2047	CUMMINS SOUTH PACIFIC
01/03/2018	116,387 kms	ROCKER LEVER CAMPAIGN R-2049	CUMMINS SOUTH PACIFIC
01/03/2018		Rocker Leavers R-1578 Replaced DLC Rocker Levers	Cummins
27/02/2018	89,472 kms	A - 10k S-887 A service	
22/02/2018	88,529 kms	R-728 Chip in drivers side window - Jennings02/03	
12/02/2018	84,027 kms 1,838 hrs	R-724 RHF headlight out, headlight globe, replaced headlight globe	
10/02/2018	84,027 kms	A - 10k S-861 A service	
18/01/2018	76,691 kms	A - 10k S-839 A service	
04/01/2018	70,374 kms	A - 10k S-819 A service	
18/12/2017	68,774 kms	B - 20k S-806 B service	
06/12/2017	64,677 kms	A - 10k S-794 A service	
15/11/2017	56,375 kms	A - 10k S-761 A service - \$290.00 consumables	
09/11/2017	51,500 kms	R-666 1. air leak worn hose, that operates tailgate on dog 2. Heater tap burst 3 . Spring on apssnger side trio coupling broken - 1. Changed trio coupling hoses 2. Chnaged heater tap 3. Cahnged trio coupling	
30/10/2017	50,516 kms	A - 10k S-732 A service	
16/10/2017	45,564 kms	B - 20k S-712 B service	
29/09/2017	4,832 kms	A - 10k S-693 A service	
19/09/2017	37,193 kms	A - 10k S-674 A service	
12/09/2017	33,140 kms 697 hrs	R-612 Booster fitting on PSR of dog snapped - replaced fitting	
04/09/2017	30,400 kms	A - 10k S-657 A service	

Date	Reading / Units	Type / Repairer Notes	Repairer
30/08/2017	29,362 kms 622 hrs	R-597 Fit up for Holcim - 1 x bonnet mirror, 1 x emergency hammer, 1 x new exh stack - Fitted bonnet mirror and adj,	
18/08/2017	24,389 kms	A - 10k S-634 A service	
28/07/2017	16,111 kms	A - 10k S-599 A service	
25/07/2017	15,002 kms	A - 10k S-593 A service	
24/07/2017	14,936 kms	A - 10k S-591 A service	
22/07/2017	14,293 kms	R-541 Steering pulls to left, to keep in a straight line you have to constantly steer to right if you let go of wheel it veers left straight away - steering issue rectified	
23/06/2017	2,640 kms	R-505 Air laek from weight gauges in truck front tarp still not working right, hoist on both units slow to start going - truck losing air to leak - air leak repaired front tarp , both hoists OK	
06/04/2017	7,740 kms	A - 10k S-448 A service	

Signed: _____
Name: _____
Date: _____