

# North Western Welding Ltd.

Box 1423  
Beaverlodge AB T0H 0C0  
northwesternweldingltd@gmail.com  
GST/HST Registration No.: 781147426RT0001

## INVOICE

BILL TO  
PVT Group  
93-721071 RR 53  
County of Grande Prairie  
Alberta T8X 0N4

INVOICE 1075  
DATE 06/07/2025  
TERMS Net 60  
DUE DATE 04/09/2025

PO NUMBER  
65550

ACTIVITY	DESCRIPTION	QTY	RATE	AMOUNT
Welding	(C1131) Repaired collapsed plumping on side of tank. Cut out pipe, fittings, and mounts. Cleaned up joints and mounts to be reused. Measured and cut pipe to size. Fit and tacked pipe to ensure proper alignment. Welded and tested with dye penetrant	8	100.00	800.00
Material	13ft 6in pipe 1/16in	1	453.37	453.37
Travel		1	100.00	100.00

---

SUBTOTAL	1,353.37
GST @ 5%	67.67
TOTAL	1,421.04

---

BALANCE DUE **\$1,421.04**

### TAX SUMMARY

	RATE	TAX	NET
GST @ 5%		67.67	1,353.37

# North Western Welding Ltd.

Box 1423  
Beaverlodge AB T0H 0C0  
northwesternweldingltd@gmail.com  
GST/HST Registration No.: 781147426RT0001

## INVOICE

BILL TO  
PVT Group  
93-721071 RR 53  
County of Grande Prairie  
Alberta T8X 0N4

INVOICE 1108  
DATE 14/09/2025  
TERMS Net 60  
DUE DATE 13/11/2025

PO NUMBER  
Need PO

ACTIVITY	DESCRIPTION	QTY	RATE	AMOUNT
Welding	(C1131) Repaired leaking sump. Cut off pipe exiting the bottom of the sump. Cut off flange from pipe to be reused. Cleaned and prepped flange. Cleaned and prepped surface of sump to be welded. Measured and cut pipe to size. Fit and welded flange to pipe. Fit and welded spool to sump. Cleaned welds. Repaired leaking on pipe exiting rear door of vac truck. Cut off pipe and removed flange from pipe to be reused. Cleaned and prepped flange. Cut out candy cane to access inside of pipe. Cleaned and prepped candy cane to be welded back in place. Cleaned and prepped surfaces of door to have pipe welded back in. Measured and cut pipe to length. Fit and welded flange to pipe. Fit and welded spool to rear door. Inside and outside. Fit and welded candy cane back in place.	16	100.00	1,600.00
Travel		2	100.00	200.00
SUBTOTAL				1,800.00
GST @ 5%				90.00
TOTAL				1,890.00
BALANCE DUE				<b>\$1,890.00</b>

### TAX SUMMARY

	RATE	TAX	NET
GST @ 5%		90.00	1,800.00

**Pro-Ex Equipment Repairs Ltd**  
 15415 89 street  
 Grande Prairie, AB T8V 0V7, CA  
 office@pro-ex.ca  
 (780) 532-7659



**Invoice: INV-2208**  
**Date: 6/27/2023**

**Bill To**  
 PVT Energy Group  
 65021 HWY 43  
 Grande Prairie, AB T8W 5E7, CA

**Remit Payment To**  
 Pro-Ex Equipment Repairs  
 15415 89 street  
 Grande Prairie, AB T8V 0V7, CA

Service Order	Terms	Due Date	Authorizer	Customer PO	Unit #
SO-3330	Net 30	7/27/2023		46360	C1131

Item	Description	Quantity	Rate	Amount
------	-------------	----------	------	--------

**Complaint:** Wash Truck

**Cause:** Customer request

Labor	<b>Correction:</b> Chassis / Chassis / Washed the truck as it came in extremely muddy.	3.00000	\$135.00	\$405.00
			<b>Subtotal</b>	\$405.00

**PM:** CVIP Truck Heavy 4 Axle

**Cause:** Customer request

(PM)

Labor	<b>Correction:</b> Chassis / Chassis / CVIP CERTIFICATE NUMBER CV7856854	2.85185	\$135.00	\$385.00
			<b>Subtotal</b>	\$385.00

**Inspection**

Labor	Wheels Off at Inspection: Wheels off at time of inspection - \$75 per axle (Waived when work completed on axle)	3.00000	\$75.00	\$225.00
			<b>Subtotal</b>	\$225.00

**Complaint:** CVIP Repairs

**Cause:** Customer request

Item	Description	Quantity	Rate	Amount
Labor	<b>Correction:</b> Chassis / Chassis / CVIP Repairs - Performed CVIP. Mirror lights found to not be working properly and not mounted properly - remove lenses and remount mirror properly Replace and repair burnt out marker lights as needed. Troubleshoot and repair wiring for hood signal lights. Both king pins have excessive play in them. Remove, repair and reseal and new bushings on steering components.	26.00000	\$135.00	\$3,510.00
Parts	King Pin Kit	1.00000	\$898.56	\$898.56
Parts	Clearance Marker	1.00000	\$16.20	\$16.20
Parts	Hubcab Gasket 6-hole	1.00000	\$5.23	\$5.23
Parts	Front Axle Wheel Set, 2137	1.00000	\$93.45	\$93.45
Parts	75W90 - Synthetic	2.00000	\$14.65	\$29.30
			<b>Subtotal</b>	\$4,552.74

**Inspection**

Labor	WHEELS HAVE BEEN REMOVED - RE-TORQUE NECESSARY: Wheels have been removed and reinstalled on your unit. A re-torque of components is necessary within 100 kms.	0.00000		\$0.00
			<b>Subtotal</b>	\$0.00

**Unit:** C1131 **VIN:** 1NKDX4EX8FJ972439  
 2015 Kenworth T8 Series  
**Chassis:** 338,952 Kilometers  
**Engine:** 30,381 Hours

<b>Labor</b>	\$4,525.00
<b>Parts</b>	\$1,042.74
<b>Shop Supplies</b>	\$207.00
<b>Pre-Charge Subtotal</b>	\$5,774.74
<b>GST</b> (5% of \$5,774.74)	\$288.74
<b>Total</b>	\$6,063.48
<b>Payments &amp; Credits</b>	\$0.00
<b>Balance Due</b>	\$6,063.48

**\*: Core charges not included in total. You will be charged for any core that is not in returnable condition. This charge may be applied on a separate invoice.**

**Your business is appreciated, thank-you.**

**GST #** 893941781RT0001

**PAYMENT METHODS:** E-mail transfer, EFT, Cheque, Debit and Credit Card. ( 2% charge will be added for Credit Card payments.)

**TERMS & CONDITIONS:** COD or Net 30 days O.A.C (Credit application available upon request)

2% per month (24% per annum) will be charged on invoices not paid within 30 days of invoice date. I/We understand that claims arising from invoices must be made within seven business days.

Pro-Ex Equipment Repairs Ltd. will not be held liable for parts and components failure due to misuse, lack of maintenance or custom non-factory vehicle customization. All warranties must be done at Pro-Ex Equipment Repairs Ltd and we will not be held responsible for third party charges. 1 year limited warranty on parts and labour. I agree to the payment terms stated above or as discussed with management of Pro-Ex Equipment Repairs Ltd. I and/or my company is responsible for the entirety of all payments associated with the work done for us, by Pro-Ex Equipment Repairs Ltd. Pro-Ex Equipment Repairs Ltd has full interest and retains all ownership of all parts and services on this invoice, until invoice is paid in full. An express mechanic's lien is hereby acknowledged on the above unit to secure the amount of parts, accessories, materials and labour for repairs thereto.

Authorized by: \_\_\_\_\_

**Pro-Ex Equipment Repairs Ltd**  
 15415 89 street  
 Grande Prairie, AB T8V 0V7, CA  
 office@pro-ex.ca  
 (780) 532-7659



**Invoice: INV-1957**  
**Date: 1/20/2023**

**Bill To**  
 PVT Energy Group  
 65021 HWY 43  
 Grande Prairie, AB T8W 5E7, CA

**Remit Payment To**  
 Pro-Ex Equipment Repairs  
 15415 89 street  
 Grande Prairie, AB T8V 0V7, CA

Service Order	Terms	Due Date	Authorizer	Customer PO	Unit #
SO-3060	Net 30	2/19/2023	Not provided	42866	C1131

Item	Description	Quantity	Rate	Amount
<b>Complaint:</b> Coolant in the fuel "Priority Job"				
<b>Cause:</b> Customer request				
Labor	<b>Correction:</b> Engine / Misc. Engine / Bring unit into shop Friday evening. Saturday morning, remove intake and valve cover. Drain coolant. Remove injector wiring. Remove fuel lines and connector tubes. Remove injectors. Clean injector bores. Install injector cups. Clean and reseal injectors. Install injectors. Install connector tubes and fuel lines. Drain coolant from fuel tanks. Change fuel filters. Fill unit with coolant. Install injector wiring. Install valve cover and intake. Start unit and check over. Top up coolant. Move unit outside and warm up to temp. Unit is good to go.	8.50000	\$155.00	\$1,317.50
Parts	Fuel Filter	1.00000	\$36.29	\$36.29
Parts	Spin on Fuel Filter	1.00000	\$67.02	\$67.02
Parts	Coolant - Rotella ELC 5050	4.00000	\$13.19	\$52.75
Parts	R134A Refrigerant	4.30000	\$24.35	\$104.68
Parts	Ring, Retaining	6.00000	\$55.59	\$333.56
Parts	Seal- O-ring	6.00000	\$9.29	\$55.73
Parts	Seal-Injector	6.00000	\$12.58	\$75.45
Parts	Connector - Fuel Injector	6.00000	\$193.81	\$1,162.84
			<b>Subtotal</b>	<b>\$3,205.82</b>

**Unit:** C1131 **VIN:** 1NKDX4EX8FJ972439

2015 Kenworth T8 Series

**Chassis:** 324,272 Kilometers

**Engine:** 28,604 Hours

<b>Labor</b>	\$1,317.50
<b>Parts</b>	\$1,888.32
<b>Shop Supplies</b>	\$65.88
<b>Pre-Charge Subtotal</b>	\$3,271.70
<b>GST</b> <b>(5.0000% of \$3,271.70)</b>	\$163.58
<b>Total</b>	\$3,435.28
<b>Payments &amp; Credits</b>	\$0.00
<b>Balance Due</b>	\$3,435.28

**\*: Core charges not included in total. You will be charged for any core that is not in returnable condition. This charge may be applied on a separate invoice.**

**Your business is appreciated, thank-you.**

**GST #** 893941781RT0001

**PAYMENT METHODS:** E-mail transfer, EFT, Cheque, Debit and Credit Card. ( 2% charge will be added for Credit Card payments.)

**TERMS & CONDITIONS:** COD or Net 30 days O.A.C (Credit application available upon request)

2% per month (24% per annum) will be charged on invoices not paid within 30 days of invoice date. I/We understand that claims arising from invoices must be made within seven business days.

Pro-Ex Equipment Repairs Ltd. will not be held liable for parts and components failure due to misuse, lack of maintenance or custom non-factory vehicle customization. All warranties must be done at Pro-Ex Equipment Repairs Ltd and we will not be held responsible for third party charges. 1 year limited warranty on parts and labour. I agree to the payment terms stated above or as discussed with management of Pro-Ex Equipment Repairs Ltd. I and/or my company is responsible for the entirety of all payments associated with the work done for us, by Pro-Ex Equipment Repairs Ltd. Pro-Ex Equipment Repairs Ltd has full interest and retains all ownership of all parts and services on this invoice, until invoice is paid in full. An express mechanic's lien is hereby acknowledged on the above unit to secure the amount of parts, accessories, materials and labour for repairs thereto.

Authorized by: \_\_\_\_\_

**Pro-Ex Equipment Repairs Ltd**  
 15415 89 street  
 Grande Prairie, AB T8V 0V7, CA  
 office@pro-ex.ca  
 (780) 532-7659



**Invoice: INV-1442**  
**Date: 3/7/2022**

**Bill To**  
 Performance Vac and Tank Services LTD  
 65021 HWY 43  
 Grande Prairie, AB T8W 5E7, CA  
 P: 780-830-0045 F: 780-830-5164

**Remit Payment To**  
 Pro-Ex Equipment Repairs  
 15415 89 street  
 Grande Prairie, AB T8V 0V7, CA

Service Order	Terms	Due Date	Authorizer	Customer PO	Service Writer	Unit #
SO-2506	Net 30	4/6/2022	Not provided	36084	Markin, Mat	C1131

Item	Description	Quantity	Rate	Amount
------	-------------	----------	------	--------

**Complaint:** Inspect, replace cam and needed rockers

**Cause:** Customer request

Labor	<b>Correction:</b> Engine / Top End / Customer complained of worn camshaft. Removed valve cover and inspected. Found camshaft and rocker levers to have excessive wear. Drained coolant. Removed intake pipes, coolant lines, wiring, brackets, a/c refrigerant, rad, valve train, belts, fan hub, front gearing, camshaft, etc. Cleaned and inspected all other parts for reuse. Also found rocker shafts to be worn out. Installed new cam, new intake and exhaust rockers, and new rocker shafts. Installed front gearing and timed engine.  Performed valve set. Reassembled all other components with new seals where necessary and torqued accordingly. Installed rad and coolant. Tested a/c system for leaks - passed. Charged a/c system. Ran engine up to temp and checked all operations - passed. Test drive unit - passed.	22.50000	\$135.00	\$3,037.50
Parts	Shaft - Lever Rocker	1.00000	\$415.212	\$415.21
Parts	Shaft - Lever Rocker	1.00000	\$413.312	\$413.31
Parts	Seal - Rectangular Strip	1.00000	\$72.5435	\$72.54
Parts	Regtangular ring seal	1.00000	\$20.04	\$20.04
Parts	Seal - O Ring	1.00000	\$21.21	\$21.21
Parts	Gasket, Camshaft	1.00000	\$17.68	\$17.68
Parts	Seal, O-Ring	1.00000	\$28.19	\$28.19
Parts	Kit, Rocker Lever	1.00000	\$1,524.38	\$1,524.38
Parts	Antifreeze Prestone ELC 50/50 Red Jug	2.00000	\$11.53	\$23.06
Parts	AC Coolant / lb.	4.50000	\$16.69	\$75.11
Parts	ATF	3.00000	\$8.61	\$25.83
Parts	Camshaft	1.00000	\$2,684.00	\$2,684.00

Item	Description	Quantity	Rate	Amount
Parts	Gasket, Valve C	1.00000	\$108.518	\$108.52
			<b>Subtotal</b>	\$8,466.58

**Complaint:** Engine B Service

**Cause:** Customer request

(Inspection)

Labor	<b>Correction:</b> Engine / Lubrication / Completed a B Service. Drained engine oil, replaced all fuel filters and oil filter. Filled up engine oil. Checked air filters and they still looked like new. Fired engine and checked for leaks, passed. Shut engine off and checked engine oil level, passed. Greased truck and looked over. Unit good to go.	2.50000	\$135.00	\$337.50
Parts	Duron 5W40 - 1L	43.00000	\$8.35	\$359.05
Parts	Oil Filter	1.00000	\$62.38	\$62.38
Parts	Fuel Filter	1.00000	\$36.298	\$36.30
Parts	Spin on Fuel Filter	1.00000	\$57.18	\$57.18
			<b>Subtotal</b>	\$852.41

**Unit:** C1131 **VIN:** 1NKDX4EX8FJ972439

2015 Kenworth T8 Series

**Chassis:** 292,918 Kilometers

**Engine:** 24,689 Hours

<b>Labor</b>	\$3,375.00
<b>Parts</b>	\$5,943.99
<b>Shop Supplies</b>	\$168.75
<b>Pre Tax Total</b>	\$9,487.74
<b>GST (5.0000% of \$9,487.74)</b>	\$474.39
<b>Total</b>	\$9,962.13
<b>Payments &amp; Credits</b>	\$0.00
<b>Balance Due</b>	\$9,962.13

"YOUR BUSINESS IS APPRECIATED, THANK YOU.

PRO-EX EQUIPMENT REPAIRS LTD

GST # 893941781

TERMS: NET 30 DAYS

CASH OR CHEQUE O.A.C. 2% PER MONTH (24% PER ANNUM) WILL BE CHARGED ON INVOICES NOT PAID WITHIN 30 DAYS OF INVOICE DATE.

THIS COMPANY DOES NOT ASSUME RESPONSIBILITY FOR VEHICLES OR EQUIPMENT LEFT FOR STORAGE OR OTHER PURPOSES, OR FOR ARTICLES LEFT IN SAME. VEHICLES DRIVEN BY OUR EMPLOYEES AT OWNERS RISK."



# Kaymor Industrial Solutions Ltd.

9703-72 Avenue  
Clairmont, Alberta T8X 5B3  
Phone: (780) 538-2623  
Fax: (780) 538-2650

# Invoice

Invoice No: **447631**

Date: 2024-03-22

**Sold to:**

PVT Energy Group Inc.  
93-721071 Range Road 53  
County of Grande No.1, AB T8X 0N4

**Ship to:**

PVT Energy Group Inc.  
93-721071 Range Road 53  
County of Grande No.1, AB T8X 0N4

P.O. No.	Contact	Unit #	Rig #	AFE#	LSD	Kaymor Ticket #:
53282	Brian Farguhar	C1131				

Item	Quantity	Description	Price Each	Amount
Hydraulics	1	Kenworth 2014 SN#1NKDX4EX8FJ972439 Km's 326396 Hrs 32353 Found the Danfoss valve that controls tank and cylinder functions leaking. Removed valve and rebuilt it. Cleaned up spool for tank lift circuit. Put valve back together and function tested. All functions worked normally and no leaks detected. Changed out both Charge filters and main return filter.	1,350.00	1,350.00
HYM	1	Filters and parts to Rebuild valve Bank	1,055.00	1,055.00
Shop Supplies	1	Shop Supplies	67.50	67.50

Overdue invoices are subject to a 2% monthly charge on balance.

Thank you for your  
business!

Terms: NET30 Due: 2024-04-21

GST/HST No. 889867925

<b>Subtotal</b>	\$2,472.50
<b>GST</b>	\$123.63
<b>Total</b>	<b>\$2,596.13</b>



PVT Energy Group Inc.  
 93-721071 Range Road 53  
 County of Grande Prairie, AB, T8X 0N4  
 Phone: 780-830-0045  
 Fax: 780-830-5164

Equipment: C1131

Work Order #: 59978

Date: 01/30/26

Completed Date: 02/19/26

Year: 2015  
 Make: Kenworth  
 Model: T800  
 Odometer: 402,818  
 Hours: 402,818

Serial Number: 1NKDX4EX8FJ972439

## Labor

Category	Description	Mechanic	Quantity/Hours	Price/Rate	Amount
LABOUR INTERNAL (PVT ...		Colley, Jason	1.00	60.00	60.00
LABOUR INTERNAL (PVT ...		Colley, Jason	2.00	60.00	120.00
LABOUR INTERNAL (PVT ...		Burse, Dakota	3.00	60.00	180.00
LABOUR INTERNAL (PVT ...		White, Mark	14.00	60.00	840.00
LABOUR INTERNAL (PVT ...		Hunter, Matthew	7.00	60.00	420.00

## Parts

Description	Quantity/Hours	Price/Rate	Amount
MC-250, CLAMP, 2-1/2" ID muffler	2.00	3.28	6.56
504060, OUT PUT BEARING	1.00	184.65	184.65
210737, SEAL-OIL	1.00	77.42	77.42
128049, NUT, FORWARD OUTPUT	1.00	20.12	20.12
504054, BEARING, OUTPUT SHAFT WSPACER	1.00	241.65	241.65
512894ETN, SHAFT KIT, OUTPUT D46-170H	1.00	483.80	483.80
170-70-18X, STRAP KIT, SPL170	2.00	25.95	51.90
S64-1195-141, PANEL, ASSY GUAGE ABS	1.00	407.13	407.13
S60-1284-321, TRIM, ASSY-GUAGE PANEL	1.00	1,799.71	1,799.71
S18-1018, Inside door handle bezel, with clips	1.00	185.75	185.75
16-09012, LAMP, DOOR	1.00	106.82	106.82
S73-1029-701, VISOR	1.00	480.69	480.69
S16-1008, HOOK, COAT PLASTIC	2.00	29.43	58.86
99570031, HANNAY CHAIN GUARD RH	1.00	98.65	98.65
RA221, 5 PORT 2 POS 4 WAY MANUAL	1.00	127.85	127.85

- 1) Check over unit and get ready for auction. (Jason - .5HR)  
 Cause: Auction check over  
 Correction: check over unit and made a repair list so another tech can take over.  
 Checked over unit to prep for auction. - Mark(2).
- 2) Complaint: upper water transfer pipping loose. (Jason - .5HR)  
 Cause: Loose mounting hardware  
 Correction: Replace seize u-bolts and tighten all hardware
- 3) Complaint: Remove samsara  
 Removed samsara, samsara components, camera harness. - Mark(3)
- 4) Complaint: Removed 2 way radio  
 Removed two way radio. - Mark(.5)
- 5) Complaint: Replace broken whale tail on rear ds storage box  
 Removed/replaced ds whale tail assembly. - Mark(.5)



PVT Energy Group Inc.  
93-721071 Range Road 53  
County of Grande Prairie, AB, T8X 0N4  
Phone: 780-830-0045  
Fax: 780-830-5164

- 6) Complaint: Replace bumper reflective tape  
Removed and replaced reflective tape on beaver tail. - Mark(1)
- 7) Complaint: Replace reflective tape on rear door with white reflective tape  
Removed and replaced reflective tape on rear door hatch. - Mark(1)
- 8) Complaint: Replace chrome axle covers with new  
Removed and replaced chrome axle covers. - Mark(.5)
- 9) Complaint: ESD switch needs to be replaced (missing knob).(Jason - 2HRS)  
Cause: threads got pulled out or knob came undone and fell off  
Correction: Replace switch and tighten leaking hydraulic fitting at control panel also. (function test switch - works good).  
Removed switch and gave to parts to get a complete one. - Matt(.5)
- 10) Complaint: Mount control panel face plate ps in wash cabinet  
Mount control panel face plate. - Mark(.5)
- 11) Complaint: Mount chain cover on front wash hose reel  
Cover is missing, its ordered, will arrive tomorrow. - Matt(.5)  
Installed hose reel chain guard. - DK(.5)
- 12) Complaint: Secure panel below glove box  
Secured panel below glove box. - Mark(.5)
- 13) Complaint: Remove in cab fire ext mount  
Removed fire ext/mount. - Mark(.5)
- 14) Complaint: PS mirror light out  
Removed and replaced ps mirror light. - Mark(.5)
- 15) Complaint: Missing ds sunvisor and all visor clips broken  
Pulled all holster bolts for sunvisor clip. - Mark(.5)  
Other tech remove reminiscent of it and installed new clip, ill need to order other position. - Matt(.5)  
Installed new visor. - DK(.5)
- 16) Complaint: A2 diff output seal  
Removed intermediate drive shaft, pulled yoke/nut, pulled pinion/shaft. - Mark(3)  
Went to install new shaft with new bearing kit. Tried for a while, could not get it to go. Found it was the wrong kit, got actual kit and installed. Went way smoother and could install the snap ring. Installed new seal, cleaned yoke and U joints and yoke on A3. Installed shaft and torqued strap kits. - Matt(5.5)
- 17) Complaint: Replaced damaged dash panel  
Replaced dash panel trim and left gauge panel. - DK(1)
- 18) Complaint: Replaced ds damaged door light  
Replaced ds door light with new. - DK(.5)
- 19) Complaint: Install missing ds door handle trim  
Installed new door handle trim. - DK(.5)

---

Total Labor	1,620.00
Total Parts	4,331.56
Total Returns	.00
Total Sublet	.00
Shop Supplies	81.00



PVT Energy Group Inc.  
 93-721071 Range Road 53  
 County of Grande Prairie, AB, T8X 0N4  
 Phone: 780-830-0045  
 Fax: 780-830-5164

Equipment: C1131

Work Order #: 57365  
 Date: 10/20/25

Completed Date: 10/23/25

Year: 2015  
 Make: Kenworth  
 Model: T800  
 Odometer: 396,994  
 Hours: 36,440

Serial Number: 1NKDX4EX8FJ972439

## Labor

Category	Description	Mechanic	Quantity/Hours	Price/Rate	Amount
LABOUR INTERNAL (PVT ...		Colley, Jason	5.00	60.00	300.00

## Parts

Description	Quantity/Hours	Price/Rate	Amount
1133, GREASE GUN PISTOL GRIP LINCON	1.00	85.47	85.47
EA4F4, 1/2 NPT WATER BLAST TIP	6.00	33.58	201.48
4EAF4, 1/2 NPT WATER BLAST CPLG	3.00	66.41	199.23
SFFIRE810, 20LBS EXTINGUISHER BRACKET	1.00	62.40	62.40
99278551, SWIVEL, HANNAY 1/2"	2.00	136.02	272.04
SDH-100, GROUND REEL, MAN 100'	1.00	713.40	713.40
S-121T-38, 3/8 STAINLESS BALL VALVE REDUCED PORT	1.00	14.36	14.36

- 1) DRAIN VALVE BOTTOM OF WASH PUMP BYPASSING. (Jason - .5HR)  
 Cause: Worn out valve seal  
 Correction: Replace Drain valve
- 2) SWIVEL AT HOSE REEL LEAKING. (Jason - .5HR)  
 Cause: Never greased  
 Correction: Replace swivel
- 3) GROUND CABLE REEL SEIZED UP. (Jason - .5HR)  
 Cause: Unsure of failure (no corrosion present and all the mechanically parts functions)  
 Correction: Remove old ground cable and clean mounting surface before mounting new reel (use Multimeter to test the connect between frame and reel - good)
- 4) REMOVE 3/8 " HOSE FITTINGS FROM HOSE REEL AND GUN INSTALL 1/2 FITTINGS. (Jason - 1HRS)  
 Cause: Want to match the newer units  
 Correction: Replace all the fitting on all wash wands and reels on unit
- 5) Defect: Passenger side cabinet door very hard to close. (Jason - 1.5HR)  
 Cause: Door was badly damaged in the past so it still had a twist in it and mounting hardware was loose  
 Correction: forcefully twist door to get it some what straight then open up the lower locating hole and test (good)
- 6) Defect: Fire extinguisher bracket is broken. (Jason - 1HR)  
 Cause: Corrosion preventing any adjustment to tension  
 Correction: Heat up adjustment stud to adjust tension ( stud broken). Replace mounting Bracket and fire Extinguisher ( yearly inspection was over due)

Total Labor 300.00



PVT Energy Group Inc.  
 93-721071 Range Road 53  
 County of Grande Prairie, AB, T8X 0N4  
 Phone: 780-830-0045  
 Fax: 780-830-5164

Equipment: C1131

Work Order #: 57122  
 Date: 10/09/25

Completed Date: 10/30/25

Year: 2015  
 Make: Kenworth  
 Model: T800  
 Odometer: 285,269  
 Hours: 8,770

Serial Number: 1NKDX4EX8FJ972439

## Labor

Category	Description	Mechanic	Quantity/Hours	Price/Rate	Amount
LABOUR INTERNAL (PVT ...		Hooley, Nathan	4.00	60.00	240.00

## Parts

Description	Quantity/Hours	Price/Rate	Amount
31280, SEAL KIT, CAT PUMP	1.00	527.76	527.76
31292, KIT, VALVE REPAIR, CAT PUMP	1.00	1,286.97	1,286.97
CA-6107, CRANKCASE OIL, CAT PUMP	1.00	25.87	25.87
DC400SS, CAMLOCK CAP, 4" INSTALOCK	1.00	124.22	124.22
2460036, 3/4" 17 MICRON WATER-ABSORBING FURL FILTER ASSY	1.00	89.99	89.99
BF7760, FUEL FILTER	1.00	22.55	22.55

1) Defect: Wash Pump is jacking

Cause: Broken internal valve

Correction: Hook up water source. Test function pump. Pressures jumping and pump jacking. Pull unit into shop. Pull pump head off and inspect valves. Valves broken in bottom of head holding valves open. Rebuild wash pump head. Install head. Setup unit with water source again. Test pump. Running smooth. building 3000psi and holding and running at 2500psi while operating gun. Blow down system with air as per Adam Currie. Park unit. Nathan H 4hrs

Total Labor	240.00
Total Parts	2,077.36
Total Returns	.00
Total Sublet	.00
Shop Supplies	12.00
Invoice Total	2,329.36



PVT Energy Group Inc.  
 93-721071 Range Road 53  
 County of Grande Prairie, AB, T8X 0N4  
 Phone: 780-830-0045  
 Fax: 780-830-5164

Equipment: C1131

Work Order #: 55349  
 Date: 07/24/25

Completed Date: 07/31/25

Year: 2015  
 Make: Kenworth  
 Model: T800  
 Odometer: 390,757  
 Hours: 35,883

Serial Number: 1NKDX4EX8FJ972439

## Labor

Category	Description	Mechanic	Quantity/Hours	Price/Rate	Amount
LABOUR INTERNAL (PVT ...		Sabado, Paul	9.50	60.00	570.00
LABOUR INTERNAL (PVT ...		Burse, Dakota	2.00	60.00	120.00

## Parts

Description	Quantity/Hours	Price/Rate	Amount
15486, COUPLING, FLOAT BOWL SWIVEL	1.00	1,102.46	1,102.46
15487, SHAFT FLOAT BOWL ASSY TSTYLE	1.00	482.63	482.63

### 1) HOOD HARD TO OPEN

Checked hood, seemed easy to open, greased hood pins. - Paul(1)

### 2) Complaint: Tank volume gauges on opposite sides on the tank do not match.

Cause: not matching

Correction: Gauge rod worn out, opened tank, took rod assembly apart, had to wait for parts. Installed new rod assembly, had to weld rod to float, closed tank, tested good, checked for leaks. - Paul(8.5) DK(2)

Total Labor	690.00
Total Parts	1,585.09
Total Returns	.00
Total Sublet	.00
Shop Supplies	34.50
<b>Invoice Total</b>	<b>2,309.59</b>



PVT Energy Group Inc.  
 93-721071 Range Road 53  
 County of Grande Prairie, AB, T8X 0N4  
 Phone: 780-830-0045  
 Fax: 780-830-5164

Equipment: C1131

Work Order #: 54209  
 Date: 06/02/25

Completed Date: 06/05/25

Year: 2015  
 Make: Kenworth  
 Model: T800  
 Odometer: 386,935  
 Hours: 35,668

Serial Number: 1NKDX4EX8FJ972439

## Labor

Category	Description	Mechanic	Quantity/Hours	Price/Rate	Amount
LABOUR INTERNAL (PVT ...		Gabriel, David	4.50	60.00	270.00
LABOUR INTERNAL (PVT ...		Farquhar, Brian	1.00	60.00	60.00

## Parts

Description	Quantity/Hours	Price/Rate	Amount
M100PSAR, STEERING BOX	1.00	750.00	750.00
NIP-64-CL-SS, 4X CLOSE SCH40 NIPPLE	1.00	48.75	48.75
Q21-1033, SENSOR, FUEL FILTER RSTR	1.00	228.42	228.42
12065287, CONNECTOR-SEALED	1.00	7.35	7.35

- 1) Complaint: Air leak on brake application  
 Troubleshoot: air leak in dash when brakes applied, pulled dash apart, bulk head fitting leaking.  
 Repair: Replaced fitting, good. - DJ(1.5)
- 2) Complaint: Passenger side mirror loose  
 Troubleshoot: loose hardware  
 Repair: Tightened mirror - DJ(.5)
- 3) Complaint: Camlock fitting on high P/S vale is out of shape  
 Troubleshoot: Found fitting was egged shaped from being beat on with hammer.  
 Repair: Replace fitting with new one. - DJ(1)
- 4) Complaint: Center low valve not closing properly  
 Troubleshoot: Cylinder would not close under spring pressure completely.  
 Repair: Hooked up air to close side and now works good. - Brian(1)
- 5) Complaint: fuel filter restriction sensor is on.  
 Troubleshoot: Pigtail and sensor corroded.  
 Repair: Replaced sensor and wired in new pigtail. - DJ(1.5)

Total Labor	330.00
Total Parts	1,034.52
Total Returns	.00
Total Sublet	.00
Shop Supplies	16.50
<b>Invoice Total</b>	<b>1,381.02</b>



PVT Energy Group Inc.  
 93-721071 Range Road 53  
 County of Grande Prairie, AB, T8X 0N4  
 Phone: 780-830-0045  
 Fax: 780-830-5164

Equipment: C1131

Work Order #: 53565  
 Date: 04/29/25

Completed Date: 04/30/25

Year: 2015  
 Make: Kenworth  
 Model: T800  
 Odometer: 385,792  
 Hours: 35,496

Serial Number: 1NKDX4EX8FJ972439

## Labor

Category	Description	Mechanic	Quantity/Hours	Price/Rate	Amount
LABOUR INTERNAL (PVT ...		Colley, Jason	3.00	60.00	180.00

## Parts

Description	Quantity/Hours	Price/Rate	Amount
PEV2824-15R101, PUMP, POWER STEERING	1.00	822.52	822.52
4988280, GASKET, P/S PUMP	1.00	5.81	5.81
KL-TF2840, DEXRON VI/MERC LV 946ML	2.00	12.89	25.78
4988280, GASKET, P/S PUMP	1.00	6.21	6.21

1) Hard to steer at low speeds. wanders lots at highway speed. (Jason - 2HRS)

Diag: After driving unit in shop i notice the lines were already hot for that short drive.(the pump also came apart during the replacement process)

Repair: Replace power steering pump and bled the sysem the checked the drag links and tie rod ends. (didn't noticed and excessive play during testing)

2) Driver seat doesnt slide all the way forward. (Jason - 1HR)

Diag: Upon inspection one bolt was missing that secure a bracket which block the release arm path of travel

Repair: Install a new bolt and test (Release arm works as it should and the seat can travel the full distance forward and backwards)

Total Labor	180.00
Total Parts	860.32
Total Returns	.00
Total Sublet	.00
Shop Supplies	9.00
Invoice Total	1,049.32



PVT Energy Group Inc.  
 93-721071 Range Road 53  
 County of Grande Prairie, AB, T8X 0N4  
 Phone: 780-830-0045  
 Fax: 780-830-5164

Equipment: C1131

Work Order #: 53038  
 Date: 04/02/25

Completed Date: 04/29/25

Year: 2015  
 Make: Kenworth  
 Model: T800  
 Odometer: 385,685  
 Hours: 35,476

Serial Number: 1NKDX4EX8FJ972439

## Labor

Category	Description	Mechanic	Quantity/Hours	Price/Rate	Amount
LABOUR INTERNAL (PVT ...		Jackson, Braydon	43.00	60.00	2,580.00
LABOUR INTERNAL (PVT ...		Farquhar, Brian	.50	60.00	30.00
LABOUR INTERNAL (PVT ...		Mulcahy, Travis	4.50	60.00	270.00
LABOUR INTERNAL (PVT ...		Sabado, Paul	15.50	60.00	930.00

## Parts

Description	Quantity/Hours	Price/Rate	Amount
CHAINGUARD-RH, CHAIN GUARD RIGHT HAND SIDE	1.00	97.85	97.85
802918BXW, VALVE, DOUBLE CHECK	1.00	43.15	43.15
BE13250M1D, HANEL SWITCH	1.00	65.25	65.25
S64-1197-1140, PANEL, ASSY GUAGE	1.00	819.44	819.44
2010L, LENS, DOOR LAMP	1.00	44.83	44.83
16-09012, LAMP, DOOR	1.00	104.04	104.04
132927W1L, FOOTPAD THROTTLE RUBBER	1.00	38.76	38.76
156.1036, DUST SHIELD	1.00	72.86	72.86
63611-5, LAMP, CLEAR LED 4" SQUARE	2.00	90.00	180.00
76223, STROBE, AMBER ROTATIONAL	1.00	398.86	398.86
905055KP1NN80R, PUMP	1.00	7,560.00	7,560.00
K11419, CONTROL GASKET	1.00	21.25	21.25
CA-6107, CRANKCASE OIL, CAT PUMP	1.00	19.25	19.25
87009780, NOZZLE, BURNER	1.00	22.49	22.49
98026680, ELECTRODE ASSY AFG, SM, SF ASSY KIT TO 9	1.00	30.70	30.70
SRV-5086, ELECTRODE, DYNABLAST BOILER HV690F	1.00	21.57	21.57
MW11031BK, HUB CAP COVER FRONT 8"	6.00	8.59	51.54
MW12091H, CAP-HUB	2.00	12.32	24.64
BAV020TD, TOGGLE VALVE, AIR	1.00	68.60	68.60
HYDHD22BLK, RANDO HD 22 HYDRAULIC OIL	65.00	5.96	387.40

- 1) Complaint: Brake pedal leaks air when applied  
 Checked for air leaks, brake system has no leak, can only hear small leak in the cab. - Braydon(.5)
- 2) Complaint: Truck wanders when going down the highway  
 Checked over suspension. - Braydon(2.5)
- 3) Go completely through unit and make inspect all components for proper function  
 Checked over truck and function test components. - Braydon(2.5)
- 4) ds beacon lights not working  
 Check rotating assembly, it turns free and gets power. Replaced complete beacon assembly, tested, working. - Travis(1)
- 5) 2 rear work lights out  
 Tested, both lights getting power. Seized and difficult to remove. Replaced and wires in, tested, good. - Travis(2)

6) fire extinguisher has no date  
Changed fire ext. - Brian(.5)

7) rear v bar worn  
Changed bushings on rear v bar. - Braydon(2.5)

8) air leak in cab  
Installed bulk head and air lines, aired up and tested for leaks. - Braydon(.5)

9) A3 ds dust shield missing  
Replaced missing dust shield on axle #3 left side. - Travis(1.5)

10) chain guard missing on hose reel  
Removed broken pieces and installed new chain guard. - Braydon(1.5)

11) water pump oilers empty  
Topped up oilers. - Paul(1)

12) ps door lamp broken  
Changed bulb and lens, light still not working, checked door switch, connector is broken, installed new switch and pigtail. - Braydon(1)

13) ds door lamp out  
Changed bulb and installed lens. - Braydon(.5)

14) wash pump motor leaking  
Removed wash pump motor and sent out for rebuild. - Braydon(3)  
Capped and plugged lines. - Pail(1.5)

15) change blower oil  
Changed blower oil. - Braydon(1.5)

16) install pressure/vacuum stickers  
No stickers available at this time, wrote over old stickers for now. - Braydon(.5)

17) grease rear wing nuts  
Changed all grease nipples and greased wing nuts. - Braydon(.5)  
Removed wing nuts and put in parts washer, greased hinge for rear door, copper coated wingnuts and reinstalled. - Braydon(6)

18) air leak under cab  
Changed air fitting on block under cab for seats. - Braydon(.5)

19) throttle pedal messing cover  
Parts ordered.

20) air leak in dash  
Found bulkhead leaking on the firewall, changed out bulkhead and tested for leaks. - Braydon(1.5)

21) pressure test valves  
Pressure tested valves, found high pressure valve leaking. Rebuilt high pressure valve and tested, good. Resealed bottom 6" flange. - Paul(6)



*PVT Energy Group Inc.*  
93-721071 Range Road 53  
County of Grande Prairie, AB, T8X 0N4  
Phone: 780-830-0045  
Fax: 780-830-5164

22) install side camera

Installed a side camera and ran wires through firewall and into samsara. - Braydon(1.5)

23) install pto idle switch

Connected both ptos to a double check valve, ran air line through the fire wall and hooked to a pressure switch and plugged into Samsara. - Braydon(3.5)

24) change instrument cluster

Removed all gauges and switched, reinstalled on new cluster, checked for leaks. - Braydon(2.5)

25) 3rd diff lock leaks air

Changed out fitting that was rotten near 4th axle. - Braydon(1.5)

26) 6 bolt pto pump leaking

Replaced pto motor control valve gasket, tested, good. - Paul(4)

27) tee behind washer control panel leaking

Tightened fittings and tested, still leaking. - Paul(2)

Removed t and steel line, cut and bent new steel line and installed. - Braydon(6)

Filled hydraulic tank and ran truck and tested hydraulic for leaks. - Braydon(1)

28) vacuum gauge on control panel not reading properly

Change vacuum gauge. - Braydon(.5)

29) cyclone drain switch leaks

Changed air switch and labeled it. - Braydon(.5)

30) label valve bank and adjust lever

Rivet on a plate with labels, ran hydraulic and tested the one way controls and set them to only move one way. - Braydon(1)

31) hub caps and nuts covers

installed hub caps and nut covers. - Paul(1)

Total Labor	3,810.00
Total Parts	10,072.48
Total Returns	.00
Total Sublet	.00
Shop Supplies	190.50
Invoice Total	14,072.98



PVT Energy Group Inc.  
 93-721071 Range Road 53  
 County of Grande Prairie, AB, T8X 0N4  
 Phone: 780-830-0045  
 Fax: 780-830-5164

Equipment: C1131

Work Order #: 51665  
 Date: 01/27/25

Completed Date: 01/31/25

Year: 2015  
 Make: Kenworth  
 Model: T800  
 Odometer: 377,994  
 Hours: 34,879

Serial Number: 1NKDX4EX8FJ972439

## Labor

Category	Description	Mechanic	Quantity/Hours	Price/Rate	Amount
LABOUR INTERNAL (PVT ...		Hooley, Nathan	34.00	60.00	2,040.00

## Parts

Description	Quantity/Hours	Price/Rate	Amount
5468170CUM, GEAR HOUSING	1.00	1,237.61	1,237.61
5484100CUM, IDLER SHAFT	1.00	128.54	128.54
4393089CUM, GEAR HOUSING GASKET	1.00	110.22	110.22
N4751001, KIT, MOUNTING RADIATOR/CHA	1.00	181.11	181.11
GW20724, KW RADIATOR MOUNT	4.00	12.36	49.44
5440813CUM, GASKET, COMPRESSOR MOUNT	1.00	22.18	22.18
5414049CUM, GASKET, FUEL PUMP	1.00	37.65	37.65
3685556CUM, GASKET ADAPTER	1.00	17.74	17.74
3685173, OIL SEAL	1.00	96.12	96.12
5414049CUM, GASKET, FUEL PUMP	1.00	37.59	37.59
4374074CUM, Twelve point cap screw	3.00	4.57	13.71
3687007CUM, SEAL-FRONT COVER	1.00	58.88	58.88
5575513CUM, Hex Flange head cap screw	1.00	11.68	11.68
5658175CUM, Rectangular ring seal	1.00	15.61	15.61
4299124CUM, SEAL,O-RING	1.00	16.67	16.67
4299125CUM, SEAL-REAR O-RING	1.00	21.24	21.24
5719778CUM, GASKET, CAMSHAFT COVER	1.00	14.00	14.00
3104392CUM, GASKET, VALVE COVER, ISX15	1.00	85.63	85.63
GW27934, ENGINE MOUNT	2.00	23.74	47.48
5406110CUM, KIT-MAIN BEARING	1.00	521.64	521.64
4089405CUM, BEARING ROD SET	6.00	112.94	677.64
2882087CUM, SET-ROD BEARING	6.00	151.40	908.40
LF14000NN, FILTER, OIL	1.00	53.36	53.36
WF10123, SPIN-ON FUEL FILTER	1.00	53.24	53.24
WF10500, FUEL FILTER	1.00	34.94	34.94
WA10009, RADIAL AIR FILTER	2.00	87.64	175.28
DW1164-30, WINDSHIELD, L/H T800 KW	1.00	53.63	53.63
5594275NXCUM, SENSOR, POSITION (OLD PRT# 2872277CUM)	1.00	34.42	34.42
5120858, BELT, GOLD LABEL POLY RIB	1.00	105.90	105.90
5060640, 6 RIB, POLY RIB BELT	1.00	37.29	37.29
5594276NXCUM, SENSOR POSITION, CAM	1.00	26.80	26.80
14916, FILTER FOREMOST 244S	1.00	245.00	245.00
10W30CHEVBLK, 10W30 CHEVRON DELO 600 ADF SAE	40.00	7.86	314.40

### 1) Oil leak on engine

Diagnose oil leak. Coming from front structure. Drain coolant. Pull rad. Drop oil pan. Remove fan, fan hub, shroud, piping, and a/c. Remove front gear train. Remove front structure. Inspect block. Block will need built up. Remove oil pump and stiffener plate. Roll new bearings into main bearings and start on con rods. wash parts. and clean bay. Nathan - 12hrs  
 Jan. 27



PVT Energy Group Inc.  
93-721071 Range Road 53  
County of Grande Prairie, AB, T8X 0N4  
Phone: 780-830-0045  
Fax: 780-830-5164

Clean mating surface for front structure. Cam tone ring ping broke off in cam. drill pin out of cam. prep block for metal build up. Apply epoxy to face of block. Finish bearing roll in on con rods. All bolts for main bearings and con rods torqued to spec and marked. Loosen off Rocker shafts and time engine. Time engine. File down block build up Install front structure with new gasket. torque bolts to spec. Install front drive train. torqued to spec. Set backlash on cam gear. Install front cover and fuel pump idler gear cover. Nathan - 9hrs Jan. 28

Install new front crank seal. install new crank and cam sensors. Install crank pulley, fan hub, rad assy, assy bracket, alt, a/c comp, and all other external assys. Install oil pan with new gasket, stiffener plate and pickup tube. Perform valve set. Install valve cover. Fill with 10w30 oil. Fill coolant system. Start engine and check for initial leaks. No leaks found. Run truck outside at high idle to operating temp. recheck for leaks. Clean bay and tools. Nathan - 10hrs

2) B Service

Inspect unit. Make list. Change Fuel filters, oil filter, air filters. Nathan -1hr

3)Placard clips missing

Replace placard clips on D/S and P/S. Nathan -0.5hrs

4)#2L dust cover missing

Replace missing dust cover on #2L. Nathan -0.5hr

5)D/S windshield

Remove D/S visor. Replace D/S windshield. Reinstall D/S visor. Nathan -1hr

Total Labor	2,040.00
Total Parts	5,445.04
Total Returns	.00
Total Sublet	.00
Shop Supplies	102.00
Invoice Total	7,587.04



PVT Energy Group Inc.  
 93-721071 Range Road 53  
 County of Grande Prairie, AB, T8X 0N4  
 Phone: 780-830-0045  
 Fax: 780-830-5164

Equipment: C1131

Work Order #: 50952  
 Date: 12/16/24

Completed Date: 12/31/24

Year: 2015  
 Make: Kenworth  
 Model: T800  
 Odometer: 374,302  
 Hours: 34,561

Serial Number: 1NKDX4EX8FJ972439

## Labor

Category	Description	Mechanic	Quantity/Hours	Price/Rate	Amount
LABOUR INTERNAL (PVT ...		Farquhar, Brian	4.00	60.00	240.00

## Parts

Description	Quantity/Hours	Price/Rate	Amount
D27-1016-0160P, ALTERNATOR - PACCAR 160A	1.00	578.10	578.10

1) NOT CHARGING

Service call, check charging system. Replaced alternator, tested, ok. - Brian(4)

Total Labor	240.00
Total Parts	578.10
Total Returns	.00
Total Sublet	.00
Shop Supplies	12.00
Invoice Total	830.10



PVT Energy Group Inc.  
 93-721071 Range Road 53  
 County of Grande Prairie, AB, T8X 0N4  
 Phone: 780-830-0045  
 Fax: 780-830-5164

Equipment: C1131

Work Order #: 50712  
 Date: 12/03/24

Completed Date: 12/17/24

Year: 2015  
 Make: Kenworth  
 Model: T800  
 Odometer: 374,012  
 Hours: 34,534

Serial Number: 1NKDX4EX8FJ972439

## Labor

Category	Description	Mechanic	Quantity/Hours	Price/Rate	Amount
LABOUR INTERNAL (PVT ...		Colley, Jason	3.00	60.00	180.00

## Parts

Description	Quantity/Hours	Price/Rate	Amount
31292, KIT, VALVE REPAIR, CAT PUMP	1.00	1,286.97	1,286.97
NST514825, 25' 12/3 SINGLE NEON BLUE LIGHTED KENWROTH END	1.00	39.57	39.57

1) Wash pump not working

Pull unit into shop and remove cat pump head to check valves, 2 out of 3 valves were badly damaged.

Also checked out the bottom end seals and pistons, good.

Reseal head and test, no water in wash bay so winterized and parked. - Jason(3)

Total Labor	180.00
Total Parts	1,326.54
Total Returns	.00
Total Sublet	.00
Shop Supplies	9.00
Invoice Total	1,515.54



PVT Energy Group Inc.  
 93-721071 Range Road 53  
 County of Grande Prairie, AB, T8X 0N4  
 Phone: 780-830-0045  
 Fax: 780-830-5164

Equipment: C1131

Work Order #: 49803

Date: 10/15/24

Completed Date: 10/31/24

Year: 2015  
 Make: Kenworth  
 Model: T800  
 Odometer: 372,643  
 Hours: 34,415

Serial Number: 1NKDX4EX8FJ972439

## Labor

Category	Description	Mechanic	Quantity/Hours	Price/Rate	Amount
LABOUR INTERNAL (PVT ...		Sabado, Paul	32.50	60.00	1,950.00
LABOUR INTERNAL (PVT ...		Debre, Matthew	3.00	60.00	180.00

## Parts

Description	Quantity/Hours	Price/Rate	Amount
3EF3-B, 3/8 FNPT ST-THRU BODY BRASS QUIC	1.00	8.63	8.63
P92-2832-8322-67, CORD, BLOCK/PAN HEATER	1.00	570.63	570.63
2252-1D, SPLITTER, RETURN NORM FLOW	1.00	141.44	141.44
2252-2D, VALVE - SPLITTER, FUEL	1.00	151.43	151.43
442/489 PTO REBUILD, 442/489 PTO REBUILD	1.00	713.38	713.38
10W30CHEVBLK, 10W30 CHEVRON DELO 600 ADF SAE	40.00	7.68	307.20
WL10107, OIL FILTER	1.00	45.29	45.29

- 1) No labels on hydraulic controls  
 Put labels on ps, ordered labels for ds. - Pau(1.5)
- 2) PTO sounds like it is not fully disengage  
 Re inspected PTO,found PTO to be engaged all the time. Drained transmission oil and changed PTO. - Paul(3.5)
- 3) Kilometer climb when blower is engaged  
 to be done during CVIP.
- 4) Water tank gauge is not reading correctly. Reads 1200  
 to be done during CVIP.
- 5) burner not getting over 50 degrees  
 to be done during CVIP.
- 6) hydraulic bank for tank and door leaking  
 to be done during CVIP.
- 7) Windshield wipers need replacing  
 Checked wipers, seem to be good. - Paul(1)
- 8) Water dump valve leaking (valve under tank)  
 Raised tank and diagnosed. Found crack on the bottom of tank. Drained water, opened waste tank to ensure safe to weld.  
 - Paul(1.5)



*PVT Energy Group Inc.*  
93-721071 Range Road 53  
County of Grande Prairie, AB, T8X 0N4  
Phone: 780-830-0045  
Fax: 780-830-5164

9) Cabinet door handle broke off on passenger side  
Installed new handle and made new locking knob. - Paul(2.5)

10) FUEL TEE LEAKING  
Replaced fuel tee. - Paul(3.5)

11) OIL PAN GASKET LEAKING  
Drained oil, unbolted oil pan, changed gasket and bolted back up. Torqued, filled up oil and ran truck. - Paul(5)

12) BLOCK AND OIL PAN HEATEER NOT GOOD  
Took old heated cord out and replaced block heater and re routed cord. - Paul(3)

13) TRANSMISSION OIL DIRTY  
Changed transmission oil. - Paul(2)

14) AIR COMPRESSOR LEAKING OIL  
Replaced power steering pump seal and air compressor seal. - Matt(3)

Total Labor	2,130.00
Total Parts	1,938.00
Total Returns	.00
Total Sublet	.00
Shop Supplies	106.50
Invoice Total	4,174.50



PVT Energy Group Inc.  
 93-721071 Range Road 53  
 County of Grande Prairie, AB, T8X 0N4  
 Phone: 780-830-0045  
 Fax: 780-830-5164

Equipment: C1131

Work Order #: 46260  
 Date: 03/29/24

Completed Date: 03/31/24

Year: 2015  
 Make: Kenworth  
 Model: T800  
 Odometer: 356,782  
 Hours: 32,402

Serial Number: 1NKDX4EX8FJ972439

## Labor

Category	Description	Mechanic	Quantity/Hours	Price/Rate	Amount
LABOUR INTERNAL (PVT ...	Starter replacement	Gillis, Peter	5.00	60.00	300.00

## Parts

Description	Quantity/Hours	Price/Rate	Amount
D61-6005-003, STARTER, C15, ISX15	1.00	775.81	775.81

### 1) REPLACE STARTER

Started bolts seized, had to cut them out. Install new starter, tested, good. - Peter(5)

### 2) 2" BALL VALVE PS

Looked for replacement valve in parts room etc, couldn't locate parts needed. - Peter(.5)

Total Labor	300.00
Total Parts	775.81
Total Returns	.00
Total Sublet	.00
Shop Supplies	15.00
Invoice Total	1,090.81



PVT Energy Group Inc.  
 93-721071 Range Road 53  
 County of Grande Prairie, AB, T8X 0N4  
 Phone: 780-830-0045  
 Fax: 780-830-5164

Equipment: C1131

Work Order #: 45676

Date: 02/26/24

Completed Date: 02/29/24

Year: 2015  
 Make: Kenworth  
 Model: T800  
 Odometer: 355,064  
 Hours: 32,264

Serial Number: 1NKDX4EX8FJ972439

## Labor

Category	Description	Mechanic	Quantity/Hours	Price/Rate	Amount
LABOUR INTERNAL (PVT ...	service	Kreutz, Ben	2.50	60.00	150.00
LABOUR INTERNAL (PVT ...	cel on	Sabado, Paul	5.00	60.00	300.00
LABOUR INTERNAL (PVT ...	ground reel	Cardinal, Dayne	1.00	60.00	60.00
LABOUR INTERNAL (PVT ...	beaver tails	Kreutz, Ben	1.00	60.00	60.00
LABOUR INTERNAL (PVT ...	blower filter	Cardinal, Dayne	.50	60.00	30.00
LABOUR INTERNAL (PVT ...	drain valves	Cardinal, Dayne	1.00	60.00	60.00
LABOUR INTERNAL (PVT ...	wash pump failure	Gillis, Peter	9.50	60.00	570.00
LABOUR INTERNAL (PVT ...	wash pump failure	Farquhar, Brian	2.00	60.00	120.00
LABOUR INTERNAL (PVT ...	repair handle	Gillis, Peter	.50	60.00	30.00
LABOUR INTERNAL (PVT ...	latch repair	Gillis, Peter	.50	60.00	30.00
LABOUR INTERNAL (PVT ...	psv repair	Gillis, Peter	.50	60.00	30.00
LABOUR INTERNAL (PVT ...	5k gauge	Gillis, Peter	.50	60.00	30.00
LABOUR INTERNAL (PVT ...	seized hyd fitting	Gillis, Peter	1.00	60.00	60.00
LABOUR INTERNAL (PVT ...	replace fuel tee	Sabado, Paul	3.50	60.00	210.00
LABOUR INTERNAL (PVT ...	clutch brake	Kreutz, Ben	1.00	60.00	60.00

## Parts

Description	Quantity/Hours	Price/Rate	Amount
244S, FILTER, BLOWER (14916)	1.00	209.08	209.08
SDH-100, GROUND REEL, MAN 100'	1.00	476.92	476.92
AF4195FLG, FILTER, AIR	1.00	94.87	94.87
LF14000NNFLG, FILTER, OIL	1.00	50.86	50.86
WF10123, SPIN-ON FUEL FILTER	1.00	53.24	53.24
FS20172FLG, FUEL/WATER SEPERATOR	1.00	38.35	38.35
CFR19501, FILTER, CAB AIR	1.00	11.20	11.20
SB200, CLUTCH BRAKE 2PC	1.00	52.00	52.00
SS5950, SENSOR, COOLANT LEVEL	1.00	57.89	57.89
LND-REB, ALUM GROUND CLAMP	1.00	42.12	42.12
SDH-100, GROUND REEL, MAN 100'	1.00	476.92	476.92
2G-3/8, 3/8" STAINLESS BALL VALVE	1.00	28.61	28.61
100T-100, 1" BALL VALVE 600WOG	1.00	20.00	20.00
2252-1D, SPLITTER, RETURN NORM FLOW	1.00	141.44	141.44
31292, KIT, VALVE REPAIR, CAT PUMP	1.00	1,225.69	1,225.69
31280, SEAL KIT, CAT PUMP	1.00	502.63	502.63
30278, OILER, CAT PUMP GRAVITY FEED	3.00	102.80	308.40
44096, PUMP CAT PART WICK	3.00	5.03	15.09
44119, RETAINER SEAL W/O PUMP	3.00	22.70	68.10
48535, PLUNGER PISTON, CAT PUMP	3.00	218.99	656.97
49038, RETAINER, SEAL CAT PUMP	3.00	83.77	251.31
6100, CAT PUMP OIL/ BULK BOTTLES	1.00	15.32	15.32
727, OILER, 16OZ THUMB PUMP	1.00	34.55	34.55
87112310, VALVE, RELIEF 3000 PSI 3 NOTCH	1.00	129.78	129.78
W6F6-B, WING COUPLER , 3/4"	1.00	41.73	41.73

### 1) B SERVICE

Greased, inspected, changed oil and filter, checked fluid levels. - Ben(2.5)



PVT Energy Group Inc.  
93-721071 Range Road 53  
County of Grande Prairie, AB, T8X 0N4  
Phone: 780-830-0045  
Fax: 780-830-5164

- 2) REPLACE CLUTCH BRAKE  
Replaced clutch brake with new. - Ben(1)
  
- 3) CEL LIGHT IS ON  
Diagnosed, checked wiring harness and sensor, changed sensor. Paul(5)
  
- 4) REPLACE GROUND REEL  
Install new ground reel. - Dayne (1)
  
- 5) PUT BEAVER TAILS DOWN AND LUBE THEM  
Freed up beaver tails and lubricate - Ben(1)
  
- 6) REPLACE BLOWER FILTER  
Installed new blower filter. - Dayne(.5)
  
- 7) DRAIN VALVE HANDLES MISSING  
Installed new drain valve.-Dayne(1)  
Replaced fuel tee - Paul(3.5)
  
- 8) WASH PUMP SYSTEM FROZE UP TEST  
Tear down pump, remove/install 2 new pump kits. Continue to install other portion of another kit, install new pistons, packing wick, set oiler, waiting on further parts. - Peter(6.5)  
Put pump back together, function and pressure tested, good. - Peter(3)  
Tested wash pump and winterized unit, ok. - Brian(2)
  
- 9)STRAIGHTEN OUT VALVE HANDLE  
Straighten out handle in a vice.- Peter(.5)
  
- 10)REPAIR LATCH  
Repair piece on latch. - Peter(.5)
  
- 11) REPLACE PSV ON PUMP  
Replaced PSV. - Peter(.5)
  
- 12) REPLACE BUNK GAUGE  
replaced 5k gauge with new. - Peter(.5)
  
- 13)HYD FITTING SEIZED  
Replaced seized fitting, used air hammer and heat to break free and replace. - Peter(1)

Total Labor	1,800.00
Total Parts	5,003.07
Total Returns	.00
Total Sublet	.00
Shop Supplies	90.00
Invoice Total	6,893.07



PVT Energy Group Inc.  
 93-721071 Range Road 53  
 County of Grande Prairie, AB, T8X 0N4  
 Phone: 780-830-0045  
 Fax: 780-830-5164

Equipment: C1131

Work Order #: 41331

Date: 07/19/23

Completed Date: 07/25/23

Year: 2015  
 Make: Kenworth  
 Model: T800  
 Odometer: 340,853  
 Hours: 30,533

Serial Number: 1NKDX4EX8FJ972439

## Labor

Category	Description	Mechanic	Quantity/Hours	Price/Rate	Amount
LABOUR INTERNAL (PVT ...	2) REPLACE FRONT SPRINGS - Put truck on stand, remove wheel shock, front clamps on spring pin, rear shackles and remove spring. Got tiger tool and removed old spring pin bushing and installed new bushing. Put new pins in spring, cleaned up all shims and axle, got new spring lifted into place with u-bolts. Adjusted pins and installed caps and shackles, put shock on, put quarter fender on and put wheel back on	Gabriel, David	8.00	60.00	480.00
LABOUR INTERNAL (PVT ...	2) REPLACE FRONT SPRINGS - Assist installation of new leaf spring	Rea, Jacob	2.00	60.00	120.00
LABOUR INTERNAL (PVT ...	2) REPLACE FRONT SPRINGS - Complete same process on passenger side	Gabriel, David	6.00	60.00	360.00
LABOUR INTERNAL (PVT ...	3) DRIVE SIDE STEER SHOCK - Replace shock	Gabriel, David	1.00	60.00	60.00
LABOUR INTERNAL (PVT ...	2) REPLACE FRONT SPRINGS - Assist installation of new leaf spring	Rea, Jacob	2.00	60.00	120.00
LABOUR INTERNAL (PVT ...	1) A SERVICE - A service	Gabriel, David	2.00	60.00	120.00
LABOUR INTERNAL (PVT ...	5) DIFF #1 OUTPUT SEAL - Remove wheels on front drive and remove jack shaft	Gabriel, David	1.00	60.00	60.00
LABOUR INTERNAL (PVT ...	1) A SERVICE - Finish service	Gabriel, David	1.00	60.00	60.00
LABOUR INTERNAL (PVT ...	4) DIFF #1 FRONT J-BAR BUSHINGS - Put truck on stands, removed wheels, disconnected j-bar, removed old bushings. Installed new ones, had a hard time lining j-bars up to get new bolts in. Put bolts in and aligned.	Gabriel, David	7.00	60.00	420.00
LABOUR INTERNAL (PVT ...	7) PASSENGER SIDE BUMPER LIGHT OUT - Traced wires, found broken wire and fixed it.	Gabriel, David	1.00	60.00	60.00
LABOUR INTERNAL (PVT ...	1) A SERVICE - A service	Rea, Jacob	2.50	60.00	150.00
LABOUR INTERNAL (PVT ...	4) DIFF #1 FRONT J-BAR BUSHINGS - Assist installing bushing and lining bar up. Set cam to ensure alignment. Install wheels an toque to 500ft lbs.	Rea, Jacob	2.50	60.00	150.00



PVT Energy Group Inc.  
 93-721071 Range Road 53  
 County of Grande Prairie, AB, T8X 0N4  
 Phone: 780-830-0045  
 Fax: 780-830-5164

## Labor

Category	Description	Mechanic	Quantity/Hours	Price/Rate	Amount
LABOUR INTERNAL (PVT ...	5) DIFF #1 OUTPUT SEAL- Had to use torch to get yoke nut off, removed yoke, installed new seal and put yoke on. When we went to put nut on found threads destroyed when taking old nut off. Removed everything again and removed output shaft. Ordered new one, installed new bearings. Put output shaft back in with new bearings and race. Would not go together right. Removed shaft again, found out that the new races were wrong and bigger, had to reinstall with old races.	Gabriel, David	5.00	60.00	300.00
LABOUR INTERNAL (PVT ...	5) DIFF #1 OUTPUT SEAL - Assisted with pinion seal. Wrong races, had to install with old races. New snap ring too big. Had to use old snap ring.	Rea, Jacob	3.00	60.00	180.00
LABOUR INTERNAL (PVT ...	5) DIFF #1 OUTPUT SEAL - Install wheels, take off stands and torque to 500ft lbs.	Rea, Jacob	1.00	60.00	60.00
LABOUR INTERNAL (PVT ...	5) DIFF #1 OUTPUT SEAL - Finish up installing output shaft, had to fix up threads a bit, installed yoke and jack shaft.	Gabriel, David	2.00	60.00	120.00
LABOUR INTERNAL (PVT ...	5) DIFF #1 OUTPUT SEAL - put wheels on and torqued and took off stands	Gabriel, David	1.00	60.00	60.00
LABOUR INTERNAL (PVT ...	5) DIFF #1 OUTPUT SEAL - Cleaned up shop in am, cleaned bay after truck was parked.	Gabriel, David	2.00	60.00	120.00
LABOUR INTERNAL (PVT ...	5) DIFF #1 OUTPUT SEAL - repaired threads on output shaft.	De Jager, Brodie	3.00	60.00	180.00
LABOUR INTERNAL (PVT ...	6) AIR LINE PINCHED BEHIND V-BAR REINFORCEMENT BRACKET - Repaired airline.	Rea, Jacob	1.00	60.00	60.00

## Parts

Description	Quantity/Hours	Price/Rate	Amount
M5449, PIN, SPRING THRD (B65-1008)	2.00	20.95	41.90
MTB186, BUSHING, SPRING PIN (B13-1002)	2.00	34.05	68.10
M5447, PIN, SPRING-THREADED (B65-6008)	4.00	24.05	96.20
FSHUBW80, U-BOLT WASHER 7/8	8.00	1.45	11.60
FSHDN7/8GR8, DEEP NUTS 1 1/4AF	8.00	2.65	21.20
FSHSR7/8X28HT, THREADED STRAIGHT ROD 4" RD BEND	4.00	34.00	136.00
TLS059-0594-00, FRONT LEAF SPRING	2.00	885.25	1,770.50
85070, STEER AXEL SHOCK/GABRIEL	1.00	53.20	53.20
48100509, KIT- BUSHING FRONT PIVOT (UPPER)	1.00	275.60	275.60
210737DAN, SEAL, OUTPUT SHAFT	2.00	67.14	134.28
DUHP54BLK, ENGINE OIL, DURON UHP 5W-40 BULK	4.00	5.65	22.60
170-70-18X, STRAP KIT, SPL170	2.00	24.55	49.10
512894ETN, SHAFT KIT, OUTPUT D46-170H	1.00	362.61	362.61
513877ETN, SHAFT, THRU 1ST DIFF	1.00	114.75	114.75

### 1) A SERVICE

- A service
- Finish service

### 2) REPLACE FRONT SPRINGS

- Put truck on stand, remove wheel shock, front clamps on spring pin, rear shackles and remove spring. Got tiger tool and removed old spring pin bushing and installed new bushing. Put new pins in spring, cleaned up all shims and axle, got new spring lifted into place with u-bolts. Adjusted pins and installed caps and shackles, put shock on, put quarter fender on and put wheel back on



PVT Energy Group Inc.  
93-721071 Range Road 53  
County of Grande Prairie, AB, T8X 0N4  
Phone: 780-830-0045  
Fax: 780-830-5164

- Assist installation of new leaf spring
- Complete same process on passenger side

3) DRIVE SIDE STEER SHOCK

- Replace shock

4) DIFF #1 FRONT J-BAR BUSHINGS

- Put truck on stands, removed wheels, disconnected j-bar, removed old bushings. Installed new ones, had a hard time lining j-bars up to get new bolts in. Put bolts in and aligned.
- Assist installing bushing and lining bar up. Set cam to ensure alignment. Install wheels an toque to 500ft lbs.

5) DIFF #1 OUTPUT SEAL

- Remove wheels on front drive and remove jack shaft
- Had to use torch to get yoke nut off, removed yoke, installed new seal and put yoke on. When we went to put nut on found threads destroyed when taking old nut off. Removed everything again and removed output shaft. Ordered new one, installed new bearings. Put output shaft back in with new bearings and race. Would not go together right. Removed shaft again, found out that the new races were wrong and bigger, had to reinstall with old races.
- Assisted with pinion seal. Wrong races, had to install with old races. New snap ring too big. Had to use old snap ring.
- Install wheels, take off stands and torque to 500ft lbs.
- Finish up installing output shaft, had to fix up threads a bit, installed yoke and jack shaft.
- put wheels on and torqued and took off stands
- Cleaned up shop in am, cleaned bay after truck was parked.
- repaired threads on output shaft.

6) AIR LINE PINCHED BEHIND V-BAR REINFORCEMENT BRACKET

- Repaired airline.

7) PASSENGER SIDE BUMPER LIGHT OUT

- Traced wires, found broken wire and fixed it.

Total Labor	3,240.00
Total Parts	3,157.64
Total Returns	.00
Total Sublet	.00
Shop Supplies	162.00
Invoice Total	6,559.64



PVT Energy Group Inc.  
93-721071 Range Road 53  
County of Grande Prairie, AB, T8X 0N4  
Phone: 780-830-0045  
Fax: 780-830-5164

Equipment: C1131

Work Order #: 37365  
Date: 01/03/23

Completed Date: 01/03/23

Year: 2015  
Make: Kenworth  
Model: T800

Serial Number: 1NKDX4EX8FJ972439

## Parts

Description	Quantity/Hours	Price/Rate	Amount
92674, PUMP RAIL KIT 126611	1.00	324.75	324.75
3560, PUMP CAT PLUNGER 20GPM @ 4000 PSI	1.00	8,528.49	8,528.49
24240, THREADLOCK, BLUE	1.00	30.47	30.47
49038, RETAINER, SEAL CAT PUMP	1.00	117.43	117.43
DC200AL, ALUM 2" FEMALE CAMLOCK CAP	1.00	21.74	21.74
		Total Labor	.00
		Total Parts	9,022.88
		Total Returns	.00
		Total Sublet	.00
		Shop Supplies	.00
		Invoice Total	9,022.88