



INDEX

## MAINTENANCE MANAGEMENT SCHEDULED MAINTENANCE

Prime Mover	Make/Model	Kenworth K200				Lead Trailer	Make/Model					Make/Model				
	Date of Manufacture	2017					Date of Manufacture					Date of Manufacture				
	Engine/VIN No.:	79965490 / 6F5000000HA458705					Engine/VIN No.:					Engine/VIN No.:				
	Registration No.:	XN56BP					Registration No.:					Registration No.:				
SERVICE TYPE	RECOMMENDED KMS	ACTUAL KMS	INTERVAL	DATE	ACCREDITED MAINTENANCE PROVIDER			ADDRESS		JOB OR INVOICE NUMBER	COMMENTS & ADDITIONAL WORK					
First service	10,000	19540	-	9,540	28/08/2017	Central West Diesel			Forbes	27132	First service					
B SERVICE	40,000	82743	-	42,743	8/12/2017	Central West Diesel			Forbes	28808	C service,					
B SERVICE	100000	118054	-	18,054	6/02/2018	Central West Diesel			Forbes	29549	B service, service ice pack, repair bottom tank gasket leak					
C SERVICE		187141			24/05/2018	Central West Diesel			Forbes	31222	C service, serviced ice pack, tune up					
B SERVICE		217140			11/07/2018	Twin City Truck Centre			Wodonga	1456366	B service,					
C SERVICE		297530			12/03/2019	Hartwigs Mechanical Altherton			Altherton	9782	C service, blew out and pressure cleaned radiator and intercooler,condenser, service ice pack					
B SERVICE		381907			22/07/2019	Inland Truck Centre			Orange	S201282	B service, replace air filter					
C SERVICE		558705			9/10/2019	Inland Truck Centre			Dubbo	S201403	C service, machine new chassis insert & locator plates, steer shocks, repair wiring to ice pack alternator					
C SERVICE		458705			13/02/2020	Inland Truck Centre			Orange	S201595	C service, replaced rear drive axle shoes and drums, rebuilt air dryer unit with new kit, fit new exhaust silencer, fill auto greaser, replaced air filter					
B SERVICE		556761			27/05/2020	Twin City Truck Centre			Albury	1551541	B service, repair exhaust leak, service icepack, repair horton, repair diff oil leak, replace tank straps, replace engine mounts, repair lights					
C SERVICE		661930			14/12/2020	Brown & Hurley			Coffs Harbour	2073994 and 2074060 (oil change)	Reline front axle A trailer and grease trailer, reline middle axle B trailer and grease trailer, crimped new terminals on wires for blinker buzzer, replaced bolt and washer on grill, ice pack service, repaired RH steer wheel bearing, installed new screws and tensioned shroud under cab, tightened cross member at rear or gearbox, replaced hose in coolant. Oil change on separate invoice.					
B SERVICE		689385			26/02/2021	Brown & Hurley			Coffs Harbour	2127356	B service, change mineral diff oil, repair TV and light bar, replace burnt out relay for lights, repair wiring to TV switch, replaced missing fuse in drivers step, replaced LH cab shock, adjusted top RH boost clamps, tightened bottom radiator bolts, refilled air dryer replaced intake pipe rubbers, replaced linings and drums on both axles, tensioned all wheels, adjusted brakes, fitted new rubber to tank strap and remounted with a new bolt and nut, repaired broken wiring in number plate					
B SERVICE		764130			24/06/2021	Brown & Hurley			Coffs Harbour	2217798	Replace engine oil and fuel filters, adjustes brakes, changed diff oils, Removed and replaced wheel bearings brake linings and hub seal					
B SERVICE		824894			11/10/2021	Cummins			Newcastle	9118613	B service and replace the diff oils.					
B SERVICE		847015			29/11/2021	Brown & Hurley			Burpengary	2347124	B service, AC hose to compressor broken, aftertreat light intermittently coming on, transmission shifting issues, cigarette lighters behind seats not working.					
C SERVICE		17618			16/09/2022	Twin City Truck Centre			Wodonga	1689068	C service					
B SERVICE		40655			2/11/2022	Twin City Truck Centre			Wodonga	1696874	B service					
C SERVICE		102516			21/02/2023	Twin City Truck Centre			Wodonga	1716703	C service - Replace tie rod ends, installed new grease fitting, replace worn torque rod brushes, eplace cab shocks, replace front diff temp gauge, replace cabin filter, repair tank strap rubbers, repaired cracked exhaust, replace bent adblue injector, replace engine belts, replace LHF drive hub seal, replace front engine mount rubbers, replaced windscreen washes, adjusted brakes, repaired turntable foot bushes, replaced leaking heater tap					
B SERVICE		155158			23/05/2023	Forbes Truck Alignment			Forbes	2028	B service, heater taps leaking, rear diff leaking					
B SERVICE		1177951			18/10/2023	Cummins			Newcastle	9659948	B service					
A service		263399			10/01/2024	Brown & Hurley			Tamworth	31209038	A service / engine service					
C SERVICE		277368			18/03/2024	Glen Arthey Truck Repairs			Tamworth	71050	C service - Removed all boost pipes, coolant hoses. Drained coolant. Removed radiator stay. Removed front grill, undid A/C condenser. Removed oil cooler from bottom of radiator, lighted out radiator, cleaned out radiator and intercooler. Cleaned bottom tank were mounts had snapped out, cleaned broken mount and straightened. Tacked into place. Welded mount into place. Painted bare metal. Refit intercooler and shroud. Changed out bottom radiator bushes, refit radiator to truck. Refit all pipes, hoses, clamps, cooler, bottom radiator mounts nuts and radiator stay. Replaced outer bushes on radiator stay. Reconnected all plugs, lines, hoses. Filled radiator with coolant. Refit A/C condenser and grill. Found leak top hose. Replaced clamp. Removed old chrome spotlights, placed in cab. Removed lightbar from top of bar, fit to bottom rail. Fit new spotlights to top of bull bar. Due to new lights having a big current draw and different settings that can be operated by a switch, was not able to use the factory Kenworth wiring for lights. New lights came with a harness, needed to modify to fit the truck. P clamps, conduit and zip ties. Placed tools for adjusting lights in cab. Inspected G light on dash. Turned off using sequence in cab with gearstick and brake pedal. Disconnected old electrical sizzle coil and replaced with new. Removed walk plate, dropped oil from isopack. Removed air filter and fuel filter, replaced with new, tightened. Drained bung and filled with new oil. Replaced both rear brae lights as LEDs were not working in both. Found the plug for reverse switch on gearbox was loose. Tightened, tested, all working. Connected ABS test light. Found LHD sensor code. Removed LHRD wheel, cleaned sensor and pushed back into place, torxed wheel. Refit wheel, tensioned. Removed dash panel, replaced bulb in volt meter. Adblue light only works when key is on. Drove truck onto pit. Used strap to hold drive shaft. Removed UNI bolts. Tightened input shaft nut. Refit shaft with new bolts. Left hand side shock mount was loose. Removed mount, fit new mount, tightened. Fit old shock with new bushes, tightened all nuts. Attempted to remove bolts from bar to add a washer, found they were seized. Cut off bolt heads. Replaced with new nuts, bolts and washers. Removed wheels, axles and hub. Found bearings unserviceable. Replaced bearings and cones. Lubed bearings and filled hub with diff oil. Fit new wheel seal. Fit hub and bearings, fit axle. Refit wheel, tensioned wheel. Jacked up chassis, attempted to removed airline hose, heated airline, sprayed black magic on nut, cracked nut, removed top bolts and bottom nut. Removed old airbag and fit new. Connected airlines, tightened all bolts. Removed and replaced turbo inlet boot. Found cable for steering adjuster had come off. Refit, tightened cable to prevent coming off. Re-greased grease nipple.					
B SERVICE		314597			31/05/2024	Glen Arthey Truck Repairs			Tamworth	72316	Carried out B service as per GATR service sheet. Tightened LH steer top shock as per request. Removed and replaced 2 windscreen wiper arms and one windscreen wiper blade. Confirmed fault, checked pins on switch, checked power supply and earth. Found switch to be faulty. Removed and replaced. Inspected driver window, greased runners, tested all okay. Inspected cab short, found wiring melted to PS work light. Rewired and tested. All okay. Removed and replaced 4 marker step lights. Greased bearing and reset G light. Topped up rear diffs and gear box oil. Secured hoses away from air bags to prevent rubbing. Inflated tires to 120psi. Re-insulated bare wires above right side air tank.					