

This live tracking will be terminated at: 01 Dec 2029 23:59

+  
-



i

Location: RIDING BOUNDARY RD, RAVENHALL

Serial#: K0860028

Hour/Odometer: 229

Next Service: 1000

## Maintenance History

---

Type	Date	Comments
REPAIRS	25/08/2025	Replace Control Desk
REPAIRS	2/06/2025	ENGINE REPLACEMENT
REPAIRS	17/03/2025	Remove mesh from Kleemann grid and run as required
REPAIRS	12/09/2024	replace screen bearing
REPAIRS	8/08/2024	Refit Feed Hopper wing
REPAIRS	24/07/2024	Replace screen Bearings 16/07/2024
REPAIRS	11/04/2024	Steel to be removed from screen.
RECORD 360	9/01/2024	Record 360
REPAIRS	22/08/2023	Feed belt jammed with rock, bent brackets
EXTERNAL SERVICE	15/08/2023	Writgen training pack up and move

EXTERNAL REPAIR	9/08/2023	Torn belt fenner
REPAIRS	27/10/2022	27/10/22 @ 863hrs Check over machine, fit all cover plates ( which were removed for transport from Skye) extend all conveyors and test run
OTHER	5/07/2022	risk assessment
EXTERNAL SERVICE	21/03/2022	supply & fit new cable assembly
SERVICE/REPAIR	14/12/2021	14/12/21 To site free up feed conveyor speed control
EXTERNAL SERVICE	17/11/2021	Conveyor Belt torn, possible from railway spike.
SERVICE/REPAIR	11/11/2021	11/11/21@822hrs Get Screen ready for transport
SERVICE/REPAIR	15/01/2019	CHANGE SCREENS TO 40MM TOP DECK - STOCK OK CHANGE SCREENS TO 20MM LOW DECK - STOCK OK WIRTGEN SUPPLIED 5 X 20MM LOWER SCREENS
PARTS	31/07/2018	SCR001 on 31/7/18 Hex set Screw GR8.8 M20 X 150 Z/P - x5 @ \$35.0
PARTS	26/07/2018	SCR001 on 26/7/18 Hex set screw GR8.8 M20 X 150 Z/P \$0.00 H/T Bolt 8.8 M20 X 150 ZP \$3.52 Wasca high tensile zinc CR3 3/4 (20MM) X 38.00 X 3.2MM \$0.31 Total \$3.83(incl. \$0.35 GST)
PARTS	26/07/2018	SCR001 on 26/7 - 31/7 Rubber profil cord 20,0M - \$252.20 Freight charges - \$100.00
SERVICE/REPAIR	25/07/2018	25.7.18-CHANGE OUT SCREENS TOP DECK 60MM MESH BOTTOM DECK PIANO WIRE LABOUR \$1020.00
REGISTRATION	13/06/2018	SCR001 on 13.6.18 Arrived on site and set machine up for screen mesh change. Removed bottom deck 4mm aggivibe meshes x3 and found 2 off the screen meshes have large hole in them. The decision was made to replace the 4mm aggivibe meshes w/ 6mm aggivibe. After meshes were replaced moved to the back of the machine and replaced the locking tab for the rear locking pin. While on site replaced the tensioner bolts to the new version. Working time x3.50hr \$120.00 Travel time x1.00hr \$100.00 Mileage x20.00KM \$1.20 Consumables 1pc \$25.00 GST \$56.90 Total - \$625.90
SERVICE/REPAIR	30/04/2018	SCR001 at 641hrs 30/4/18 - Initial 500hr service. 500hr service kit x1 400litres Hyd.oil Engine oil x9 Engine lube, filter x1 Fuel filter x2 SCR001 at 674hrs 9/5/18 - Travel to ODR site - general check of machine, overburden conveyor belt - Not Running True - adjust as required - clean out grizzly/hopper mesh etc. Test run machine - all OK.
EXTERNAL SERVICE	15/03/2018	SCR001 at 554hrs. 15/3/18 - Warranty fault, hydraulic motor adrift from mounting plate. Organise kleenman/service order parts from germany. 20/3/18 - All parts fitted - machine OK to run. 22/3/18 - Run machine x1 belt not moving (excess material to heavy). Set machine to access components + start shoveling out material. 24/3/18 554hrs - Continue clean out + reset machine + operate - OK.
SERVICE/REPAIR	9/01/2018	SCR001@394hrs carry out 250 hr service carry out machine inspection repair wiring harness (broken wires) Parts \$145 labour \$446.25
EXTERNAL SERVICE	8/07/2017	SCR001 @91hrs carry out initial 50hr service