

This live tracking will be terminated at: 15 Dec 2028 23:59

+  
-



i

Location: BEATTIE RD, JINDIVICK

Serial#: VAT7045617B028888

Hour/Odometer: 8681

Next Service: 9000

## Maintenance History

---

Type	Date	Comments
REPAIRS	1/06/2026	Lime boring works.
REPAIRS	5/08/2025	TYRE REPLACEMENT
REPAIRS	10/06/2025	CUTTING EDGE BOLT
REPAIRS	6/06/2025	HOOD LATCH
REPAIRS	6/06/2025	FOOT ACCELERATOR
REPAIRS	24/03/2025	WL01 SERVICE KIT
REPAIRS	5/03/2025	TWO NEW BATTERIES
REPAIRS	4/03/2025	LOCKABLE ISOLATER SWITCH
REPAIRS	27/02/2025	AIRCON GAS
REPAIRS	11/02/2025	REPAIRS FOR BLOWN HOSE
REPAIRS	19/09/2024	Beacon light not working

REPAIRS	18/06/2024	2 x batteries
REPAIRS	24/11/2023	Alternator not charging
REPAIRS	9/11/2023	Electrical problems
PARTS	2/11/2023	2 x Batteries flat and U/S
EXTERNAL REPAIR	24/10/2023	Bucket work, patches, strengthening to keep going
EXTERNAL SERVICE	16/10/2023	Transport from elder st to Workshop
SERVICE	13/10/2023	8000hr service
REPAIRS	20/06/2023	Boom hose leaking
SERVICE	20/06/2023	Hydraulic contamination switch fault
REPAIRS	19/06/2023	Hydraulic swarf sensor warning
REPAIRS	8/06/2023	Front wiper not working
EXTERNAL SERVICE	26/05/2023	No drive issue,
EXTERNAL REPAIR	23/05/2023	Hydraulic hose leaking Sublet Enzed Moorabin
REPAIRS	18/05/2023	Beacon n/w
REPAIRS	12/05/2023	Fuel cap missing
EXTERNAL REPAIR	11/05/2023	Front wiper not working MT mechanical
REPAIRS	20/03/2023	BUCKET CUTTING EDGES NEED REPLACING
EXTERNAL SERVICE	17/02/2023	7,000hr type service @76##
REPAIRS	2/02/2023	Hydraulic sensor showing Swarf codes
EXTERNAL REPAIR	15/12/2022	Grease lines on z bar damaged and leaking Sublet to ended Moorabbin
REPAIRS	15/12/2022	UHF radio n/w
REPAIRS	7/12/2022	Steering column tilt non function
REPAIRS	26/10/2022	Beacon N/W
SERVICE/REPAIR	19/09/2022	Bucket cutting edges u/s stock edges, need to reorder
REPAIRS	6/09/2022	site reported broken fuel cap
SERVICE/REPAIR	12/08/2022	Hydraulic oil leak underneath near park brake disc O rings P/N 10813831 Liebherr
OTHER	5/07/2022	risk assessment
PARTS	31/03/2022	hydraulic oil x 4 and main battery switch x 1
EXTERNAL SERVICE	23/03/2022	WL01 @7073hrs Hydraulic Oil Loss major
EXTERNAL SERVICE	27/09/2021	Carry out repairs to bucket pick ups with weld s/fit up wear plates underneath bucket for heel plates and fully weld
SERVICE/REPAIR	15/09/2021	float shift from Hallam to Elder St

SERVICE/REPAIR	14/09/2021	TURN CUTTING EDGES REPAIR GREASE LINES REPLACE UHF RADIO CHECK OVER MACHINE
EXTERNAL SERVICE	26/05/2021	WL01@6886HRS Throttle pedal fault requires adjust and recalibrate G & J mechanical
EXTERNAL SERVICE	23/11/2020	air con not working
EXTERNAL SERVICE	9/11/2020	fit new yokohama tyres x 4
EXTERNAL SERVICE	23/10/2020	swarf sensor not working on travel pump
PARTS	25/09/2020	flange joint, high pressure hose, hinged threaded union, grease line
PARTS	16/09/2020	service kit and sample bottles
PARTS	15/09/2020	hoses x 2
EXTERNAL SERVICE	9/09/2020	WL01@6658hrs Carry out 6,500hr service as per Liebherr. tighten fittings on header tank
PARTS	28/08/2020	hoses x 2
PARTS	26/08/2020	angle sensor
SERVICE/REPAIR	19/08/2020	Low power, engine de-rated
PARTS	17/07/2020	sealing ring, angle cutter & knife
EXTERNAL SERVICE	16/09/2019	19/9/19 WL01@6158hrs Liebherr carry out 6,000hr service as per Liebherr schedule
SERVICE/REPAIR	22/03/2019	22/3/19 - WL01 @ 5887 HRS CUTTING EDGES & HARDWARE REPLACE 25/3/2019 - FIT ONE EDGE & REPAIR UHF RADIO & RESET
SERVICE/REPAIR	16/02/2019	FOUND NO GAS IN SYSTEM. LOCATED LEAKING ORING ON COMPRESSOR, REPLACED THE ORING. VACUUM SYSTEM & CHARGED TO MAN SPECS.RESET AC CONTROLLERS CHECKED OPERATIONAL PRESSURES AC NOW WORKING. TRAVEL PARTS LABOUR \$520.00
SERVICE/REPAIR	20/11/2018	TRAVEL TO SITE AND WASH DOWN MACHINE LABOUR \$191.25
SERVICE/REPAIR	2/02/2018	WL01 at 5496hrs. carry out 5500hrs service. Battery pos to neg link. 250-300mm R.H.F work light N/W Sample gun failed, to still to sample oils- oil leak slight - hose - steering under cab/artic area minor Transmisson seal leaking - Hood release needs attention.
SERVICE/REPAIR	1/02/2017	WL01 at 5277hrs. Source bolts at dandy bolts, travel to elder st, drill out broken bolt in Z bar retainer pin, tap new 16mm threads, s/fit bolts and washers. Bolts/washers 16mm tap \$96.98
SERVICE/REPAIR	25/01/2017	WL01 supply and fit new UHF radio
SERVICE/REPAIR	19/07/2016	WL01@5237hrs engine wont start,found speed sensors U/S and starter motor burnt out due to excessive cranking.source new starter motor from Ashdown/ingrams and fit up. contract liebherr to s/fit 2x new speed sensors. starter motor \$633.00 Labour Lantrak \$395.25 speed sensors \$979.00 labour Liebherr \$198.85 Total \$2206.10
SERVICE/REPAIR	15/07/2016	WL01 at 5236hr. Check over - 5250hr type service, Hard start, found speed sensor N/W. Starter motor U/S, Remove starter. Liebhier to fit speed sensors. WL01 at 5237hrs. Source starter motor, modify turbo drain pipe. (heat + bond) fit new silicone elbow. Fit starter motor + Test - OK!! Check code history - fault first 5/7/2016 + most days after that.

SERVICE/REPAIR	30/06/2016	WL01 at 5168hrs. Check over- S/fit new wiper blade assembly. Check auto greaser, add two cartridges of grease.. 1.7.2016 at 5170hrs. Check over machine - all ok - lube door catch (stiff) Note. Transmission front oil seal weeping -(slight)
SERVICE/REPAIR	25/05/2016	WL01 at 5114hrs. Check over loads after , leibherr prepared pump seals - OK ALL Adjusted engine hatch release - (too tight) Fluid levels OK grease point all OK
SERVICE/REPAIR	4/01/2016	WL01@4953hrs carry out 5,000hr type service repair fuel filter housing bleeder screw stripped, remove housing, source new plug and tap new thread. weld exhaust muffler (cracked) replace step rubbers straighten side steps and rails weld repairs to Bucket, weld cracks, fabricate wear plates and weld to underside of bucket. s/fit new wiper blade.
SERVICE/REPAIR	5/10/2015	WL01@4783hrs carry out 4750hr type service
SERVICE/REPAIR	16/09/2015	WL01@4735HRS TURN CUTTING EDGES, AND REPLACE HARDWARE
EXTERNAL SERVICE	1/09/2015	WL01 fit radiator coolant header tank assy, and coolant.
SERVICE/REPAIR	26/08/2015	WL01 REPLACE COOLANT BOTTLE ASSY.
SERVICE/REPAIR	10/06/2015	Travel to site, test batteries(failed load test), jump start machine so as can use, source new batteries ,N150 Euro batteries, return to site, remove old batts, clean battery compartment, clean terminals, fit 2x new batteries and test, all OK.
SERVICE/REPAIR	14/05/2015	WL01@4459hrs carry out 4,500hr service as per Liebherr schedule
SERVICE/REPAIR	31/03/2015	WL01@4319HRS RADIATOR HOSES SWEELING. REPLACE TOP AND BOTTOM RADIATOR HOSES,CLAMPSX4,COOLANT X 40 LITRES
SERVICE/REPAIR	31/03/2015	WL01@4319HRS CARRY OUT 4250 HR SERVICE
SERVICE/REPAIR	6/03/2015	WL01 RADIATOR HOSES SWELLING,ORDER NEW HOSES AND COOLANT FOR REPLACEMENT
SERVICE/REPAIR	28/01/2015	28/1/15,5HRS WL01@4052HRS 4,000HR SERVICE,PART SERVICE STILL TO BE COMPLETED.
SERVICE/REPAIR	21/01/2015	WL01@4042HRS ON SITE AT OLD DANDY RD PREPAIR AND WELD QUICK HITCH PINS WITH STAINLESS RODS. 27/1/15 Original Bucket refitted(at weld it for repairs to hitch hooks)loan Bucket returned to Liebherr this day.
SERVICE/REPAIR	6/01/2015	WL01@3990HRS ON SITE OLD DANDY RD QUICK HITCH N/W,REMOVE BUCKET SEIZED PINS,BROKEN CLEVIS PINS,BROKEN CYINDER ROD. REMOVE CYINDER ASSY,TAKE TO ENZED FOR WELD REPAIRS,WELDER NO GOOD.BACK TO SITE PACK UP ALL ON SITE, TRAVEL TO HOME TO WELD AND REPAIR CYLINDER 7/1/15 OLD DANDY RD SITE,FIT REPAIRED CYLINDER AND TEST, ALL OK.
SERVICE/REPAIR	28/10/2014	WL01@3781HRS CARRY OUT 3750 HR SERVICE,REPAIR BEACON N/W REWIRE SHORT AND REPLACE GLOBE AND FUSE CLEAN OUT ALL COOLERS AND AIR FILTERS CHECK FOR HYD OIL LEAKS,ALL OK.
EXTERNAL SERVICE	27/10/2014	28/10/14 WL01@3781HRS LIEBHERR TO SITE,INSPECT MACHINE STEERING COLUMN DAMAGE AFTER ACCIDENT (ROHAN) TAG MACHINE OUT AND ORDER PARTS FOR STEERING COLUMN. ORDER WINDSCREEN. 28/10/14 GREG FROM LIEBHERR ONSITE FOR STEERING COLUMN REPAIRS.
SERVICE/REPAIR	1/09/2014	1/9/14@3552HRS WL01 OLD DANDY RD SITE S/FIT NEW CUTTING EDGES AND HARDWARE.
SERVICE/REPAIR	8/07/2014	WL01@3301HRS CARRY OUT 3250 HR SERVICE REQUIRES- BUCKET TOP LUGS WELDING,PUMP HOSE STARTING TO WEEP,QUICK HITCH WONT RELEASE,GREASE SYSTEM CHECK OPERATION.
EXTERNAL SERVICE	21/03/2014	WL01@2967hrs carried out by liebherr dandenong 3,000hr type service,

EXTERNAL SERVICE	29/01/2014	WL01 STEERING COLUMN COLLASPED REPLACE GAS SPRING,PINS AND NUTS PARTS
SERVICE/REPAIR	13/01/2014	WL01@2792HRS SOURCE HYDRAULIC OIL FROM LIEBHERR TAKE TO SITE OLD DANDY RD SUBCONTRACT BLOWN HOSE TO ENZED MOORABIN
SERVICE/REPAIR	10/01/2014	WL01@2761HRS CARRY OUT 2750HR TYPE SERVICE. REPLACE ENGINE OIL,OIL FILTERS,SAMPLE ENGINE OIL,CHECK OVER MACHINE.
EXTERNAL SERVICE	16/12/2013	WL01 STEERING COLUMN SUPPORT STRUT FAILED CONTRACT LIEBHERR FOR REPAIRS
SERVICE/REPAIR	15/11/2013	WL01 15/11/13 CARRY OUT 2500 HR SERVICE@2628HRS replace engine oil filters, fuel filters, outer air filter, check all fluid levels, auto grease operation, radiators and coolers, splitter box levels, tyres and pressures, as per service schedule
SERVICE/REPAIR	8/10/2013	WL01@2488HRS BUCKET QUICK HITCH WILL NOT RELEASE REPAIR HYD.PIN ACTIVATORS CLEVIS PINS U/S TEST ALL OK INFORM OPERATOR PIN ID NEEDS TO BE CHECKED DAILY
SERVICE/REPAIR	23/07/2013	WL01 CARRY OUT 2250HR@2215HRS
SERVICE/REPAIR	23/05/2013	S/FIT NEW CUTTING EDGES AND HARDWARE ON SITE AT OLD DANDY RD
EXTERNAL SERVICE	21/05/2013	WL01 2,000HR SERVICE AT 1998HRS
SERVICE/REPAIR	15/04/2013	1750HR SERVICE @ 1802HRS SERVICE DELAYED AS COULD NOT GET TO MACHINE DUE TO OTHER WORK..... LIEBHERR REPLACED STARTER MOTOR NOT UNDER WARRANTY.....DUE TO HRS AND TIME (ELECTRICAL)
SERVICE/REPAIR	14/02/2013	1500HR SEVICE@ 1513HRS CHECK OVER MACHINE ALL OK
SERVICE/REPAIR	7/02/2013	7/2/13 TRAVEL TO OLD DANDY RD REMOVE AND TURN AND REFIT CUTTING EDGES
SERVICE/REPAIR	4/02/2013	REMOVE QUICK HITCH COVER,REFIT QUICK HITCH INDICATOR,S/FIT 3 X MISSING BOLTS,REFIT COVER,CHECK QUICK HITCH OPERATION ALL OK.
SERVICE/REPAIR	16/01/2013	TRAVEL TO OLD DANDY RD SITE PRESSURE TEST COOLING SYSTEM,COULD NOT FAULT LEAK (HOLDING PRESSURE @15PSI) ADD 4 LITER WATER...INFORM OPERATOR HOW AND WHEN TO CHECK COOLANT LEVEL...
SERVICE/REPAIR	19/12/2012	1250HR SERVICE@1317HRS FIT SAETY DECALS
EXTERNAL SERVICE	30/11/2012	WL01 CARRY OUT INITIAL 1,000HR SERVICE @ 1023HRS ON SITE AT OLD DANDY RD.