

Work Order History

D41 DOZER - GPS

WO#	Date	Hours/Kms	Maintenance Required	Item No#	Priority	Date of Work	Work Done By	Details of Work Done	Parts Needed
90481	06-Aug-20	0	90481 Install telematics				Ross Kavney	Tracker fitted and registered	
	Service Type:			1	Minor Defects	08-Sep-20	Install telematics		
90482	06-Aug-20	0	90482 Fit fleet numbers				Damien Allison	Fit fleet and company decals	
	Service Type:			1	Minor Defects	11-Sep-20	Fit fleet numbers		
91457	31-Aug-20	0	91457 Telematics - not reporting cor				Cameron Smith	replace tracker and test - All working as should be	
	Service Type:			1	Equipment ineffective	09-Sep-20	Telematics - not reporting correctly to plant hours		
91465	31-Aug-20	150	91465 2000hr service due at 6000hrs				Rick Fitzpatrick	FINAL DRIVE- OIL CHANGE	
	Service Type: KOMATSU D65WX-16 DOZER			1	Service Due	25-Sep-20			
91929	10-Sep-20	6191	91929 check over for work				Rick Fitzpatrick	Complete check list, weld up cracked muffler, belly guard bolts loose. Fill up with fuel. all okay. Replace U/S water in fuel sensor.	
	Service Type:			1	Minor Defects	25-Sep-20			
91979	11-Sep-20	5981	91979 Update spreadsheet for D30 and				Koki Mukai	Completed	
	Service Type:			1	Minor Defects	14-Sep-20			
92041	14-Sep-20	5983	92041 Blade sensor initialising				Koki Mukai	Completed	
	Service Type:			1	Minor Defects	18-Sep-20			
92118	16-Sep-20	5999	92118 GPS auto fault				Ross Kavney	Intermittent fault. Will monitor	
	Service Type:			1	Equipment ineffective	06-Oct-20			
93223	12-Oct-20	0	93223 A/C not cold				Ross Kavney	Inspected system, found blocked condenser core. Wash out, and test ok	
	Service Type:								

Work Order History

D41 DOZER - GPS

WO#	Date	Hours/Kms	Maintenance Required	Item No#	Priority	Date of Work	Work Done By	Details of Work Done	Parts Needed
Service Type:									
93242	12-Oct-20	6083	93242 Fuel filter leaking	1	Equipment ineffective	16-Oct-20	A/C not cold Craig	Changed drain tap on primary filter sediment bowl on the 14-10-20.	
Service Type:									
93630	20-Oct-20	6119	93630 Autos not working	1	Minor Defects	15-Oct-20	Tyler Bell	Remeasured and calibrated	
Service Type:									
94287	05-Nov-20	0	94287 Engine keeps shutting down	1	Minor Defects	16-Nov-20	Lance Draper	Check the intermittent engine fault and found the wiring harness connector next to the battery to be faulty. Replaced the deutsch connector and removed the damaged excess wiring.	
Service Type:									
95478	02-Dec-20	302	95478 250hr service due at 6250hrs	1	Equipment ineffective	06-Nov-20	Craig	Done at 6254hr on hr meter on the 21-12-20.	
250 Service Type: KOMATSU D65WX-16 DOZER									
96065	17-Dec-20	0	96065 Blown hydraulic hose	1	Service Due	23-Dec-20	Allan Casserly	Replace main pump hose.	
Service Type:									
96169	21-Dec-20	6253	96169 Needs new cutting edge	1	Equipment ineffective	22-Dec-20	Craig	Fit new cutting edges and corner tips on the 14-1-21.	
Service Type:									

Work Order History

D41 DOZER - GPS

WO#	Date	Hours/Kms	Maintenance Required	Item No#	Priority	Date of Work	Work Done By	Details of Work Done	Parts Needed
96479	11-Jan-21	0	96479 A/C not working - fans are wor				Ross Kavney	Tested system, found intermittent fault. Everything working correctly .	
Service Type:									
				1	Equipment ineffective	20-Jan-21		A/C not working - fans are working	
98596	03-Mar-21	0	98596 Telematics - not reporting hou				Ross Kavney	Inspected . Found tracker faulty. Replaced and fitted new tracker and tested ok	
Service Type:									
				1	Equipment ineffective	08-Mar-21		Telematics - not reporting hours or GPS	
100095	13-Apr-21	0	100095 Bonnet latch won't open				Shane	Fit new left side engine bay door latch/ lock as required on the 20-4-2021	
Service Type:									
				1	Minor Defects	20-Apr-21		Bonnet latch won't open	
100096	13-Apr-21	0	100096 Blade centre pivot grease nipp				Shane	Replace damaged grease nipples and free up seized grease tracks in blade pivot on the 14-4-2021	
Service Type:									
				1	Minor Defects	15-Apr-21		Blade centre pivot grease nipple won't take grease	
100245	15-Apr-21	572	100245 500hr service due at 6500hrs				Craig	Done at 6541hr on hr meter on the 16-4-21	
500 Service Type: KOMATSU D65WX-16 DOZER									
				1	Service Due	16-May-21		ENGINE OIL- SAMPLE OBTAIN	
Service Type: KOMATSU D65WX-16 DOZER									
				46	Service Due	16-May-21		PM2-500 Service	
101922	27-May-21	0	101922 Prestart Failure - Air Seat wo				Lance Draper	Checked seat switch and ordered new part. Installed and tested	
Service Type:									
				1	Equipment ineffective	16-Jun-21		Prestart Failure - Air Seat won't resales air	

Work Order History

D41 DOZER - GPS

WO#	Date	Hours/Kms	Maintenance Required	Item No#	Priority	Date of Work	Work Done By	Details of Work Done	Parts Needed
102009	30-May-21	0	102009 250hr service due at 6750hrs				Glen McDonald	Service completed 26/6/21 at 6857 hrs. Took 15 lt trans oil	
250	Service Type: KOMATSU D65WX-16 DOZER								
				1	Service Due	27-Jun-21	ENGINE OIL- SAMPLE OBTAIN		
103386	30-Jun-21	0	103386 Replace hose assembly for fan				Kale Lindrea	Pirtek Sunshine coast have replaced hose assembly for fan motor	
	Service Type:								
				1	Equipment Down	12-Aug-21	Replace hose assembly for fan motor		
104361	23-Jul-21	0	104361 1000hr service due at 7000hrs				Glen McDonald	Service completed 2/8/21 at 7069 hrs	
1000	Service Type: KOMATSU D65WX-16 DOZER								
				1	Service Due	03-Aug-21	ENGINE OIL- SAMPLE OBTAIN		
				46	Service Due	03-Aug-21	PM2-500 Service		
				52	Service Due	03-Aug-21	PM3-1000 Service		
104807	02-Aug-21	7070	104807 Hydraulic Oil Temp Overheating				Kale Lindrea	replaced fan pump	
	Service Type:								
				1	Minor Defects	13-Aug-21			
104914	04-Aug-21	0	104914 Replace hydraulic hose - under				Kale Lindrea	Pirtek Sunshien coast completed Job	
	Service Type:								
				1	Equipment ineffective	12-Aug-21	Replace hydraulic hose - under floor		
105007	06-Aug-21	0	105007 Install grease nipple to blade				Kale Lindrea	replaced grease nipple	
	Service Type:								
				1	Minor Defects	13-Aug-21	Install grease nipple to blade centre pivot ball		
105008	06-Aug-21	0	105008 Rewire E stop				Ryan Gerken	E-stops have to be wired up this way with the Komatsu's.	
	Service Type:								
				1	Equipment ineffective	12-Aug-21	Rewire E stop		
105138	10-Aug-21	7098	105138 Replace Blade Lift Cylinder Ho				Allan Casserly	Replaced 4x blade lift cylinder hoses, new fittings, new spiral wrap, new hoses	

Work Order History

D41 DOZER - GPS

WO#	Date	Hours/Kms	Maintenance Required	Item No#	Priority	Date of Work	Work Done By	Details of Work Done	Parts Needed
Service Type:									
105429	17-Aug-21	7103	105429 Overheating	1	Equipment ineffective	13-Aug-21		Diagnosed over heating fault to load sense section of main implement valve Removed cab to access valve on disassembly found load sense vale has damaged main spools got spools and valve body lapped replaced all valves and seals in implement control valve	
Service Type:									
105635	20-Aug-21	7107	105635 blade repairs	1	Minor Defects	27-Sep-21	James	wear plates welded to each side of blade	
Service Type:									
107284	27-Sep-21	7111	107284 Workshop repairs	1	Equipment ineffective	02-Sep-21	Phil Knight	Replaced Belt Tensioner, Upper door locks, Shift button Rubbers, Operational Test, All Good. Genuine Parts Used	
Service Type:									
107458	30-Sep-21	7133	107458 Initializing	1	Minor Defects	07-Oct-21	Koki Mukai	Completed	
Service Type:									
108263	22-Oct-21	7198	108263 Blade heading initializing	1	Minor Defects	28-Oct-21	Koki Mukai	Completed	
Service Type:									

Work Order History

D41 DOZER - GPS

WO#	Date	Hours/Kms	Maintenance Required	Item No#	Priority	Date of Work	Work Done By	Details of Work Done	Parts Needed
108343	25-Oct-21	1442	108343 250hr service due at 7250hrs				Glen McDonald	Service completed 19/11/21 at 7269 hrs	
250	Service Type: KOMATSU D65WX-16 DOZER								
				1	Service Due	22-Nov-21	ENGINE OIL- SAMPLE OBTAIN		
108476	27-Oct-21	0	108476 Hydraulic oil leak / Drain tan				Phil Knight	Drain and Refill Hydraulic oil, 10W, Replaced suction screen filter and return filter, Due to contaminated oil entering system, Replaced leaking return hose from value bank to hydraulic tank, found cracked pilot valve case housing, Replaced, OEM Part On start up, found engine over heating fault, Washed out radiator, blocked up with mud, Water in fuel indicator on dash, Replaced faulty Sensor and replaced 2 x fuel filters, 7222hrs for Service, Operational Test, All Good.	
Service Type:									
				1	Equipment ineffective	06-Nov-21	Hydraulic oil leak - Drain tank & refill		
108516	27-Oct-21	7222	108516 Hydraulic oil leak				Phil Knight	Refer to WO 108476	
	Service Type:								
				1	Minor Defects	06-Nov-21			

Work Order History

D41 DOZER - GPS

WO#	Date	Hours/Kms	Maintenance Required	Item No#	Priority	Date of Work	Work Done By	Details of Work Done	Parts Needed
109475	22-Nov-21	0	109475 Prestart Failure - Two way radio works sometimes an then doe				Lance Draper	Check the uhf radio operation and found the aerial connections to be faulty. Repaired the aerial and retested.	
Service Type: 1 Equipment ineffective 24-Nov-21 Prestart Failure - Two way radio works sometimes an then doe									
109960	06-Dec-21	7291	109960 Body IMU electro mechanical error				Koki Mukai	Completed	
Service Type: 1 Minor Defects 09-Dec-21									
110035	08-Dec-21	0	110035 Prestart Failure - Hydraulic oil leak				Phil Knight	Replaced Case Drain hose from Fan motor to Rear of Hydraulic Tank, Topped up Hydraulic Oil, Operational Test, All Good.	
Service Type: 1 Equipment ineffective 10-Feb-22 Prestart Failure - Hydraulic oil leak									
110821	05-Jan-22	0	110821 Hydraulic oil leak - belly plates				Gavin Tomsen	Replaced hose from tank to fan case drain	
Service Type: 1 Equipment ineffective 12-Feb-22 Hydraulic oil leak - belly plates									
110868	06-Jan-22	7411	110868 Replaced Broken Engine Dip Stick				Phil Knight	Replaced Engine Dip Stick, Operational Test, All Good.	
Service Type: 1 Minor Defects 10-Feb-22									
112793	18-Feb-22	1895	112793 500hr service due at 7500hrs				Glen McDonald	Service completed 8/3/22 at 7494 hrs	
500 Service Type: KOMATSU D65WX-16 DOZER									
Service Type: KOMATSU D65WX-16 DOZER									
112926	21-Feb-22	7464	112926 Body IMU error				Koki Mukai	Completed	
Service Type: 1 Minor Defects 24-Feb-22									

Work Order History

D41 DOZER - GPS

WO#	Date	Hours/Kms	Maintenance Required	Item No#	Priority	Date of Work	Work Done By	Details of Work Done	Parts Needed
113380	08-Mar-22	0	113380 Hydraulic oil leak - belly plate				Gavin Tomsen	Replaced leaking transmission hoses	
Service Type:			1	Equipment ineffective		29-Mar-22		Hydraulic oil leak - belly plate	
113384	08-Mar-22	0	113384 A/C not working	1	Equipment ineffective	08-Apr-22	Ross Kavney	Intermittent fault	
Service Type:			1	Equipment ineffective			A/C not working		
113755	16-Mar-22	0	113755 Trans shift up switch - open circuit				Ross Kavney	Fault code E02DD12KA	
Service Type:			1	Equipment ineffective		08-Apr-22		Inspected, tested circuits, replaced up and down shift switches and tested ok	
114088	23-Mar-22	7568	114088 Slope sensor offline				Tyler Bell	mc2+ sensor has failed replaced mc2+ body sensor	1x mc2 + sensor
Service Type:			1	Minor Defects		28-Mar-22		Tested okay	
114747	06-Apr-22	7629	114747 Refit rear vision mirror in cab				Matt West	Refitted mirror after it fell off.	
Service Type:			1	Minor Defects		23-Apr-22			
115275	22-Apr-22	7697	115275 3D-MC shut down often	1	Minor Defects	28-Apr-22	Koki Mukai	Completed	
Service Type:			1	Minor Defects					
115358	27-Apr-22	2163	115358 250hr service due at 7750hrs				Glen McDonald	Service completed 19/5/22 at 7741 hrs	
Service Type:			1	Service Due		24-May-22		ENGINE OIL- SAMPLE OBTAIN	
116112	19-May-22	0	116112 Replace cutting edges				Phil Knight	Replaced all blade cutting edges. 13/6/22	
Service Type:			1	Equipment ineffective		14-Jun-22		Replace cutting edges	

Work Order History

D41 DOZER - GPS

WO#	Date	Hours/Kms	Maintenance Required	Item No#	Priority	Date of Work	Work Done By	Details of Work Done	Parts Needed
116536	31-May-22	0	116536 Frame sensor fault				Cameron Smith	Diagnose faulty MC2+ sensor. Replace sensor with new and recalibrate.	
Service Type: 1 Equipment ineffective 20-Jun-22 GPS screen won't turn on									
118035	30-Jun-22	7862	118035 GPS out of calibration	1			Cameron Smith	Recalibrated new sensor properly	
Service Type: 1 Equipment ineffective 05-Jul-22									
118571	15-Jul-22	7874	118571 GPS autos not going up				Cameron Smith	Found Auto up solenoid not located properly - Tested now all working	
Service Type: 1 Equipment ineffective 20-Jul-22									
119344	05-Aug-22	0	119344 Undercarriage repairs				Liam Kruiemel	Remove track/chain assembly. Remove sprocket sections and fit replacements. Replace carrier rollers. Inspect track rollers. Incorrect chains supplied by Komatsu, chains shortened by Komatsu fitter with assistance. Remove front idler assembly and rebuild track adjusters. Refit track adjusters. Old track plates built onto new chains. Fit chains to machine. Lower onto ground and tension to spec. Tension again after driving machine.	
Service Type: 1 Equipment ineffective 06-Sep-22 Replace sprocket segments									

Work Order History

D41 DOZER - GPS

WO#	Date	Hours/Kms	Maintenance Required	Item No#	Priority	Date of Work	Work Done By	Details of Work Done	Parts Needed
119393 08-Aug-22 2498 119393 2000hr service due at 8000hrs									
Service Type: KOMATSU D65WX-16 DOZER									
				1	Service Due	06-Sep-22	Liam Kruimel	ENGINE OIL- SAMPLE OBTAIN	
Service Type: KOMATSU D65WX-16 DOZER									
				46	Service Due	06-Sep-22		PM2-500 Service	
Service Type: KOMATSU D65WX-16 DOZER									
				52	Service Due	06-Sep-22		PM3-1000 Service	
Service Type: KOMATSU D65WX-16 DOZER									
				60	Service Due	06-Sep-22		PM4-2000 Service	
119554 10-Aug-22 7966 119554 GPS out of calibration. Fit new sensor									
Service Type:									
				1	Equipment ineffective	21-Sep-22	Cameron Smith	All done and programmed with Koki and Simon from PP	
120033 19-Aug-22 7971 120033 Rehose dozer									
Service Type:									
				1	Minor Defects	01-Sep-22	Gavin Tomsen	Replaced hoses	
120097 22-Aug-22 7971 120097 lance out front cylinder pins									
Service Type:									
				1	Minor Defects	06-Sep-22	Liam Kruimel	Front lift cylinder pins lanced out. Replacements made by Mel.	

Work Order History

D41 DOZER - GPS

WO#	Date	Hours/Kms	Maintenance Required	Item No#	Priority	Date of Work	Work Done By	Details of Work Done	Parts Needed
120098	22-Aug-22	7971	120098 workshop repairs				Liam Kruime1	Machine brought into workshop. Find excessive hydraulic oil leaks from multiple spots. Machine had a history from hydraulic oil temp issues. Sam instructed to remove cab and rechase machine. Follow procedure and remove cab. Fabricate and replace all hoses for hydraulic system under cab. Check and replace any other hoses required. Rebuild all cylinders due to leaks or perished wiper seals. Replace estop in cab. Replace operation manual in cab. Re-gas AC. replace A/C. Replace water pump. Replace radiator cap. Replace radiator overflow hose. Replace oil filler tube mounting gasket. Re-fit cab. Needle gun and clean rust from roof - repaint effected spots. Carry out checks on all parts of machine for leaks or issues post repairs.	

Work Order History

D41 DOZER - GPS

WO#	Date	Hours/Kms	Maintenance Required	Item No#	Priority	Date of Work	Work Done By	Details of Work Done	Parts Needed
Service Type:									
120164	23-Aug-22	7971	120164 carry out valve adjustment	1	Minor Defects	06-Sep-22	Liam Kruimel	Wash machine. Carry out final checklist.	
Service Type:									
121191	15-Sep-22	0	121191 Prestart Failure - A few grease points missing. 1 grease poi	1	Minor Defects	06-Sep-22	David Lewis	Carry out valve adjustment whilst in workshop for repairs.	
Service Type:									
122717	25-Oct-22	0	122717 Prestart Failure - Air not cold..warm air	1	Equipment ineffective	20-Sep-22	Lance Draper	Replace missing grease nipples Prestart Failure - A few grease points missing. 1 grease poi	
Service Type:									
122729	25-Oct-22	0	122729 A/C not working - blowing hot air	1	Equipment ineffective	02-Nov-22	Lance Draper	Airconditioning repaired see the other order number Checked the airconditioning operation and found the compressor to be faulty, sourcing a new denso compressor from Jas and and condenser from Ashdowns. New drier and tx valve from Komatsu. Installed parts and regassed. Washed the radiator core out and tested	
Service Type:									
124347	01-Dec-22	2917	124347 250hr service due at 8250hrs	1	Equipment ineffective	25-Nov-22	Glen McDonald	A/C not working - blowing hot air	
Service Type: KOMATSU D65WX-16 DOZER									
250					Service Due	13-Dec-22	ENGINE OIL- SAMPLE OBTAIN		

Work Order History

D41 DOZER - GPS

WO#	Date	Hours/Kms	Maintenance Required	Item No#	Priority	Date of Work	Work Done By	Details of Work Done	Parts Needed
124713	09-Dec-22	8226	124713 Slope sensor offline and swap tracker battery	1	Minor Defects	15-Dec-22	Koki Mukai	Completed	
125371	10-Jan-23	2966	125371 DK30KB fault code - steering	1	Equipment ineffective	11-Jan-23	Cameron Smith	Couldnt fault at time DK30KB fault code - steering	
128810	23-Mar-23	8369	128810 3D-MC sensor not initialised	1	Minor Defects	29-Mar-23	Koki Mukai	Blade heading calibration	
129002	28-Mar-23	8370	129002 MC2+ sensor offline				Cameron Smith	Test sensors not connecting, screen getting hot. Randomly started working and could not fault afterwards	
129869	19-Apr-23	3069	129869 500 Hour Service due at 8500 hrs				Shane		
				1	Service Due	24-Apr-23	PM1-250 Service		
				46	Service Due	24-Apr-23	PM2-500 Service		
131041	18-May-23	8531	131041 Overheating issue				Jaxson Dawsey	Replaced alternator belt, air con belt and belt support pulley for both belts. A/C pulley is cracked, but I have one on order from Komatsu - overseas. Topped up cooling system and tested.	
132229	14-Jun-23	8554	132229 Replace AC belt pulley	1	Equipment Down	23-May-23	Jaxson Dawsey	Replaced AC belt pulley and adjusted belt. Tested	

Work Order History

D41 DOZER - GPS

WO#	Date	Hours/Kms	Maintenance Required	Item No#	Priority	Date of Work	Work Done By	Details of Work Done	Parts Needed
Service Type:									
132364	15-Jun-23	8562	132364 Body sensor IMU fault	1	Equipment ineffective	14-Jun-23	Koki Mukai	After turning on/off a few times, started working again	
Service Type:									
133209	05-Jul-23	0	133209 Prestart Failure - Left hand wiper doesn't work..latch left	1	Minor Defects	20-Jun-23	Jaxson Dawsey	Replaced LH outside door latch and LH door wiper motor. Tested	Ordered parts through Komatsu
Service Type:									
133754	19-Jul-23	8686	133754 Brake test failed	1	Equipment ineffective	01-Aug-23	Jaxson Dawsey	Adjusted brake pedal linkage, brake oil pressure is still with spec. Realised at 0 psi and pressed at 330 psi. Brake pressure was originally at when realised 160 psi and pressed at 400 psi. Adjusted linkage to correct brake pressures. Tested operation.	
Service Type:									
133895	21-Jul-23	3372	133895 250 Hour Service due at 8750 hrs	1	Equipment ineffective	27-Jul-23	Glen McDonald	Service completed 7/8/23 at 8741 hrs	
Service Type: KOMATSU D65WX-16 DOZER									
133928	21-Jul-23	0	133928 Exhaust leak	1	Service Due	10-Aug-23	Jaxson Dawsey	Replaced exhaust muffler, heat cover, bolts and gasket. Genuine parts. Tested operation	Ordered parts through Mammoth and Komatsu
Service Type:									

Work Order History

D41 DOZER - GPS

WO#	Date	Hours/Kms	Maintenance Required	Item No#	Priority	Date of Work	Work Done By	Details of Work Done	Parts Needed
134068	25-Jul-23 Service Type:	0	134068 Prestart Failure - Exhaust leak	1	Equipment ineffective	26-Jul-23	Jaxson Dawsey	Job already made Prestart Failure - Exhaust leak	
134069	25-Jul-23 Service Type:	0	134069 Prestart Failure - Brake pedal down accelerate an it won't h	1	Equipment ineffective	25-Jul-23	Jaxson Dawsey	Job already made Prestart Failure - Brake pedal down accelerate an it won't h	
134276	28-Jul-23 Service Type:	8728	134276 Height bouncing	1	Minor Defects	03-Aug-23	Koki Mukai	Checked blade sensor cable	
134391	01-Aug-23	8742	134391 Intermittent changing gear issue				Jaxson Dawsey	Repaired broken wire in gear selector control level, tested operation. Selecting all gears now	
134693	07-Aug-23	0	134693 Hydraulic leak behind hydraulic tank	1	Equipment ineffective	01-Aug-23	Gavin Tomsen	Tightened main suction hose, clean down and monitor for further leaking	
134962	11-Aug-23	8744	134962 Auto not calibrated	1	Equipment ineffective	08-Aug-23	Cameron Smith	Blade heading needs to be calibrated before auto will work	
136237	08-Sep-23	8905	136237 Remount the uhf radio	1	Minor Defects	11-Aug-23	Lance Draper	Moved the uhf further up the Post and Resecured	
136612	18-Sep-23 1000 Service Type: KOMATSU D65WX-16 DOZER	3663	136612 1000 Hour Service due at 9000 hr	1	Equipment ineffective	14-Sep-23	Glen McDonald	Service completed 20/9/23 at 8981 hrs PM1-250 Service	

Work Order History

D41 DOZER - GPS

WO#	Date	Hours/Kms	Maintenance Required	Item No#	Priority	Date of Work	Work Done By	Details of Work Done	Parts Needed
		Service Type: KOMATSU D65WX-16 DOZER		2	Service Due	22-Sep-23	PM2-500 Service		
		Service Type: KOMATSU D65WX-16 DOZER		3	Service Due	22-Sep-23	PM3-1000 Service		
136789	20-Sep-23	0	136789 Leaking around pivot shafts				Rohan Webber	pivot shaft seals, bushes and backing plates replaced. track frames installed with new equalizer bar pins and bushes. filled pivot shafts with oil.	
		Service Type:		1	Equipment ineffective	13-Dec-23			
136844	21-Sep-23	0	136844 Needs new cutting edges				Phil Knight	Replaced Cutting edges, and hardware, Operational Test, All Good	
		Service Type:		1	Equipment ineffective	25-Sep-23			
136887	21-Sep-23	8985	136887 Accuracy out				Koki Mukai	Calibrated twice but still not good. Arranged PP	
		Service Type:		1	Minor Defects	10-Oct-23			
137343	04-Oct-23	9018	137343 Dirt Entry in Both Final Drives				Ryan Gerken	oil samples of both finals were sent away and tests came back good. no further action required.	Oil to be re-sampled and changed at 9100hrs
		Service Type:		1	Minor Defects	15-Dec-23			
137410	05-Oct-23	0	137410 Prestart Failure - One grease point won't take grease.				Rohan Webber	removed pin and clean up pin and bushing. cleaned out grooves in bushing. reassembled and greased	
		Service Type:		1	Equipment ineffective	04-Dec-23		Prestart Failure - One grease point won't take grease.	

D41 DOZER - GPS

Service Type:	1	Equipment ineffective	01-Dec-23	Prestart Failure - Drive leaking oil
139266 14-Nov-23	3838	139266 250 Hour Service due at 9250 hr	Glen McDonald	Service completed 23/11/23 at 9229 hrs. Final drive oil was changed and sampled, both pivot shafts leak
250 Service Type: KOMATSU D65WX-16 DOZER	1	Service Due	27-Nov-23	PM1-250 Service

Work Order History

D41 DOZER - GPS

WO#	Date	Hours/Kms	Maintenance Required	Item No#	Priority	Date of Work	Work Done By	Details of Work Done	Parts Needed
139913	28-Nov-23	9230	139913 workshop repairs				Rohan Webber	replaced lift cylinder rod pins and bushes for Bushes, bushes and the ripper frame. pins in lower section of ripper frame, replaced bushes and pins and seals for lift cylinder seals in Equalizer bar. re-shimmed Draft Arms and Blade Oscillation ball. replaced blanking plug and seal in bell-housing. replaced oil in dampener case, removed and replaced broken breather in dampener case. replace alternator belt. remove and repair cracked heat shield on Turbo replace damaged conduit on wiring harness. replaced damaged hydraulic hose on blade angle cylinder.	
Service Type:									
140639	14-Dec-23	9234	140639 leaking output shaft seal on dampener case	1	Minor Defects	13-Dec-23	Rohan Webber	replaced output shaft seal. run up and check for leaks	07072-50085 Komatsu oil seal 85x110x13 DB lip seal
Service Type:									
140734	15-Dec-23	9234	140734 GPS height issue	1	Minor Defects	15-Dec-23	Cameron Smith	Wrong machine, D31	

Work Order History

D41 DOZER - GPS

WO#	Date	Hours/Kms	Maintenance Required	Item No#	Priority	Date of Work	Work Done By	Details of Work Done	Parts Needed
Service Type:									
141308	12-Jan-24	9237	141308 Check site visit invoice	1	Minor Defects	15-Dec-23	Koki Mukai	Completed	
Service Type:									
143394	22-Feb-24	9285	143394 Machine direction takes time to be recognised by system	1	Minor Defects	15-Feb-24	Koki Mukai	Completed	
Service Type:									
145496	11-Apr-24	4275	145496 500 Hour Service due at 9500 hr	1	Minor Defects	13-Mar-24	Kale Lindrea	Service completed at 9477hrs	
KIT ORDERED PO 649775									
Service Type: KOMATSU D65WX-16 DOZER									
Service Type: KOMATSU D65WX-16 DOZER									
148744	14-Jun-24	9582	148744 Blade sensor no readings	1	Equipment ineffective	17-Jun-24	Cameron Smith	Test sensor - wiring was all good and sensor powering on. Did a VRAM reset at it came good - Tested all good	
Service Type:									
149375	27-Jun-24	9605	149375 Replace batteries	1	Minor Defects	28-Jun-24	Phil Knight	Replaced batteries, 2 x N150, Operational Test, All Good, Checked charge voltage.	
Service Type:									
149376	27-Jun-24	0	149376 Replace batteries	1	Equipment ineffective	28-Jun-24	Phil Knight	Replaced batteries, 2 x N150, Operational Test, All Good, Checked charge voltage.	
Service Type:									
150173	16-Jul-24	0	150173 Turn tips in for transport	1	Equipment ineffective	28-Jun-24	Phil Knight	No required.	

Work Order History

D41 DOZER - GPS

WO#	Date	Hours/Kms	Maintenance Required	Item No#	Priority	Date of Work	Work Done By	Details of Work Done	Parts Needed
Service Type:									
150538	24-Jul-24	0	150538 Prestart Failure - Spacer has come out	1	Equipment ineffective	18-Jul-24	Kale Lindrea	Replace idler slides and springs, test operation all good	
Service Type:									
151726	20-Aug-24	9697	151726 Blade slope sensor intermittent	1	Equipment ineffective	31-Jul-24	Prestart Failure - Spacer has come out	Replaced blade sensor cable	
Service Type:									
151731	21-Aug-24	0	151731 250 Hour Service due at 9750 hr	1	Minor Defects	30-Oct-24	Casey Smith	Service completed at 9697hrs on 30/8/24	
K/I/T ORDERED PO 671094 Service Type: KOMATSU D65WX-16 DOZER									
153513	27-Sep-24	9735	153513 Out of accuracy	1	Minor Defects	30-Aug-24	PM1-250 Service Koki Mukai	Did sensor calibration	
Service Type:									
153828	08-Oct-24	0	153828 Prestart Failure - Air conditioner not cool	1	Equipment ineffective	15-Oct-24	Prestart Failure - Air conditioner not cool Lance Draper	Checked the airconditioning operation and found the evaporator air flow to be blocked with mud. Stripped down the cabin and accessed the evaporator core. Washed out the mud build up, cleaned the cabin filters and tested.	
Service Type:									
155337	06-Nov-24	0	155337 Prestart Failure - Left hand side angle tilt won't take grea	1	Equipment ineffective	12-Nov-24	Prestart Failure - Left hand side angle tilt won't take grea Casey Smith	Pumped grease as operator moves machine	
Service Type:									

Work Order History

D41 DOZER - GPS

WO#	Date	Hours/Kms	Maintenance Required	Item No#	Priority	Date of Work	Work Done By	Details of Work Done	Parts Needed
155482	08-Nov-24	5125	155482 2000 Hour Service due at 10,000 hr				Kale Lindrea	Service completed at 10021hrs	
2000									
Service Type: KOMATSU D65WX-16 DOZER				1	Service Due	02-Dec-24	PM1-250 Service		
Service Type: KOMATSU D65WX-16 DOZER				2	Service Due	02-Dec-24	PM2-500 Service		
Service Type: KOMATSU D65WX-16 DOZER				3	Service Due	02-Dec-24	PM3-1000 Service		
Service Type: KOMATSU D65WX-16 DOZER				4	Service Due	02-Dec-24	PM4-2000 Service		
156109	26-Nov-24	0	156109 Prestart Failure - Oil leaking up belly plate not sure if it				Casey Smith	Found hole in fan motor hose as it rubbed on the chassis Removed hose and replaced with new clamps Refill HYD oil tested allgood	
Service Type:									
				1	Equipment ineffective	04-Dec-24	Prestart Failure - Oil leaking up belly plate not sure if it		
156188	28-Nov-24	0	156188 Prestart Failure - Roof lights front and rear not working				Josh Ellaway	Not required as not night machine	
Service Type:									
				1	Equipment ineffective	11-Jan-25	Prestart Failure - Roof lights front and rear not working		
156500	04-Dec-24	10041	156500 Sensor intermittent				Koki Mukai		
Service Type:									
				1	Minor Defects	04-Dec-24			
156501	04-Dec-24	10041	156501 Sensor intermittent				Koki Mukai	Completed	
Service Type:									
				1	Minor Defects	16-Dec-24			
156836	12-Dec-24	10068	156836 replace cutting edges				Josh Ellaway	Replaced edges	
Service Type:									
				1	Minor Defects	11-Jan-25			

Work Order History

D41 DOZER - GPS

WO#	Date	Hours/Kms	Maintenance Required	Item No#	Priority	Date of Work	Work Done By	Details of Work Done	Parts Needed
157133	19-Dec-24	10079	157133 overheating				Josh Ellaway	Replaced tank to block bleeder hose as leaking at top tank, cleaned out cooling pack, operated machine and temp alarm at 98d went off, removed thermostat and getting half stuck, replaced & retested on stock pile, temp holding at 90-91	
Service Type: 1 Equipment ineffective 11-Jan-25									
157688	15-Jan-25	10102	157688 Modem intermittent	1	Minor Defects	22-Jan-25	Koki Mukai	Replaced modem	
Service Type: 1									
157740	16-Jan-25	10104	157740 GPS broken	1	Equipment ineffective	22-Jan-25	Koki Mukai	Modem replaced	
Service Type: 1									
157966	21-Jan-25	10133	157966 Blade tilt pin fallen out				Jamie Squires	Je, welded bar on top of tilt pin as groove gone from retainer, ordered pin but was incorrect. Sent pin back to Komatsu. New pin to be fabricated by mikey	
Job closed due to decommissioning machine - Jack pound									
Service Type: 1 Equipment ineffective 24-Oct-25									
158491	31-Jan-25	0	158491 Prestart Failure - Two radio skips channels				Josh Ellaway	6/1/25 je, replaced uhf & tested	
Service Type: 1 Equipment ineffective 07-Feb-25 Prestart Failure - Two radio skips channels									

Work Order History

D41 DOZER - GPS

WO#	Date	Hours/Kms	Maintenance Required	Item No#	Priority	Date of Work	Work Done By	Details of Work Done	Parts Needed
1586673	04-Feb-25	5235	1586673 250 Hour Service due at 10,250 hr				Josh Ellaway	Je, 250hr done at 10287hrs	
250 Service Type: KOMATSU D65WX-16 DOZER									
158951	11-Feb-25	0	158951 Prestart Failure - Grease nipple not taking grease on right	1	Service Due	20-Feb-25	Josh Ellaway	Je, freed up pin and bush and took grease, replaced nipple	
Service Type:									
				1	Equipment ineffective	14-Feb-25		Prestart Failure - Grease nipple not taking grease on right	
159450	20-Feb-25	0	159450 Oil leaking under belly guards				Jamie Squires	Leaks Found - Sump - Engine rear main - engine output shaft seal - starter motor seal - bell housing - dip stick - oil cooler - tranny filter hoses - behind MCV - Behind HYD tank A lot of oil around engine and transmission will need to wash and assess	
Service Type:									
				1	Equipment ineffective	24-Oct-25		Job closed due to decommissioning machine - Jack pound	
Service Type:									
				2	Equipment ineffective	24-Oct-25		Overall Hydraulic Condition – Cylinder condition, leaks, loo Overall Undercarriage Condition – Sprockets, chains, grouser	

Work Order History

D41 DOZER - GPS

WO#	Date	Hours/Kms	Maintenance Required	Item No#	Priority	Date of Work	Work Done By	Details of Work Done	Parts Needed
159451	20-Feb-25	0	159451	Left lower roller leaking oil			Jamie Squires	Found rollers collapsed and leaking Will need to completed CTS to conform if other roller are in good condition Job closed due to decommissioning machine - Jack pound	
Service Type:									
				1	Equipment ineffective	24-Oct-25		Overall Hydraulic Condition – Cylinder condition, leaks, loo	
Service Type:									
				2	Equipment ineffective	24-Oct-25		Overall Undercarriage Condition – Sprockets, chains, grouser	
159452	20-Feb-25	10287	159452	CTS Inspection required			Jamie Squires	CTS Inspection completed by Casey Smith - ACTION REQUIRED - TRACK BUSHES 97% AND 106%	ACTION REQUIRED - TRAC K BUSHES 97% AND 106%
Service Type:									
				1	Equipment ineffective	24-Oct-25		Job closed due to decommissioning machine - Jack pound	
161030	26-Mar-25	5295	161030	500 Hour Service due at 10,500 hr			Casey Smith	Service completed at 10,467 hours on 27/3/25	
500 Service Type: KOMATSU D65WX-16 DOZER									
				1	Service Due	27-Mar-25		PM1-250 Service	
Service Type: KOMATSU D65WX-16 DOZER									
				2	Service Due	27-Mar-25		PM2-500 Service	
162818	12-May-25	10625	162818	Auto trying to kick in while switched off			Koki Mukai	Bypassed new switch sensor cable (green and white only) and run next to the arm rest	
Service Type:									
				1	Minor Defects	21-May-25			

Work Order History

D41 DOZER - GPS

WO#	Date	Hours/Kms	Maintenance Required	Item No#	Priority	Date of Work	Work Done By	Details of Work Done	Parts Needed
162887	14-May-25	0	162887 Prestart Failure - GPS playing up wants to use auto when it	1	Equipment ineffective	14-May-25	Koki Mukai	duplicate	
Service Type:									
163590	28-May-25	0	163590 250 Hour Service due at 10,750hr				Jamie Squires	machine being decommissioned	
250									
Service Type: KOMATSU D65WX-16 DOZER									
				1	Service Due	24-Oct-25	PM1-250 Service		
163990	05-Jun-25	10758	163990 Missing GPS box	1	Minor Defects	10-Jun-25	Koki Mukai	Found one in Kings Forest job	
Service Type:									
171927	22-Oct-25	10760	171927 Decommission GPS	1	Equipment waiting Disposal		Cameron Smith		
Service Type:									
171997	23-Oct-25	10760	171997 Decommission Machine				Kaleb Carlrow	Carried out decommissioning of machine. Removed: Tracker, UHF radio, company decals, fleet decals, number plates, Removed from sniper and viewpoint. Cleaned machine cab and exterior. - Jack Pound	
Service Type:									
				1	Equipment ineffective	24-Oct-25			