



Vehicle History Summary

Fleet #	XQ31WK
Registration	XQ31WK
Make	Mercedes
Model	Actross
VIN / Chassis #	WDB96342420351728
Build Date	2021

Date	Reading / Units	Type / Repairer Notes	Repairer
		R-2003	
		Panel Damage R-997	
		mudflap, NUMBER PLATE R-1455	
24/07/2025		headlights R-2467 HEALS LIGHT BULB REPLACE PARKING LIGHT BULB REPLACE	gora truck and tarilor
19/07/2025		engine oil, windshield R-2552 New oil pan seal installed , engine oil 40L, new windshield cover installed, Axle3 passenger side mudguard changed	workshop
16/07/2025		Turbo R-2460 EXPRESS ASSESSMENT CLAIM NUMBER# Q17382D COMPLAINT TRUCK TOWED IN PLEASE DIAGNOSE & REPORT ON TURBO FAILURE CONTRACT - WARRANTY - CAUSE Inner bearing has collapsed due to material fatigue consequentially causing propellor shaft to have float and contact C: Excessive turbine play causing turbine to bind with housing C: Got initial and checked oil level all ok Found multiple boost faults Checked if tail shaft is in truck all ok Brought truck into workshop Tilted cab and removed turbo intake elbow pipe Found turbine shattered Removed air box and charge pipe off turbo found further damage Removed intake pipe into intake manifold found very minimal metal in pipe Ordered turbo Drained coolant into clean container Degassed A/C and removed pipe off Compressor and TX valve Removed all radiator hoses Removed fan and fan hub from engine Removed cooling pack from truck Removed turbo mount bolts Removed turbo oil drain and feed Removed sensor Removed bottom bracket bolts Removed exhaust nut Removed turbo Disassembled cooling pack till intercooler is bare and ready to be sent off for testing Intercooler outside control office Need exhaust studs could not remove old studs without damage Fit new studs to new turbo Fit turbo to manifold and exhaust with new gaskets, bolts and nuts Reassembled cooling pack with cleaned intercooler Square nuts were missing from intercooler got new ones from parts Fit cooling pack to truck Reassembled all coolant lines, A/C pipes and charge pipes Fit fan and fan hub ensured tight Reassembled intake pipe and all other connections Reassembled air box and engine guards Vacced A/C system and re gassed 880g R134a Vacuum bled cooling system and ensured full using star Topped	Daimler
16/07/2025		non sensor R-2462 Maintenance COMPLAINT FAULT ON DASH - NOX SENSOR FAULT - DID A REGEN, NOW HAS WARNING ON DASH - SUSPECT NOX SENSOR NEEDS TO BE REPLACED WARRANTY START DATE - 25/03/2021 CONTRACT - BESTBASIC 2026 / 482,000KMS CAUSE done Cause: No codes in ACM or MCM Correction: Check Xentry for any codes, no stored or current codes in ACM or MCM. Requires test drive to confirm customer complaint CORRECTION QTY ITEM D	damimler
16/07/2025		oil leakage R-2461 Additional Service Request CLAIM NUMBER# Q24305D COMPLAINT OIL LEAK ON LH SIDE OF MOTOR - C - CHECK AND REPORT ON RADIATOR CRACKED AND LEAKING	daimler
01/07/2025		indicator bulb R-2553 Passenger side new door indicator bulb installed	workshop
12/06/2025		brake booster R-2435 BRAKE BOOSTER HOSE (CUSTOMER) BRAKE BOOSTER HOSE REPLACE	Gora Truck & Trailer

Date	Reading / Units	Type / Repairer Notes	Repairer
08/06/2025		gps, guardian R-2554 GPS removed, guardian removed	workshop
04/06/2025		coolant R-2555 Coolant 25l	workshop
01/05/2025		ai leakage R-2557 Air Leakage	workshop
26/04/2025		adblue R-2556 Adblue leaking,filter housing	workshop
10/03/2025		headlight bulb R-2149 Fixed	D&G Mechanic
10/03/2025		Breaks R-2088 fixed	D&G Mechanic
10/03/2025		fire extinguisher R-2150 Fixed	D&G Mechanic
10/03/2025		side light R-2089 fixed	D&G Mechanic
08/03/2025		Breaks R-2087 Fixed	D&G Mechanic
01/03/2025		clean R-1993	D&G Mechanic
23/02/2025		wipers R-1908 fixed	D&G Mechanic
23/02/2025	8,888,888 kms 888,888 hrs	Clean R-1811 done	Inhouse repair
23/02/2025		steering R-1910 fixed	D&G Mechanic
23/02/2025		headlight R-1916 fixed	D&G Mechanic
23/02/2025		Clean R-1914 Fixed	D&G Mechanic
23/02/2025		Clean R-1913 fixed	D&G Mechanic
16/02/2025		Tyre Repair T-700 1 Puncture Repair Position 10	Legend Tyre Services
13/02/2025		Mudgard R-1823 MUDGUARD LEFT SIDE REAR MUDGUARD REPLACE MUDGUARDBAR REPLACE REFLECTER REPLACE LABOUR TYRE FITEEDNON RIM 275	Gora Truck & Trailer
05/02/2025		Coolant Pump R-2162 COOLENT PIPE (CUSTOMER) 40 LT COOLENT COOLNET PIPE REPLACE FILL UP COOLENT	Gora Truck & Trailer
24/01/2025		screw R-1739 SCREW AIR FREIGHT	Daimler
24/01/2025		marker lamp, Wheel Nut R-1733	Daimler

Date	Reading / Units	Type / Repairer Notes	Repairer
		MARKER LAMP NUT	
24/01/2025		non sensor R-1730 DPF FAULT ON DASH (PULLING POWER) WARRANTY START 25.03.2021 CONTRACT NONE Done CP C - DPF fault on dash (pulling power) C - internal short in outlet nox sensor causing limp mode C: -brought vehicle around to workshop -connected xentry and scanned for codes -found multiple codes relating to outlet nox sensor -removed drivers side wheel arch guard -removed mount bolts for nox sensor to get access to plug -disconnected plug from outlet nox sensor and inspected - all good -checked wiring from acm control unit to nox sensor - all good -carried out testing in xentry -replace outlet nox sensor -quoted replacement parts -done OUTLET NOX SENSOR INTERNAL FAULT Done CP C - OUTLET NOX SENSOR INTERNAL FAULT C - internal short in outlet nox sensor causing engine light and derating C: -brought vehicle into workshop -removed drivers' side rear wheel arch / guard -removed nox sensor and plug -installed in reverse order -cleared codes -carried out road test - all good -got finals -parked out	Daimler
24/01/2025		lock R-1734 LOCK in FREIGHT	Daimler
23/01/2025		brake pads, wipers R-1714 CARRY OUT SERVICE AS PER DATA SHEET & HISTORY ----- CONTRACT EXPIRED BY KMS C - CARRY OUT SERVICE AS PER DATA SHEET & HISTORY ----- CONTRACT EXPIRED BY KMS C - due for inspection service C - carried out service as per sheet - topped up windscreen washer fluid (water only) - topped engine oil 4LTR 10w40 - checked all diff fluids (okay) - checked coolant level (okay) notes cooling system pressurizing requires T.K test - greased drive shaft 500mm special grease - IMPORTANT NOTES - FRONT BRAKE ROTORS CRACKED AND BRAKE PADS WORN - PLEASE REFER TO EXTRA WORKSHEET FOR MORE FAULTS C: Replace wiper rubbers INVOICE REPRINT C: Material fatigue causing wipers to streak C: Requested part Removed wipers Installed new wipers Electrical Components, Engine CARRY OUT REPAIRS TO LIGHTS. - LHF DOOR INDICATOR. - LH STOP/PARK LIGHT C: INSPECT AND CONFIRM FAULT FOUND LH PARK AND INDICATOR LIGHT INOP AND OPEN CIRCUIT DROP BULLBAR - REMOVE HEADLIGHT ASSEMBLY REMOVE AND REPLACE LH PARK LIGHT RESECURE HEADLIGHT AND BULLBAR REMOVE L/H INDICATOR HOUSING AND REPLACE L/H INDICATOR BULB REFIT HOUSING TO TRUCK TEST OPERATION OF LIGHTS - ALL OKAY CLEAR FAULTS Electrical Components, Engine CARRY OUT REPAIRS TO LIGHTS. - LHF DOOR INDICATOR. - LH STOP/PARK LIGHT C: INSPECT AND CONFIRM FAULT FOUND LH PARK AND INDICATOR LIGHT INOP AND OPEN CIRCUIT DROP BULLBAR - REMOVE HEADLIGHT ASSEMBLY REMOVE AND REPLACE LH PARK LIGHT RESECURE HEADLIGHT AND BULLBAR REMOVE L/H INDICATOR HOUSING AND REPLACE L/H INDICATOR BULB REFIT HOUSING TO TRUCK TEST OPERATION OF LIGHTS - ALL OKAY CLEAR FAULTS Glass, Windows REPLACE WIPER RUBBERS. C: Replace wiper rubbers C: Material fatigue causing wipers to streak C: Requested part Removed wipers Installed new wipers ST - FRONT PADS AND ROTORS Body, Cab Electrical Components, Engine EST - REPLACE DAMAGE L/H/F HEADLIGHT ASSEMBLY. EST - REPLACE DAMAGE L/H BODY LIGHT AND BRACKET.	Daimler
23/01/2025	712,459 kms	B - B SERVICE S-1099 Maintenance CARRY OUT SCHEDULED SERVICE Job: Inspection service Moved vehicle into workshop, carried out quick test and data sheet printouts. Carried out inspection service as per checklist. Checked oil levels removed and inspected pollen dust filter - ok removed and inspected air filter - ok Topped up engine oil -10w40- 6L Topped up gearbox oil - prime trans 75w90- 1L Topped up A3 and A4 diff oils - prime axle 75w90- 1.5L Tested cooling level and topped up cooling system - GP-P40- 500ml Adjusted headlight aiming Removed and replaced wiper blades due to streaking Topped up washer bottle Removed and replaced faulty license plate bulb Inspected faulty fog light bulb and found impact damage to lamp Reconnected and cleaned up marker light that was faulting Greased vehicle, jackshaft grease - 0.4kg Carried final test Replaced service sticker Washed truck and cleaned off fingerprints Parked up for QC Road tested all good qc vehicle get tech to reenable active brake assist front LHS foglight inop Cleaned radar glass guard as instructed by team leader. Cleared faults. Engine Lubrication INVESTIGATE LOW OIL PRESSURE CODE Diagnosis: brought truck into workshop removed oil filter Kut open oil filter to inspect for metal -- non found installed new oil filter to truck C - low oil pressure codes (6 occurrences) - remove and inspect filter for contaminants C: -brought vehicle into workshop -removed oil filter and cut open -checked for metal - all good -refitted oil filter and clear codes - topped up 2L 10w40 -done	
23/01/2025		filter R-1713 FILTER ELEMENT	Daimler
23/01/2025		Air Brakes R-1725 C - Airline fitting seating seal cracked C- Performed quicktest and printed (10 mins) Built air pressure and checked for leaks, no leaks found (20 mins) Checked air pressure and had another tech press brake pedal while looking for leaks, Leak found from LHF brake hose booster fitting (20 mins) Removed air line and cleaned out fittings (25 mins) Fitted new air line and resecured wiring with zip ties (20 mins) Built air pressure and checked for leaks, none found (5 mins) Test drove truck 712,461km - 712,464km (30 mins) Performed final quicktest, cleaned handprints off truck and parked up for QC (15 mins)	Daimler
23/01/2025		circuit fuse R-1716	Daimler

Date	Reading / Units	Type / Repairer Notes	Repairer
		Sold Operations C- fault lights on dash C- The power supply 30B has open circuit C- Carried out Diagnosed with Xentry Found fault at TCM transmission control (the power supply of 30B has open circuit) Carried out use test light to test the fuses. Carried out found open circuit fuse. Carried out organized parts. Carried out replaced open circuit fuse. Carried out erased faults Carried out Reset EPU unit Carried out printed finals	
16/01/2025	751,192 kms	B - B SERVICE S-1050 ERVICE DUE Sold Operations WARRANTY START DATE - 25/03/21 CONTRACT - BEST BASIC 2026 - 482,000 Done CP Moved vehicle into workshop, carried out quick test and data sheet printouts. Carried out inspection service as per checklist. removed and inspected Pollen dust filter - ok removed and inspected air filter – ok Topped up engine oi Topped up power steer fluid Topped up gearbox oil Topped up A3 and A4 diff oils Tested cooling level and topped up cooling system Check batteries and levels. Adjusted headlight aiming Perform regen of DPF removed and replaced wiper blades due to streaking Greased vehicle jackshaft grease - 0.4kg Road tested all good Locate and carry out final test with Xentry. Carry out cylinder dynamic compression test cold. Drive and get up to temperature. Carry out a second test. no changes. Oil leak can be narrowed down to issue with oil spinner with a possibilty sump could also be leaking.	
12/01/2025		New Tyre T-434 2 Steer Tire Brand Bridgestone 154 Size 295/80/22.5 Km 732418 Call Out Charges After Hours Location BP Laverton Time 10:30 PM Date 25/05/2024	Legend Tyre Services
08/01/2025	811,989 kms	B - B SERVICE S-1129 KM 811989 OIL FILTER REPLACE FUEL FILTER REPLACE FUEL WATER FILTER REPLACE ENGINE OIL REPLACE AIR FILTER CLEAN 1.00 300.00 10% 300.00 ENGINE OIL 10W 40 40.00 7.20 10% 288.00 COOLENT TANK EXCHANGE FROM ANOTHER TRUCK 4.00 90.00 10% 360.00 CLEAR DPF SCAN TOOL USED 1.00 90.00 10% 90.00 DRIVER SIDE HEAD LIGHT REPLACE NOTES (LEFT SIDE FOG LIGHT NEEDS TO REPLACE)	
08/01/2025		old tyre replace T-362 49 Strip and fit 8 Blacklion 11R22.5 BD173 Strip&fit	Ultimate Tyres
31/12/2024		batteries R-1615 BATTERIES REMOVED AND REPLACED	Gora Truck & Trailer
19/12/2024	751,192 kms	Major Oil Leak R-1329 Warranty Repair carried out as per attached Daimler Repair Sheet.	Daimler
18/12/2024		headlight bulb R-2175 fixed	D&G Mechanic
09/12/2024	802,420 kms	Express Assessment R-1566 As per attached Daimler Repair Invoice	Daimler
28/11/2024		Registration O-379	TMR - 32246
31/08/2024		Registration O-296	
17/07/2024	751,135 kms	Engine, Nox Sensor , oil pressure R-1261 Low Oil Pressure Warning - Fit Jaltest Scan Codes. Low Oil Low Oil Pressure Nox Sensor x 2 Check oil level via Dash - Added 12L. Low warnings gone. inspected under carriage & found. All undercarriage covered in oil. Appears to be coming from engine breather.	D&G Mechanic
19/06/2024	741,831 kms	B - B SERVICE S-850 B Service as per attached Service Sheet.	D&G Mechanic
19/06/2024	741,831 kms	rear guards R-1179 RH Door latch loose - Adjust & Tighten Door Striker for Door to cclose & Align properly. Adjust rear guards - lift height of rear guards to prevent rubbing on tyres when bags deflated	D&G Mechanic
19/06/2024	737,886 kms	B - B SERVICE S-849 B Service as per attached Service Sheet.	D&G Mechanic
30/05/2024		Registration O-185	TMR - 32246
24/04/2024		mudguard R-1023	Gora Truck & Trailer

Date	Reading / Units	Type / Repairer Notes	Repairer
		LEFT SIDE REAR MUDGUARDREPLACE MUDGUARDBARREPLACE REFLECTER REPLACE LABOUR TYRE FITTED ON RIM 275	
02/04/2024	712,459 kms	General R-958 Job #1 - Diagnosis: brought truck into workshop removed oil filter Kut open oil filter to inspect for metal -- non found installed new oil filter to truck C - low oil pressure codes (6 occurrences) - remove and inspect filter for contaminants C:- brought vehicle into workshop-removed oil filter and cut open-checked for metal - all good-refitted oil filter and clear codes-topped up 2L 10W40 Job #2 - C - Airline fitting seating seal cracked Performed quick test and printed (10 mins) Built air pressure and checked for leaks, no leaks found (20 mins) Checked air pressure and had another tech press brake pedal while looking for leaks, Leak found from LHF brake. hose booster fitting (20 mins) Removed airline and cleaned out fittings (25 mins) Fitted new airline and resecured wiring with zip ties (20 mins) Built air pressure and checked for leaks, none found (5 mins) Test drove truck 712,461km - 712,464km (30 mins) Performed final quick test, cleaned handprints off truck and parked up for QC (15 mins)	Daimler
02/04/2024	712,459 kms	B - B SERVICE S-737 B Service as per attached Service Sheet.	Daimler
20/03/2024		Brake pads R-937 Replace 2nd and 3rd Axle Drive Brake Pads	Gora Truck & Trailer
05/03/2024		Mud guard, TYRES R-894 Left side rear Mudguard replaced Reflector Replaced Labour Tyre Fitted on Rim 275	Gora Truck & Trailer
29/02/2024		Registration O-130	TMR - 32246
05/02/2024	633,560 kms	mirror, Panel Repairs R-568	D&G Mechanic
30/01/2024		ad blue cap R-790 FIT NEW ADBLUE CAP	D&G Mechanic
11/12/2023	660,738 kms	B - B SERVICE S-611 B Service Carried out as per the attached - Service Document 1.Both Drive Axles to be Replaced on Next Service @ 720,000 2.Several Body Panels Missing or Damaged, Adblue Cap Taped On	D&G Mechanic
29/11/2023		Registration O-26	
15/11/2023		tyres R-610 STRIP AND FIT TYRES X8 AS PER ATTACHED INVOICE	Ultimate Tyres
14/11/2023		Parts R-644 PARTS PURCHASED FROM TRANZMILE	TRANZMILE
11/10/2023		Parts R-468 PARTS PURCHASED FROM DAIMLER FOR HUB	D&G Mechanic
05/10/2023		Parts R-436 PARTS PURCHASED FROM DAIMLER TRUCKS DARRA AS PER ATTACHED	D&G Mechanic
27/09/2023		Parts R-404 PARTS PURCHASED FROM MULTISPARES FOR XQ31WK - 22/09/2023	D&G Mechanic
26/09/2023	610,212 kms	Repairs R-400	robert parkinson
11/09/2023	606,686 kms	Codes R-371 BRING INTO WORKSHOP - ATTACHED LAPTOP - CHECK FAULT CODES DID MANUAL REGEN ON EXHAUST SYSTEM ALL BUT ON FAULT CODE CLEARED - TRANSMISSION FAULT UNIT IS TO GO TO DAIMLER UNDERGO REPAIRS	D&G Mechanic
07/09/2023	604,540 kms	Regeneration R-369 Plugged in Laptop + Started Manual Regen Burn Cleared all Codes and Cleared	D&G Mechanic
22/08/2023		Parts R-330 Parts purchased from Tranzmile Invoice 429887 As per attached documents	D&G Mechanic

Date	Reading / Units	Type / Repairer Notes	Repairer
16/08/2023	591,338 kms	B - B SERVICE S-470 As per attached documents	DG Mechanic
14/06/2023	558,515 kms	mirror R-226	robert parkinson
28/03/2023	508,489 kms	B - Basic Service S-427 service completed	Workshop
21/06/2022	1,234 kms 12 hrs	C - C SERVICE S-190	
18/08/2021	86,536 kms	B - B SERVICE S-94	Daimler
29/06/2021	50,870 kms	B - B SERVICE S-87 B Service	Daimler

Signed: _____

Name: _____

Date: _____