J.D.A. Ventures Ltd.

Equipment: 261 Work Order #: 31092

Work Order Type: Cry Sheet

Date: 1/15/25

Year: 2014 Make: Peterbilt Model: 367

Serial Number: 1NPTP4TX7ED239336

Odometer: 953,234 Hours: 6,550

Labor

		Quan tity/H	
Description	Mechanic	ours	Amount
1 Complaint: Center axle does not lock. Click in the diff lock and it just grinds and will not engage 1 Cause: Broken			.00
1 Correction: Pulled first divider becuase inner axle was not spinning while loaded. Power divider was missing the pump. Installed new pump. Put power divider back together and in. Brought truck out and put aganist bed truck to test diffs. Brought back in and pulle dmiddle diff power divider, shift fork and shift collar were worn out, replaced. Pump fell out of mushroom gear. Put a ne wpump, bearing, and mushroom gear on. New shift collar and fork put in, tightened bolts, driveline. Pulled secondary airtank above the D/S step out because the bracket was broken, also had a crack under the battery box. Put tank back in once fixed and tested for airleaks.	Keydon Payne	16.00	1,600.00
1.1 Correction: Repaired Bracket for the Air tank, Cleaned bracket to clean Aluminum and Tacked Pieces in Place, Sip Cut Seem and welded Btoh sides. Moved Welder into Position and Welded 1 of two cracks on Battery box unable to weld one of the cracks could not get spool gun in to the crack	Mark Carroll	1.00	100.00

Parts

Description	Part Supplier Full	Supplier Invoice	Quantity/Hours	Price/Rate	Amount
5043641, Lube Pump Kit	A1 Driveline	01P86527	1.00	470.04	470.04
5043641, Lube Pump Kit	The Gear Centre	4146020-00	1.00	494.18	494.18
131466qg, Gear Output Shaft Side			1.00	291.89	291.89
139975, Bearing Cone			1.00	105.04	105.04
131332qg, Sliding Clutch			1.00	237.28	237.28

Keydon - Center Axle Does Not Lock

Total Labor	1,700.00
Total Parts	1,598.43
Total Returns	.00
Total Sublet	.00
Shop Supplies	170.00
Invoice Total	3 468 43



Equipment: 261 Work Order #: 29561

Date: 10/17/24

Year: 2014 Make: Peterbilt Model: 367

Serial Number: 1NPTP4TX7ED239336

Odometer: 936,701 W/O Notes: Used Wheel Seal - That had been

Charged out already

Work Order Type: Cry Sheet, Service

Hours: 5,969

Labor

Description	Mechanic	tity/H ours	Amount
1 Complaint: 300hr Service & Inspection			.00
1 Cause: Due			.00
1 Correction: 300hr Service & Inspection. Changed Oil & Oil Filter. Changed Fuel Filters. Checked lights & Levels. Inspected Air Filters - Good. Checked Diffs/Trans Levels and all were good. Topped up Coolant. Blew out back up Alarm, since it was full of dirt. Replaced DS work light since old one snapped off. Replaced DS Stock Bushing. DS Draglink and Steering Shaft, Replaced due to Slop. DS ABS Sensor, Replaced due to ABS light on. Replaced rad support since bushing was punched out. Temp Sensor on trans was broken. Got new pigtail and installed. New Airline installed under DS Door. Had Massive Leak and hole in line. Trouble shoot pro-heat and found it was wired in wrong and had blown fuse, swapped connections and fired it up - Worked. Had to pull hub off #1 drive PS since we found very bad s-cam bushings, Replaced Bushing and Cleaned hub and Parts Installed Back on Axle. Had to weld up on roller due to brake shoe sticking out of drum. Installed all parts and put wheels back on and Torqued. Re/Re Square Mirroe on Due to it being Cracked.	Keegan Hazard	24.00	2,400.00
i i	Dylan Dawson	7.00	700.00
wheels back on and Torqued. Re/Re Square Mirroe on Due to it being Cracked. 1.1 Correction: Dylan Labour	Dylan Dawson	7.00	700.00

Parts

Description	Part Supplier Full	Supplier Invoice	Quantity/Hours	Price/Rate	Amount
unilw4602c, Round, 6 Diode, LED			1.00	25.99	25.99
Flood Lamp k181267bxw, Wheel Speed Sensor	Stahl Peterbilt	P725610	1.00	101.63	101.63
STRAIGHT					
f651080696094, Radiator Tie-Rod			1.00	414.41	414.41
m136004, Bushing - Pin, Isolator rubber			2.00	10.75	21.50
m131009, Mounting Exhaust Bushing			1.00	34.03	34.03
m656000, exhaust clamp pin			1.00	82.29	82.29
cn10950, Connector-Shell 2cav pack			1.00	6.06	6.06
cn50200, Packard Seal			2.00	1.97	3.94
cn41050, Lock-Packard 2 Way			1.00	1.58	1.58
dlp3092s, Draglink			1.00	179.98	179.98
sk000283, U-Joint Kit steer shaft			2.00	58.55	117.10
cn26400, Terminal- F Spade 16-20GA	Stahl Peterbilt	P725611	2.00	1.67	3.34
lf14000nn, Oil Filter (Fleetguard)			1.00	57.28	57.28
ff5776, Fuel Filter			1.00	66.27	66.27
k371004, Fuel/ Water Filter			1.00	57.65	57.65
oilsample, Oil Sample / Anaysis - Basic Wear			2.00	31.50	63.00
cfr19010, Filter - Air Cab Exterior			1.00	13.83	13.83
12073eagp, 5.5" x 7.5" S/S			1.00	19.87	19.87
Replacement Mirror Head dshp15blk, 15W40 Oil - Duron SHP Bulk			42.00	5.02	210.84

Parts

Description	Part Supplier Full	Supplier Invoice	Quantity/Hours	Price/Rate	Amount
am1561005, dust shield drive axle (aftm 805143)	Stahl Peterbilt	P725815	1.00	72.39	72.39
dlp3092s, Draglink			1.00	179.98	179.98
l14mn0002, nut - ball stud			2.00	6.24	12.48
cn10850, Shell Connector 2cav Pack			1.00	4.16	4.16
cn26150, terminal-f spade 16-18ga			2.00	1.96	3.92
k126580kbxw, Kit - Cam Service	Stahl Peterbilt	P725829	1.00	47.18	47.18
1000035, Bushing			2.00	3.57	7.14
804017, Retaining Ring			1.00	2.69	2.69
bhk077, Brake Hardware Kit	Bradvin HD Inc.	01P6877	1.00	9.42	9.42
41802211, Shaft - Steering	Stahl Peterbilt	P725733	1.00	416.29	416.29

Returns

Description	Quantity/Hours	Price/Rate	Amount
sk000283, U-Joint Kit steer shaft	1.00	58.55	58.55

Keegan - 300hr Service & Inspection/ DS Front axle drive re-cap/ Exhaust Leak under truck/ DS Steering Joint/ Air Leak/ Left Wheel Speed Sensor/ Steering makes popping sound

Total Labor	3,100.00
Total Parts	2,236.24
Total Returns	-58.55
Total Sublet	.00
Shop Supplies	310.00
Invoice Total	5,587.69

Equipment: 261 Work Order #: 29792

Work Order Type: Cry Sheet

Date: 10/30/24

Year: 2014 Make: Peterbilt Model: 367

Model. 307

Serial Number: 1NPTP4TX7ED239336

Odometer: 940,844 Hours: 6,077

Labor

Description	Mechanic	Quan tity/H ours	Amount
1 Complaint: Diffs have always slipped a touch when super slippery. But this morning (Oct 25) spinning though mud they sounded like like death			.00
1 Cause: N/A			.00
Correction: tested Diffs Out. Working as they Should Complaint: Brake pot leaking Cause: Leaking.	Morgan Kane	1.00	100.00 .00 .00
2 Correction: Re/Re R3 Brake pot. Repaired Wiring on PS Little Door Lock. Found open in Front Left ABS Sensor. Installed New Sensor, Cleared Codes. Re-Adjusted Brakes Left Middle Drive out of Adjustement	Morgan Kane	5.00	500.00
2.1Correction: Installed Fender Toolbox on PS. Replaced DS rear mudflap. Breather for Fuel tanks Plugged up. took off bothsides and Cleaned up put back on.	Ashton Pelletier	3.00	300.00
3 Complaint: ["Steps.","Fenders.","Mudflaps."]			.00
Passenger side 3 Cause: Bent 3 Correction: Straightened Rear Aluminum Fender PS Cutout Bent Welded In New. Fixed Antisail Bracket PS Started Cutting Steps Off Box	Mark Carroll	2.50	.00 250.00

Parts

Description	Part Supplier Full	Supplier Invoice	Quantity/Hours	Price/Rate	Amount
tt03100050, MUDFLAP HANGER (Bill indvidually)			1.00	29.40	29.40
bn3030sblswc, Brake pot 3030 - long			1.00	78.83	78.83
stroke (square port) k181267bxw, Wheel Speed Sensor	Stahl Peterbilt	P727040	1.00	101.63	101.63
STRAIGHT 1794001, Clamp ring assy, Type 30	Bradvin HD Inc.	01P7530	1.00	9.47	9.47

Sublet

Description	Invoice Description	Price/Rate	Quantit y/Hours	Amount
Invoice: 01P7530 Supplier: Bradvin Trailer Sales *GP (CHQ)	freight in	15.00	1.00	15.00
Invoice: 31195 Supplier: AutoExotic Trim & Signs*(DD)	Remove old decals, new decals on sleeper, jda decal	163.75	1.00	163.75

Ashton/Mark - Diffs/ Brake Pot Leaking/ ABS Light/ Fender, Mudflaps PS/ New Decals



Total Parts	219.33
Total Returns	.00
Total Sublet	178.75
Shop Supplies	115.00
Invoice Total	1,663.08

Equipment: 261 Work Order #: 30181

Work Order Type: Service

Date: 11/20/24

Year: 2014 Make: Peterbilt Model: 367

Wodel. 507

Serial Number: 1NPTP4TX7ED239336

Odometer: 947,952 Hours: 6,278

Labor

Description	Mechanic	Quan tity/H ours	Amount
1 Complaint: 300hr Service & Inspection 1 Cause: Due			.00.
1 Correction: 300hr Service & Inspection. Changed Oil & Oil Filter. Changed Fuel Filters. Tightened Breather Clamp. Replaced all Dust Shields on the DS and Mid Axle on the PS. Fan Shroud was in the rad housing, removed it and put it in proper. Took Roda apart found, bent pin. Couldnt get part (Getting made) Put Roda back together. Repaired weather stripping on the PS tool Box.	Kelly Derksen	8.00	800.00
1.1 Correction: Repaired PS Bunk Marker.	Ashton Pelletier	.50	50.00
1.2 Correction: Removed Broken Bolts from Dust Cover Center Axle PS. Mudflap Hanger Bent Straightened it out.	Mark Carroll	1.50	150.00

Parts

Description	Part Supplier Full	Supplier Invoice	Quantity/Hours	Price/Rate	Amount
uniled2000c10ap, LED 2" CL/Lens Amber Bulb			1.00	5.18	5.18
67050ea, 2 Wire Marker Lamp Pigtail			1.00	1.34	1.34
k371004, Fuel/ Water Filter			1.00	57.25	57.25
ff5776, Fuel Filter			1.00	66.27	66.27
lf14000nn, Oil Filter (Fleetguard)			1.00	57.28	57.28
oilsample, Oil Sample / Anaysis - Basic Wear			1.00	31.50	31.50
p614986c, P614986 - Used/Cleaned			2.00	45.00	90.00
f166009031b413sb0, T-Bolt Hose Clamp			2.00	20.91	41.82
203108, 8m Extension Cord			1.00	41.61	41.61
am1561005, dust shield drive axle (aftm 805143)	Stahl Peterbilt	P728815	4.00	72.39	289.56
p534934, Air cleaner nuts dshp15blk, 15W40 Oil - Duron SHP Bulk	Stahl Peterbilt	P728799	1.00 42.00	22.11 5.02	22.11 210.84

Kelly - 300hr Service & Inspection

Total Labor	1,000.00
Total Parts	914.76
Total Returns	.00
Total Sublet	.00
Shop Supplies	100.00
Invoice Total	2.014.76