



Vehicle History Summary



Fleet #	TLS1211
Registration	XB32NP
Make	Kenworth
Model	T610
VIN / Chassis #	6F5000000PA484953
Build Date	2023

Date	Reading / Units	Type / Repairer Notes	Repairer
30/06/2026	500,529 kms	Fault R-7711 Removed and replace dash control switch. L.P 30/6/2026	Tasman workshop QLD
24/06/2026	499,352 kms	Fault, HEADLIGHT R-7657 Organise BDSM to attend site to carry out repairs as required. Repaired broken wiring under bonnet *See attached invoice for further details*	BDSM - Breakdown Diesel Service And Maintenance
12/05/2026	490,314 kms	Governor Valve R-7159 Breakdown - Reported vehicle can't build up air. Travel and locate vehicle. Check and found governor valve bypassing. Organise and pick up parts. Remove and replace valve. Adjust pressure. Check operation. O.K. Pack up tools and equipment and travel back. - CB *See attached invoice for further details*	BDSM - Breakdown Diesel Service And Maintenance
03/04/2026	485,187 kms	Air Conditioner, Air Leak, Brake Light/s, Cruise Control, Diff Leak, fuel tank, Low Air Alarm R-6473 1. Battery cover missing 3 x screws - Removed old securing mechanism for battery box lid, tapped out holes and installed bolts to secure the battery box lid (J.R 02/04/26) 2. 2nd drive axle diff weeping at front face - Removed and cleaned both drive axle diff breathers, wash down front of both drive diffs (J.R 02/04/26) 3. 3rd axle LH shock bushes perished - monitor at next service (J.R 02/04/26) 4. Stability control light active on dash - Organise BH Hemmant to diagnose fault in stability control - recalibrate steering angle sensor and test - repaired by BH Hemmant - see attached invoice for further details. 5. Adblue tank dented at rear - not impacting or leaking - monitor at next service (J.R 02/04/26) 6. All tank strap rubbers perished - Removed and replaced all six fuel tank straps as required (J.R 02/04/26) 7. Front grille dented LHS - not impacting or fouling - monitor at next service (J.R 02/04/26) 8. Weep at rear of compressor - monitor at next service (J.R 02/04/26) 9. Water and oil present in purge valve - Organise BH Hemmant to diagnose and replace faulty unloader valve and truck low air sensor - repaired by BH Hemmant - see attached invoice for further details. 10. 2nd axle RH torque rod bush collapsing - monitor at next service (J.R 02/04/26) 11. All airbags signs of perishing - monitor at next service (J.R 02/04/26) 12. Rear engine mounts starting to split - monitor at next service (J.R 02/04/26) 13. Coolant hose bracket is broken/cracked - Removed and replaced the broken coolant draw down hose bracket (J.R 02/04/26)	Brown and Hurley - Hemmant, Tasman workshop QLD
30/03/2026	485,155 kms	NHVR-Annual Inspection-HV I-462 Organise Brown and Hurley to carry out NHVR inspection as per attached check sheet at time of service.	Brown and Hurley - Hemmant
30/03/2026	485,155 kms	Speed Limiter Inspection I-470 Organise Brown and Hurley Hemmant to carry out speed limiter calibration as per requirements.	Brown and Hurley - Hemmant
30/03/2026	485,155 kms	C - 150k/Annual Service S-5160 Organise Brown and Hurley Hemmant to carry out "C" service as per Paclease service sheet. Faults Found: 1. Battery cover missing 3 x screws - require repair 2. 2nd drive axle diff weeping at front face - requires further inspection 3. 3rd axle LH shock bushes perished - requires further inspection 4. Stability control light active on dash - requires repair 5. Adblue tank dented at rear - requires further inspection 6. All tank strap rubbers perished - requires repair 7. Front grille dented LHS - requires further inspection 8. Weep at rear of compressor - requires further inspection 9. Water and oil present in purge valve - requires repair 10. 2nd axle RH torque rod bush collapsing - requires further inspection 11. All airbags signs of perishing - requires further inspection 12. Rear engine mounts starting to split - Monitor at next service 13. 2nd axle diff oil very dark - changed as part of "C" service. 14. A/C reportedly intermittent - replace both cabin filters as part of "C" service and no further faults found.	Brown and Hurley - Hemmant
24/03/2026		Registration O-1044	QLD Government
18/12/2025	469,123 kms	HEADLIGHT, Transmission R-5982	Brown and Hurley - Hemmant

Date	Reading / Units	Type / Repairer Notes	Repairer
		1. Remove and replace transmission brake pressure sensor. 2. Diagnose fault in LH headlight. *See invoice for further details*	
18/12/2025		Scale Calibration R-6210 Inspected and working as per spec.	Tasman workshop QLD
17/12/2025	469,133 kms	Balance, New T-4248 4x 11R22.5 Forlanders FDL929 2nd axle due to low tread 2x 295/80R22.5 due to shaking problems	Tasman workshop QLD
16/12/2025	469,123 kms	A - 25k Km Service S-4987 Carried out: - A service - Topped up engine oil 5ltrs Faults Found: 1. LH high beam has fault 2. Transmission warning active. *See attached service sheet for further details*	Brown and Hurley - Hemmant
04/12/2025	464,506 kms	Air Conditioner, Electrical R-5874 1. Organise All Sorts Auto Electrical to attend site at Toowoomba depot. 2. Diagnose, supply and replace faulty fan blower motor. 3. Diagnose, supply and replace faulty steering column combo switch. *See attached invoice for further details*	All Sorts Auto Electrical
17/10/2025	432,506 kms	A - 20k Km Check S-4746 Missed A service in for B Reference S-4826	Tasman workshop QLD
17/10/2025	432,506 kms	New T-3936 2x 295/80R22.5 TBB tires Steers	Tasman workshop QLD
17/10/2025	432,506 kms	B - 40k Km Service S-4826 Carried out by Kobi, Katie and Jess Monitor - fuel tank rubbers bulging - L/H/S hand rail bent - Turntable minor wear (not enough for adjustment) - Weep at front diff input shaft seal - 3x chips in windscreen - Dent in L/H/S grill Repairs - tightened rear L/H shock - tightened second diff head bolts - tightened diff filter - replaced both front shock	Tasman workshop QLD
30/09/2025	411,850 kms	Airbags R-5232 Breakdown: collected parts drove past bowenville about 15 minutes arrived at truck jacked u removed old airbag installed new one built air up and checked for anymore leaks, helped tyre fitter aswell	Brown and Hurley - Toowoomba
11/09/2025	411,793 kms	11R22.5 T-3833 Call Out. 2 x Supply & Fit	
11/08/2025	391,650 kms	Electrical R-4874 - R&R diff lock switch (Luke carried out) - Replaced Damaged fuel tank rubbers (Katie and Kobi carried out) - Replaced all the P clamps for the coolant drawdown hose. (Luke carried out)	Tasman workshop QLD
11/08/2025	391,650 kms	B - 40k Km Service S-4603 - Carry out B Service - Repairs Refer R-4874 Monitor - Chips in windscreen - Dent in L/H Grille - Front Diff input shaft seal weep - Rear Diff head weep.	Tasman workshop QLD
31/07/2025	383,498 kms	Air Leak R-4735 Brown and Hurley Tamworth arranged repair. Travel out to truck broken down on the side of the Newell highway heading north. Pulled over and marked out a safety perimeter, inspect the customers fault, not building air due to air leak behind the dash. Remove the dash panels to gain access to the air manifold where the air leak was present. Found the trailer light sensor had popped out of the connector. Clean out the connector and push and secure the sensor back into the connector. Install all of the dash panels back in the reverse order as they came out. Test and confirm repair. Pack up tools and travel back to the workshop."	Brown And Hurley - Tamworth
23/07/2025	380,883 kms	A - 20k Km Check S-4486 - Carry out A Service	BDS Mechanical - Toowoomba
24/06/2025		295/80R22.5 T-3747 Call out. 1 x Supply & Fit	
17/06/2025		11R22.5 T-3600 Call Out. Supply & fit - 1 x 11R22.5	Victoria Wide Tyre Services Pty Ltd (VWTS)
09/06/2025	353,258 kms	Brakes, Engine Fan R-4334	Tasman workshop QLD

Date	Reading / Units	Type / Repairer Notes	Repairer
		- Carried out full rear end brake and drum replacement. (Jess and Elyssa) - Replaced Horton fan Assembly (Jess and Elyssa) - Replaced all tank rubbers (Jess and Elyssa) - replaced turntable wear plates (Jess and Elyssa)	
09/06/2025	353,258 kms	Speed Limiter Inspection I-218 Hooked up scan tool checked speed limiter and changed cruise control from 93-98 and top speed from 95-98 as per company polices road tested to confirm correct speed limiting	Tasman workshop QLD
06/06/2025	353,258 kms	C - 120k/Annual Service S-4301 - Carry out C Service - Service repairs Refer R-4334	Tasman workshop QLD
27/05/2025	339,678 kms	AdBlue R-4256 Job 1. Complaint: AFT light Cause: connected laptop and found multiple codes but all inactive with most recent one being blockage in hose Correction: flushed both air and wet side with water. Carried out cal update. Test drove truck and no faults appeared. - Job 2. greased gearbox components and re-set GI on computer	Brown and Hurley - Toowoomba
11/04/2025	330,154 kms	A - 20k Km Check S-4121 - Carry out A Service (Complete waiting on service sheet)	Trailer Works - Toowoomba
20/03/2025	317,481 kms	Puncture Repair T-3390 1 x Repair - Puncture.	Wise's Mobile Tyres
17/03/2025	305,967 kms	Breakdown R-3805 Batteries outside of warranty.	Brown and Hurley - Toowoomba
03/03/2025	307,963 kms	B - 40k Km Service S-3982 - Carry out B service (Complete waiting on service sheet)	Trailer Works - Toowoomba
30/01/2025	277,370 kms	Transmission R-3540 Parts not covered by Paccar/Eaton Claim Part Number Part Description Quantity Total Cost K3341 O RING KIT 20918 1.00 36.87 4301254 Comments: 1x arrived Zane.K 5/12 // RO SHED SNAP RING 1.00 2.04 17073 GASKET 1.00 2.55 4303583 GASKET SPLITTER CYL 960N 1.00 1.78 VS169PTC-6-6 ELBOW 1.00 10.84 3415488-1 TRANSMAX MANUAL E LL 40 17.00 585.14 CSC82052 BOLT 8.00 46.32 17237 FILTER ELEMENT	Brown and Hurley - Toowoomba
24/12/2024	277,991 kms	A - 20k Km Check S-3704 1. Carried out A service as per service sheet. (Chris Aurora and Indy carried out service) Next service R/H fuel tank rubber needs replacement.	Tasman workshop QLD
01/11/2024	261,296 kms	Air Conditioner R-2936 Repair Aircon, blocked filters.	Brown and Hurley - Yatala
14/10/2024	259,142 kms	B - 40k Km Service S-3390 1. Carried out B service as per service sheet. Repairs on service. Replaced exhaust flex and clamps. Repaired air leak along cross member of Cabin.	Tasman workshop QLD
04/09/2024	243,117 kms	A - 20k Km Check S-3300 1. Carried out A service as per service sheet. Next service 1. requires new exhaust flex	Tasman workshop QLD
21/08/2024		Battery R-2492 Trailer works replaced batteries.	Trailer Works - Toowoomba
05/08/2024		295/80R22.5, New T-2170 Job opened Twice	Wise's Mobile Tyres
18/07/2024		295/80R22.5, New T-2000 sending back to port for wharf truck.	Wise's Mobile Tyres
08/07/2024	218,864 kms	295/80R22.5 T-2146 Call Out. 2 x Supply & Fit - 295/80R22.5	Victoria Wide Tyre Services Pty Ltd (VWTS)
05/07/2024	218,864 kms	C - 120k/Annual Service S-3003	Tasman workshop QLD

Date	Reading / Units	Type / Repairer Notes	Repairer
		1. Carried out C service 2. Replaced both diff oils and filter. 3. Replaced air dryer filter. 4. Replaced P/S oil and filter. 5. Replaced front steer hub oil and fitted new axle cap gaskets. 6. Checked transmission for leaks and level. 7. Changed engine air filter. 8. Replaced cabin filter 9. Checked and adjusted brakes where applicable. 10 Checked suspension components 11. Replaced Ab blue filters. 12 Checked Driveline.	
05/07/2024	218,864 kms	Brakes, Hub Leak R-2176	Tasman workshop QLD
		1. Removed both front hubs. 2. Cleaned and inspected wheel bearings found to be in a serviceable condition at time of inspection. 3. Removed and replaced brake shoes. 4. cleaned up hubs oiled bearings. 5. Fitted new hub seal fitted hubs filled with oil torqued bearings to manufactures specs. 6. Refitted axle caps with new gaskets. Filled caps to correct level. (Chris and Jess carried out repair)	
05/07/2024	218,864 kms	295/80R22.5 T-1992	Tyre Evolution - Eagle Farm
		Tyre Evo replaced Steer Tyres.	
17/06/2024		TMA - Telematics Monitoring O-760	MTData
		Certificate of Enrolment TMA XB32NP 17-06-2024	
14/06/2024		Rotate T-2009	Wise's Mobile Tyres
		Rotate tyres	
15/05/2024	179,540 kms	11R22.5 T-1843	Wise's Mobile Tyres
		1 x Supply & Fit - 11R22.5	
01/05/2024	170,337 kms	Mirrors R-1684	Brown and Hurley - Toowoomba
		Replaced RHS mirror assembly.	
10/04/2024	161,304 kms	A - Service 30,000 km S-2616	Tasman workshop QLD
		Carry out B service. Changed oil and filter. Changed fuel filters.	
27/03/2024		Registration O-393	
		registration was changed from XW51JJ to XB32NP	
04/03/2024		C.O.I / R.W.C O-207	QLD Government
		QLD_31845905_CERTIFICATE_OF_INSPECTION_FINAL_XW51JJ	
29/02/2024	135,821 kms	Windscreen R-1234	Brown and Hurley - Toowoomba
		Replace windscreen.	
24/02/2024		C.O.I / R.W.C O-96	QLD Government
		QLD_First_Inspection_Report_XW51JJ-Failed	
10/02/2024		C.O.I / R.W.C O-136	QLD Government
		QLD_HVRAS_XW51JJ QLD_Vehicle_Details_Inspection_XW51JJ	
22/01/2024	125,319 kms	A - Service 30,000 km S-2358	Brown and Hurley - Toowoomba
		Completed B service as per service sheet.	
22/12/2023	109,781 kms	295/80R22.5 T-1019	Wise's Mobile Tyres
		Supply & Fit 2 x 295/80R22.5 DOUBLE COIN RR202 152/149M 5-18	

Signed: _____

Name: _____

Date: _____