



Vehicle History Summary



Fleet #	TLS1205
Registration	XB55OI
Make	Kenworth
Model	T610
VIN / Chassis #	6F5000000PA481810
Build Date	2023

Date	Reading / Units	Type / Repairer Notes	Repairer
22/07/2026		Scale Verification I-679 Carry out full scale calibration using both full and empty weights following both OEM specifications and procedures that have been approved by TCA as per attached calibration certificate. *Further images and information can be accessed through SharePoint Calibration Tracker*	Tasman workshop QLD
20/07/2026		AdBlue R-7865 1. SCR fault on dash - removed Adblue injector from exhaust and placed into hot water. Removed injector line fitting and installed new fitting. Carried out flow test, all okay. Reinstalled Adblue injector and tested all okay (J.R 20/07/26)	Tasman workshop QLD
24/06/2026	412,918 kms	Speed Limiter Inspection I-619 Organise Brown and Hurley Hemmant to carry out speed limiter calibration as per requirements.	Brown and Hurley - Hemmant
24/06/2026	420,739 kms	Air Dryer, Brakes, Coolant leak, Engine intake system, Exhaust clamp, fuel tank, Grease, Horton, Hub Leak, hub seal, Lights, Steering, Steering Shaft, trailer plug, Wiper Blades, Wiper Washer R-7613 Faults found at service: 1. Wipers streaking, RH jet clogged - Removed washer jet and blew air through to remove blockage. Removed and replaced both wiper blades. Tested all okay (J.R 24/06/26) 2. Steering shaft worn and hitting intake pipes - Loosened all intake pipes and readjusted to prevent further wear. Removed steering shaft, and installed new steering shaft (J.R 23/06/26) 3. Engine oil low - Engine oil level adjusted at service (B.H 19/06/26) 4. LH tank strap deteriorating - Removed and replaced fuel tank strap rubbers (J.R 24/06/26) 5. Air dryer silencer broken - Removed Broken air dryer silencer. Install new silencer as required (J.R 23/06/26) 6. Exhaust mount straps snapped x2 - Removed both broken straps from vehicle. Cleaned up the areas to be welded. Welded the broken straps where required. Primed and painted both straps black, Reinstalled straps onto truck and exhaust DPF. (J.R 24/06/26) 7. RH steer brakes contaminated - Removed both steer axle hubs, brake drums, and brake shoes. Removed wheel bearings from the hubs. Removed s-cams, seals and bushings. Cleaned down backing plate of contamination. Installed new s-cam seals and bushings where required, refitted s-cams. Installed new brake shoes and drums. Fitted new bearing and races onto both hubs. Installed hubs onto the steer axle and torqued to specification. Filled hubs with oil (J.R 23/06/26) 8. Coolant leak at rear of engine - fault fixed at service see invoice for details (B.H 19/06/26) 9. 7 pin electrical plug, pin pushed in - replaced 7 pin plug (J.S 22/06/26) 10. Adblue tank strap rubbers cracked - Removed and replaced fuel both tank strap rubbers on the Adblue tank (J.R 24/06/26) 11. 2nd axle D/S brakes contaminated - Removed RH 2nd axle wheels. Removed Brake drums and shoes, cleaned brake shoes. Removed and replaced hub seals as needed. Installed Brake shoes, and hub torquing the hub to specification, installed brake drum. (J.R 23/06/26) 12. Clutch not greased - Greased clutch throughout bearing as required (J.R 23/06/26) 13. Intake rubber tube ring stretched - Removed silicon 4" pipe and installed new pipes (J.R 23/06/26) 14. Horton fan needs rekitting - Removed both drive belts, and auto tensioners. Removed A/C idler pulley and alternator. Removed Horton fan assembly from engine. Disassembled Horton fan and replace all worn parts as required. Installed Horton fan onto engine torquing bolts. Replaced all belts, tensioners and idler pulleys. Installed new alternator and torqued all bolts as required. Remove and replace horton solenoid and wire in plug (J.R 22/06/26) 15. Load light requires replacing - Removed all back cab panels, removed load light, unplug light and feed wire back through back wall. Installed new load light, fed wires back though back panels, depinned old plug and repinned new wire. Plugged in, put everything back together. (J.S 22/06/26) 16. 3rd axle P/S mudguard has a hole - Covered hole as needed (J.R 23/06/26) 17. 2nd and 3rd axle breathers clogged - Removed both axle breathers, cleaned breathers out and reinstalled (J.R 23/06/26) 18. Pitman arm moved- Loosened pitman arm bolt. Reseated Pitman arm to it correct position and tightened securing bolt (J.R 19/06/26) Monitor at next service: 4. 3rd axle input seal leaking - Wash down and Monitor at next service (J.R 24/06/26) 6. Splitter misting - Wash down and Monitor at next service (J.R 24/06/26) 13. 1st drive output seal beginning to leak - Wash down and Monitor at next service (J.R 24/06/26) 10. Damage to slip joint driveshaft/ play - Monitor at next service (J.R 24/06/26) 5. Bonnet/ front guard impact damage - Monitor at next service (J.R 24/06/26) 6. Dent in Passenger door - Monitor at next service (J.R 24/06/26) 2. Small stone chip LH windscreen - Monitor at next service (J.R 24/06/26)	Tasman workshop QLD
18/06/2026	420,739 kms	NHVR-Annual Inspection-HV I-620	Brown and Hurley - Hemmant

Date	Reading / Units	Type / Repairer Notes	Repairer
		Organise Brown and Hurley to carry out NHVR inspection as per attached check sheet at time of service.	
18/06/2026	420,739 kms	A - 25k Km Service S-5425 Organise Brown and Hurley Hemmant to carry out "A" service as per Paclease service sheet. Faults found at service: 1. Wipers streaking, RH jet clogged 2. Small stone chip LH windscreen 3. Steering shaft worn and hitting intake pipes 4. Engine oil low 5. Bonnet/ front guard impact damage 6. Dent in Passenger door 7. LH tank strap deteriorating 8. Air dryer silencer broken 9. Exhaust mount straps snapped x2 10. Damage to slip joint driveshaft/ play 11. RH steer brakes contaminated 12. Coolant leak at rear of engine 13. 1st drive output seal beginning to leak	Brown and Hurley - Hemmant
04/06/2026	417,217 kms	Auto greaser, ENGINE / GEARBOX GENERAL, Fault, Reverse Alarm R-7464 1. Prestart FAIL: Q7 Horn. 7. Test horn, reverse beeper and hazards (all warning devices). Reverse beeper - found reverse buzzer is not working and requires rectification. Installed a reverse buzzer to vehicle as required (J.R 04/06/26) 2. Driver reports unit not selecting reverse - disconnected selector switch from the truck. Sprayed the terminals with contact cleaner as required. Tested all okay (J.R 04/06/26) 3. Auto Greaser has moisture present - Cleaned auto greaser unit, reinstalled auto greaser onto truck and filled with grease (J.R 04/06/26)	Tasman workshop QLD
07/05/2026	408,301 kms	Electrical, Turntable R-7145 1. Damaged EBS Cable - Replaced EBS Suzi coil (S.G 07/05/26) 2. Damaged Light Cable - Replaced Light Suzi Cable (S.G 07/05/26) 3. No Revers Alarm - Fitted New Revers Alarm (S.G 07/05/26) 4. Damaged Turntable LH wear pad - Replaced Wear Pads (K.H 07/05/26) 5. Leaking Cab Shock - Replaced Cab Shock (S.G 07/05/26)	Tasman workshop QLD
23/04/2026	400,856 kms	trailer plug R-6978 1. Trailer plug damaged - Checked truck and trailer plugs and found the the EBS coil has ripped the plug out of its socket, removed EBS coil and installed a new coil to the truck. Wrapped coil up with the other trailer connector and air coils, tested all okay. (J.R 23/04/26)	Tasman workshop QLD
17/04/2026		Registration O-1158	
16/01/2026	390,022 kms	Trailer Lights, Warning lights on dash R-6170 1. Check unit for trailer light fault and found damaged 7 pin plug housing. Remove and replace 7 pin plug and test - ok. (Jess) 2. Check unit for multiple reported dash lights. Scan ECU top find various inactive after treat codes - clear all active/inactive codes. Found gearbox grease interval service warning active - grease clutch and reset warning. Check dash for further warnings - ok. (Jess)	Tasman workshop QLD
20/12/2025	387,198 kms	B - 50k Km Service S-4981 Carried out: - B service Faults Found: 1. Injector leaking through seal 2. LH rear guard has minor damage 3. Fuel tank strap rubber worn 4. Turn table pads worn. *See attached service sheet for further details*	Brown and Hurley - Toowoomba
15/12/2025	383,789 kms	Air Conditioner R-5932 1. Organise cam to replace internal and external cabin filters and test. *See attached invoice for further details*	BDS Mechanical - Toowoomba
24/11/2025	375,305 kms	Coolant leak R-5999 1. Found coolant level light active on dash. Fill 5l coolant and check unit for leaks - found heater hose clamps leaking coolant. Tension clamps and wash down residue. (Luke)	Tasman workshop QLD
19/11/2025		Puncture Repair T-4084 1. Organise after hours call out to carry out puncture repair to position 9 tyre.	Victoria Wide Tyre Services Pty Ltd (VWTS)
28/10/2025	360,163 kms	Cooling System R-5842 Replace 2 x hose clamps	BDS Mechanical - Toowoomba
13/10/2025		REPAIRS & MAINTENANCE R-5521 Warranty repairs from cropped exhaust value. Refer to invoice	Brown and Hurley - Toowoomba
11/09/2025	354,694 kms	AdBlue R-5203 - Found Ad blue in poor condition while doing dosing test - Drained tank removed air and fluid filters - Carried out 2 more dosing tests until fluid came out clear	Tasman workshop QLD
05/09/2025	353,339 kms	11R22.5, New T-3803 David Fitted up 4 Drives	Tasman workshop QLD
04/09/2025	353,339 kms	A - 20k Km Check S-4696 - Carry out A Service	Tasman workshop QLD

Date	Reading / Units	Type / Repairer Notes	Repairer
25/08/2025	343,104 kms	New T-3780 Dave replaced front drive tyres	Tasman workshop QLD
05/08/2025	332,124 kms	Steering Wheel R-4776 R&R Steering wheel. (Jess replaced) Fridge not working. (Jess replaced)	Tasman workshop QLD
05/08/2025	332,124 kms	Steer Tyres T-3691 David put on Test Tyre C	Tasman workshop QLD
05/08/2025	332,124 kms	B - 40k Km Service S-4551 - Carry out B Service (Luke Kobi and Katie carried out service and repairs) - Found two Boost hoses U/S one left one right (replaced) - Found both muffler mount cracked welded back up replaced missing 8m nuts - Replaced one Ad blue and fuel tank strap rubber - Tightened up Front drive lower shocker nuts Monitor next service - Horton fan clutch at 2mm to Rivets - Crack in bug deflector and L/H headlight protector - Front Drive output shaft seal weep.	Tasman workshop QLD
30/06/2025	308,720 kms	Battery, Electrical R-4524 - R&R Alternator - R&R Batteries - Ordered new draw fridge	Tasman workshop QLD
30/06/2025	308,720 kms	Speed Limiter Inspection I-223 Hooked up scan tool checked speed limiter and changed cruise control from 93-98 and top speed from 95-98 as per company polices road tested to confirm correct speed limiting	Tasman workshop QLD
27/06/2025	308,719 kms	A - 20k Km Check S-4405 - Carry out A Service (Kobi serviced) - Replaced batteries Refer R-4524	Tasman workshop QLD
12/06/2025	300,152 kms	Electrical R-4361 R&R Indicator stalk	Tasman workshop QLD
12/05/2025	287,071 kms	C - 120k/Annual Service S-4192 - Carry out C service - Replaced 2 Fuel tank strap rubbers. - Repaired Front Muffler bracket.	Tasman workshop QLD
08/04/2025		Rotation T-3418 2 x Rotation	
26/03/2025	265,693 kms	A - 20k Km Check S-3929 - Carry out A service.	Tasman workshop QLD
26/03/2025	265,693 kms	NHVR-Annual Inspection-HV I-153 - Carried out NHVR COI	Tasman workshop QLD
26/03/2025	265,693 kms	Damage, Mirrors, Turntable R-3626 R&R Damaged L/H mirror assembly (Jess replaced) Replaced Turntable (Chris replaced) Full check over carried out by Jess	MaxiPARTS PTY LTD, Tasman workshop QLD
08/01/2025	245,456 kms	B - 40k Km Service S-3794 1. Carried out B service as per service sheet.	Tasman workshop QLD
23/12/2024	241,159 kms	Wiper Blades R-3348 Removed and replaced wipers.	Tasman workshop QLD
19/12/2024	237,418 kms	Transmission R-3334 Transmission fault Hooked up computer carried out service activity report. Checked for fault codes in service ranger. No fault codes. Latest update was available. Put in. carried out grease interval and clutch adjustment on test Drive Steve could not fault any way possible and was happy to send truck. Horton fault Put bonnet over checked high pressure switch for a/c cut zip tie. Found a broken wire, took photos removed and replaced broken pressure switch. Test drove truck with Steve Stroud Horton works as it should.	Brown and Hurley - Yatala
10/12/2024	231,231 kms	A - 20k Km Check S-3683 1. Carried out A service as per service sheet. (Chris and Jess carried out service)	Tasman workshop QLD
07/11/2024	205,693 kms	B - 40k Km Service S-3545	Tasman workshop QLD

Date	Reading / Units	Type / Repairer Notes	Repairer
		1. Carried out B service as per service sheet. (Chris and Aurora carried out) Next service. needs L/H Front tank strap.	
04/11/2024	201,980 kms	11R22.5, 295/80R22.5 T-2674 10 x supply & fit.	Michelin Australia Pty Ltd
30/09/2024	186,514 kms	Exhaust, Hub Leak R-2734 (Chris and Jess carried out repairs) Job 1. Hub seal leak. Jacked up and removed front R/H wheel and hub assembly, removed bearings cleaned and checked for damage and wear, removed brake shoes, fitted up new shoes installed new hub seal tensioned to specs filled hub with new oil. Job 2. Removed Muffler bracket welded painted refitted bracket. Job 3. Fitted new bolt to step. Job 4 Replaced cabin filter.	Tasman workshop QLD
24/09/2024	186,514 kms	A - 20k Km Check S-3389 1. Carried out A service as per service sheet. (Chris and Jess carried out service) Repairs from service is on job R-2734	Tasman workshop QLD
06/09/2024	173,523 kms	Turntable R-2600 Replaced turntable wear pads. (Jess replaced)	Tasman workshop QLD
30/08/2024	167,914 kms	C - 120k/Annual Service S-3276 1. Carried out C service as per service sheet. (Chris and Jess carried out service)	Tasman workshop QLD
29/08/2024	167,821 kms	REPAIRS & MAINTENANCE R-2573 Warranty transfer to TasLog. Various warranty repairs. Water leak, heater, washer hose, replace front diff oil & filter, R&R Eaton shifter, Driver's seat rattle, R&R coolant draw pipe, tank straps, R&R diff seal. Cleared fault codes. Test drive. Refer to invoice.	Brown and Hurley - Yatala
29/08/2024	167,821 kms	REPAIRS & MAINTENANCE R-2573 Consumables - Replace front diff oil and filter	Brown and Hurley - Yatala
20/06/2024	117,162 kms	REPAIRS & MAINTENANCE R-2127 Job 1. Check cooling fan. No fault found. - job 2. Check transmission issue. No fault found. Road test.	Brown and Hurley - Yatala
20/06/2024	126,879 kms	Battery R-2076 Removed and replaced batteries. (Jess replaced 19/06/24)	Tasman workshop QLD
14/06/2024		TMA - Telematics Monitoring O-782 Certificate of Enrolment TMA XB55OI 14-06-2024	MTData
06/06/2024	117,162 kms	B - 40k Km Service S-2884 Job 1. Carried out B service as per invoice from Brown and Hurley Yatala. - Job 2. Warranty repairs - various. Refer to invoice.	Brown and Hurley - Yatala
28/05/2024	117,111 kms	275/70R22.5 T-1850 Call Out. 4 x Supply & Fit - 275/70R22.5	Victoria Wide Tyre Services Pty Ltd (VWTS)
27/05/2024		REPAIRS & MAINTENANCE R-1964 Service call. tablet not charging. Replace holder.	MTData
27/05/2024	116,529 kms	New T-1786 Tyre evo replaced front drive Tyres.	Tyre Evolution - Eagle Farm
10/05/2024		REPAIRS & MAINTENANCE R-1824 Weight measurement calibration	Tramanco Pty Ltd
02/05/2024		New T-1624 6 x Supply & Fit - New	Michelin Australia Pty Ltd
22/04/2024		Registration O-614 Registration transferred to TasLog. Registration changed from XW64JJ to XB55OI	
17/04/2024		New T-1539 replaced rear drive axle kept 3 as runouts.	Michelin Australia Pty Ltd
27/02/2024		C.O.I / R.W.C O-173	QLD Government

Date	Reading / Units	Type / Repairer Notes	Repairer
		QLD_CERTIFICATE_OF_INSPECTION_XW64JJ	
17/02/2024		C.O.I / R.W.C O-251	
		QLD_HVRAS_XW64JJ QLD_Vehicle_Details_Inspection_XW64JJ	
14/02/2024		Call Out, Puncture Repair T-1146	Victoria Wide Tyre Services Pty Ltd (VWTS)
		POSITION 8	
18/01/2024	59,441 kms	B - 40k Km Service S-2346	Brown and Hurley - Toowoomba
		KW B - Service Labour;	

Signed: _____

Name: _____

Date: _____