



Vehicle History Summary



Fleet #	TLS1203
Registration	XB54NX
Make	Kenworth
Model	T610
VIN / Chassis #	6F5000000PA481811
Build Date	2023

Date	Reading / Units	Type / Repairer Notes	Repairer
24/06/2026	421,057 kms	Speed Limiter Inspection I-622 Organise Brown and Hurley Hemmant to carry out speed limiter calibration as per requirements.	Brown and Hurley - Hemmant
23/06/2026	421,066 kms	Auto greaser, Body General, Coolant System, Electrical, Fault, reflectors R-7564 1. Light lead has damaged pins - Replaced 7 pin connector had to grind out the housing to suit wires (T.M 23/06/2026) 2. Drivers side steps loose - Tightened driver side step (T.M 23/06/2026) 3. Rear left chevron minor damage - monitor at next service 4. Reflector missing RH side - Replaced reflector on driver side step (T.M 23/06/2026) 5. All torque rods bushes minor cracking - monitor at next service 6. Drive axle low shock bushes worn - monitor at next service 7. Grease line on RH draglink rubbing on shock - Re routed grease line and wrapped with some electrical tape after inspecting for any pin holes (T.M 23/06/2026) 8. LH mudguard pole missing reflector - Replaced missing reflector on mudguard pole (T.M 23/06/2026) 9. Auto greaser low - Topped up auto greaser (T.M 23/06/2026) 10. Inspect unit for reported fault - connect diagnostic computer and check for fan run time and conditions - all ok. Check ECU for high temp or other system faults - none found. Run unit on high idle with a/c on and monitor horton fan start/stop ratios - ok. Turn A/C off and run unit on high idle to verify horton kicking in as per spec - cut in at 98 degrees (verified on diagnostic CPU through ECU, gauge and through thermal temp readings at thermostat housing). Suspect cooling system fault causing to run warm. Inspect for temps at thermostat housing, upper and lower radiator hoses all at 98 degrees when tested with thermal gun - matching ecu and gauge. Inspect for low coolant level - all ok. Check for leaks - none found. Suspect blockage in radiator - blow all debris and test drive - all ok. (L.P 23/06/2026) 11. Coolant leaks from heater taps and EGR bypass hose - BH Hemmant to replace EGR bypass orings under warranty. Fill coolant and test - ok. (BH 22/06/2026)	Tasman workshop QLD
22/06/2026	421,057 kms	C - 150k/Annual Service S-5427 Organise Brown and Hurley Hemmant to carry out "C" service as per Paclease service sheet. Faults Found: 1. Light lead has damaged pins - requires repair 2. Drivers side steps loose - requires repair 3. Rear left chevron minor damage - monitor at next service 4. Reflector missing RH side - requires repair 5. All torque rods bushes minor cracking - monitor at next service 6. Drive axle low shock bushes worn - monitor at next service	Brown and Hurley - Hemmant
22/06/2026	471,057 kms	NHVR-Annual Inspection-HV I-621 Organise Brown and Hurley to carry out NHVR inspection as per attached check sheet at time of service.	Brown and Hurley - Hemmant
18/05/2026	331,109 kms	Coolant leak R-7189 1. Driver reports coolant leak at heater taps - checked unit for reported fault and found coolant leaking from the heater taps, removed and replaced both heater taps, filled coolant and pressure tested - found further leak at heater line. Tensioned all cooling system hose clamps and re-pressure tested - all ok. (J.R 18/05/26)	Tasman workshop QLD
08/05/2026	407,179 kms	Tank Strap Rubber R-7148 1. Bonnet touching bumper - monitor at next service 2. Air dryer leaking around bolts - remove and reseal bolts and retest. (Brown and Hurley POB 7/5/26) 3. Tank strap rubbers split - remove and replace all tank strap rubbers. (S.G 8/5/26) 4. Torque rod bushes starting to split - monitor at next service. 5. Drive shocks starting to crack - monitor at next service. 6. Front diff input seal leaking - remove and replace input seal and wash residue. (Brown and Hurley POB 7/5/26) 7. Drive tyres scalloping - monitor at next service. 8. RH front drive airbag leak - remove and replace leaking airbag. (Brown and Hurley POB 7/5/26)	Brown and Hurley - Hemmant, Tasman workshop QLD
07/05/2026	407,157 kms	NHVR-Annual Inspection-HV I-497 Organise Brown and Hurley to carry out NHVR inspection as per attached check sheet at time of service.	Brown and Hurley - Hemmant
07/05/2026	407,157 kms	B - 50k Km Service S-5217	Brown and Hurley - Hemmant

Date	Reading / Units	Type / Repairer Notes	Repairer
		Organise Brown and Hurley Hemmant to carry out "B" service as per Paclease service sheet. Faults Found: 1. Bonnet touching bumper - monitor at next service 2. Air dryer leaking around bolts - requires repair 3. Tank strap rubbers split - requires repair 4. Torque rod bushes starting to split - monitor at next service. 5. Drive shocks starting to crack - monitor at next service. 6. Front diff input seal leaking - requires repair. 7. Drive tyres scalloping - monitor at next service.	
07/05/2026	407,157 kms	Speed Limiter Inspection I-498	Brown and Hurley - Hemmant
		Organise Brown and Hurley Hemmant to carry out speed limiter calibration as per requirements.	
10/04/2026	399,800 kms	Diff Lock R-6803	BDSM - Breakdown Diesel Service And Maintenance
		Organise to attend site and carry out required diagnostics and replace cross lock switch. *See attached invoice for further details*	
31/03/2026		Balance T-4427	Charlton Tyre Service
		1. Attend site and inspect for potential balance issue - carry out rebalance.	
31/03/2026		Registration O-1077	
11/03/2026	389,094 kms	AdBlue, ELEC BODY GENERAL R-6567	BDS Mechanical - Toowoomba
		1. Organise BDSM to attend site to replace damaged wiring and plug to adblue pickup. *See attached invoice for further details*	
23/02/2026	383,997 kms	295/80R22.5, Balance, Pressure Check, Rotation T-4354	Tasman workshop QLD
		Remove, strip, clean ,flip and re-fit 2 x 295/80r22.5 on position 1,2 Wheel alignment is required Pressure check position 3-10	
19/01/2026	377,684 kms	Defect List R-6160	Tasman workshop QLD
		1. Radiator blow out - blow out as much dust residue as possible with shop air. 2. Upper and lower shock rubbers - monitor at next inspection. 3. Thrushaft dust seal worn - washed down and to be monitored at next service. 4. Front diff weep - monitor at next inspection. 5. LH front and RH second airbags minor leaks - no leaks present at time of inspection. 6. Minor kingpin wear - monitor at next inspection. 7. Turntable adjust - not enough movement for adjustment - monitor at next inspection. 8. Oil leak at front - no leaks present at time of inspection. 9. ABS and rear diff light on dash - no warnings active at time of inspection. 10. Gl interval reset - carry out grease interval reset. 11. Check if clutch has been greased - greased clutch. 12. Brakes sticking - pull maxi on/off to clear - no fault found at time of inspection. 13. Check coolant leaks - pressure test cooling system and found no leaks or loss of pressure. 14. General check over - carry out inspection and repair faults below: 15. Tension loose RH 1st axle shock absorber. 16. Tension exhaust muffler brackets RH side of engine. 17. Tension loose bolts in underrun bar.	
14/01/2026	377,495 kms	A - 25k Km Service S-4999	Brown and Hurley - Toowoomba
		Carried out: - A service Faults Found: 1. LH fuel tank strap rubber worn - replaced on R-6160. 2. 1st diff thrushaft seal weep - washed down on R-6160 - further leaks to be monitored at next service. 3. Rear shock bushes minor wear - tightened on R-6160 - further wear to be monitored at next service. 4. Steering shaft has excessive wear - replaced on R-6160. 5. Front diff input/head has oil misting - washed on R-6160 - further leaks to be monitored at next service. 6. LH 1st drive axle and RH 2nd drive axle airbags have slight leaks - inspected on R-6160 - no leaks found - further leaks to be monitored at next service. 7. Kingpins have minor wear - further wear to be monitored at next service. *See attached service sheet for further details*	
14/01/2026	347,345 kms	Exhaust, SCR Catalyst R-6276	Brown and Hurley - Toowoomba

Date	Reading / Units	Type / Repairer Notes	Repairer
		1 -Check for primary fault codes - No other relevent fault codes \$629.01 2 - Aftertreatment diesel exhaust fluid is contaminated - Adblue not contaminated or diluted 3 - Leaks in the intake air system - Inspect the intake plumbing for possible air leaks, none found 4 - Aftertreatment SCR temperature sensor module is malfunctioning - Run the engine at idle for 10 minute as per procedure Monitor the aftertreatment SCR outlet temperature sensor. all Ok Monitor the aftertreatment SCR intake temperature sensor. all ok 4.1 - Aftertreatment SCR temperature sensor module pin to pin short circuit check - Disconnect the aftertreatment SCR temperature sensor module from the OEM wiring harness. Disconnect the aftertreatment SCR outlet temperature sensor from the aftertreatment SCR temperature sensor module. - All in spec Disconnect the aftertreatment SCR intake temperature sensor from the aftertreatment SCR temperature sensor module. - All in spec 5 - Turbocharger is malfunctioning - Remove the intake and exhaust connections from the turbocharger. Visually inspect the turbocharger compressor and turbine blades for damage or wear, no damage or abnormal wear found. 6 - Aftertreatment SCR temperature sensor is malfunctioning - Removed sensor and inspect for dmaages, no damage found. 7 - Turbocharger wastegate actuator is malfunctioning - Visually inspect the turbocharger wastegate actuator control line for damage. Inspect the turbocharger wastegate valve body assembly for damage. Measure the radial and axial clearance of the turbocharger wheel. Visually inspect the turbocharger compressor and turbine blades for damage or wear. Visually inspect the compressor wheel retaining nut for signs of dust ingestion. Visually inspect the exhaust and intake plumbing for signs of lubricating oil contamination. - No visually damage or wear found.. All troubleshooting steps extinguished - Removed exhaut pipe form SCR to fin oprecious metal loose inn SCR. REMoved and replaced SCR as required. Road test, and perform High NOx Reset to confirm fixed, all ok. *See attached invoice for further details*	
14/01/2026	377,495 kms	Steering Shaft, Tank Strap Rubber R-6160	Brown and Hurley - Hemmant
		1. Remove and replace 1 x LH tank strap rubber. 2. Remove and replace steering shaft assembly and centre steering wheel. *See attached invoice for further details*	
27/11/2025	361,848 kms	Brake Light/s, Electrical, Trailer Lights R-6008	Tasman workshop QLD
		1. Check unit for reported no brake lights on trailer. Remove plug at truck output and test power - ok. Connect light tester to trailer lead output - no power. Strip plug and check for power directly at wire - no power. Remove and replace trailer 7 pin electrical suzi coil and secure. Test - ok. (Jess)	
31/10/2025	347,345 kms	B - 40k Km Service S-4863	Brown and Hurley - Toowoomba
		See Invoice attached. 1. B service carried out by Brown and Hurley Toowoomba. 2. Remove and replace drivers seat assembly due to wear.	
16/10/2025	347,345 kms	REPAIRS & MAINTENANCE R-5797	Brown and Hurley - Toowoomba
		R&R air filter badly blocked. kgs of dirt came out and housing was full	
18/09/2025		Coolant leak R-5479	Tasman workshop QLD
		changed heater taps	
04/09/2025	333,760 kms	11R22.5, 295/80R22.5, New T-3793	Tasman workshop QLD
		Dave Stripped and fitted a full set of drives and steer Tyres keeping all Tyres for runouts on trailers	
03/09/2025	323,760 kms	Shockers R-5110	Tasman workshop QLD
		- Checked for play in the steer wheel bearing Nil found - Checked front shockers found no resistance ordered new shockers - Fitted new Steer shocker (Jess) - Fitted new wear pads (Jess)	
02/09/2025	323,760 kms	A - 20k Km Check S-4680	Tasman workshop QLD
		- Carry out A Service - Found Steer Tyres to be wearing funny Refer R-5110	
29/07/2025	315,216 kms	Engine Fan R-4702	Tasman workshop QLD
		Tested engine fan found to be working as it should A/C Test by Electrician on the 25th to make sure A/C is not turning on the system.	
16/07/2025	311,693 kms	B - 40k Km Service S-4447	Tasman workshop QLD
		- Carry out B Service (Jess and Kobi carried out service and repairs) - Found on Service - R/H Steer hub seal leak (Replaced) - Front Drive L/H Hub seal leak (Replaced) - Horton fan needed a kit (Kitted) - Coolant draw down hose P-Clamps broken (Replaced) Monitor next service - Coolant leak from filter tightened - L/H Fuel tank rubbers	
20/06/2025		Windscreen R-4444	Trailer Works - Toowoomba
		Trailer works subletted out repair	
23/05/2025	281,679 kms	A - 20k Km Check S-4215	Tasman workshop QLD
		- Carry out A Service last service was incorrect will fix up the C Service at next B Service. - Oil filter leak cleaned down and tightened up - Replaced damaged 7 pin plug Next service - Horton Fan requires kit	

Date	Reading / Units	Type / Repairer Notes	Repairer
23/05/2025	281,679 kms	Speed Limiter Inspection I-201 - Hooked up scan tool checked speed limiter and changed cruise control from 93-98 and top speed from 95-98 as per company polices road tested to confirm correct speed limiting	Tasman workshop QLD
01/05/2025	266,611 kms	C - 120k/Annual Service S-4142 - Carry out B service. Minor repairs.	Trailer Works - Toowoomba
29/04/2025	268,332 kms	Brakes R-4142 Brake warning code. Pull off steer tyres and drums. Pressure cleaned hub and sensor area and put back together.. test	Trailer Works - Toowoomba
26/02/2025	245,948 kms	NHVR-Annual Inspection-HV I-103 - Carried out NHVR COI	Tasman workshop QLD
25/02/2025	245,948 kms	Driveline, TOWING R-3699 - Knights towed form Service station at Hattonvale to POB. - Refitted tail shaft drove into workshop found oil leak from bottom of Diff to filter housing at the transfer tube. - Took sample of oil to send away. - drained oil found no metal fragments or glittery oil. - removed transfer tube reseal fitting replaced diff filter and replaced oil in both diff - Cleaned down Diff with degreaser and test drove.	Knight's Towing
25/02/2025	245,948 kms	A - 20k Km Check S-3962 - Carry out A service - Towed into the workshop 24/02 with a suspected diff failure Refer R-3699 for repair	Tasman workshop QLD
08/01/2025	223,579 kms	B - 40k Km Service S-3792 1. Carried out B service as per service sheet. (Jess Carried out service) - Replaced trailer low air switch - Replaced wiper blades - Replaced all 3 coolant draw down P clamps Next service 1X Fuel tank strap needs replacing Monitor turntable jaw wear	Tasman workshop QLD
26/11/2024	205,347 kms	A - 20k Km Check S-3629 1. Carried out A service as per service sheet. (Chris and Aurora carried out service) Found on service. Minor damage on rear mudguards.	Tasman workshop QLD
15/10/2024	186,368 kms	B - 40k Km Service S-3471 1. Carried out B service as per service sheet. (Chris and Jess carried out service)	Tasman workshop QLD
26/09/2024		Windscreen R-2764 R&R windscreen.	
11/09/2024	159,494 kms	AdBlue R-2666 found filter blocked	Cummins - Toowoomba
06/09/2024	172,653 kms	A - 20k Km Check S-3313 1. Carried out A service as per service sheet.	Tasman workshop QLD
16/08/2024	135,623 kms	Engine R-2482 Warranty Repairs. Job 1. Horton fan Kit. - Job 2. filters and Lubes. Job 3. Major repairs. #6 Inlet valve dropped. Damage to #6 injector, cylinder head, metal into the filter. Refer to invoice.	Brown and Hurley - Toowoomba
15/08/2024		295/80R22.5, New T-2169 Wises replaced Steer Tyres.	Wise's Mobile Tyres
24/07/2024	151,052 kms	C - 120k/Annual Service S-3089 1. Carried out C service as per service sheet (Chris and Jess carried out)	Tasman workshop QLD
11/07/2024	142,359 kms	11R22.5 T-2193 8 x supply & fit.	Wise's Mobile Tyres
02/07/2024	135,623 kms	Battery R-2155 B&H fitted 4 x new batteries	Brown and Hurley - Toowoomba
10/06/2024	132,980 kms	Air Systems R-2017	Brown and Hurley - Toowoomba

Date	Reading / Units	Type / Repairer Notes	Repairer
		Had Brown and Hurley Toowoomba test and clear defect. check brake system as per ADR, system air capacity holds enough to get 5 full brake applications before system pressure reached 50% of volume, check pressures to all wheel ends, all good.	
28/05/2024	125,023 kms	A - Service 30,000 km S-2799 1. Carry out B service while in having warranty repairs looked at B&H Yatala.	Brown and Hurley - Yatala
10/05/2024		REPAIRS & MAINTENANCE R-1828 Weight measurement calibration	Tramanco Pty Ltd
04/04/2024		Registration O-538 Registration transferred to TasLog. Registration changed from XW55JJ to XB54NX	
15/03/2024		C.O.I / R.W.C O-258 QLD_31860794_CERTIFICATE_OF_INSPECTION_FIRST_XW55JJ	
13/03/2024		Electrical R-1473 Replace sim	MTData
29/02/2024		Puncture Repair T-1088 POS 9	Victoria Wide Tyre Services Pty Ltd (VWTS)
17/02/2024		C.O.I / R.W.C O-275 QLD_HVRAS_XW55JJ QLD_Vehicle_Details_Inspection_XW55JJ	
02/02/2024		Electrical R-1208 GPS tracking unit. Pins dirty. Cleaned and re-seated	MTData
16/01/2024	50,177 kms	A - Service 30,000 km S-2328 Job 1. Service. - Warranty	Brown and Hurley - Yatala

Signed: _____

Name: _____

Date: _____